

## Importance of Preventative Maintenance

On July 10, 1994, a 33,000 dead weight ton, 23-year-old, bulk cargo vessel lost propulsion while outbound in the Strait of Juan de Fuca. The vessel was forced to shut down her main engine because a piston nut that holds the skirt to the crown had worked itself loose, fallen, and was pounding with each stroke of the piston. The vessel was 2.6 miles due south of Beechey Head, British Columbia when the engine was shut down. The vessel was towed to Port Angeles, Washington for temporary repairs.

The engineer on watch first became aware of a problem when he heard a loud knocking noise coming from cylinder number five. The vessel had been underway for approximately eight hours when the noise first occurred. The rpm of the engine was reduced immediately and then varied to determine if the noise changed with speed. When the knocking noise did not diminish, the engine was stopped while still on heavy oil. The turning gear was engaged and the scavenge and crankcase spaces for cylinder number five were opened. A piston nut was found lying on its side in the scavenge space. The nut is part number E345050.

The main engine is a Sulzer 7RD 76, rated at 11,200 horsepower. The pounding of the piston nut caused significant damage to the main engine. A small hole was created in the diaphragm, the support to the telescopic gland for piston cooling water was cracked, and the bolts securing the diaphragm were stripped and damaged because the whole diaphragm was pushed down approximately 3/4 of an inch. In addition, damage was caused to the piston cooling chest in way of the L-shaped connecting parts.

This casualty is common for older engines that have not been properly maintained. Proper maintenance could have prevented this and other similar casualties.

### WHY IT MATTERS

This bulletin was prepared to share lessons learned with industry and the interested public. Prevention recommendations are also made to prevent similar occurrences. Sharing lessons learned is important if Washington State is to achieve its "zero spills" goal.

### WEBSITE INFORMATION

<http://www.ecy.wa.gov/programs/spills/spills.html>

### Contact information:

Mike Lynch  
360-407-7482  
mily461@ecy.wa.gov

### Special accommodations:

To ask about the availability of this document in a version for the visually impaired call the Spills Program at 360-407-7455. Persons with hearing loss, call 711 for Washington Relay Service. Persons with a speech disability, call 877-833-6341.

During the casualty investigation, it was discovered that the manufacturers required piston nut locking device was not being used at the time of this incident. The locking device is a disk with a circumferential serrated edge that fits over and mates onto the piston nut. The disk is then fastened to the piston stud with two bolts. A safety plate then fits over the two bolts, which prevents the bolts from coming loose.

In addition, engineers need to be aware of the dangers of using rebuilt parts. Rebuilt parts that have exceeded their cyclic life should not be used as replacement parts. A rebuilt piston stud may be stretched and may no longer meet the original manufacturer specifications. Even a properly torque piston nut may still back-off under thermal stresses, if it is on a stretched piston stud without a piston nut locking device.

Sulzer manufactured seven to eight thousand of these particular diesel engines 35 to 45 years ago. Thousands of these engines may still be operating today. The RD 76 engine was well-designed with low combustion pressures suggesting that it will last a long time with a little care, but like any system that contains moving parts and is over 15 years old, will begin to experience failures if not properly maintained.

Ecology strongly urges each company to review their preventive maintenance policies and procedures for engine overhauls, including the use of piston nut locking devices. Rebuilt parts that have exceeded their cyclic life or no longer meet manufacturer tolerances may contribute to engine failure. Your local Sulzer field representative or Sulzer authorized maintenance contractor can assist you in

properly evaluating rebuilt parts and has the latest information for these particular engines.

### **MORE SAFETY ADVISORY BULLETINS**

- SAB 09-01:** Vessel Fueling Spills (09-08-010)
- SAB 06-02:** Oil Transfer Rates (06-08-019)
- SAB 06-01:** Automatic Identification Systems (AIS) (06-08-010)
- SAB 00-01:** The Importance of Identifying and Addressing Root Causes of Equipment Malfunctions (00-08-015)
- SAB 97-01:** Deep Water Anchoring (00-08-004)
- SAB 96-01:** Shifting a Ship by Warping (00-08-003)
- SAB 94-03:** Piston Crown Maintenance (00-08-006)
- SAB 94-02:** Importance of Preventative Maintenance (00-08-007)
- SAB 94-01:** Potential Problems with Steam Turbine Throttle Controls (00-08-005)
- SAB 99-02:** Passage Planning for the Oregon and Washington Coasts: Special Considerations (99-256)
- SAB 99-01:** Traffic Separation Scheme and Puget Sound Vessel Traffic Service (99-253)
- SAB 98-01:** Shipboard Systems Modifications (98-252)

For additional copies of **Safety Advisory Bulletins**, call or Fax us at the number below, or visit our website. Please be sure to provide your name, address and phone number.

**Phone:** (360) 407-7455

**Fax:** (360) 407-7288 or 1-800-664-9184

**Program website:**

<http://www.ecy.wa.gov/programs/spills/spills.html>

**Publication website:**

<http://www.ecy.wa.gov/biblio/spills.html>