My Em Cong

GEOTECH CONSULTANTS, INC.

13256 N.E. 20th St. (Northup Way), Suite 16 Bellevue, WA 98005 (206) 747-5618 FAY: 747-8561

September 15, 1992

医感性治疗性心管的 直角 计多多多数

JN 92324E

Ira Alexander 1500 Arboretum Place Seattle, Washington 98112

Subject: Underground Storage Tank Removal and Supplemental Environmental Studies

Bayside Volvo

753 9th Avenue North Seattle, Washington

Dear Mr. Alexander:


In accordance with your recent request, Geotech Consultants, Inc. has completed field observation, documentation and laboratory analysis associated with the removal of three underground storage tanks (USTs) from the Bayside Volvo dealership in Seattle, Washington. The property is located at 753 9th Avenue North, as illustrated on the Vicinity Map, Plate 1.

0000000

The site is currently occupied by a one-story concrete masonry building. At the time of our visits on July 22, and September 2, 1992, the building was vacant, having previously been used as a car dealership. Topography in the vicinity slopes moderately toward the northeast. Shallow groundwater would be expected to follow surface topography, flowing generally toward the northeast and draining into Lake Union.

The tanks were located in an asphalt-surfaced parking area on the northwest portion of the property. The tanks were reportedly installed during 1949, when the existing building was constructed.

This activity was initiated to satisfy regulatory requirements imposed under WAC 173-360 pertaining to site assessment at the time of closure. This report provides a summary of our field and laboratory methods along with results and conclusions.

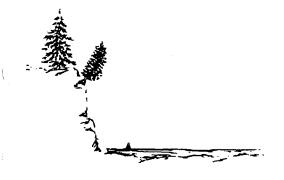

FINDINGS

Agency Notification

It is our understanding, since the tanks had not been used for several years, that permits and 30-day notification was not required by the Washington Department of Ecology. A letter from the UST removal contractor (T.M. Services) that addresses this issue has been appended.

Tank Excavation

On July 22, 1992, an environmental engineer from our firm was present during the removal of the USTs from the property. Upon our arrival on the site, we were met by Ed Mason, a UST supervisor for T.M. Services Corporation, of Arlington, Washington. Mr. Mason informed us that the tanks had been pumped and rinsed on the previous day by Marine Vacuum Service, Inc., of Seattle, Washington, and that the contents of the tanks had been disposed of properly.

Mr. Mason also stated that prior to our arrival on July 22, the tanks had been conditioned in a manner consistent with guidelines offered in API Recommended Practice 1604 (Removal and Disposal of Underground Petroleum Storage Tanks), and API Publication 2015. Specifically, dry ice had been added to the tanks, and at 11 a.m. on July 22, the tanks were inspected and removal approved by Inspector Chris Yamini of the Seattle Fire Department. A copy of the Fire Department permit has been appended.

Excavation and removal of the tanks was performed using a backhoe provided by T.M. Services. The tanks were removed between 12:30 and 2:30 p.m. and transported off site by T.M. Services for proper disposal.

Observations During Tank Removal

The tanks were "in-place" at the time of our arrival on July 22. All three tanks were single wall coated steel tanks, and were overlain by 3 to 4 feet of soil. The locations of the former USTs are shown on the Site Plan, Plate 2.

After removal, the tanks were measured, and inspected for holes and indications of leakage. The following table provides the condition, dimensions, maximum calculated capacity, and reported contents of each tank:

<u> Tank</u>	Contents	Length (inches)	Diameter (inches)		Condition
1	gasoline	74	63	1,000	Poor
2	used oil	61	38	300	Fair-Poor
3	fuel oil	98	45	675	Poor

Several "pinholes" were detected in Tanks 1 and 3. No holes or indications of leakage were detected in Tank 2. According to T.M. Service personnel, Tank 2 had been full of used oil prior to pumping on July 21.

As illustrated on the Site Plan, Tanks 1 and 2 were relatively close to each other, so removal resulted in one excavation. Soils with characteristic hydrocarbon odors were observed in this excavation from a depth of approximately 4 feet down to the maximum depth of 14 feet. The maximum lateral dimensions of the excavation were roughly 15 feet by 15 feet.

The excavation for Tank 3 measured roughly 12 feet (north-south) by 7 feet (east-west), and achieved a maximum depth of 9 feet. Soils with characteristic hydrocarbon odors were observed in this excavation extending from approximately 4 feet down to about 8 feet.

Soils in both excavations consisted of sand/silt mixtures. The lack of stratification and the presence of foreign materials such as bottles and brick fragments suggests that the soils in this area are imported fill down to at least a 10-foot depth. No groundwater seepage was observed in either excavation.

Soil Sampling

Discrete "grab" samples for laboratory analysis were collected from the excavations at selected depths. Composite samples were also collected from the upper 4 feet of material

May and the state of the state

Ira Alexander September 15, 1992

removed from the excavation, which did not appear to be contaminated with petroleum hydrocarbons.

Samples were placed in sterilized glass jars with teflon-sealed lids furnished by the project laboratory. Samples were stored in an iced chest at the site and taken to the lab in this condition in an effort to preserve sample integrity by minimizing excessive dissipation of volatile fraction hydrocarbons. Each jar was clearly labeled as to sampling location, time of sampling, sampling person, project number, etc. EPA-recommended protocol for sample management, including maintenance of chain-of-custody documentation, was observed during the course of the project.

Once soil samples were obtained, the material which appeared to be contaminated was returned to the excavations. Soils from the upper 4 feet of the excavations were stockpiled on the site pending the results of laboratory analysis.

<u>Laboratory Analysis</u>

Since several types of petroleum products were reportedly stored on the site, one sample from each excavation was initially analyzed using the Washington Total Petroleum Hydrocarbons-Hydrocarbon Identification (WTPH-HCID) analysis, a quantitative test used to determine which hydrocarbon constituents, if any, are present. Gasoline-range hydrocarbons were detected in both samples. These and other selected samples were then analyzed using the WTPH-G method for gasoline, along with the gasoline constituents benzene, toluene, ethylbenzene, and xylenes (BTEX). Reported concentrations provide a basis for comparison of site conditions to cleanup levels specified in the Model Toxics Control Act (MTCA).

The results of laboratory analysis are presented in Table A, appended to this report. Review of this table suggests that gasoline concentrations in soils from both excavations exceed MTCA cleanup levels. Gasoline concentrations detected in soils sampled from the bottom of the excavation for Tanks 1 and 2 (at a depth of 14 feet), were below cleanup levels. However, benzene concentrations in this sample exceeded cleanup levels. No concentrations of benzene were detected in any of the other samples.

No gasoline or gasoline constituents were detected in the samples collected from the soils removed from the upper 4

feet of the excavations. These were soils which did not appear to be contaminated with petroleum hydrocarbons and were stockpiled on site.

Only gasoline-range hydrocarbon concentrations were detected in the soils sampled during this study.

PRELIMINARY CONCLUSIONS

Observations during the removal of the tanks and subsequent laboratory analyses indicate that the soils proximal to all three of the removed tanks are contaminated with levels of gasoline petroleum hydrocarbons that exceed Washington MTCA cleanup guidelines. The contamination appears to extend from 4 feet in depth to 12 or 14 feet in depth. No fuel oil contamination was identified in the soils from the excavation where the fuel oil tank was removed, even though the tank was observed to contain pin holes. If gasoline from the gasoline tank (Tank 1) extended as far as Tank 3, which is located more than 50 feet to the north, then it is highly probable that contamination extends under the building.

SUPPLEMENTAL ENVIRONMENTAL STUDIES

Because contamination was anticipated to extend under the existing building, additional exploration was considered necessary to define the extent of the contamination so that proper remediation measures could be developed. Previous site exploration by Environmental Associates, Inc. in June 1992, found no hydrocarbon concentrations exceeding cleanup limits in the soils or groundwater samples collected from boreholes located adjacent to the tanks and the eastern or front side of the building. However, their tests were primarily for diesel contamination.

Plans for Exploration Under Building

Potential exploration techniques included borings with portable equipment inside the building, limited backhoe exploration from outside the building, or later exploration when the building is demolished. A limited exploration using an extendahoe was chosen to obtain timely information at a reasonable cost.

Sm. Associate

On September 2, 1992, we arrived on site to conduct an exploration in an attempt to define the extent of contamination under the existing building. Because the building was reported to be supported on piling, excavating under the footings and floor slab was considered acceptable and the potential for building damage low. Using both backhoe and hand methods we expected to be able to explore at least 5 feet under the building. Based on the previous drilling and experience with similar spills from small tanks. this extent of exploration was considered to be adequate.

Two Supplemental Test Pits

Prior to extending the tank removal excavations under the building we excavated a test pit along the western fence about 28 feet from the southern building wall. excavation encountered gasoline contamination from 4 feet in depth to about 12-14 feet in depth--almost identical to the contamination encountered in the tank removal excavations. analysis identified gasoline vapors measured headspace at approximately 600 parts per million (ppm). additional test pit was excavated in the northwestern corner of the site 14 feet from the north fence and 6 feet from the west fence. Similar conditions were encountered in this excavation with contamination encountered at about 4 feet and extending to about 12-14 feet in depth. It appeared to be the concentrated within the old landfill debris. Based on the test pit information, the area of contamination appears to extend throughout the area of the parking lot (62 by 120 feet) behind the building and an unknown distance under the building and outside the property boundaries.

Previous Off-Site Exploration

As part of an environmental study of the property across Aloha Street to the north, <u>Earth Consultants Inc.</u> (ECI) installed three monitoring wells in Aloha Street. Two of these wells, located north of the building on the subject property, identified hydrocarbon contamination that decreased downgradient -- toward the north/northeast. Contamination was not identified in monitoring wells installed in Aloha Street northwest of the subject property or in a well Westlake Avenue to the east.

CONCLUSIONS

Based upon the information developed as a result of this study, it appears that soils proximal to the former USTs on

GEOTECH CONSULTANTS, INC.

this site were contaminated by off-site sources, most likely located upgradient to the west. Any potential contamination from the on-site gasoline tank would have a very low probability of being able to migrate upgradient enough to be encountered in the test pits excavated along the western fence and in the northwestern corner of the property. Also the contamination in the test pits was first encountered at an elevation that was equal to or above the tops of the removed tanks.

ECI monitoring wells located in Aloha Street partially define the northern limits of the contamination plume to northeast of the site parking lot. Wells located west of the alley on west side of the site did not detect contamination.

Presently, as it is located underneath buildings and paved surfaces, the gasoline contamination plume does not appear to be an immediate health threat. The paving prevents human exposure to the contaminated soil and the plume does not appear to extend across Westlake Avenue or to approach Lake Union. Groundwater is not utilized in the area.

The following are issues that will need to be answered and further information that may need to be collected to address the condition of the site:

Limitations to Data Base

- 1. The source for the gasoline contamination has not been identified.
- 2. The extent of the contamination plume has not been defined.

Environmental - Legal Issues

- 1. Who are all the potentially liable parties?
- 2. How to pay for cleanup.
- 3. Design of an effective remediation method.

PRELIMINARY RECOMMENDATIONS

There are several approaches to cleanup that should be carefully considered. The options range from the possibility of taking no action at all to a coordinated group effort.

No Action

Because the contamination on the site is not a current human health threat through soil contact exposure or groundwater, the concern level by the WDOE will probably be low. According to our contacts with WDOE personnel, their immediate concern is to the health and safety of contractors who could have exposure during future earthwork construction. They are also concerned during any sales, that there is full disclosure of the potential problem to any prospective buyer. The problem and concern regarding cleanup lies in the number of buildings, streets, and utilities located above the contaminated area.

On-Site Cleanup

An individual cleanup action can be conducted for this site. In this activity WDOE has no official input or control. However, WDOE would review the final report and pass judgement on the project. There is no final acceptance and the site may be reopened for additional activities at the discretion of the state. Technologies considered for this site include microbiologic and vapor extraction methods. Installation of the chosen remediation technology would be most cost effective at the time of building demolition. The eventual cleanup of the site is limited if the contamination source is off-site and not controlled.

Group Cleanup

Another method of remediating the site is through a consent decree between the State of Washington, WDOE, and the potentially liable parties (PLPs). This action is administered by WDOE and would include participation of all parties involved with the contamination plume. Some state or federal matching funds may be available. Costs generally exceed individual actions by several times, but it is often the only way to involve a reluctant landowner in the remediation process.

AVAILABLE CLEANUP TECHNOLOGIES

One cleanup method is microbiological injection, or augmentation of existing organisms that ingest petroleum products as a natural part of their life process. This

process requires wells or some other way of getting the organisms into contact with the contaminated media. Though considerable time is required for final cleanup, there appears to be a minimal production of objectionable byproducts, and the activity appears to be able to proceed even under slabs and pavement. Costs vary with the type, concentration and amount of contamination present.

Another method is thermal desorption, which heats the soil to evaporate or burn the contaminating hydrocarbons. The soils are heated to 300-700 degrees with the off gasses reheated at higher temperatures. The method is very effective for gasoline contamination and the treated soils may be immediately returned into the site excavation.

Soil venting or vapor extraction involves the installation of wells or a system of horizontal piping in the area of soil contamination. An air blower is used to draw vapors out of the ground. Off gasses may be treated or vented to the air. This technology is effective for gasoline but not for diesel. The effectiveness is also dependent on the soil permeability (i.e. it is better in sand than in fine-grained soils).

The contaminated soils may also be excavated and removed from the site for off-site treatment or disposal. Liability for off-site disposal, however, remains with the owner for life. Costs include excavation, hauling, treatment/disposal fees, and replacement soil placed at the site.

There are other potential treatment methods but this is a review of those that are most practiced in the Seattle area. All costs are dependent on the amount of material to be remediated. More information is required prior to any effective analysis leading to a choice of remediation method.

INFORMATION REQUIRED

To make informed decisions regarding the site, more exploration is required. We know that there is gasoline contamination in the soil at 4 to about 14 feet in depth throughout the parking area of the site. It would be helpful to have information farther south and west of the parking

area. Since groundwater contamination was indicated in the two wells in Aloha Street, additional groundwater studies are needed. A drilling program including at least two borings that are developed as monitoring wells in the alley to the west of the site appears to be a logical first step in understanding the potential causes and extent of the contaminant plume. Any exploration of contamination under the present building should be deferred until after building demolition.

LIMITATIONS

This current status letter has been prepared for specific application to this project in a manner consistant with that level of care and skill normally exercised by members of the environmental science profession currently practicing under similar conditions in the area, and in accordance with the terms and conditions set forth in your request. No other warranty is expressed or implied.

If new information is developed in future site work which may include excavations, borings, studies, etc., Geotech Consultants, Inc. should be allowed to reevaluate the conclusions of this report and to provide amendments as required.

We understand at this period of the project that there are probably more questions than answers. It is our approach to attempt to gather information in stages in order to control costs.


We trust this information is adequate for your present planning activities. If you have any questions or if we may be of further service, please do not hesitate to contact us.

Respectfully Submitted,

GEOTECH CONSULTANTS, INC.

John Cole by f.KF.
John F. Cole

Senior Environmental Geologist

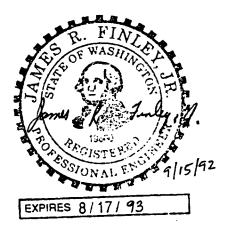


James R. Finley, Jr., P.E. President

Attachments:

Table A, Laboratory Results
Plate 1, Vicinity Map
Plate 2, Site Exploration Plan
Removal Documentation (8) Laboratory Report (6)

TABLE A: LABORATORY RESULTS

Sample #	Location	Analyte	Concentration
T12-SPLS	1 Excavation for Tanks 1 and 2, 7-foot depth	TPH-gas B T E X	3,000 ppm <250 ppb 1,000 ppb 22,000 ppb 111,000 ppb
T12-SPLS	2 Excavation for Tanks 1 and 2, 14-foot depth	B	80 ppm 600 ppb 60 ppb 920 ppb 2,240 ppb
T12-CL1	Excavation for Tanks 1 and 2, upper 4 feet of soil	TPH-gas B T E X	<50 ppm <50 ppb <50 ppb <50 ppb
T3-SPLS2	Excavation for Tank 3, 7.5-foot depth	TPH-gas B T E X	1,700 ppm <50 ppb 1,600 ppb 4,600 ppb 9,500 ppb
T3-CL1	Excavation for Tank 3, upper 4 feet of soil	TPH-gas B T E X E X	<50 ppm <50 ppb <50 ppb <50 ppb <50 ppb <1 ppb <1 ppb
Cleanup Act (MTC	guidelines as publ A), chapter 173-340	lished in the) WAC:	Model Toxics Control
Soil for TPH, for BTEX	gasoline range		100 ppm B< 500 ppb T< 40,000 ppb
	B denotes benzene T denotes toluene E denotes ethylbenz X denotes total xyl ppm denotes concent ppb denotes concent	lenes cration in par	

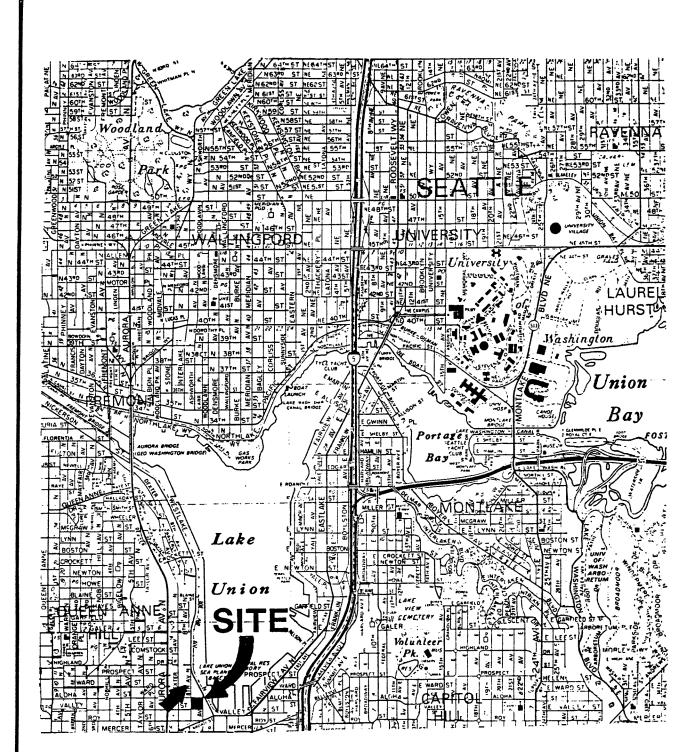

LEGEND:




APPROXIMATE DIRECTION OF SHALLOW GROUNDWATER FLOW NEAR SITE



VICINITY MAP
753 9th AVENUE NORTH
SEATTLE, WASHINGTON

Job No.:	Date:	Plate:
92324E	SEP 14,1992	1
	<u> </u>	

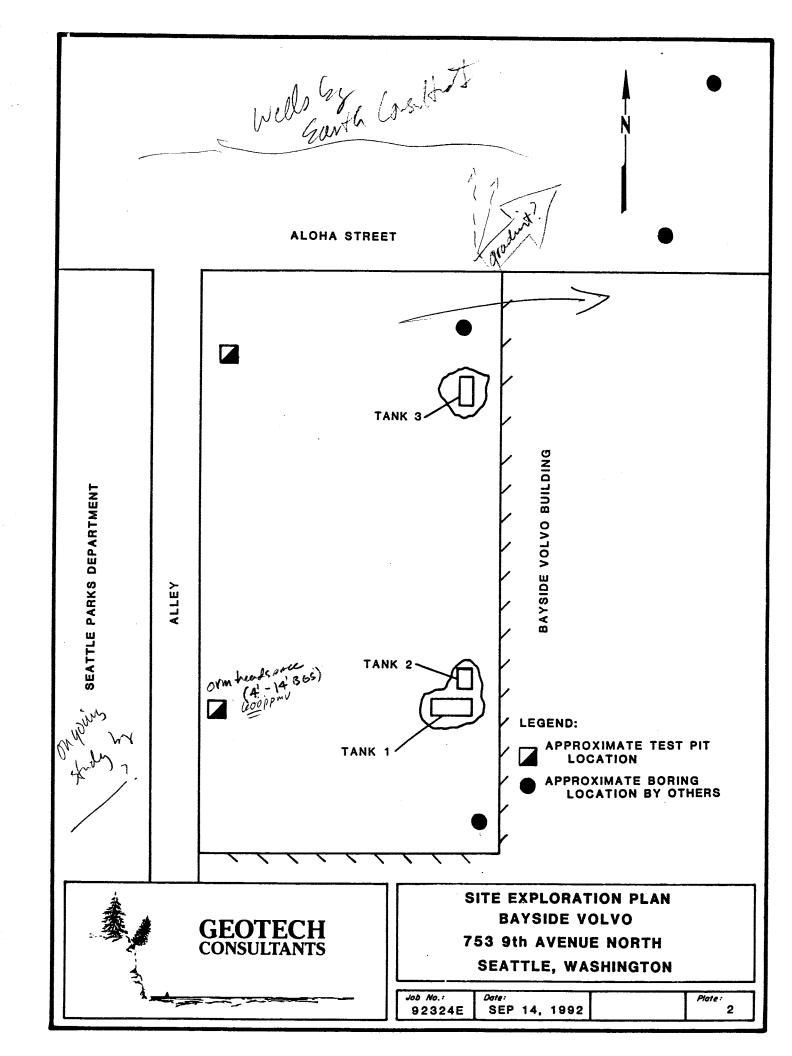

Seattle re Department

APPLICATION FOR PERMIT

1. 18 6



Daw Mondo No. 700	Title: TEMPORARY UN	RECEIVE IDERGROUND TANK	D PERMIT DESK	NDONMENT PERMIT
Permit Code No.: 799		101	2 1 1992	** * <u>*</u>
Fee: \$98,00 (No Renewal)	Code Reference: SFC		ate Received	/ 7/22/97 Date issued
Receipt # 1164886 or Da	ata Entry #	*) 	Expires	7/22/92
Firm Name: TM Sex	rvices !	, (Phone: (206	1435-3309
Firm Address: 20221	67TH AVE	City Arling Ton	_ State wa	zip 9522.3
Job Site: 753	9 TH AUE N	SCAH	12	
Person in Charge: E.P.			Phone: 435	-3309
			TIPATES MATELIA	THE APPLICATION TO

REMITTANCE FOR PERMIT FEE AS SHOWN ABOVE MUST BE RETURNED WITH THIS APPLICATION TO:

SEATTLE FIRE DEPARTMENT HEADQUARTERS
HAZARDOUS MATERIAL PERMITS
301 Second Avenue South
Seattle, WA 98104-2618

"HAZ MAT

Make Checks Payable To: SEATTLE CITY TREASURER

PERMIT CONDITIONS:

- 1. TANKS MAY BE REMOVED ONLY AFTER FIRE DEPARTMENT INSPECTION.
- 2. Two (2) 40 BC portable fire extinguishers are to be on site within 50' of the operation.
- 3. Rope or ribbon barricades must be provided circling 10' from the operation or be enclosed in a fenced yard.
- 4. "No Smoking" signs must be posted in readily visible locations.
- 5. No hot works allowed unless the tanks are certified gas free. A separate Fire Department permit (Code 491) is required for cutting and welding operations.

PROCEDURES:

1. Call 388-1450, 24 hours prior to removal to arrange for an appointment. Appointments must be confirmed by an inspector.

Permits may cover multiple tanks located at a single inspection area. If additional tanks are to be removed or abandoned at later dates, separate permits shall be obtained.

3. Additional fees will be charged if inspectors are required to work other than normal business hours. (Normal business hours are 7:30 a.m. to 4:30 p.m.)

QUALITY WORK ---MINIMUM DOWN TIME



July 21 1992

To whom it may concern,

This letter is in reference to our inquiry with the State of Washington Department of Ecology as to whether a permit and thirty day notification was required for the removal of the tanks located at Bayside Volvo, 753 9th Ave. N., Seattle, WA.. Per my conversation with Doug Knowlton with the State D.O.E. we have been given permission to treat these tanks as taken out of service prior to 1988. Because of the size of the tanks and because they have not been used since well before 1988, they can be treated as non-regulated tanks and do not require any permits from the State D.O.E.

Thank you for your cooperation regarding this matter.

Michael Thornes

T.M. Services COrporation

- 4. To ensure tanks are completely free of all flammable or combustible liquids, a receipt or certificate must be or site indicating the tanks has been pumped and rinsed with an approved material. Product and rinse water must be disposed of in an approved manner.
- 5. If tanks are being removed, the tanks' atmosphere must be inerted using one of the following approved methods:
 - a. Solid dry ice
 - b. Compressed gas cylinders releasing CO₂ in the vapor phase
 - c. Purging using air

Specific guidelines for the use of each method is provided in the Seattle Fire Department Inspection Guideline No. 79.6011.

- 6. Tanks being abandoned must be filled with a lean concrete mixture. Tanks previously containing Class I liquids must be inerted prior to filling with lean concrete.
- 7. A Fire Marshal's Office Inspector will test the tanks' atmosphere using a gas detector.

A minimum reading of 60% CO₂ must be obtained prior to tank removal if CO₂ is used to lnert the tank.

A maximum reading of 10% LEL must be achieved prior to removal of the tank if the air purging method of inertion is used.

- 8. CO₂ fire extinguishers and discharge of <u>liquid</u> CO₂ from compressed gas cylinders is prohibited.
- Tanks with baffles to prevent movement of liquid (or tanks without baffles larger than 10,000 gallons) must be certified gas free by a Marine Chemist or a Petroleum Industry Safety Engineer regularly engaged in that business prior to removal.
- 10. Tanks being removed must be removed from the ground and relocated to a remote, approved facility on the same day that the permit is issued.
- 11. After the tanks are removed, if the tank has not already been opened, the openings should be sealed so the CO₂ gas will remain in the tank during transit. In addition, tanks large enough to allow a person to enter it to do repair work should be marked on one side with spray paint "NO AIR INERT GAS."

	1-300 gal dun	re vil
A	V V	1117
lump and vince h	1 Marine Vacuum	
DUE notifud, tanks	were deemed non-vegor	ated my Bouz Knowlton
(Oz > 60% mg	Bucharach	SEATTLE FIRE DEPARTMENT
O		



UNDERGROUND STURAGE TANK 30 Day Notice of Intent to Close/Decommission Tanks

The purpose of this form is to provide the Department of Ecology with notice of intent to close/decommission an UST. It must be received 30 days prior to the closure activities. It must be signed and dated by either the owner/operator of the UST to be closed or his/her authorized representative. (This could be the firm contracted to do the work.) Ecology will notify the identified person of the earliest date closure/decommissioning activities may commence.

For questions on completing this form please call (206) 459-6293.

Please type or use ink.

The completed checklist should be mailed to:

Underground Storage Tank Section Department of Ecology Mail Stop PV-11 Olympia, WA 98504-8711

1. TANK OWNER AN	D LOCATION	经联系的	MINER LIVING I	"说话"
UST Owner/Operator:	Tra Alexander			
Owners Mailing Address:	1500 Arboretum	P1. E.		P.O. Box
	Seattle, WA. 9	8112		ZIF-Code
Telephone:	(206) 325-5188			
Site ID Number (on invol	ce or available from Ecology if			
Site/Business Name:	Bayside Volvo (old location)	not in busin	ê \$ S
Site Address:	753-9th Ave. N		King	County
	Seattle WA. 98	3109 State		ZIP-Code
2. TANK PERMANEI	NT CLOSURE TO BE PER	FORMED BY (If know	h): (*)	HOLE TO THE
	TM Services Co			
Firm:	20221-67th Ave			
Address:	Bireet			P.O. Box
\ \	Arlington, WA	, 98223		ZIP Code
Telephone:	(206) 435-3309		Contact Name: M1c	hael Thornes
3. TANK INFORMAT	TION (AABELTA) A TANK	a ag (sag) (sag)	kija ja j	
Tank Identification	Approx. Closure Date	Tank Capacity	Tank Age (years)	Last Substance Stored
	/wus. 1992	(gallons)	'20 plus	gasoline
	Aug 1992	500	20 plus	fuel oil
	Aug_1992		20 91118	_wasts oil
4. SIGNATURE OF	TANK OWNER/OPERATO	R OR AUTHORIZED	REPRESENTATIVE:	
11-00	11	Bullen		7-15-92
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	Addate	- Line Of	Title	Deta

Marine Vacuum Service, Inc.

A WASHINGTON ENVIRONMENTAL COMPANY
MARINE AND INDUSTRIAL CLEANING
TANK REMOVAL

P.O. Box 24263 Seattle, Washington 98124

Telephone (206) 762-0240

FAX (206) 763-8084

1-800-540-7491

UNDERGROUND STORAGE TANK
PUMP AND RINSE CERTIFICATE

Date: July 21, 1992

Attn: T.M. Services Corporation 20221 67th Ave. NE Suite C Arlington, Wa. 98223

Job Number:

Tank Owner: Ira Alexander

Tank Location: 753 Ninth Ave. N

Seattle, Wa.

Tank Capacity: 1 - 300 Gallon

Last contents held in tank: Waste Oil

Marine Vacuum Service certifies that the tank mentioned above has been pumped of all liquid materials and has been triple rinsed, with a high pressure washer and soap solution.

Thank You,

Representative

Mextur sound.

Marine Vacuum Service Inc.

DBE # D4M1302341

EPA # WAD980974521

A MINORITY BUSINESS ENTERPRISE ID # D4M1302341

Marine Vacuum Service, Inc.

A WASHINGTON ENVIRONMENTAL COMPANY
MARINE AND INDUSTRIAL CLEANING
TANK REMOVAL

P.O. Box 24263 Seattle, Washington 98124

Telephone (206) 762-0240

FAX (206) 763-8084

1-800-540-7491

UNDERGROUND STORAGE TANK
PUMP AND RINSE CERTIFICATE

Date: July 21, 1992

Attn: T.M. Services Corporation 20221 67th Ave. NE Suite C Arlington, Wa. 98223

Job Number:

Tank Owner: Ira Alexander

Tank Location: 753 Ninth Ave. N

Seattle, Wa.

Tank Capacity: 1 - 300 Gallon

Last contents held in tank: Waste Oil

Marine Vacuum Service certifies that the tank mentioned above has been pumped of all liquid materials and has been triple rinsed, with a high pressure washer and soap solution.

Thank You,

Representative

Menter remark

Marine Vacuum Service Inc.

DBE # D4M1302341

EPA # WAD980974521

A MINORITY BUSINESS ENTERPRISE ID # D4M1302341



30 Day Notice of Intent to Close/Decommission Tanks

The purpose of this form is to provide the Department of Ecology with notice of intent to close/decommission an UST. It must be received 30 days prior to the closure activities. It must be signed and dated by either the owner/operator of the UST to be closed or his/her authorized representative. (This could be the firm contracted to do the work.) Ecology will notify the identified person of the earliest date closure/decommissioning activities may commence.

For questions on completing this form please call (206) 459-6293.

Please type or use ink.

The completed checklist should be mailed to:

Underground Storage Tank Section Department of Ecology Mail Stop PV-11 Olympia, WA 98504-8711

1. TANK OWNER A	IND LOCATION	學的問題的		
UST Owner/Operator:	Ira Alexander			
Owners Mailing Addres	ss: 1500 Arboretum	n Pl. E.		
	Saattle, WA.			P.O. Box
Telephone:	(205) 325-5188	State		TP-Code
Site ID Number (on invo	pice or available from Ecology	If tank is registered):		
Site/Business Name:	Bayside Volvo) not in busi	ness
Sile Address:	753-9th Ave. N			
	Street		Kin	R County County
	Seattle, WA. 9	81 () 9 Biale		ZP-Code
. TANK PERMANE	NT CLOSURE TO BE PER	REPORMED BY III know	Vinte Zalvaro social	A HARAS TO THE RESERVE
lrm:	TM Services C		MANAGE VARIA (1981)	
ddress:	20221-67th Av			
<u>\</u>	Arlington, WA	98223		P.O. Box
elephone:	(206) 435-3309	Dtele	Contact Name: M1	IP-Code chael Thornes
. TANK INFORMAT	ION			
ank identification	Approx. Closure Date			The second second
		Tank Capacity (gallons)	Tank Age (years)	Last Substance Stored
	- Aug. 1992	1000	'20 plus	gasoline
	Aug 1992	500	20 plus	fuel oil
	- Aug 1992	500	-20 plus	waste cil
	Commission of the control of the con			
SIGNATURE OF T	ANK OWNER/OPERATOR	OR AUTHORIZED	FORFAGNITATIVE.	
11:00	4	1		Marie Specifica
Bigos	- Active	Soulean	dra	7-15-99
निर्माक । । । । । । । । । । । । । । । । । । ।	المراجعة والمراجعة و	71	rie .	Cata

To ensure tanks are completely free of all flammable or combustible liquids, a receipt or certificate must be on site indicating the tanks has been pumped and rinsed with an approved material. Product and rinse water must be disposed of in an approved manner. If tanks are being removed, the tanks' atmosphere must be inerted using one of the following approved methods: Solid dry ice a. Compressed gas cylinders releasing CO2 in the vapor phase b. Purging using air Specific guidelines for the use of each method is provided in the Seattle Fire Department Inspection Guideline No. 79.6011. Tanks being abandoned must be filled with a lean concrete mixture. Tanks previously containing Class I 6. liquids must be inerted prior to filling with lean concrete. A Fire Marshal's Office Inspector will test the tanks' atmosphere using a gas detector. 7. A minimum reading of 60% CO₂ must be obtained prior to tank removal if CO₂ is used to inert the tank. A maximum reading of 10% LEL must be achieved prior to removal of the tank if the air purging method of inertion is used. CO₂ fire extinguishers and discharge of liquid CO₂ from compressed gas cylinders is prohibited. 8. Tanks with baffles to prevent movement of liquid (or tanks without baffles larger than 10,000 gallons) must be 9. certified gas free by a Marine Chemist or a Petroleum Industry Safety Engineer regularly engaged in that business prior to removal. Tanks being removed must be removed from the ground and relocated to a remote, approved facility on the same day that the permit is issued. 11. After the tanks are removed, if the tank has not already been opened, the openings should be sealed so the CO₂ gas will remain in the tank during transit. In addition, tanks large enough to allow a person to enter it to do repair work should be marked on one side with spray paint "NO AIR - INERT GAS." Marine Yacum Tanks were Mimed non-vervated.

SEATTLE FIRE DEPARTMENT

Inspector

1805 (2/92) Permits Dsk

Lab Traveler: 07-024

Project: 92324

Matrix: Soil

Date Extracted: July 23, 1992 Date Analyzed: July 23, 1992

WTPH-HCID

Sample #	GC Characterization	o-terphenyl Surrogate Recovery
T3-SPL5-2	gasoline	120%
T12-SPL5-1	gasoline	120%

QUALITY ASSURANCE

Method Blank	<20 ppm Gas	120%
	<50 ppm Diesel	
	<100 ppm Heavy Oil	

Lab Traveler: 07-024

Project: 92324

Matrix: Soil Units: ppb

Date Extracted: July 24 & 27, 1992 Date Analyzed: July 24, 25, & 27, 1992

	ANALYSIS BY (PUR	·u'	· Upper		
	0 = 1.5	Upper 4/	0~7	0~14	Fill Hill
Sample #:	T3-SPL5-2	T3-CL-1	T12-SPL5-1	T12-B-1	T12-CL-1
Dilution Factor	50	50	1000	50	50
Analyte:					
Benzene	<50 ^M	<50	<250 ^M , N, Z	600	<50
Toluene	1600 ^M	<50	1.000 ^M	60	<50
Ethylbenzene	4600 ^M	<50	22,000 ^M	920	<50
m,p-Xylene	3.500 ^M	<50	80,000 ^M	1600	<50
o-Xylene	6,000 ^M	<50	3 <u>1</u> ,000 ^M	640	<50
WTPH-G units: ppm	1700 ^M	<50	3000 ^M	80	<50
4-Bromoflourobenzene Surrogate Recovery	83%	67%	100%	70\$	75%

M-Headspace present in sample.

N-Data from 1:50 dilution.

Z-Interferences were present which prevented the quantitation of the analyte indicated below the given detection limit.

Lab Traveler: 07-024

Project: 92324

Matrix: Soil Units: ppb

Date Extracted: July 24, 1992 Date Analyzed: July 24, 1992

ANALYSIS BY EPA 8020 & WTPH-G (PURGE & TRAP)

QUALITY CONTROL

Sample #: 07-028-5

	Method Blank	Sample Concentration	Duplicate Concentration	RPD
Dilution Factor	50	50	50	
Analyte:				
Benzene	<50	<50	<50	0%
Toluene	<50	<50	<50	0%
Ethylbenzene	<50	<50	<50	0%
m,p-Xylene	<50	<50	<50	0%
o-Xylene	<50	<50	<50	0%
WTPH-G units: ppm	<50	<50	<50	0%
4-Bromofluorobenzene Surrogate Recovery	83%	71%	71%	

Lab Traveler: 07-024

Project: 92324

Matrix: Soil Units: ppb

Date Extracted: July 24, 1992 Date Analyzed: July 24, 1992

ANALYSIS BY EPA 8020 & WTPH-G (PURGE & TRAP)

MATRIX SPIKE QUALITY CONTROL

Sample #: 07-028-5 Spiked @ 1000 ppb

	M.S. Conc.	Percent Recovery	M.S. Dup. Conc.	Percent Recovery	RPD
Dilution Factor	50		50		
Analyte:					
Benzene	722	72%	737	74%	2.1%
Toluene	730	73%	745	75%	2.0%
Ethylbenzene	751	75%	766	77%	2.0%
m,p-Xylene	744	74%	759	76%	2.0%
o-Xylene	735	74%	750	75%	2.0%
4-Bromofluorobenzene Surrogate Recovery	70%		71%		

Lab Traveler: 07-024

Project: 92324

Date Analyzed: July 24, 1992

RESULTS OF DRY WEIGHT

Sample #	Moisture
T3-SPL5-2	21%
T3-CL-1	18%
T12-SPL5-1	14%
T12-B-1	18%
T12-CL-1	5.6%

CHAIN (CUSTODY RECORD

ON-SITE ENVIRONMENTAL INC.

2859 152nd Ave. NE Redmond, WA 98052 (206) 883-3881

Client:	60	tech

Project Manager:

Perin

Project #:

92324

Project Name:

dash	Sample Number	Date Sampled	Туре	# Jars	Analysis Required		Comments
	T3-5965-Z	7/22	5	1	1+C10 Followol by qu	ent C	
	73-CL-1)	Ì		HOLD YOUR		1
	T12-5965-1				HCIOA Foliand by 2	2012	
	T17-B-1				How street		
	T12-4-1			L	HoLO gamt		
	A ()						
ubmit	ted: Hay have	date: 7/73	Received,	Sys	William.	date:	7/25/92
rm:	Garley	time: 4:30	Firm:	S, Y.	Tavironmental	time:	7/25/92 8:30 Am
ubmit	ted;	date:	Received I			date:	
m:	TEX added Due 500	time.	Firm:			time:	

CIBIEX added per results of