

**APPENDIX F**

**GROUNDWATER ELEVATIONS AND HYDROGRAPHS**

**APPENDIX F TABLES**

Table F-1	Summary of Groundwater Elevations
Table F-2	Summary of Groundwater Elevations in Contingent Action Addendum Monitoring Wells
Table F-3	Summary of Pressure Transducer Data 2017 to 2021

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
<b>Shallow Zone</b>								
BB-8A	Roy Street ROW	Unknown	-	--	01/29/09	DOF	20.60	-
					02/19/10	SES	19.05	-
					05/03/10	SES	19.34	-
					06/02/11	SES	18.18	-
BB-10	Dexter Ave N ROW, E side	29 to 39	-	--	09/05/97	B&V	25.91	-
					09/09/97	B&V	25.70	-
					10/17/97	B&V	25.80	-
					11/13/97	B&V	25.30	-
					12/02/97	B&V	25.30	-
					01/21/98	B&V	25.88	-
					02/27/98	B&V	25.72	-
					03/25/98	B&V	25.53	-
					04/23/98	B&V	29.54	-
					06/05/98	B&V	26.20	-
					07/01/98	B&V	26.24	-
					07/27/98	B&V	26.85	-
					08/25/98	B&V	27.27	-
09/29/98	B&V	27.00	-					
				Decommissioned prior to 2017				
BB12A	9th Ave N ROW	Unknown	-	--	02/19/11	SES	14.40	-
					05/02/10	SES	15.81	-
				Decommissioned prior to 2017				
DMW-1S	615 Dexter, SE quadrant	20.0 to 30.0	38.9 to 28.9	55.76	03/21/19	HC	21.01	34.75
					03/27/19	HC	20.88	34.88
					12/05/19	HC	24.88	30.88
					03/19/20	HC	22.35	33.41
					03/26/20	HC	22.37	33.39
					05/11/20	HC	23.28	32.48
					07/13/20	HC	24.33	31.43
					11/16/20	PES	25.40	30.36
					02/01/21	HC	21.41	34.35
06/07/21	PES	22.27	33.49					
DMW-2S	615 Dexter, SE quadrant	25.0 to 35.0	31.0 to 21.0	55.74	03/19/20	HC	22.89	32.85
					05/11/20	HC	23.76	31.98
					07/13/20	HC	24.72	31.02
					11/16/20	PES	25.69	30.05
					02/01/21	HC	21.53	34.21
					06/07/21	PES	22.27	33.47
DMW-4S	Alley S of SE quadrant of 615 Dexter	23.0 to 33.0	38.8 to 28.8	61.54	03/19/20	HC	22.28	39.26
					05/11/20	HC	22.51	39.03
					07/13/20	HC	23.11	38.43
					11/16/20	PES	23.28	38.26
					02/01/21	HC	21.48	40.06
					06/07/21	PES	24.32	37.22
DMW-5IA	Alley S of 615 Dexter	39.8 to 49.8	29.7 to 19.7	69.15	03/19/20	HC	38.71	30.44
					05/11/20	HC	39.32	29.83

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>	
DMW-5IA					07/13/20	HC	40.37	28.78	
					11/16/20	PES	41.95	27.20	
					02/01/21	HC	38.25	30.90	
					06/07/21	PES	38.91	30.24	
DMW-6	615 Dexter, NE quadrant	34.0 to 44.0	32.3 to 22.3	66.08	03/19/20	HC	28.91	37.17	
					05/11/20	HC	29.28	36.80	
					07/13/20	HC	29.91	36.17	
					11/16/20	PES	30.84	35.24	
					02/01/21	HC	28.30	37.78	
					06/07/21	PES	28.04	38.04	
DMW-7S	Dexter Ave N ROW, W side	28.0 to 38.0	30.3 to 20.3	58.01	02/01/21	HC	23.59	34.42	
					06/07/21	PES	24.73	33.28	
					Abandoned 2022?				
DMW-8S	Dexter Ave N ROW, W side	27.0 to 37.0	31.6 to 21.6	58.35	02/01/21	HC	24.46	33.89	
					06/07/21	PES	25.52	32.83	
					Abandoned 2022?				
DMW-9S	Dexter Ave N ROW, W side	23.0 to 33.0	35.9 to 25.9	58.55	02/01/21	HC	22.20	36.35	
					06/07/21	PES	23.12	35.43	
					Abandoned 2022?				
DMW-10S	601 Dexter, NE quadrant	35.0 to 55.0	24.5 to 4.5	59.24	02/01/21	HC	28.58	30.66	
					06/07/21	PES	29.81	29.43	
DMW-11S	601 Dexter, NE quadrant	30.0 to 50.0	31.2 to 11.2	60.86	02/01/21	HC	28.93	31.93	
					06/07/21	PES	30.10	30.76	
DMW-12S	615 Dexter, S central edge of Property	30.0 to 50.0	36.1 to 16.1	65.67	02/01/21	HC	29.48	36.19	
					06/07/21	PES	31.67	34.00	
DMW-13S	Alley S of SW quadrant of 615 Dexter	30.0 to 50.0	36.3 to 16.3	65.02	02/01/21	HC	35.24	29.78	
					06/07/21	PES	35.79	29.23	
DMW-14S	Alley S of SW quadrant of 615 Dexter	41.0 to 51.0	29.3 to 19.3	70.15	02/01/21	HC	40.47	29.68	
					06/07/21	PES	40.70	29.45	
F5	Property, NW quadrant	10 to 40	29.1 to -1.0	39.00	03/20/17	PES	4.02	34.98	
					03/24/17	PES	NA		
					04/14/17	PES	NA		
					04/28/17	PES	NA		
					05/05/17	PES	NA		
					05/12/17	PES	NA		
					05/19/17	PES	6.91		32.09
					06/12/17	PES	9.72		29.28
					10/11/17	PES	16.27		22.73
					03/14/19	PES	-		
	Decommissioned March 2019								
F9	Property, NE quadrant	10 to 40	28.5 to -1.5	38.76	03/20/17	PES	4.40	34.36	
					03/24/17	PES	5.01	33.75	
					04/14/17	PES	4.98	33.78	
					04/28/17	PES	6.01	32.75	

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
F9 (continued)					05/05/17	PES	6.14	32.62
					05/12/17	PES	6.80	31.96
					05/19/17	PES	7.16	31.60
					06/12/17	PES	10.46	28.30
					10/11/17	PES	17.73	21.03
					03/14/19	PES	4.09	
Decommissioned March 2019								
F13	Property, NE quadrant	10 to 40	28.4 to -1.6	38.69	03/20/17	PES	4.34	34.35
					03/24/17	PES	4.80	33.89
					04/14/17	PES	4.68	34.01
					04/28/17	PES	5.62	33.07
					05/05/17	PES	5.90	32.79
					05/12/17	PES	6.43	32.26
					05/19/17	PES	6.99	31.70
					06/12/17	PES	9.87	28.82
					10/11/17	PES	18.58	20.11
					03/14/19	PES	3.86	
Decommissioned March 2019								
FMW-132	Block 38 West, N end	5 to 10	20.7 to 15.7	25.48	08/30/18	Farallon	7.44	18.04
					12/28/18	Farallon	6.80	18.68
					03/26/19	Farallon	7.01	18.47
FMW-133	Block 38 West, N end	6.5 to 11.5	18.8 to 13.8	24.87	08/30/18	Farallon	6.86	18.01
					12/28/18	Farallon	6.21	18.66
					03/26/19	Farallon	6.41	18.46
FMW-134	Block 38 West, S end	12 to 17	13.4 to 8.4	24.98	08/30/18	Farallon	8.66	16.32
					12/28/18	Farallon	7.80	17.18
					03/26/19	Farallon	7.51	17.47
FMW-135	Block 38 West, N end	7 to 12	18.6 to 13.6	25.29	08/30/18	Farallon	7.14	18.15
					12/28/18	Farallon	6.78	18.51
					03/26/19	Farallon	6.81	18.48
FMW-143	9th Ave N ROW, E side	23 to 28	10 to 5	32.69	10/31/19	PES	14.88	17.81
					01/13/20	PES	15.02	17.67
					05/11/20	PES	20.47	12.22
					07/13/20	PES	21.01	11.68
					11/16/20	PES	21.19	11.50
					02/01/21	PES	17.48	15.21
					06/07/21	PES	15.68	17.01
G12	Property, NE quadrant	10 to 40	29.4 to -0.6	39.40	03/20/17	PES	5.29	34.11
					03/24/17	PES	5.74	33.66
					04/14/17	PES	5.89	33.51
					04/28/17	PES	7.10	32.30
					05/05/17	PES	7.18	32.22
					05/12/17	PES	7.89	31.51
					05/19/17	PES	8.32	31.08
					06/30/17	PES	13.58	25.82
					10/11/17	PES	18.68	20.72
					03/14/19	PES	5.85	33.55
					Decommissioned March 2019			

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
G-MW2	Property	8 to 18	-	-	07/24/01	GeoEngine	9.93	
					01/29/09	DOF	10.76	
					06/02/11	SES	7.45	31.50
					02/07/12	Windward	8.49	30.46
					09/06/12	SES	10.53	28.47
					12/21/12	SES	9.63	29.37
					03/29/13	SES	8.56	30.44
Decommissioned prior to 2017								
HMW-1S	SDOT Mercer Parcels, NE quadrant	20.0 to 30.0	16.0 to 6.0	35.73	03/20/19	HC	16.11	19.62
					03/26/19	HC	16.21	19.52
					07/16/19	HC	16.85	18.88
					12/05/19	HC	18.89	16.84
					01/13/20	HC	22.80	12.93
					03/19/20	HC	24.53	11.20
					05/11/20	HC	26.44	9.29
					07/13/20	HC	Dry	
					11/16/20	PES	Dry	
					02/01/21	HC	20.78	14.95
06/07/21	PES	19.43	16.30					
HMW-2S	SDOT Mercer Parcels, NE quadrant	19.8 to 29.8	27.6 to 17.6	47.28	03/19/19	HC	21.68	25.60
					03/26/19	HC	24.21	23.07
					07/16/19	HC	23.98	23.30
					12/05/19	HC	25.87	21.41
					01/13/20	HC	23.45	23.83
					03/19/20	HC	24.98	22.30
					05/11/20	HC	25.82	21.46
					07/13/20	HC	26.61	20.67
					11/16/20	PES	24.08	23.20
					02/01/21	HC	21.95	25.33
06/07/21	PES	23.49	23.79					
HMW-9S	SDOT Mercer Parcels, SW quadrant	25.0 to 35.0	30.4 to 20.4	58.54	03/19/20	HC	33.25	25.29
					05/11/20	HC	33.61	24.93
					07/13/20	HC	33.94	24.60
					11/16/20	PES	33.44	25.10
					02/01/21	HC	31.78	26.76
06/07/21	PES	32.66	25.88					
HMW-10S	SDOT Mercer Parcels, SE quadrant	24.7 to 34.7	23.5 to 13.5	51.09	03/19/20	HC	26.37	24.72
					05/11/20	HC	27.11	23.98
					07/13/20	HC	27.83	23.26
					11/16/20	PES	28.12	22.97
					02/01/21	HC	23.91	27.18
06/07/21	PES	26.04	25.05					
HMW-11S	SDOT Mercer Parcels	25.0 to 35.0	16.5 to 6.5	44.77	03/19/20	HC	35.50	9.27
					05/11/20	HC	37.15	7.62
					07/13/20	HC	37.80	6.97
					11/16/20	PES	37.54	7.23
					02/01/21	HC	32.53	12.24
06/07/21	PES	23.40	21.37					

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
HMW-17S	SDOT Mercer Parcels, NW quadrant	35.0 to 45.0	22.2 to 12.2	57.35	11/16/20	PES	28.64	28.71
					06/07/21	PES	26.37	30.98
HMW-18S	SDOT Mercer Parcels, NW quadrant	35.0 to 45.0	22.6 to 12.6	57.44	11/16/20	PES	29.28	28.16
					06/07/21	PES	27.05	30.39
HMW-19S	SDOT Mercer Parcels, NW quadrant	35.0 to 45.0	23.2 to 13.2	61.08	11/16/20	PES	33.61	27.47
					06/07/21	PES	31.77	29.31
HMW-20S	SDOT Mercer Parcels, NW quadrant	25.0 to 35.0	28.8 to 18.8	56.49	11/16/20	PES	31.71	24.78
					06/07/21	PES	30.63	25.86
HMW-21S	SDOT Mercer Parcels, SE quadrant	30.0 to 40.0	8.2 to -1.8	37.92	11/16/20	PES	30.41	7.51
					06/07/21	PES	22.32	15.60
HMW-22S	SDOT Mercer Parcels, SE quadrant	27.0 to 37.0	11.7 to 1.8	38.58	11/16/20	PES	31.37	7.21
					06/07/21	PES	23.14	15.44
J5	Property, SW quadrant	10 to 40	29.8 to -0.2	39.95	03/20/17	PES	2.16	37.79
					03/24/17	PES	2.64	37.31
					04/14/17	PES	2.71	37.24
					04/28/17	PES	3.87	36.08
					05/05/17	PES	3.71	36.24
					05/12/17	PES	4.41	35.54
					05/19/17	PES	4.88	35.07
					06/12/17	PES	8.13	31.82
					10/11/17	PES	15.15	24.80
					03/14/19	PES	–	
Decommissioned March 2019								
J15	Property, SE quadrant	10 to 40	28.7 to -1.3	38.85	03/20/17	PES	4.90	33.95
					03/24/17	PES	5.35	33.50
					04/14/17	PES	5.55	33.30
					04/28/17	PES	6.82	32.03
					05/05/17	PES	6.82	32.03
					05/12/17	PES	6.74	32.11
					05/19/17	PES	6.24	32.61
					06/12/17	PES	11.30	27.55
					10/11/17	PES	18.29	20.56
					03/14/19	PES	5.05	33.80
Decommissioned March 2019								
K8	Property, SW quadrant	10 to 40	29.9 to -0.1	40.39	03/20/17	PES	2.97	37.42
					03/24/17	PES	3.77	36.62
					04/14/17	PES	3.70	36.69
					04/28/17	PES	5.10	35.29
					05/05/17	PES	5.15	35.24
					05/12/17	PES	5.99	34.40
05/19/17	PES	6.47	33.92					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
K8 (continued)					06/12/17	PES	10.11	30.28
					10/11/17	PES	17.17	23.22
					03/14/19	PES	–	
					Decommissioned March 2019			
M15	Property, SE quadrant	10 to 40	29.5 to -0.5	39.82	03/20/17	PES	5.22	34.60
					03/24/17	PES	5.75	34.07
					04/14/17	PES	5.97	33.85
					04/28/17	PES	7.24	32.58
					05/05/17	PES	7.40	32.42
					05/12/17	PES	7.93	31.89
					05/19/17	PES	8.47	31.35
					06/12/17	PES	11.53	28.29
					10/11/17	PES	18.44	21.38
					03/14/19	PES	5.05	
Decommissioned March 2019								
MW-1	800 Aloha Street Street Parcel	17.5 to 37.5	–	–	06/17/93	Retec	16.10	
Decommissioned on October 12, 1993								
MW-2	9th Avenue North ROW	27.5 to 37.5	–	–	06/17/93	Retec	15.55	
Decommissioned on October 12, 1993								
MW-3	800 Aloha Street Parcel	17.5 to 37.5	–	–	06/17/93	Retec	15.17	
Decommissioned on October 12, 1993								
MW-4	800 Aloha Street Parcel	22.5 to 32.5	–	–	06/17/93	Retec	15.80	
Decommissioned on October 12, 1993								
MW-5	8th Avenue North ROW	12.5 to 22.5	–	–	06/17/93	Retec	14.57	
Decommissioned on October 12, 1993								
MW-6	800 Aloha Street Parcel	7 to 22	–	58.76	10/26/93	Retec	16.79	41.97
					01/25/94	Retec	17.43	41.33
					04/25/94	Retec	15.75	43.01
					09/15/94	Retec	16.61	42.15
					02/07/12	Windward	14.91	23.29
				38.20				
MW-7	800 Aloha Street Parcel	9 to 18.5	–	55.82	10/26/93	Retec	14.10	41.72
					01/25/94	Retec	15.30	40.52
					04/25/94	Retec	13.40	42.42
					09/15/94	Retec	14.29	41.53
					02/07/12	Windward	12.56	22.53
				35.09				
MW-8	Seattle Roy Aloha Shops, N end	4.5 to 19	28.7 to 14.2	53.72	10/26/93	Retec	12.35	41.37
					01/25/94	Retec	13.51	40.21
					04/25/94	Retec	11.80	41.92
					09/15/94	Retec	12.49	41.23
					02/07/12	Windward	11.64	21.55
					03/20/17	PES	10.42	22.77
					03/24/17	PES	10.54	22.65
					06/12/17	PES	18.95	14.24
					03/14/19	PES	11.23	21.96
					04/22/19	PES	11.18	22.01
					07/16/19	PES	11.97	21.22
					10/21/19	PES	12.46	20.73
					01/13/20	PES	12.15	21.04
				33.19				

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>	
MW-8 (continued)					05/11/20	PES	17.12	16.07	
					07/13/20	PES	17.95	15.24	
					11/16/20	PES	16.84	16.35	
					02/02/21	PES	12.74	20.45	
					06/01/21	PES	13.66	19.53	
MW-9	8th Ave N ROW, E side	7 to 22	34.1 to 19.1	61.35	01/25/94	Retec	15.51	45.84	
					04/25/94	Retec	17.09	44.26	
					09/15/94	Retec	15.50	45.85	
					40.81	06/20/02	Urban	18.30	22.51
						06/02/11	SES	14.89	25.92
					40.74	02/07/12	Windward	16.39	24.42
						09/04/12	SES	16.84	23.97
					12/21/12	SES	15.94	24.87	
					01/06/14	SES	13.99	26.82	
					03/20/17	PES	13.33	27.48	
					03/24/17	PES	13.32	27.49	
					04/14/17	PES	13.59	27.22	
				04/28/17	PES	15.60	25.21		
				05/05/17	PES	15.68	25.13		
				05/12/17	PES	16.54	24.27		
				05/19/17	PES	16.78	24.03		
				06/12/17	PES	19.91	20.90		
				10/11/17	PES	21.80	19.01		
				03/14/19	PES	13.81	27.00		
				04/22/19	PES	13.93	26.88		
				07/16/19	PES	15.27	25.54		
				08/19/19	PES	18.32	22.49		
				10/21/19	PES	20.77	19.97		
				01/13/20	PES	21.58	19.16		
				05/11/20	PES	Dry			
				07/13/20	PES	Dry			
				08/04/20	PES	21.01	19.73		
08/17/20	PES	20.54	20.20						
09/03/20	PES	20.45	20.29						
09/21/20	PES	20.55	20.19						
11/16/20	PES	19.78	20.96						
02/01/21	PES	17.54	23.20						
06/07/21	PES	15.80	24.94						
MW-10	800 Aloha Street Parcel	7 to 22	-	58.53	01/25/94	Retec	15.09	43.44	
					04/25/94	Retec	16.64	41.89	
					09/15/94	Retec	16.64	41.89	
					37.95	06/20/02	Urban	16.55	41.98
						02/07/12	Windward	15.85	22.10
MW121	8th Ave N ROW, E side	15 to 25	26.7 to 16.7	41.72	01/06/14	SES	18.69	23.03	
					03/20/17	PES	12.25	29.47	
					03/24/17	PES	11.09	30.63	
					04/14/17	PES	11.24	30.48	
					04/28/17	PES	11.65	30.07	

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW121 (continued)					05/05/17	PES	12.36	29.36
					05/12/17	PES	11.75	29.97
					05/19/17	PES	11.61	30.11
					06/12/17	PES	14.35	27.37
					10/11/17	PES	21.67	20.05
					03/14/19	PES	10.86	30.86
					04/22/19	PES	11.58	30.14
					07/16/19	PES	17.95	23.77
					08/19/19	PES	22.95	18.77
					10/21/19	PES	24.23	17.49
					01/13/20	PES	24.22	17.50
					05/11/20	PES	Dry	
					07/13/20	PES	Dry	
					07/21/20	PES	24.30	17.42
					08/04/20	PES	24.30	17.42
					08/17/20	PES	24.33	17.39
					09/03/20	PES	24.30	17.42
					09/21/20	PES	24.40	17.32
					11/17/20	PES	19.67	22.05
					02/01/21	PES	16.86	24.86
06/07/21	PES	16.75	24.97					
MW125	Valley St ROW, N side	15 to 30	28.6 to 13.6	43.55	01/06/14	SES	24.18	19.37
					03/20/17	PES	14.40	29.15
					03/24/17	PES	14.55	29.00
					06/28/17	PES	22.20	21.35
					10/11/17	PES	26.39	17.16
					03/14/19	PES	15.59	27.96
					04/22/19	PES	14.95	28.60
					07/16/19	PES	18.30	25.25
					08/19/19	PES	25.96	17.59
					10/21/19	PES	27.26	16.29
					01/13/20	PES	27.85	15.70
					05/11/20	PES	Dry	
					07/13/20	PES	Dry	
					07/21/20	PES	Inaccessible	
					08/17/20	PES	25.15	18.40
					09/03/20	PES	24.68	18.87
					09/21/20	PES	Inaccessible	
					11/16/20	PES	20.9	22.65
02/01/21	PES	18.07	25.48					
06/07/21	PES	18	25.55					
MW-154	Roy St ROW, S side	25 to 35	28.1 to 18.1	52.57	03/14/19	PES	20.81	31.76
					03/26/19	HC	21.94	30.63
					04/22/19	PES	22.40	30.17
					07/16/19	PES	27.03	25.54
					07/17/19	HC	27.02	25.55
					08/19/19	PES	28.80	23.77
					10/21/19	PES	30.16	22.41

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-154 (continued)					01/13/20	PES	29.30	23.27
					03/19/20	HC	29.10	23.47
					05/11/20	PES	29.44	23.13
					07/13/20	PES	30.05	22.52
					07/21/20	PES	29.76	22.81
					08/04/20	PES	29.56	23.01
					08/17/20	PES	29.41	23.16
					09/03/20	PES	29.15	23.42
					09/21/20	PES	28.98	23.59
					11/16/20	PES	25.44	27.13
					02/01/21	PES	22.04	30.53
					06/07/21	PES	24.55	28.02
					MW-155	Roy St ROW, S side	20 to 30	24.4 to 14.4
03/26/19	HC	17.20	26.85					
04/22/19	PES	17.95	26.10					
07/16/19	PES	20.94	23.11					
08/19/19	PES	22.38	21.67					
10/21/19	PES	24.54	19.51					
01/13/20	PES	22.55	21.50					
02/19/20	PES	20.38	23.67					
03/19/20	HC	23.10	20.95					
05/11/20	PES	24.31	19.74					
07/13/20	PES	25.17	18.88					
07/21/20	PES	25.05	19.00					
08/04/20	PES	24.90	19.15					
08/17/20	PES	24.74	19.31					
09/03/20	PES	24.55	19.50					
09/21/20	PES	24.53	19.52					
11/16/20	PES	22.55	21.50					
02/01/21	PES	Inaccessible						
06/07/21	PES	Inaccessible						
MW-159	8th Ave N ROW, E side	20 to 30	22.9 to 12.9	42.79	03/14/19	PES	14.70	28.09
					04/22/19	PES	15.67	27.12
					07/16/19	PES	20.55	22.24
					08/19/19	PES	25.60	17.19
					10/21/19	PES	29.34	13.45
					01/13/20	PES	29.35	13.44
					05/11/20	PES	Dry	
					07/13/20	PES	Dry	
					07/21/20	PES	Dry	
					08/04/20	PES	28.65	14.14
					08/17/20	PES	27.30	15.49
					09/03/20	PES	26.65	16.14
					09/21/20	PES	26.31	16.48
					11/16/20	PES	22.27	20.52
					02/01/21	PES	18.91	23.88
06/07/21	PES	19.73	23.06					

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-210	Valley St ROW, N side	10 to 20	17.1 to 7.1	26.57	03/20/17	PES	–	
					03/24/17	PES	17.75	8.82
					06/12/17	PES	10.95	15.62
					10/11/17	PES	12.71	13.86
					03/14/19	PES	8.59	17.98
					04/22/19	PES	8.71	17.86
					07/16/19	PES	8.22	18.35
					10/21/19	PES	8.62	17.95
					01/13/20	PES	8.95	17.62
					05/11/20	PES	9.30	17.27
					07/13/20	PES	9.55	17.02
					11/16/20	PES	9.91	16.66
					02/01/21	PES	9.69	16.88
					06/07/21	PES	8.23	18.34
MW-214	Valley St ROW, S side	7 to 17	20.8 to 10.8	27.32	03/20/17	PES	6.84	20.48
					03/24/17	PES	7.67	19.65
					06/12/17	PES	16.45	10.87
					10/11/17	PES	Dry	
					03/14/19	PES	8.92	18.40
					04/22/19	PES	9.03	18.29
					07/16/19	PES	8.97	18.35
					10/21/19	PES	9.54	17.78
					01/13/20	PES	9.74	17.58
					05/11/20	PES	13.40	13.92
					07/13/20	PES	13.70	13.62
					11/16/20	PES	13.75	13.57
					02/01/21	PES	11.56	15.76
					06/07/21	PES	9.35	17.97
MW-301	Valley St ROW, S side	18.2 to 28.3	35.6 to 25.65	53.54	10/21/19	PES	Dry	
					07/13/20	PES	Inaccessible	
					07/21/20	PES	Inaccessible	
					08/04/20	PES	Dry	
					08/17/20	PES	Dry	
					09/03/20	PES	Dry	
					09/21/20	PES	Dry	
					11/16/20	PES	22.26	31.28
					02/01/21	PES	19.90	33.64
					06/07/21	PES	21.51	32.03
MW-305	Roy St ROW, S side	22.8 to 32.8	37.4 to 27.4	59.86	10/21/19	PES	28.17	31.69
					01/13/20	PES	27.85	32.01
					03/19/20	HC	23.83	36.03
					05/11/20	PES	25.26	34.60
					07/13/20	PES	26.44	33.42
					07/21/20	PES	26.50	33.36
					08/04/20	PES	26.75	33.11
					08/17/20	PES	26.92	32.94
					09/03/20	PES	27.31	32.55
					09/21/20	PES	28.05	31.81

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-350 (continued)					11/17/20	PES	28.23	31.63
					02/01/21	PES	21.23	38.63
					06/07/21	PES	23.61	36.25
MW-310	Alley E of Seattle Roy Aloha Shops	13.7 to 23.7	19.2 to 9.2	32.48	10/21/19	PES	13.67	18.81
					01/13/20	PES	14.71	17.77
					05/11/20	PES	19.70	12.78
					07/13/20	PES	20.56	11.92
					11/16/20	PES	19.32	13.16
					02/01/21	PES	14.17	18.31
					06/07/21	PES	12.61	19.87
MW-312	Alley E of Seattle Roy Aloha Shops	15.7 to 25.7	19.9 to 9.9	34.99	10/21/19	PES	15.66	19.33
					01/13/20	PES	15.97	19.02
					05/11/20	PES	22.37	12.62
					07/13/20	PES	23.34	11.65
					07/21/20	PES	23.47	11.52
					08/04/20	PES	23.71	11.28
					08/17/20	PES	23.81	11.18
					09/03/20	PES	23.94	11.05
					09/21/20	PES	Inaccessible	
					11/16/20	PES	22.85	12.14
					02/01/21	PES	14.94	20.05
					06/07/21	PES	15.74	19.25
					MW-313	Alley E of Seattle Roy Aloha Shops	19.4 to 29.4	20.4 to 10.4
01/13/20	PES	23.57	15.96					
05/11/20	PES	Dry						
07/13/20	PES	Dry						
11/16/20	PES	Dry						
02/01/21	PES	25.13	14.40					
06/07/21	PES	22.82	16.71					
MW-320	9th Ave N ROW, W side	15.5 to 25.5	18.6 to 8.6	33.57	10/21/19	PES	15.45	18.12
					01/13/20	PES	15.62	17.95
					05/11/20	PES	21.20	12.37
					07/13/20	PES	21.96	11.61
					11/16/20	PES	22.20	11.37
					02/01/21	PES	17.62	15.95
					06/07/21	PES	16.20	17.37
MW-332	Roy St ROW, N side	20.3 to 30.3	15.4 to 5.4	35.72	05/11/20	PES	25.58	10.14
					07/13/20	PES	26.07	9.65
					11/16/20	PES	25.97	9.75
					02/01/21	PES	21.05	14.67
					06/07/21	PES	18.95	16.77
MW-337	Lake Union Park, N end	9.7 to 19.7	17.8 to 7.8	27.51	05/11/20	PES	9.12	18.39
					07/13/20	PES	9.41	18.10
					11/16/20	PES	10.30	17.21
					02/01/21	PES	10.19	17.32
					06/07/21	PES	8.70	18.81

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-339	Lake Union Park, S end	10.1 to 20.1	18.0 to 8.0	28.06	05/11/20	PES	9.95	18.11
					07/13/20	PES	10.26	17.80
					11/16/20	PES	10.74	17.32
					02/01/21	PES	10.20	17.86
					06/07/21	PES	9.15	18.91
N7	Property, SW quadrant	10 to 40	41.8 to 11.8	52.44	03/20/17	PES	NA	
					03/24/17	PES	NA	
					04/14/17	PES	18.70	33.74
					04/28/17	PES	16.98	35.46
					05/05/17	PES	17.10	35.34
					05/12/17	PES	17.51	34.93
					05/19/17	PES	18.02	34.42
					06/12/17	PES	20.93	31.51
					10/11/17	PES	27.13	25.31
					03/14/19	PES	14.72	
Decommissioned March 2019								
R-MW1	Property, NE quadrant	4 to 14	-	28.11	10/24/92	Roux	7.15	20.96
					01/29/09	DOF	10.50	17.61
					02/19/10	SES	10.35	27.43
					06/02/11	SES	7.79	29.99
					02/07/12	Windward	8.98	28.80
					09/05/12	SES	10.11	27.67
					12/21/12	SES	8.44	29.34
					03/29/13	SES	6.72	31.06
Decommissioned prior to 2017								
R-MW2	Property, NE quadrant	5 to 15	36.7 to 26.7	30.86	10/24/92	Roux	10.04	20.82
					01/29/09	DOF	12.97	17.89
					02/19/10	SES	12.93	27.60
					06/02/11	SES	10.52	30.01
					02/07/12	Windward	11.61	30.13
					09/04/12	SES	12.64	29.10
					12/21/12	SES	10.84	30.90
					03/29/13	SES	9.85	31.89
					01/06/14	SES	Dry	
					03/20/17	PES	6.20	35.54
					03/24/17	PES	6.55	35.19
					04/14/17	PES	6.56	35.18
					04/28/17	PES	7.35	34.39
					05/05/17	PES	7.87	33.87
					05/12/17	PES	8.12	33.62
					05/19/17	PES	8.55	33.19
					06/12/17	PES	11.26	30.48
10/11/17	PES	Dry						
03/14/19	PES	6.39	35.35					
Decommissioned March 2019								
R-MW3	Property, NE quadrant	7 to 17	34.7 to 24.7	32.04	10/24/92	Roux	11.29	20.75
					01/29/09	DOF	14.22	17.82
					02/19/10	SES	14.21	27.53
					06/02/11	SES	11.77	29.97

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
R-MW3					02/07/12	Windward	12.90	28.84
					09/04/12	SES	14.00	27.74
					12/21/12	SES	12.09	29.65
					03/29/13	SES	11.17	30.57
					01/06/14	SES	16.35	25.39
					03/20/17	PES	7.34	34.40
					03/24/17	PES	7.66	34.08
					04/14/17	PES	7.68	34.06
					04/28/17	PES	8.46	33.28
					05/05/17	PES	8.78	32.96
					05/12/17	PES	9.20	32.54
					05/19/17	PES	9.48	32.26
					06/12/17	PES	12.48	29.26
					10/11/17	PES	16.45	25.29
					03/14/19	PES	7.41	34.33
Decommissioned March 2019								
R-MW4	Valley St ROW, S side	15 to 30	–	40.94	10/24/92	Roux	21.99	18.95
Decommissioned before 2009								
R-MW5	Dexter Ave N ROW, E side	15 to 30	42.4 to 27.4	47.20	10/28/92	Roux	22.89	24.31
					01/29/09	DOF	22.80	24.40
					02/19/10	SES	21.93	35.08
				57.01	06/02/11	SES	20.48	36.53
					02/07/12	Windward	21.61	35.40
					09/05/12	SES	23.72	33.31
					12/21/12	SES	22.55	34.48
					03/29/13	SES	21.72	35.31
					12/18/13	SES	28.59	28.44
					03/20/17	PES	17.92	39.11
					03/24/17	PES	18.29	38.74
					06/12/17	PES	21.58	35.45
					10/11/17	PES	26.31	30.72
				57.03	03/14/19	PES	18.18	38.85
					04/22/19	PES	18.83	38.20
					07/16/19	PES	25.25	31.78
					10/21/19	PES	25.95	31.06
57.01	01/13/20	PES	25.17	31.84				
	05/11/20	PES	26.49	30.52				
	07/13/20	PES	27.46	29.55				
	11/16/20	PES	22.01	35.00				
	02/01/21	PES	19.54	37.47				
06/07/21	PES	20.56	36.45					
R-MW6	8th Ave N ROW, W side	12 to 22	33.3 to 23.3	35.39	10/28/92	Roux	17.85	17.54
					01/29/09	DOF	19.15	16.24
				45.18	02/19/10	SES	18.25	26.93
					05/03/10	SES	18.25	26.93
					06/02/11	SES	16.22	28.96
				45.28	02/07/12	Windward	14.11	31.07
					09/05/12	SES	19.38	25.90
					12/21/12	SES	15.27	30.01

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
R-MW6 (continued)					03/29/13	SES	17.18	28.10
					01/06/14	SES	22.58	22.70
					03/20/17	PES	11.49	33.79
					03/24/17	PES	11.82	33.46
					04/14/17	PES	12.37	32.91
					04/28/17	PES	13.41	31.87
					05/05/17	PES	13.60	31.68
					05/12/17	PES	13.99	31.29
					05/19/17	PES	14.21	31.07
					06/12/17	PES	17.08	28.20
					10/11/17	PES	Dry	
					03/14/19	PES	12.24	33.04
					04/22/19	PES	Inaccessible	
					07/16/19	PES	Inaccessible	
					05/11/20	PES	Inaccessible	
					07/13/20	PES	Inaccessible	
					09/21/20	PES	21.31	23.97
					10/01/20	PES	20.10	25.18
11/16/20	PES	Inaccessible						
02/01/21	PES	12.30	32.98					
06/07/21	PES	16.41	28.87					
SCL-MW101	Alley E of Seattle Roy Aloha Shops	5 to 15	25.5 to 15.5	30.46	02/07/12	Windward	7.48	22.98
					01/06/14	SES	13.09	17.37
					03/20/17	PES	7.00	23.46
					03/24/17	PES	7.08	23.38
					06/14/17	PES	11.50	18.96
					10/11/17	PES	Dry	
					03/14/19	PES	7.64	22.82
					04/22/19	PES	7.55	22.91
					07/16/19	PES	7.90	22.56
					10/21/19	PES	8.85	21.17
					01/13/20	PES	7.87	22.15
					05/11/20	PES	12.46	17.56
					07/13/20	PES	13.95	16.07
					11/16/20	PES	11.32	18.70
02/01/21	PES	9.57	20.45					
06/07/21	PES	9.60	20.42					
SCL-MW102	800 Aloha Street Parcel	-	-	-	02/07/12	Windward	7.89	
SCL-MW105	Alley E of Seattle Roy Aloha Shops	20 to 30	11.1 to 1.1	31.26	02/07/12	Windward	10.46	20.80
					01/06/14	SES	13.88	17.38
					03/20/17	PES	11.40	19.86
					03/24/17	PES	10.04	21.22
					06/12/17	PES	20.45	10.81
					10/11/17	PES	23.47	7.79
					03/14/19	PES	7.97	23.29
					04/22/19	PES	7.98	23.28
07/16/19	PES	10.87	20.39					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
SCL-MW105 (continued)				30.77	10/21/19	PES	10.42	20.35
					01/13/20	PES	13.00	17.77
					05/11/20	PES	16.90	13.87
					07/13/20	PES	14.63	16.14
					11/16/20	PES	16.74	14.03
					02/01/21	PES	13.48	17.29
					06/07/21	PES	11.95	18.82
SCS-1	800 Aloha Street Parcel	–	–	39.55	02/07/12	Windward	17.51	22.04
SCS-2	Seattle Roy Aloha Shops, N end	11 to 21	28.2 to 18.2	39.16	02/07/12	Windward	16.56	22.60
					03/20/17	PES	15.65	23.51
					03/24/17	PES	–	
					06/12/17	PES	20.18	18.98
					03/14/19	PES	16.22	22.94
					04/22/19	PES	16.29	22.87
					07/16/19	PES	17.04	22.12
					10/21/19	PES	18.95	20.21
					01/13/20	PES	18.28	20.88
					05/11/20	PES	Dry	
					05/11/20	PES	Dry	
					07/13/20	PES	Dry	
					11/16/20	PES	Dry	
					02/02/21	PES	18.44	20.72
06/01/21	PES	18.68	20.48					
SCS-3	800 Aloha Street Parcel	–	–	36.73	02/07/12	Windward	14.10	22.63
SCS-4	800 Aloha Street Parcel	–	–	35.33	02/07/12	Windward	12.93	22.40
SCS-5	800 Aloha Street Parcel	–	–	39.06	02/07/12	Windward	17.81	21.25
<b>Intermediate A Zone</b>								
BB-5	SDOT Mercer Parcels, SE quadrant	30 to 40	–	–	09/05/97	B&V	23.60	
					09/09/97	B&V	23.90	
					10/17/97	B&V	22.78	
					11/17/97	B&V	23.40	
					12/02/97	B&V	22.28	
					01/21/98	B&V	23.85	
					02/27/98	B&V	23.45	
					03/25/98	B&V	22.86	
					04/24/98	B&V	23.40	
					06/05/98	B&V	23.56	
					07/08/98	B&V	23.83	
					07/27/98	B&V	24.25	
					08/25/98	B&V	24.42	
					09/30/98	B&V	24.04	
Decommissioned prior to 2017								
BB-7	Valley St ROW, S side	25 to 35	–	–	06/13/97	B&V	8.80	
					06/20/97	B&V	8.40	

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>					
BB-7 (continued)					06/24/97	B&V	9.70						
					11/17/97	B&V	9.44						
					12/02/97	B&V	7.78						
					01/22/98	B&V	9.83						
					02/27/98	B&V	9.01						
					03/25/98	B&V	8.98						
					04/22/98	B&V	9.18						
					06/05/98	B&V	9.39						
					07/08/98	B&V	9.14						
					07/27/98	B&V	9.55						
					08/25/98	B&V	10.50						
					09/29/98	B&V	9.83						
					Decommissioned prior to 2017								
					BB-8	Roy St ROW, S side	30 to 40	14.0 to 4.0	-	06/20/97	B&V	17.49	
06/24/97	B&V	19.00											
10/06/97	B&V	20.40											
01/25/98	B&V	20.68											
02/28/98	B&V	20.20											
03/30/98	B&V	20.14											
04/22/98	B&V	19.99											
06/04/98	B&V	20.51											
07/27/98	B&V	24.02											
01/29/09	DOF	20.08											
44.25	02/19/10	SES	18.66	25.59									
	05/03/10	SES	19.90	24.35									
	06/02/11	SES	17.64	26.61									
	02/07/12	Windward	15.39	28.86									
44.26	09/05/12	SES	20.01	24.25									
	12/21/12	SES	16.23	28.03									
	03/29/13	SES	18.70	25.56									
43.69	01/06/14	SES	24.42	19.27									
	06/16/15	SES	18.90	24.79									
	03/20/17	PES	13.21	30.48									
	03/24/17	PES	13.26	30.43									
	06/12/17	PES	18.80	24.89									
	10/11/17	PES	23.87	19.82									
	03/14/19	PES	13.73	29.96									
	04/22/19	PES	15.36	28.33									
	07/17/19	PES	20.41	23.28									
43.64	10/21/19	PES	26.19	17.45									
	01/13/20	PES	24.10	19.54									
	05/11/20	PES	26.62	17.02									
	07/13/20	PES	27.60	16.04									
	11/16/20	PES	20.95	22.69									
	02/01/21	PES	15.33	28.31									
	06/07/21	PES	18.35	25.29									
BB-12	9th Ave N ROW, W side	35 to 45	-	-	03/25/98	B&V	14.89						
					04/27/98	B&V	14.97						
					05/19/98	B&V	15.01						

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
BB-12 (continued)				34.01	07/08/98	B&V	15.32	17.68 19.49
					07/28/98	B&V	15.68	
					08/25/98	B&V	15.00	
					09/29/98	B&V	14.78	
					02/19/10	SES	16.33	
					05/02/10	SES	14.52	
Decommissioned prior to 2017								
BB-13	Westlake Ave N ROW, W side	35 to 45	-	-	03/25/98	B&V	9.38	18.15 18.52 20.09
					04/23/98	B&V	8.76	
					05/19/98	B&V	9.11	
					07/08/98	B&V	9.00	
					07/28/98	B&V	9.25	
					09/29/98	B&V	8.00	
					02/19/10	SES	9.50	
					05/02/10	SES	9.13	
					02/07/12	Windward	7.56	
Decommissioned prior to 2017								
BB-14	Valley St ROW, N side	40 to 60	-	-	03/25/98	B&V	8.38	
					04/22/98	B&V	8.24	
					05/19/98	B&V	8.29	
					07/08/98	B&V	7.42	
					07/28/98	B&V	9.03	
					08/25/98	B&V	9.49	
					09/29/98	B&V	6.14	
					Decommissioned prior to 2017			
DMW-3IA	615 Dexter, NE quadrant	39.0 to 49.0	16.8 to 6.8	55.84	03/19/20	HC	25.39	30.45
					05/11/20	HC	25.99	29.85
					07/13/20	HC	26.68	29.16
					11/16/20	PES	26.24	29.60
					02/01/21	HC	22.90	32.94
					06/07/21	PES	23.79	32.05
HC-4	601 Dexter, NE quadrant	40 to 50	20.2 to 10.2	60	03/19/20	HC	31.50	28.50
					05/11/20	HC	32.21	27.79
					06/07/21	PES	31.13	28.87
FMW-136	Block 38 West, S end	30 to 40	-4.9 to -14.9	24.79	08/30/18	Farallon	8.10	16.69
					12/28/18	Farallon	7.74	17.05
					03/26/19	Farallon	7.41	17.38
FMW-142	9th Ave N ROW, E side	37.5 to 42.5	-4.6 to -9.6	32.52	10/31/19	PES	15.50	17.02
					01/13/20	PES	17.13	15.39
					04/28/20	PES	18.83	13.69
					07/13/20	PES	22.86	9.66
					11/16/20	PES	22.57	9.95
					02/01/21	PES	18.91	13.61
					06/07/21	PES	16.13	16.39
G-MW3	Property, SE quadrant	26 to 36	-	-	07/24/01	GeoEngine	13.05	26.72
					12/10/04	DOF	15.30	
					01/29/09	DOF	13.49	
					02/19/10	SES	12.83	

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
G-MW3 (continued)					06/02/11	SES	11.00	28.55
					02/07/12	Windward	10.51	29.04
					09/06/12	SES	13.14	26.41
					12/21/12	SES	10.95	28.60
					03/29/13	SES	11.14	28.41
Decommissioned prior to 2017								
GEI-1	Block 37, SW quadrant	26.8 to 36.8	1.2 to -8.9	27.95	03/24/17	PES	8.63	19.32
					06/12/17	PES	21.91	6.04
					03/14/19	PES	9.64	18.31
					04/22/19	PES	9.28	18.67
					07/16/19	PES	9.59	18.36
					10/21/19	PES	10.62	17.33
					01/13/20	PES	11.37	16.58
					05/11/20	PES	15.74	12.21
					07/13/20	PES	16.09	11.86
					11/16/20	PES	15.75	12.20
					02/01/21	PES	13.03	14.92
06/07/21	PES	10.98	16.97					
GEI-MW-1	Block 79 East, N end	39.8 to 59.8	-9.7 to -29.7	30.30	05/11/20	PES	18.65	11.65
					07/13/20	PES	18.97	11.33
					11/16/20	PES	Inaccessible	
					02/01/21	PES	15.82	14.48
					06/07/21	PES	13.25	17.05
HMW-2IA	SDOT Mercer Parcels, NE quadrant	34.8 to 44.8	10.8 to 0.8	47.51	03/20/19	HC	18.61	28.90
					03/26/19	HC	19.11	28.40
					07/16/19	HC	24.28	23.23
					12/05/19	HC	27.83	19.68
					01/13/20	HC	25.48	22.03
					03/19/20	HC	27.29	20.22
					04/10/20	HC	27.59	19.92
					05/11/20	HC	28.27	19.24
					07/13/20	HC	28.86	18.65
					11/16/20	PES	23.31	24.20
					02/01/21	HC	19.55	27.96
06/07/21	PES	23.32	24.19					
HMW-3IA	SDOT Mercer Parcels, NW quadrant	34.8 to 44.8	20.2 to 10.2	54.75	03/19/19	HC	23.71	31.04
					03/26/19	HC	23.99	30.76
					07/16/19	HC	28.11	26.64
					12/05/19	HC	30.82	23.93
					01/13/20	HC	29.86	24.89
					03/19/20	HC	29.54	25.21
					04/10/20	HC	29.70	25.05
					05/11/20	HC	30.05	24.70
					07/13/20	HC	30.58	24.17
					11/16/20	PES	27.90	26.85
					02/01/21	HC	24.59	30.16
06/07/21	PES	26.52	28.23					

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
HMW-6IA	SDOT Mercer Parcels, SW quadrant	37.5 to 47.5	21.2 to 11.2	61.27	03/19/20	HC	33.43	27.84
					05/11/20	HC	34.25	27.02
					07/13/20	HC	36.05	25.22
					11/16/20	PES	35.39	25.88
					02/01/21	HC	33.25	28.02
					06/07/21	PES	33.91	27.36
HMW-9IA	SDOT Mercer Parcels, SW quadrant	36.7 to 46.7	18.6 to 8.6	58.21	03/19/20	HC	34.18	24.03
					05/11/20	HC	34.48	23.73
					07/13/20	HC	34.95	23.26
					11/16/20	PES	32.91	25.30
					02/01/21	HC	30.89	27.32
					06/07/21	PES	32.22	25.99
HMW-20IA	SDOT Mercer Parcels, NW quadrant	41.0 to 51.0	12.8 to 2.8	56.47	11/16/20	PES	30.74	25.73
					06/07/21	PES	30.43	26.04
MW107	8th Ave N ROW, W side	35 to 45	8.8 to -1.2	43.82	12/21/12	SES	17.28	26.54
					03/29/13	SES	18.28	25.54
					01/06/14	SES	26.74	17.08
					06/16/15	SES	17.78	26.04
					10/19/15	SES	19.88	23.94
					02/01/16	SES	12.85	30.97
					03/20/17	PES	11.80	32.02
					03/24/17	PES	12.20	31.62
					04/14/17	PES	12.31	31.51
					04/28/17	PES	14.12	29.70
					05/05/17	PES	14.34	29.48
					05/12/17	PES	14.85	28.97
					05/19/17	PES	15.03	28.79
					06/12/17	PES	18.62	25.20
					10/11/17	PES	25.10	18.72
					03/14/19	PES	12.84	30.98
					04/22/19	PES	13.35	30.47
					07/16/19	PES	21.75	22.07
					10/21/19	PES	35.69	8.13
					01/13/20	PES	31.55	12.27
					05/11/20	PES	34.30	9.52
					07/13/20	PES	34.99	8.83
					07/21/20	PES	30.10	13.72
08/04/20	PES	27.84	15.98					
08/17/20	PES	26.56	17.26					
09/03/20	PES	25.84	17.98					
09/21/20	PES	25.32	18.50					
					11/16/20	PES	Inaccessible	
					02/01/21	PES	Inaccessible	
					06/07/21	PES	Inaccessible	
MW108	Alley E of Seattle Roy Aloha Shops	40 to 50	-7.2 to -17.2	32.78	12/21/12	SES	13.43	19.35
					03/29/13	SES	15.76	17.02
					01/06/14	SES	21.44	11.34

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW108 (continued)					06/16/15	SES	15.53	17.25
					10/19/15	SES	17.16	15.62
					02/01/16	SES	16.31	16.47
					03/20/17	PES	12.53	20.25
					03/24/17	PES	12.61	20.17
					06/12/17	PES	28.13	4.65
					10/11/17	PES	29.02	3.76
					03/14/19	PES	13.46	19.32
					04/22/19	PES	13.19	19.59
					07/16/19	PES	13.84	18.94
					10/21/19	PES	15.92	16.86
					01/13/20	PES	17.32	15.46
					05/11/20	PES	22.13	10.65
					07/13/20	PES	22.50	10.28
					11/16/20	PES	21.55	11.23
02/01/21	PES	18.04	14.74					
06/07/21	PES	15.50	17.28					
MW109	Alley E of Seattle Roy Aloha Shops	35 to 45	-0.0 to -10.0	34.97	12/21/12	SES	15.80	19.17
					03/29/13	SES	18.39	16.58
					01/06/14	SES	24.74	10.23
					06/16/15	SES	18.06	16.91
					10/19/15	SES	19.80	15.17
					02/01/16	SES	19.04	15.93
					03/20/17	PES	15.00	19.97
					03/24/17	PES	15.00	19.97
					06/12/17	PES	31.53	3.44
					10/11/17	PES	32.17	2.80
				03/14/19	PES	15.87	19.10	
				04/22/19	PES	15.62	19.35	
				07/16/19	PES	16.23	18.74	
				10/21/19	PES	18.14	16.83	
				01/13/20	PES	19.58	15.29	
				02/24/20	PES	23.01	11.86	
				05/11/20	PES	24.80	10.07	
				07/13/20	PES	25.28	9.59	
				07/21/20	PES	25.21	9.66	
				08/04/20	PES	25.25	9.62	
08/17/20	PES	25.21	9.66					
09/03/20	PES	25.22	9.65					
09/21/20	PES	Inaccessible						
11/16/20	PES	24.59	10.28					
02/01/21	PES	20.78	14.09					
06/07/21	PES	18.14	16.73					
MW110	Alley E of Seattle Roy Aloha Shops	35 to 45	4.7 to -5.3	39.67	12/21/12	SES	20.01	19.66
					03/29/13	SES	22.95	16.72
					01/06/14	SES	30.48	9.19
					04/22/15	SES	22.59	17.08
					06/16/15	SES	22.72	16.95

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW110 (continued)					10/19/15	SES	24.57	15.10
					02/01/16	SES	23.30	16.37
					03/20/17	PES	19.10	20.57
					03/24/17	PES	18.95	20.72
					06/12/17	PES	34.70	4.97
					10/11/17	PES	36.46	3.21
					03/14/19	PES	20.18	19.49
					04/22/19	PES	20.08	19.59
					07/16/19	PES	20.83	18.84
					10/21/19	PES	22.65	17.02
					01/13/20	PES	23.89	15.78
					05/11/20	PES	29.95	9.72
					07/13/20	PES	30.51	9.16
					07/21/20	PES	30.55	9.12
					08/04/20	PES	30.70	8.97
					08/17/20	PES	30.64	9.03
					09/03/20	PES	30.67	9.00
					09/21/20	PES	Inaccessible	
					11/16/20	PES	30.04	9.63
					02/01/21	PES	25.28	14.39
06/07/21	PES	23.00	16.67					
MW114	SDOT Mercer Parcels, NW quadrant	35 to 45	10.8 to 0.8	45.84	12/21/12	SES	16.50	29.34
					03/29/13	SES	19.54	26.30
					01/06/14	SES	25.93	19.91
					Destroyed			
MW115	9th Ave N ROW, W side	35 to 45	-0.6 to -10.6	34.14	12/21/12	SES	15.26	18.88
					03/29/13	SES	18.34	15.80
					01/06/14	SES	26.08	8.06
					04/22/15	SES	16.49	17.65
					06/16/15	SES	17.72	16.42
					10/19/15	SES	19.61	14.53
					02/01/16	SES	19.14	15.00
					03/20/17	PES	14.72	19.38
					03/24/17	PES	14.70	19.40
					06/12/17	PES	32.50	1.60
				10/11/17	PES	32.58	1.52	
				03/14/19	PES	15.64	18.46	
				04/22/19	PES	15.42	18.68	
				07/16/19	PES	15.80	18.30	
				10/21/19	PES	17.34	16.76	
				01/13/20	PES	19.13	14.97	
				05/11/20	PES	24.84	9.26	
				07/13/20	PES	25.39	8.71	
				11/16/20	PES	24.97	9.13	
				02/01/21	PES	21.00	13.10	
06/07/21	PES	18.00	16.10					
MW116	9th Ave N ROW, W side	35 to 45	-3.1 to -13.1	31.36	12/21/12	SES	12.24	19.12
					03/29/13	SES	14.65	16.71

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW116 (continued)				31.34	01/06/14	SES	20.30	11.06
					06/16/15	SES	14.54	16.82
					10/19/15	SES	16.07	15.29
					02/01/16	SES	15.49	15.87
					03/20/17	PES	11.95	19.39
					03/24/17	PES	11.99	19.35
					04/14/17	PES	11.99	19.35
					04/28/17	PES	20.60	10.74
					05/05/17	PES	21.35	9.99
					05/12/17	PES	22.16	9.18
					05/19/17	PES	22.46	8.88
					06/12/17	PES	27.33	4.01
					10/11/17	PES	28.26	3.08
					03/14/19	PES	12.72	18.62
					04/22/19	PES	12.41	18.93
					07/16/19	PES	12.80	18.54
					10/21/19	PES	13.30	18.04
					01/13/20	PES	15.59	15.75
					05/11/20	PES	20.55	10.79
					07/13/20	PES	20.99	10.35
11/16/20	PES	21.41	9.93					
02/01/21	PES	18.88	12.46					
06/07/21	PES	14.66	16.68					
MW117	Dexter Ave N ROW, E side	40 to 55	16.9 to 1.9	56.90	02/08/13	SES	27.46	29.44
					03/29/13	SES	27.81	29.09
					01/06/14	SES	30.54	26.36
					Destroyed			
MW118	Mercer St ROW, N side	40 to 50	12.9 to 2.9	52.91	03/25/13	SES	27.18	25.73
					03/29/13	SES	27.49	25.42
					01/06/14	SES	29.81	23.10
					Destroyed			
MW119	9th Ave N ROW, W side	35 to 45	2.7 to -7.3	37.35	03/25/13	SES	22.21	15.14
					03/29/13	SES	22.52	14.83
					01/06/14	SES	32.12	5.23
					04/22/15	SES	21.12	16.23
					06/16/15	SES	21.12	16.23
					10/19/15	SES	23.50	13.85
					02/01/16	SES	22.99	14.36
					03/20/17	PES	17.40	20.02
					03/24/17	PES	17.45	19.97
					04/14/17	PES	17.91	19.51
					04/28/17	PES	27.14	10.28
					05/05/17	PES	28.25	9.17
					05/12/17	PES	29.25	8.17
					05/19/17	PES	29.68	7.74
					06/12/17	PES	35.73	1.69
					10/11/17	PES	39.94	-2.52
					03/14/19	PES	18.79	18.63
03/26/19	HC	18.62	18.80					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW119 (continued)					04/22/19	PES	18.64	18.78
					07/16/19	PES	19.07	18.35
					07/17/19	HC	18.97	18.45
					07/30/19	HC	19.18	18.24
					10/21/19	PES	20.44	16.98
					11/11/19	Farallon	20.74	16.68
					01/13/20	PES	22.31	15.11
					01/14/20	Farallon	22.51	14.91
					02/18/20	Farallon	25.66	11.76
					03/19/20	HC	28.14	9.28
					03/24/20	Farallon	28.36	9.06
					05/11/20	PES	29.32	8.10
					07/13/20	PES	29.96	7.46
					11/16/20	PES	29.50	7.92
					02/01/21	PES	24.79	12.63
06/07/21	PES	21.75	15.67					
MW120	8th Ave N ROW, E side	40 to 50	0.0 to -10.0	40.00	01/06/14	SES	22.80	17.20
					06/16/15	SES	18.10	21.90
					10/19/15	SES	19.91	20.09
					02/01/16	SES	16.98	23.02
					03/20/17	PES	16.50	23.50
					03/24/17	PES	15.24	24.76
					06/12/17	PES	23.65	16.35
					10/11/17	PES	26.99	13.01
					03/14/19	PES	16.06	23.94
					04/22/19	PES	15.79	24.21
					07/16/19	PES	17.55	22.45
					08/19/19	PES	20.17	19.83
					10/21/19	PES	22.88	17.12
				39.94	01/13/20	PES	23.57	16.37
				05/11/20	PES	26.57	13.37	
				07/13/20	PES	26.52	13.42	
				07/21/20	PES	25.45	14.49	
				08/04/20	PES	24.39	15.55	
				08/17/20	PES	23.88	16.06	
				09/03/20	PES	23.55	16.39	
				09/21/20	PES	23.55	16.39	
11/16/20	PES	22.07	17.87					
02/01/21	PES	19.3	20.64					
06/07/21	PES	18.34	21.60					
MW127	8th Ave N ROW, E side	40 to 50	-1 to -11	39.04	01/06/14	SES	22.09	16.95
					08/01/19	PES	17.76	21.28
					10/21/19	PES	20.33	18.71
					01/13/20	PES	21.06	17.98
					05/11/20	PES	24.08	14.96
					07/13/20	PES	24.06	14.98
11/16/20	PES	21.42	17.62					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW127 (continued)					02/01/21	PES	19.31	19.73
					06/07/21	PES	18.10	20.94
MW131	Property, SE quadrant	45 to 55	-4.2 to -14.2	39.39	03/20/17	PES	9.73	29.66
					03/24/17	PES	10.11	29.28
					04/14/17	PES	10.31	29.08
					04/28/17	PES	12.10	27.29
					05/05/17	PES	13.10	26.29
					05/12/17	PES	12.69	26.70
					05/19/17	PES	12.84	26.55
					06/12/17	PES	15.77	23.62
					10/11/17	PES	20.75	18.64
					03/14/19	PES	8.48	30.91
Decommissioned prior to 2017								
MW-142	8th Ave N ROW, E side	40 to 50	2.4 to -7.6	42.12	03/14/19	PES	15.42	26.70
					04/22/19	PES	15.75	26.37
					07/16/19	PES	20.13	21.99
					08/19/19	PES	27.21	14.91
					10/21/19	PES	29.14	12.98
					01/13/20	PES	29.58	12.54
					05/11/20	PES	32.15	9.97
					07/13/20	PES	32.26	9.86
					07/21/20	PES	29.21	12.91
					08/04/20	PES	27.42	14.70
					08/17/20	PES	26.62	15.50
					09/03/20	PES	26.05	16.07
					09/21/20	PES	25.85	16.27
					11/16/20	PES	22.44	19.68
02/01/21	PES	19.42	22.70					
06/07/21	PES	19.63	22.49					
MW-144	8th Ave N ROW, E side	40 to 50	3.9 to -6.1	43.50	03/14/19	PES	14.07	29.43
					04/22/19	PES	15.73	27.77
					07/16/19	PES	-	
Decommissioned December 2019								
MW-144R	8th Ave N ROW, E side	40 to 50	2.8 to -7.3	42.46	01/13/20	PES	29.43	13.03
					05/11/20	PES	31.36	11.10
					07/13/20	PES	30.83	11.63
					07/21/20	PES	29.77	12.69
					08/04/20	PES	28.68	13.78
					08/17/20	PES	26.61	15.85
					09/03/20	PES	Inaccessible	
					09/21/20	PES	Inaccessible	
					11/16/20	PES	21.43	21.03
					02/01/21	PES	18.53	23.93
06/07/21	PES	22.48	19.98					
MW-146	Roy St ROW, S side	40 to 50	12.9 to 2.9	52.34	03/14/19	PES	19.89	32.45
					03/26/19	HC	21.12	31.22
					04/22/19	PES	22.15	30.19
					07/16/19	PES	30.04	22.30

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-146 (continued)					07/17/19	HC	30.16	22.18
					08/19/19	PES	32.45	19.89
					10/21/19	PES	33.98	18.36
					01/13/20	PES	32.90	19.44
					03/19/20	HC	33.66	18.68
					05/11/20	PES	33.90	18.44
					07/13/20	PES	34.35	17.99
					07/21/20	PES	33.58	18.76
					08/04/20	PES	32.84	19.50
					08/17/20	PES	32.44	19.90
					09/03/20	PES	31.90	20.44
					09/21/20	PES	31.35	20.99
					11/16/20	PES	25.89	26.45
					02/01/21	PES	22.24	30.10
06/07/21	PES	25.91	26.43					
MW-149	Property, NE quadrant	35 to 45	0.7 to -9.3	35.22	03/14/19	PES	3.15	32.07
Decommissioned March 2019								
MW-151	Property, SW quadrant	35 to 45	4.9 to -5.1	39.38	03/14/19	PES	3.35	36.03
Decommissioned March 2019								
MW-156	8th Ave N ROW, E side	40 to 50	2.0 to -8.0	41.24	01/24/19	PES	15.06	26.18
					03/14/19	PES	15.72	25.52
					04/22/19	PES	16.06	25.18
					07/16/19	PES	19.32	21.92
					08/19/19	PES	26.07	15.17
					10/21/19	PES	27.26	13.98
					01/13/20	PES	27.61	13.63
					05/11/20	PES	30.58	10.66
					07/13/20	PES	30.44	10.80
					07/21/20	PES	28.06	13.18
					08/04/20	PES	26.56	14.68
					08/17/20	PES	25.80	15.44
					09/03/20	PES	25.46	15.78
					09/21/20	PES	25.20	16.04
11/16/20	PES	22.24	19.00					
02/01/21	PES	19.25	21.99					
06/07/21	PES	19.20	22.04					
MW-189	Valley St ROW, S side	48.8 to 58.8	-1.2 to -11.2	47.33	10/21/19	PES	34.50	12.83
					01/13/20	PES	34.96	12.37
					05/11/20	PES	35.56	11.77
					07/13/20	PES	35.10	12.23
					07/21/20	PES	32.15	15.18
					08/04/20	PES	30.91	16.42
					08/17/20	PES	28.82	18.51
					09/03/20	PES	28.16	19.17
					09/21/20	PES	27.77	19.56
					10/01/20	PES	26.35	20.98
11/16/20	PES	23.37	23.96					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-189 (continued)					02/01/21	PES	20.61	26.72
					06/07/21	PES	21.78	25.55
MW-302	Dexter Ave N ROW, E side	54.3 to 64.3	3.0 to -7.0	57.03	10/21/19	PES	46.52	10.51
					01/13/20	PES	40.09	16.94
					05/11/20	PES	45.70	11.33
					07/13/20	PES	41.51	15.52
					11/16/20	PES	28.90	28.13
					02/01/21	PES	24.61	32.42
					06/07/21	PES	25.23	31.80
MW-306	Roy St ROW, S side	42.8 to 52.8	17.2 to 7.2	59.48	10/21/19	PES	30.04	29.44
					01/13/20	PES	29.63	29.85
					03/19/20	HC	28.75	30.73
					05/11/20	PES	29.29	30.19
					07/13/20	PES	29.98	29.50
					07/21/20	PES	30.00	29.48
					08/04/20	PES	30.08	29.40
					08/17/20	PES	30.20	29.28
					09/03/20	PES	30.39	29.09
					09/21/20	PES	30.42	29.06
					11/16/20	PES	29.75	29.73
					02/01/21	PES	26.39	33.09
					06/07/21	PES	27.22	32.26
MW-308	Alley E of Seattle Roy Aloha Shops	35.1 to 45.1	-4.7 to -14.7	30.15	10/21/19	PES	13.07	17.08
					01/13/20	PES	14.32	15.83
					02/24/20	PES	17.04	13.11
					05/11/20	PES	18.70	11.45
					07/13/20	PES	19.06	11.09
					11/16/20	PES	18.25	11.90
					02/01/21	PES	15.02	15.13
					06/07/21	PES	12.65	17.50
MW-315	Mercer St ROW, N side	37.5 to 47.5	12.2 to 2.2	49.18	10/21/19	PES	27.08	22.10
					01/13/20	PES	25.80	23.38
					03/19/20	HC	27.24	21.94
					05/11/20	PES	28.12	21.06
					07/13/20	PES	28.65	20.53
					11/16/20	PES	25.28	23.90
					02/01/21	PES	22.31	26.87
					06/07/21	PES	24.80	24.38
MW-317	9th Ave N ROW, W side	28.2 to 38.2	3.4 to -6.6	31.35	10/21/19	PES	13.86	17.49
					01/13/20	PES	14.80	16.55
					05/11/20	PES	19.14	12.21
					07/13/20	PES	19.65	11.70
					11/16/20	PES	19.37	11.98
					02/01/21	PES	16.28	15.07
					06/07/21	PES	14.18	17.17
MW-325	Mercer St ROW, N side	34.5 to 44.5	7.0 to -3.0	40.90	10/21/19	PES	23.69	17.21
					01/13/20	PES	25.57	15.33

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-325 (continued)					03/19/20	PES	31.64	9.26
					05/11/20	PES	33.31	7.59
					07/13/20	PES	34.03	6.87
					09/21/20	PES	34.33	6.57
					11/16/20	PES	33.78	7.12
					02/01/21	PES	28.79	12.11
					06/07/21	PES	25.55	15.35
MW-327	Lake Union Park, S end	24.8 to 34.8	3.6 to -6.3	28.15	10/21/19	PES	10.06	18.09
					01/13/20	PES	10.48	17.67
					05/11/20	PES	12.52	15.63
					07/13/20	PES	12.95	15.20
					09/21/20	PES	13.83	14.32
					11/16/20	PES	12.38	15.77
					02/01/21	PES	11.04	17.11
06/07/21	PES	9.75	18.40					
MW-330	Valley St ROW, N side	52.1 to 62.1	-0.4 to -10.4	51.67	05/11/20	PES	34.24	17.43
					07/13/20	PES	34.98	16.69
					08/17/20	PES	29.84	21.83
					09/03/20	PES	29.06	22.61
					09/21/20	PES	28.6	23.07
					11/16/20	PES	24.6	27.07
					02/01/21	PES	22.27	29.40
06/07/21	PES	23.01	28.66					
MW-331	Alley E of Seattle Roy Aloha Shops	35.6 to 45.6	-5.2 to -15.2	30.43	05/11/20	PES	17.05	13.38
					07/13/20	PES	17.32	13.11
					11/16/20	PES	16.83	13.60
					02/03/21	PES	14.07	16.36
					06/07/21	PES	12.09	18.34
MW-333	900 Roy St, S end	33.2 to 43.2	-2.1 to -12.1	31.10	05/11/20	PES	20.26	10.84
					07/13/20	PES	20.65	10.45
					11/16/20	PES	20.34	10.76
					02/01/21	PES	17.12	13.98
					06/07/21	PES	14.57	16.53
MW-344	SDOT Mercer Parcels, NW quadrant	39.4 to 49.4	13.6 to 3.6	52.70	06/07/21	PES	26.19	26.51
<b>Intermediate B Zone</b>								
FMW-130	Block 38 West, S end	45 to 55	-22.8 to -32.8	21.86	08/30/18	Farallon	5.14	16.72
					12/28/18	Farallon	4.98	16.88
					03/26/19	Farallon	4.42	17.44
FMW-141	Alley E of Seattle Roy Aloha Shops	47.5 to 57.5	-12.1 to -22.1	35.15	10/30/19	PES	18.31	16.84
					01/13/20	PES	19.86	15.29
					05/11/20	PES	25.17	9.98
					07/13/20	PES	26.65	8.50
					07/21/20	PES	25.53	9.62
					08/04/20	PES	25.55	9.60
					08/17/20	PES	24.53	10.62

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>					
FMW-141 (continued)					09/03/20	PES	25.54	9.61					
					09/21/20	PES	Inaccessible						
					11/16/20	PES	24.25	10.90					
					02/01/21	PES	22.15	13.00					
					06/07/21	PES	18.52	16.63					
G-MW1	Property, NW quadrant	30 to 35	-	-	07/24/01	GeoEngine	10.54						
					01/29/09	DOF	11.25						
					02/19/10	SES	10.47	28.54					
					06/03/11	SES	8.15	30.86					
					02/07/12	Windward	9.34	29.67					
					09/06/12	SES	11.11	27.90					
					12/21/12	SES	9.04	29.97					
					03/29/13	SES	10.11	28.90					
					Decommissioned prior to 2017								
					HMW-1IB	SDOT Mercer Parcels, NE quadrant	54.3 to 64.3	-16.0 to -26.0	38.38	03/20/19	HC	19.29	19.09
03/26/19	HC	19.47	18.91										
05/16/19	HC	19.22	19.16										
07/17/19	HC	19.89	18.49										
08/15/19	HC	20.25	18.13										
12/05/19	HC	21.91	16.47										
01/13/20	HC	20.79	17.59										
03/19/20	HC	28.58	9.80										
04/10/20	HC	29.39	8.99										
05/11/20	HC	29.90	8.48										
07/13/20	HC	30.57	7.81										
11/16/20	PES	30.10	8.28										
02/01/21	HC	25.55	12.83										
06/07/21	PES	22.60	15.78										
HMW-2IB	SDOT Mercer Parcels, NE quadrant	52.8 to 62.8	-5.4 to -15.4	47.19	03/20/19	HC	27.50	19.69					
					03/26/19	HC	27.32	19.87					
					07/16/19	HC	28.29	18.90					
					12/05/19	HC	30.51	16.68					
					01/13/20	HC	31.02	16.17					
					03/12/20	HC	36.15	11.04					
					03/19/20	HC	36.33	10.86					
					04/10/20	HC	37.11	10.08					
					05/11/20	HC	37.68	9.51					
					07/13/20	HC	38.41	8.78					
					11/16/20	PES	37.62	9.57					
					02/01/21	HC	33.32	13.87					
					06/07/21	PES	31.03	16.16					
HMW-4IA	SDOT Mercer Parcels, SW quadrant	50.0 to 60.0	8.7 to -1.3	58.53	03/19/19	HC	29.50	29.03					
					03/26/19	HC	30.21	28.32					
					07/17/19	HC	33.10	25.43					
					12/05/19	HC	35.08	23.45					
					01/13/20	HC	34.20	24.33					
					03/19/20	HC	33.70	24.83					
04/10/20	HC	33.79	24.74										

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
HMW-4IA (continued)					05/11/20	HC	34.11	24.42
					07/13/20	HC	34.71	23.82
					02/01/21	HC	30.68	27.85
					06/07/21	PES	31.96	26.57
HMW-5IB	SDOT Mercer Parcels, SW quadrant	49.7 to 59.7	8.7 to -1.3	60.99	03/19/20	HC	34.60	26.39
					05/11/20	HC	35.09	25.90
					07/13/20	HC	35.72	25.27
					11/16/20	PES	34.38	26.61
					02/01/21	HC	31.47	29.52
					06/07/21	PES	32.82	28.17
HMW-6IB	SDOT Mercer Parcels, SW quadrant	50.0 to 60.0	8.7 to -1.3	61.61	03/19/20	HC	34.87	26.74
					05/11/20	HC	35.22	26.39
					07/13/20	HC	36.01	25.60
					11/16/20	PES	36.06	25.55
					02/01/21	HC	33.86	27.75
					06/07/21	PES	34.70	26.91
HMW-7IB	SDOT Mercer Parcels, SW quadrant	49.7 to 59.7	9.0 to -1	61.38	03/19/20	HC	35.61	25.77
					05/11/20	HC	36.10	25.28
					07/13/20	HC	36.87	24.51
					11/16/20	PES	36.67	24.71
					02/01/21	HC	34.54	26.84
					06/07/21	PES	35.42	25.96
HMW-8IB	SDOT Mercer Parcels, SW quadrant	50.5 to 60.5	7.5 to -2.5	60.78	03/19/20	HC	36.69	24.09
					05/11/20	HC	37.08	23.70
					07/13/20	HC	37.62	23.16
					11/16/20	PES	35.59	25.19
					02/01/21	HC	33.26	27.52
					06/07/21	PES	34.73	26.05
HMW-9IB	SDOT Mercer Parcels, SW quadrant	57.0 to 67.0	-1.6 to -11.6	57.89	03/19/20	HC	36.54	21.35
					05/11/20	HC	37.15	20.74
					07/13/20	HC	37.60	20.29
					11/16/20	PES	32.81	25.08
					02/01/21	HC	29.99	27.90
					06/07/21	PES	32.33	25.56
HMW-11IB	SDOT Mercer Parcels, SE quadrant	44.9 to 54.9	-5.2 to -15.2	42.91	03/19/20	HC	33.50	9.41
					05/11/20	HC	35.06	7.85
					07/13/20	HC	35.81	7.10
					11/16/20	PES	35.41	7.50
					02/01/21	HC	30.61	12.30
					06/07/21	PES	27.56	15.35
HMW-15IB	SDOT Mercer Parcels, SW quadrant	64.0 to 73.0	-5.1 to -14.1	58.33	11/16/20	PES	41.03	17.30
					02/01/21	HC	39.61	18.72
					06/07/21	PES	38.80	19.53
HMW-16IB	SDOT Mercer Parcels, NW quadrant	55.0 to 65.0	2.0 to -8.0	56.80	11/16/20	PES	34.59	22.21
					02/01/21	HC	33.08	23.72
					06/07/21	PES	33.97	22.83

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW111	Alley E of Seattle Roy Aloha Shops	70 to 80	-33.5 to -43.5	36.48	12/21/12	SES	17.45	19.03
					03/29/13	SES	20.17	16.31
					01/06/14	SES	26.54	9.94
					04/22/15	SES	20.05	16.43
					06/16/15	SES	19.90	16.58
					10/19/15	SES	21.67	14.81
					02/01/16	SES	21.25	15.23
					03/20/17	PES	18.24	18.24
					03/24/17	PES	16.82	19.66
					06/12/17	PES	25.23	11.25
					10/11/17	PES	33.74	2.74
					03/14/19	PES	18.36	18.12
					04/22/19	PES	17.44	19.04
				07/16/19	PES	17.96	18.52	
				10/21/19	PES	19.57	16.91	
				01/13/20	PES	21.12	15.26	
				05/11/20	PES	26.42	9.96	
				07/13/20	PES	26.88	9.50	
				07/21/20	PES	26.96	9.42	
				08/04/20	PES	26.96	9.42	
				08/17/20	PES	26.95	9.43	
09/03/20	PES	26.97	9.41					
09/21/20	PES	Inaccessible						
11/16/20	PES	26.40	9.98					
02/01/21	PES	22.77	13.61					
06/07/21	PES	19.96	16.42					
MW112	Dexter Ave N ROW, E side	75 to 85	-17.2 to -27.2	57.49	12/21/12	SES	42.45	15.04
					03/29/13	SES	38.76	18.73
					01/06/14	SES	40.79	16.70
					06/16/15	SES	39.40	18.09
					03/20/17	PES	36.65	20.80
					03/24/17	PES	36.46	20.99
					06/12/17	PES	38.72	18.73
					10/11/17	PES	40.46	16.99
				03/14/19	PES	36.62	20.83	
				04/22/19	PES	34.71	22.74	
				07/16/19	PES	37.13	20.32	
				10/21/19	PES	40.90	16.55	
				01/13/20	PES	39.66	17.81	
				05/11/20	PES	42.60	14.87	
				07/13/20	PES	42.51	14.96	
				11/16/20	PES	40.02	17.45	
02/01/21	PES	38.03	19.44					
06/07/21	PES	37.61	19.86					
MW126	Alley E of Seattle Roy Aloha Shops	85 to 95	-54.1 to -64.1	30.94	01/06/14	SES	18.08	12.86
					03/20/17	PES	12.75	18.19
					03/24/17	PES	13.35	17.59
					06/12/17	PES	24.98	5.96

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW126 (continued)					10/11/17	PES	24.24	6.70
					03/14/19	PES	12.88	18.06
					04/22/19	PES	12.62	18.32
					07/16/19	PES	12.92	18.02
					10/25/19	PES	14.09	16.85
					01/13/20	PES	15.13	15.81
					02/19/20	PES	17.50	13.44
					05/11/20	PES	18.91	12.03
					07/13/20	PES	19.32	11.62
					11/16/20	PES	19.24	11.70
					02/01/21	PES	16.95	13.99
					06/07/21	PES	14.75	16.19
MW130	Property, NW quadrant	70 to 80	-30.9 to -40.9	39.55	03/20/17	PES	21.21	18.34
					03/24/17	PES	22.54	17.01
					04/14/17	PES	23.35	16.20
					04/28/17	PES	23.89	15.66
					05/05/17	PES	23.30	16.25
					05/12/17	PES	23.65	15.90
					05/19/17	PES	23.81	15.74
					06/12/17	PES	24.28	15.27
					10/11/17	PES	26.39	13.16
					03/14/19	PES	21.86	17.69
Decommissioned March 2019								
MW-132	Property, SE quadrant	70 to 80	-29.9 to -39.9	40.07	10/11/17	PES	28.11	11.96
					03/14/19	PES	17.32	22.75
Decommissioned March 2019								
MW-134	Property, NE quadrant	80 to 90	-38.6 to -48.6	41.05	10/11/17	PES	29.93	11.12
					03/14/19	PES	22.89	18.16
Decommissioned March 2019								
MW-135	Property, NE quadrant	70 to 80	-30.9 to -40.9	38.96	10/11/17	PES	23.48	15.48
					03/14/19	PES	13.62	25.34
Decommissioned March 2019								
MW-136	Property, SW quadrant	84.6 to 94.6	-32.7 to -42.7	51.45	10/11/17	PES	39.13	12.32
					03/14/19	PES	33.70	17.75
Decommissioned March 2019								
MW-139	Property, SE quadrant	70 to 80	-30.2 to -40.2	39.44	10/11/17	PES	25.73	13.71
					03/14/19	PES	15.45	23.99
Decommissioned March 2019								
MW-143	8th Ave N ROW, E side	70 to 80	-27.7 to -36.6	42.04	03/14/19	PES	18.29	23.75
					04/22/19	PES	18.42	23.62
					07/16/19	PES	21.67	20.37
					10/21/19	PES	27.66	14.38
					01/13/20	PES	28.15	13.89
					02/04/20	PES	28.05	13.99
					05/11/20	PES	30.98	11.06
					07/13/20	PES	31.36	10.68
					07/21/20	PES	29.51	12.53
					08/04/20	PES	28.51	13.53
08/17/20	PES	27.86	14.18					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-143 (continued)					09/03/20	PES	27.62	14.42
					09/21/20	PES	27.55	14.49
					11/16/20	PES	9.74	32.30
					02/01/21	PES	22.75	19.29
					06/07/21	PES	21.82	20.22
MW-145	8th Ave N ROW, E side	70 to 80	-26.1 to -36.1	43.46	03/14/19	PES	26.55	16.91
					04/22/19	PES	20.62	22.84
					07/16/19	PES	-	
Decommissioned December 2019								
MW-145R	8th Ave N ROW, E side	70 to 80	-27.5 to -37.5	42.00	01/13/20	PES	28.06	13.94
					05/11/20	PES	30.27	11.73
					07/13/20	PES	30.59	11.41
					07/21/20	PES	29.53	12.47
					08/04/20	PES	28.82	13.18
					08/17/20	PES	28.31	13.69
					09/03/20	PES	28.07	13.93
					09/21/20	PES	Inaccessible	
					11/16/20	PES	25.63	16.37
					02/01/21	PES	23.83	18.17
06/07/21	PES	22.70	19.30					
MW-147	Roy St ROW, S side	70 to 80	-17.6 to -27.6	51.85	03/14/19	PES	25.65	26.20
					03/26/19	HC	26.36	25.49
					04/22/19	PES	27.14	24.71
					07/16/19	PES	31.10	20.75
					07/17/19	HC	31.53	20.32
					10/21/19	PES	36.23	15.62
					01/13/20	PES	34.45	17.40
					03/19/20	HC	37.68	14.17
					05/11/20	PES	38.56	13.29
					07/13/20	PES	38.50	13.35
					07/21/20	PES	36.31	15.54
					08/04/20	PES	35.50	16.35
					08/17/20	PES	35.22	16.63
					09/03/20	PES	34.71	17.14
					09/21/20	PES	34.33	17.52
					11/16/20	PES	30.25	21.60
02/01/21	PES	27.75	24.10					
06/07/21	PES	29.32	22.53					
MW-148	Roy St ROW, S side	70 to 80	-25.7 to -35.7	43.91	03/14/19	PES	24.31	19.60
					03/26/19	HC	24.21	19.70
					04/22/19	PES	24.26	19.65
					07/16/19	PES	25.21	18.70
					10/21/19	PES	26.92	16.99
					01/13/20	PES	28.07	15.84
					03/19/20	HC	32.80	11.11
					05/11/20	PES	33.80	10.11
					07/13/20	PES	34.47	9.44
					07/21/20	PES	34.45	9.46

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-148 (continued)					08/04/20	PES	34.50	9.41
					08/17/20	PES	34.45	9.46
					09/03/20	PES	34.43	9.48
					09/21/20	PES	34.41	9.50
					11/16/20	PES	33.50	10.41
					02/01/21	PES	Inaccessible	
06/07/21	PES	Inaccessible						
MW-150	Property, NE quadrant	49 to 59	-13.3 to -23.3	35.39	03/14/19	PES	3.58	31.81
Decommissioned March 2019								
MW-152	Property, SW quadrant	50 to 60	-10.2 to -20.2	39.11	03/14/19	PES	5.21	33.90
Decommissioned March 2019								
MW-157	8th Ave N ROW, E side	70 to 80	-28.3 to -38.2	41.22	01/24/19	PES	14.00	27.22
					03/14/19	PES	14.94	26.28
					04/22/19	PES	15.32	25.90
					07/16/19	PES	18.86	22.36
					10/21/19	PES	28.18	13.04
					01/13/20	PES	28.77	12.45
					05/11/20	PES	31.11	10.11
					07/13/20	PES	30.92	10.30
					07/21/20	PES	27.90	13.32
					08/04/20	PES	26.35	14.87
					08/17/20	PES	25.50	15.72
					09/03/20	PES	25.09	16.13
					09/21/20	PES	24.83	16.39
					11/16/20	PES	23.56	17.66
02/01/21	PES	22.43	18.79					
06/07/21	PES	-						
MW-190	Valley St ROW, S side	78.8 to 88.8	-30.2 to -40.2	48.39	10/21/19	PES	34.03	14.36
					01/13/20	PES	33.33	15.06
					05/11/20	PES	35.32	13.07
					07/13/20	PES	35.30	13.09
					07/21/20	PES	34.53	13.86
					08/04/20	PES	33.54	14.85
					08/17/20	PES	31.01	17.38
					09/03/20	PES	30.59	17.80
					09/21/20	PES	30.30	18.09
					11/16/20	PES	27.40	20.99
					02/01/21	PES	24.36	24.03
06/07/21	PES	25.40	22.99					
MW-303	Dexter Ave N ROW, E side	71.4 to 81.4	-13.8 to -23.8	57.28	10/21/19	PES	44.60	12.68
					01/13/20	PES	40.00	17.28
					05/11/20	PES	42.21	15.07
					07/13/20	PES	42.42	14.86
					11/16/20	PES	38.75	18.53
					02/01/21	PES	36.39	20.89
06/07/21	PES	37.20	20.08					
MW-307	Roy St ROW, S side	72.8 to 82.8	-12.4 to -22.4	60.21	10/21/19	PES	41.65	18.56
					01/13/20	PES	41.55	18.66

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-307 (continued)					03/19/20	HC	43.34	16.87
					05/11/20	PES	43.90	16.31
					07/13/20	PES	44.69	15.52
					07/21/20	PES	44.14	16.07
					08/04/20	PES	44.28	15.93
					08/17/20	PES	44.24	15.97
					09/03/20	PES	44.47	15.74
					09/21/20	PES	44.33	15.88
					11/16/20	PES	43.88	16.33
					02/01/21	PES	42.38	17.83
					06/07/21	PES	41.94	18.27
MW-309	Alley E of Seattle Roy Aloha Shops	62.4 to 72.4	-32.0 to -42.0	29.97	10/21/19	PES	12.91	17.06
					01/13/20	PES	14.15	15.82
					05/11/20	PES	18.49	11.48
					07/13/20	PES	18.81	11.16
					11/16/20	PES	17.92	12.05
					02/01/21	PES	14.80	15.17
MW-311	Alley E of Seattle Roy Aloha Shops	62.2 to 72.2	-29.0 to -39.0	32.98	10/21/19	PES	16.45	16.53
					01/13/20	PES	17.81	15.17
					05/11/20	PES	22.42	10.56
					07/13/20	PES	22.76	10.22
					11/16/20	PES	21.29	11.69
					02/01/21	PES	17.67	15.31
MW-314	Alley E of Seattle Roy Aloha Shops	67.8 to 77.8	-28.0 to -38.0	39.19	10/21/19	PES	22.34	16.85
					01/13/20	PES	23.83	15.36
					05/11/20	PES	29.54	9.65
					07/13/20	PES	30.02	9.17
					11/16/20	PES	30.49	8.70
					02/01/21	PES	25.45	13.74
MW-316	Mercer St ROW, N side	59.8 to 69.8	-10.0 to -20.0	49.44	10/21/19	PES	31.72	17.72
					01/13/20	PES	32.70	16.74
					03/19/20	HC	37.66	11.78
					05/11/20	PES	38.95	10.49
					07/13/20	PES	39.74	9.70
					09/21/20	PES	39.78	9.66
					11/16/20	PES	38.97	10.47
					02/01/21	PES	35.07	14.37
					06/07/21	PES	33.10	16.34
MW-318	9th Ave N ROW, W side	54.8 to 64.8	-23.1 to -33.1	31.36	10/21/19	PES	14.56	16.80
					01/13/20	PES	16.06	15.30
					05/11/20	PES	20.82	10.54
					07/13/20	PES	21.27	10.09
					11/16/20	PES	20.88	10.48

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-318 (continued)					02/01/21	PES	17.60	13.76
					06/07/21	PES	14.81	16.55
MW-322	9th Ave N ROW, W side	54.7 to 64.7	-21.2 to -31.2	33.13	10/21/19	PES	16.41	16.72
					01/13/20	PES	18.02	15.11
					05/11/20	PES	23.22	9.91
					07/13/20	PES	23.70	9.43
					11/16/20	PES	23.41	9.72
					02/01/21	PES	19.71	13.42
					06/07/21	PES	16.76	16.37
MW-334	900 Roy St, S end	53.1 to 63.1	-21.9 to -31.9	31.22	05/11/20	PES	22.02	9.20
					07/13/20	PES	22.41	8.81
					11/16/20	PES	22.02	9.20
					02/01/21	PES	18.38	12.84
					06/07/21	PES	15.21	16.01
MW-335	Mercer St ROW, N side	60.8 to 70.8	-26.5 to -36.5	34.26	05/11/20	PES	29.24	5.02
					07/13/20	PES	29.85	4.41
					11/16/20	PES	29.05	5.21
					02/01/21	PES	23.75	10.51
					06/07/21	PES	19.40	14.86
MW-338	Lake Union Park, N end	44.4 to 54.4	-17.0 to -27.0	27.38	05/11/20	PES	15.45	11.93
					07/13/20	PES	15.77	11.61
					11/16/20	PES	15.92	11.46
					02/01/21	PES	13.24	14.14
					06/07/21	PES	10.60	16.78
MW-340	Lake Union Park, S end	44.4 to 54.4	-16.4 to 26.4	28.02	05/11/20	PES	17.35	10.67
					07/13/20	PES	17.65	10.37
					11/16/20	PES	17.53	10.49
					02/01/21	PES	14.54	13.48
					06/07/21	PES	11.63	16.39
MW-345	SDOT Mercer Parcels, NW quadrant	54.4 to 64.4	-1.6 to -11.6	52.61	06/07/21	PES	28.30	24.31
MW-346	SDOT Mercer Parcels, NW quadrant	53.9 to 63.9	-2.2 to -12.2	51.63	06/07/21	PES	28.91	22.72
MW-347	SDOT Mercer Parcels, NW quadrant	54.0 to 64.0	-1.3 to -11.3	52.70	06/07/21	PES	29.97	22.73
MW-348	SDOT Mercer Parcels, SW quadrant	58.6 to 68.6	-4.6 to -14.6	53.84	06/07/21	PES	31.11	22.73
MW-349	SDOT Mercer Parcels, SW quadrant	58.6 to 68.6	-2.8 to -12.8	55.58	06/07/21	PES	31.02	24.56

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-350	SDOT Mercer Parcels, NW quadrant	59.4 to 69.4	-1.7 to -11.7	57.55	06/07/21	PES	35.53	22.02
W-MW-01	8th Ave N ROW, W side	70 to 80	-25.1 to -35.1	44.88	02/07/12	Windward	21.22	23.66
					09/06/12	SES	23.26	21.62
					12/21/12	SES	21.82	23.06
					03/29/13	SES	23.63	21.25
					01/06/14	SES	28.96	15.92
					06/16/15	SES	24.60	20.28
					10/19/15	SES	26.86	18.02
					02/01/16	SES	25.26	19.62
					03/20/17	PES	21.02	23.86
					03/24/17	PES	21.85	23.03
					04/14/17	PES	22.11	22.77
					04/28/17	PES	25.09	19.79
					05/05/17	PES	25.33	19.55
					05/12/17	PES	25.88	19.00
					05/19/17	PES	26.09	18.79
					06/12/17	PES	29.15	15.73
					10/11/17	PES	31.50	13.38
					03/14/19	PES	21.77	23.11
					04/22/19	PES	-	
					07/16/19	PES	-	
05/11/20	PES	-						
07/13/20	PES	-						
09/03/20	PES	30.18	14.70					
11/16/20	PES	27.43	17.45					
02/01/21	PES	24.80	20.08					
06/07/21	PES	25.65	19.23					
W-MW-02	8th Ave N ROW, W side	70 to 80	-26.3 to -36.5	43.46	02/07/12	Windward	17.51	25.95
					09/05/12	SES	19.95	23.51
					12/21/12	SES	17.82	25.64
					03/29/13	SES	19.14	24.32
					01/06/14	SES	24.40	19.06
					06/16/15	SES	18.79	24.67
					10/19/15	SES	20.94	22.52
					02/01/16	SES	15.85	27.61
					03/20/17	PES	15.24	28.22
					03/24/17	PES	14.97	28.49
					04/14/17	PES	15.34	28.12
					04/28/17	PES	18.18	25.28
					05/05/17	PES	18.53	24.93
					05/12/17	PES	19.10	24.36
					05/19/17	PES	19.28	24.18
					06/12/17	PES	22.83	20.63
					10/11/17	PES	27.86	15.60
03/14/19	PES	15.46	28.00					
04/22/19	PES	16.13	27.33					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
W-MW-02 (continued)					07/16/19	PES	–	
					07/23/19	PES	21.71	21.75
					10/21/19	PES	31.93	11.53
					01/13/20	PES	–	
					05/11/20	PES	33.88	9.58
					07/13/20	PES	34.15	9.31
					07/21/20	PES	30.60	12.86
					08/04/20	PES	28.25	15.21
					08/17/20	PES	27.32	16.14
					09/03/20	PES	26.85	16.61
					09/21/20	PES	26.46	17.00
					11/16/20	PES	22.94	20.52
					02/01/21	PES	19.88	23.58
					06/07/21	PES	–	
W-MW-03	Property, NE quadrant	70 to 80	–	39.23	02/07/12	Windward	17.73	21.50
					09/06/12	SES	18.36	20.87
					12/21/12	SES	18.19	21.04
					03/29/13	SES	18.22	21.01
Decommissioned prior to 2017								
W-MW-04**	Property, NE quadrant	68 to 77	–	35.53	02/07/12	Windward	14.13	22.72
					09/06/12	SES	16.73	20.37
					12/21/12	SES	16.69	20.40
					03/29/13	SES	16.90	20.21
Decommissioned prior to 2017								
<b>Deep Zone</b>								
FMW-3D	Terry Ave N ROW, E side	59 to 69	-31.1 to -41.1	27.88	03/24/17	PES	9.58	18.30
					06/12/17	PES	30.87	-2.99
Decommissioned prior to 2017								
FMW-129	SDOT Mercer Parcels, NE quadrant	84 to 89	-45.6 to -50.6	–  38.31	10/19/15	SES	25.20	
					02/01/16	SES	25.25	
					04/14/17	PES	19.78	18.53
					04/28/17	PES	25.30	13.01
					05/05/17	PES	29.55	8.76
					05/12/17	PES	30.25	8.06
					05/19/17	PES	30.74	7.57
					06/12/17	PES	34.90	3.41
					03/14/19	PES	20.11	18.20
					03/26/19	HC	19.99	18.32
					05/01/19	PES	19.72	18.59
					05/16/19	HC	19.56	18.75
					07/16/19	PES	20.24	18.07
					07/17/19	HC	20.13	18.18
					07/30/19	HC	20.34	17.97
					10/21/19	PES	21.54	16.77
					01/13/20	PES	24.49	13.82
05/11/20	PES	29.20	9.11					
07/13/20	PES	29.80	8.51					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
FMW-129 (continued)					11/16/20	PES	29.57	8.74
					06/07/21	PES	–	
FMW-131	Block 37, SE quadrant	63 to 73	-34.7 to -44.7	27.85	03/24/17	PES	9.56	18.29
					06/12/17	PES	32.94	-5.09
					03/14/19	PES	10.26	17.59
					04/22/19	PES	9.82	18.03
					07/16/19	PES	–	
					10/21/19	PES	12.21	15.64
					01/13/20	PES	14.95	12.90
					05/11/20	PES	22.57	5.28
					07/13/20	PES	22.77	5.08
					11/16/20	PES	21.69	6.16
					02/01/21	PES	17.03	10.82
06/07/21	PES	13.98	13.87					
FMW-137	Alley E of Block 38 West	72 to 85	-41.9 to -54.9	30.09	11/20/18	Farallon	13.02	17.07
					12/28/18	Farallon	12.74	17.35
					03/14/19	Farallon	12.56	17.53
					05/06/19	Farallon	12.08	18.01
					07/08/19	Farallon	12.25	17.84
					11/06/19	PES	14.11	15.98
					01/13/20	PES	19.50	10.59
					05/11/20	PES	33.07	-2.98
					07/13/20	PES	33.37	-3.28
					11/16/20	PES	30.61	-0.52
					02/01/21	PES	21.52	8.57
06/07/21	PES	15.74	14.35					
FMW-138	Alley E of Block 38 West	90 to 100	-50.0 to -60.0	40.44	11/20/18	Farallon	24.50	15.94
					12/28/18	Farallon	24.38	16.06
					03/14/19	Farallon	24.14	16.30
					05/06/19	Farallon	23.80	16.64
					07/08/19	Farallon	23.84	16.60
FMW-140	900 Roy St, S end	70 to 80	-38.0 to -48.0	31.71	10/31/19	PES	15.03	16.68
					01/13/20	PES	17.07	14.64
					05/11/20	PES	22.55	9.16
					07/13/20	PES	22.91	8.80
					11/16/20	PES	22.34	9.37
					02/01/21	PES	18.00	13.71
					06/07/21	PES	15.63	16.08
GEI-2	Block 37, NW quadrant	50.5 to 60.5	-21.1 to -31.1	29.38	03/24/17	PES	10.96	18.42
					06/12/17	PES	37.60	-8.22
					03/14/19	PES	11.70	17.68
					04/22/19	PES	11.26	18.12
					07/16/19	PES	11.51	17.87
					10/21/19	PES	13.54	15.84
					01/13/20	PES	9.93	19.45
					05/11/20	PES	23.05	6.33
					07/13/20	PES	23.36	6.02
					11/16/20	PES	22.60	6.78

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
GEI-2 (continued)					02/01/21	PES	18.06	11.32
					06/07/21	PES	14.00	15.38
HMW-1D	SDOT Mercer Parcels, NE quadrant	80.0 to 90.0	-41.9 to -51.9	37.99	03/20/19	HC	20.33	17.66
					03/26/19	HC	20.34	17.65
					05/16/19	HC	19.90	18.09
					07/16/19	HC	20.28	17.71
					07/17/19	HC	20.32	17.67
					07/30/19	HC	20.50	17.49
					08/15/19	HC	20.60	17.39
					12/05/19	HC	25.56	12.43
					01/13/20	HC	23.40	14.59
					03/09/20	HC	28.29	9.70
					03/19/20	HC	28.53	9.46
					04/10/20	HC	29.29	8.70
					05/11/20	HC	29.55	8.44
					07/13/20	HC	30.39	7.60
					11/16/20	PES	30.05	7.94
02/01/21	HC	26.78	11.21					
06/07/21	PES	23.97	14.02					
HMW-2D	SDOT Mercer Parcels, NE quadrant	80.0 to 90.0	-32.7 to -42.7	47.19	03/19/19	HC	27.98	19.21
					03/26/19	HC	27.26	19.93
					05/16/19	HC	27.95	19.24
					07/16/19	HC	28.66	18.53
					08/15/19	HC	29.17	18.02
					12/05/19	HC	30.52	16.67
					01/13/20	HC	30.31	16.88
					03/12/20	HC	35.94	11.25
					03/19/20	HC	36.06	11.13
					03/27/20	HC	36.04	11.15
					04/10/20	HC	36.75	10.44
					05/11/20	HC	37.18	10.01
					07/13/20	HC	37.84	9.35
					11/16/20	PES	37.19	10.00
					02/01/21	HC	33.53	13.66
06/07/21	PES	31.36	15.83					
HMW-3D	SDOT Mercer Parcels, NW quadrant	80.0 to 90.0	-23.4 to -33.4	56.37	03/19/19	HC	38.90	17.47
					03/26/19	HC	38.77	17.60
					07/16/19	HC	39.11	17.26
					12/05/19	HC	39.60	16.77
					01/13/20	HC	39.62	16.75
					03/12/20	HC	41.82	14.55
					03/19/20	HC	41.86	14.51
					03/27/20	HC	42.29	14.08
					04/10/20	HC	42.43	13.94
					05/11/20	HC	42.57	13.80
					07/13/20	HC	43.31	13.06
11/16/20	PES	43.07	13.30					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
HMW-3D (continued)					02/01/21	HC	42.15	14.22
					06/07/21	PES	41.30	15.07
HMW-6D	SDOT Mercer Parcels, SW quadrant	79.7 to 89.7	-21.1 to -31.1	61.49	03/19/20	HC	46.89	14.60
					05/11/20	HC	47.65	13.84
					07/13/20	HC	48.39	13.10
					11/16/20	PES	48.38	13.11
					02/01/21	HC	47.25	14.24
					06/07/21	PES	46.45	15.04
HMW-9D	SDOT Mercer Parcels, SW quadrant	79.7 to 89.7	-24.4 to -34.4	58.14	03/19/20	HC	43.55	14.59
					05/11/20	HC	44.46	13.68
					07/13/20	HC	45.17	12.97
					11/16/20	PES	44.63	13.51
					02/01/21	HC	42.95	15.19
					06/07/21	PES	42.22	15.92
HMW-10D	SDOT Mercer Parcels, SE quadrant	79.0 to 89.0	-30.8 to -40.8	51.03	03/19/20	HC	39.97	11.06
					03/25/20	HC	40.32	10.71
					05/11/20	HC	41.37	9.66
					07/13/20	HC	42.14	8.89
					11/16/20	PES	41.44	9.59
					02/01/21	HC	37.53	13.50
					06/07/21	PES	35.23	15.80
HMW-12D	SDOT Mercer Parcels, NE quadrant	82.0 to 92.0	-48.5 to -58.5	35.86	11/16/20	PES	27.09	8.77
					02/01/21	HC	23.35	12.51
					06/07/21	PES	20.33	15.53
HMW-13D	SDOT Mercer Parcels, SE quadrant	89.5 to 99.5	-44.2 to -54.2	45.08	11/16/20	PES	36.83	8.25
					02/01/21	HC	33.40	11.68
					06/07/21	PES	30.53	14.55
HMW-14D	SDOT Mercer Parcels, SE quadrant	70.0 to 80.0	-23.7 to -33.7	46.11	11/16/20	PES	38.63	7.48
					02/01/21	HC	33.12	12.99
					06/07/21	PES	30.50	15.61
MW101	Property, NE quadrant	105 to 115	-65.5 to -75.5	39.49	09/06/12	SES	21.48	18.01
					12/21/12	SES	21.14	18.35
					03/29/13	SES	22.22	17.27
Decommissioned prior to 2017								
MW102	Valley St ROW, S side	115 to 125	-65.8 to -75.8	49.19	09/05/12	SES	31.11	18.08
					12/21/12	SES	30.78	18.41
					03/29/13	SES	31.65	17.54
					01/06/14	SES	33.80	15.39
					10/19/15	SES	37.06	12.13
					02/01/16	SES	38.22	10.97
					03/20/17	PES	32.25	16.94
					03/24/17	PES	33.50	15.69
					04/14/17	PES	34.38	14.81
					04/28/17	PES	35.18	14.01
					05/05/17	PES	34.77	14.42
					05/12/17	PES	35.00	14.19
					05/19/17	PES	35.21	13.98

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW102 (continued)				49.11	06/12/17	PES	36.87	12.32
					10/11/17	PES	37.59	11.60
					03/14/19	PES	31.94	17.25
					04/22/19	PES	31.78	17.41
					07/16/19	PES	31.80	17.39
					10/21/19	PES	32.20	16.91
					01/13/20	PES	32.46	16.65
					05/11/20	PES	35.36	13.75
					07/13/20	PES	36.04	13.07
					07/21/20	PES	35.81	13.30
					08/04/20	PES	35.98	13.13
					08/17/20	PES	35.93	13.18
					09/03/20	PES	36.13	12.98
					09/21/20	PES	36.00	13.11
					11/16/20	PES	35.93	13.18
					02/01/21	PES	34.74	14.37
06/07/21	PES	33.95	15.16					
MW103	Alley E of Seattle Roy Aloha Shops	105.5 to 112.5	-67.6 to -77.6	35.92	09/05/12	SES	18.03	17.89
					12/21/12	SES	17.38	18.54
					03/29/13	SES	19.70	16.22
					01/06/14	SES	26.45	9.47
					06/16/15	SES	20.03	15.89
					10/19/15	SES	22.31	13.61
					02/01/16	SES	22.40	13.52
					03/20/17	PES	17.10	18.82
					03/24/17	PES	17.36	18.56
					04/14/17	PES	17.68	18.24
					04/28/17	PES	25.82	10.10
					05/05/17	PES	26.17	9.75
					05/12/17	PES	26.71	9.21
					05/19/17	PES	27.99	7.93
					06/12/17	PES	30.85	5.07
					10/11/17	PES	30.31	5.61
				03/14/19	PES	17.75	18.17	
				04/22/19	PES	17.50	18.42	
				07/16/19	PES	16.85	19.07	
				10/21/19	PES	19.17	16.75	
				01/13/20	PES	20.53	15.33	
				01/30/20	PES	20.11	15.75	
05/11/20	PES	24.87	10.99					
07/13/20	PES	25.56	10.30					
07/21/20	PES	25.55	10.31					
08/04/20	PES	25.61	10.25					
08/17/20	PES	25.68	10.18					
09/03/20	PES	25.73	10.13					
09/21/20	PES	Inaccessible						
11/16/20	PES	25.50	10.36					
				35.86				

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW103 (continued)					02/01/21	PES	22.69	13.17
					06/07/21	PES	20.18	15.68
MW104	8th Ave N ROW, W side	119 to 129	-76.3 to -86.3	42.68	09/06/12	SES	24.72	17.96
					12/21/12	SES	24.31	18.37
					03/29/13	SES	25.78	16.90
					01/06/14	SES	28.87	13.81
					10/19/15	SES	30.04	12.64
					02/01/16	SES	30.90	11.78
					03/20/17	PES	25.00	17.68
					04/14/17	PES	26.58	16.10
					04/28/17	PES	30.11	12.57
					05/05/17	PES	30.71	11.97
					05/12/17	PES	30.43	12.25
					05/19/17	PES	30.60	12.08
					06/30/17	PES	33.10	9.58
					10/11/17	PES	32.69	9.99
					03/14/19	PES	25.00	17.68
					04/22/19	PES	24.86	17.82
					07/16/19	PES	25.01	17.67
					10/21/19	PES	25.62	17.06
					01/13/20	PES	-	
					05/11/20	PES	29.68	13.00
					07/13/20	PES	30.21	12.47
08/17/20	PES	30.06	12.62					
09/03/20	PES	Inaccessible						
09/21/20	PES	29.98	12.70					
11/16/20	PES	Inaccessible						
02/01/21	PES	Inaccessible						
06/07/21	PES	Inaccessible						
MW105	Roy St ROW, S side	130 to 140	-85.3 to -95.3	44.69	09/05/12	SES	26.85	17.84
					12/21/12	SES	26.26	18.43
				03/29/13	SES	28.47	16.22	
				44.17	01/06/14	SES	32.48	11.69
					04/02/15	SES	28.56	15.61
					06/16/15	SES	28.59	15.58
					10/19/15	SES	31.15	13.02
					02/01/16	SES	31.58	12.59
					03/20/17	PES	25.86	18.31
					03/24/17	PES	26.22	17.95
					04/14/17	PES	26.71	17.46
					04/28/17	PES	34.10	10.07
					05/05/17	PES	34.40	9.77
					05/12/17	PES	34.91	9.26
					05/19/17	PES	35.39	8.78
					06/12/17	PES	38.85	5.32
					10/11/17	PES	38.22	5.95
03/14/19	PES	26.33	17.84					
04/22/19	PES	26.06	18.11					

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW105 (continued)				44.12	07/17/19	PES	26.25	17.92
					10/21/19	PES	27.47	16.65
					01/13/20	PES	28.75	15.37
					05/11/20	PES	33.01	11.11
					07/13/20	PES	33.82	10.30
					11/16/20	PES	33.91	10.21
					02/01/21	PES	31.11	13.01
					06/07/21	PES	28.53	15.59
MW106	SDOT Mercer Parcels, NW quadrant	130 to 140	-78.0 to -88.0	51.99	09/05/12	SES	34.09	17.90
					03/29/13	SES	34.92	17.07
					01/06/14	SES	37.15	14.84
					10/19/15	SES	40.11	11.88
					02/01/16	SES	41.02	10.97
					04/14/17	PES	36.78	15.21
					06/30/17	PES	40.60	11.39
					03/14/19	PES	34.64	17.35
					03/26/19	HC	34.43	17.56
					04/22/19	PES	34.53	17.46
					07/16/19	PES	34.62	17.37
					07/17/19	HC	34.62	17.37
					10/21/19	PES	35.25	16.74
					01/13/20	PES	35.56	16.43
					03/19/20	HC	38.23	13.76
					05/11/20	PES	38.87	13.12
07/13/20	PES	39.58	12.41					
11/10/20	PES	39.28	12.71					
02/01/21	PES	37.82	14.17					
06/07/21	PES	36.74	15.25					
MW113	9th Ave N ROW, W side	70 to 80	-36.8 to -46.8	32.94	12/21/12	SES	14.15	18.79
					03/29/13	SES	16.95	15.99
					01/06/14	SES	23.35	9.59
					06/16/15	SES	16.46	16.48
					10/19/15	SES	18.24	14.70
					02/01/16	SES	17.87	15.07
					03/20/17	PES	13.60	19.30
					03/24/17	PES	13.65	19.25
				04/14/17	PES	13.80	19.10	
				04/28/17	PES	24.10	8.80	
				05/05/17	PES	24.94	7.96	
				05/12/17	PES	25.68	7.22	
				05/19/17	PES	26.01	6.89	
				06/12/17	PES	31.15	1.75	
				10/11/17	PES	31.00	1.90	
				03/14/19	PES	14.52	18.38	
				04/22/19	PES	14.21	18.69	
07/16/19	PES	14.57	18.33					
10/21/19	PES	16.19	16.72					
11/11/19	Farallon	16.41	16.50					
				32.90				
				32.91				

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW113 (continued)					01/13/20	PES	17.91	15.00
					01/14/20	Farallon	18.04	14.87
					01/30/20	PES	17.05	15.86
					02/17/20	Farallon	20.79	12.12
					03/24/20	Farallon	22.72	10.19
					05/11/20	PES	25.17	7.74
					07/13/20	PES	23.67	9.24
					11/16/20	PES	23.25	9.66
					02/01/21	PES	19.60	13.31
					06/07/21	PES	16.66	16.25
MW122	Alley E of Seattle Roy Aloha Shops	105 to 119	-74.9 to -84.9	30.03	01/06/14	SES	17.61	12.42
					10/19/15	SES	15.59	14.44
					02/01/16	SES	15.75	14.28
					03/20/17	PES	11.62	18.41
					03/24/17	PES	11.57	18.46
					04/14/17	PES	11.76	18.27
					04/28/17	PES	19.98	10.05
					05/05/17	PES	20.43	9.60
					05/12/17	PES	20.94	9.09
					05/19/17	PES	21.30	8.73
					06/12/17	PES	25.23	4.80
					10/11/17	PES	24.93	5.10
					03/14/19	PES	11.99	18.04
					04/22/19	PES	11.60	18.43
					07/16/19	PES	11.93	18.10
					10/21/19	PES	13.23	16.80
					01/13/20	PES	14.53	15.50
					01/30/20	PES	14.09	15.94
					05/11/20	PES	18.57	11.46
					07/13/20	PES	19.02	11.01
11/16/20	PES	18.86	11.17					
02/01/21	PES	16.27	13.76					
06/07/21	PES	13.60	16.43					
MW123	Westlake Ave N ROW, W side	70 to 80	-42.5 to -52.5	27.51	01/06/14	SES	15.69	11.82
					03/20/17	PES	8.50	19.01
					03/24/17	PES	8.60	18.91
					06/12/17	PES	24.68	2.83
					10/11/17	PES	24.43	3.08
					03/14/19	PES	9.32	18.19
					04/22/19	PES	8.89	18.62
				07/16/19	PES	9.22	18.29	
				10/21/19	PES	10.64	16.86	
				01/13/20	PES	12.15	15.35	
				05/11/20	PES	16.51	10.99	
				07/13/20	PES	16.80	10.70	
				11/16/20	PES	16.64	10.86	
				02/01/21	PES	14.00	13.50	
06/07/21	PES	10.92	16.58					
				27.50				

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW124	Valley St ROW, S side	110 to 120	-53.8 to -63.8	56.24	01/06/14	SES	40.50	15.74
					03/20/17	PES	39.33	16.91
					03/24/17	PES	40.59	15.65
					04/14/17	PES	41.54	14.70
					04/28/17	PES	41.81	14.43
					05/05/17	PES	41.28	14.96
					05/12/17	PES	41.52	14.72
					05/19/17	PES	41.60	14.64
					06/12/17	PES	42.95	13.29
					10/11/17	PES	43.95	12.29
					03/14/19	PES	38.98	17.26
				04/22/19	PES	38.81	17.43	
				07/16/19	PES	38.87	17.37	
				10/21/19	PES	39.28	16.96	
				01/13/20	PES	-		
				01/30/20	PES	42.92	13.25	
				02/19/20	PES	40.76	15.41	
				05/11/20	PES	41.98	14.19	
				07/13/20	PES	42.86	13.31	
				08/04/20	PES	42.75	13.42	
				08/17/20	PES	42.79	13.38	
09/03/20	PES	42.91	13.26					
11/16/20	PES	42.79	13.38					
02/01/21	PES	Inaccessible						
06/08/21	PES	40.93	15.24					
MW128	Westlake Ave N ROW, E side	60 to 70	-30.8 to -40.8	-	04/22/15	SES	12.91	
					10/19/15	SES	14.15	
					02/01/16	SES	14.23	
					03/20/17	PES	10.00	18.59
					03/24/17	PES	10.04	18.55
					04/14/17	PES	10.13	18.46
					04/28/17	PES	25.30	3.29
					05/05/17	PES	26.35	2.24
					05/12/17	PES	27.06	1.53
					05/19/17	PES	27.44	1.15
					06/12/17	PES	33.41	-4.82
				10/11/17	PES	30.51	-1.92	
				03/14/19	PES	10.79	17.80	
				04/22/19	PES	10.43	18.16	
				07/16/19	PES	10.67	17.92	
				09/09/19	PES	11.12	17.47	
				10/21/19	PES	12.36	16.23	
				11/11/19	Farallon	12.49	16.10	
				01/13/20	PES	14.27	14.32	
				01/30/20	PES	13.68	14.91	
				02/17/20	Farallon	18.11	10.48	
05/11/20	PES	20.10	8.49					
07/13/20	PES	20.46	8.13					
11/16/20	PES	20.01	8.58					

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW128 (continued)					02/01/21	PES	16.35	12.24
					06/07/21	PES	12.81	15.78
MW-133	Property, SW quadrant	129 to 139	-88.9 to -98.9	39.77	10/11/17	PES	27.57	12.20
					03/14/19	PES	22.62	17.15
Decommissioned March 2019								
MW-137	Property, SW quadrant	105 to 115	-53.3 to -63.3	51.46	10/11/17	PES	39.66	11.80
					03/14/19	PES	33.99	17.47
Decommissioned March 2019								
MW-138	Dexter Ave N ROW, E side	105 to 115	-47.6 to -57.6	57.06	10/11/17	PES	44.78	12.28
					03/14/19	PES	39.75	17.31
				57.03	04/22/19	PES	39.64	17.42
					07/19/19	PES	39.82	17.21
					10/21/19	PES	40.19	16.84
					01/13/20	PES	40.32	16.71
					05/11/20	PES	43.06	13.97
					07/13/20	PES	43.92	13.11
					11/16/20	PES	43.85	13.18
					02/01/21	PES	42.62	14.41
06/07/21	PES	41.90	15.13					
MW-140	Roy St ROW, N side	129.5 to 139.5	-78.9 to -88.9	50.20	10/11/17	PES	39.55	10.65
Decommissioned 2019								
MW-141	Property, SE quadrant	95 to 105	-55.4 to 65.4	39.32	10/11/17	PES	29.40	9.92
					03/14/19	PES	21.80	17.52
Decommissioned March 2019								
MW-153	Roy St ROW, S side	120 to 130	-65.3 to -75.3	54.35	03/14/19	PES	37.27	17.08
					03/26/19	HC	36.85	17.50
					04/22/19	PES	37.12	17.23
					07/16/19	PES	37.27	17.08
					07/17/19	HC	37.11	17.24
					10/21/19	PES	37.60	16.75
					01/13/20	PES	38.80	15.55
					01/30/20	PES	38.41	15.94
					02/19/20	PES	39.41	14.94
					02/24/20	PES	39.81	14.54
					03/19/20	HC	40.14	14.21
					05/11/20	PES	40.67	13.68
					07/13/20	PES	41.55	12.80
					07/21/20	PES	41.11	13.24
					08/04/20	PES	41.31	13.04
					08/17/20	PES	41.29	13.06
					09/03/20	PES	41.37	12.98
					09/21/20	PES	41.33	13.02
					11/16/20	PES	41.39	12.96
02/01/21	PES	40.15	14.20					
06/07/21	PES	39.39	14.96					
MW-158A	8th Ave N ROW, E side	90 to 100	-48.2 to -58.5	41.09	01/24/19	PES	22.98	18.11
					03/14/19	PES	23.15	17.94
					04/22/19	PES	23.29	17.80

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-158A (continued)					07/16/19	PES	23.54	17.55
					10/21/19	PES	24.31	16.78
					01/13/20	PES	24.91	16.18
					01/30/20	PES	25.00	16.09
					05/11/20	PES	28.27	12.82
					07/13/20	PES	28.73	12.36
					07/21/20	PES	28.56	12.53
					08/04/20	PES	28.66	12.43
					08/17/20	PES	28.58	12.51
					09/03/20	PES	28.65	12.44
					09/21/20	PES	28.60	12.49
					11/16/20	PES	28.37	12.72
					02/01/21	PES	26.80	14.29
					06/07/21	PES	25.63	15.46
MW-160	8th Ave N ROW, W side	118 to 128	-75.4 to -85.4	42.24	03/14/19	PES	24.70	17.54
					04/22/19	PES	24.56	17.68
					07/16/19	PES	24.72	17.52
					10/21/19	PES	25.28	16.96
					01/13/20	PES	25.83	16.41
					01/30/20	PES	26.04	16.20
					02/19/20	PES	27.70	14.54
					05/11/20	PES	29.08	13.16
					07/13/20	PES	29.79	12.45
					07/21/20	PES	29.56	12.68
					08/04/20	PES	29.70	12.54
					08/17/20	PES	29.64	12.60
					09/03/20	PES	29.74	12.50
					09/21/20	PES	29.61	12.63
11/16/20	PES	29.51	12.73					
02/01/21	PES	27.93	14.31					
06/07/21	PES	26.92	15.32					
MW-161	8th Ave N ROW, W side	130 to 140	-85.6 to -95.6	43.99	03/14/19	PES	26.50	17.49
					04/22/19	PES	26.33	17.66
					07/16/19	PES	26.51	17.48
					10/21/19	PES	27.03	16.96
					01/13/20	PES	27.63	16.36
					05/11/20	PES	31.30	12.69
					07/13/20	PES	31.90	12.09
					07/13/20	PES	31.69	12.30
					08/04/20	PES	31.80	12.19
					08/17/20	PES	31.76	12.23
					09/03/20	PES	31.75	12.24
					09/21/20	PES	Inaccessible	
					11/16/20	PES	31.48	12.51
					02/01/21	PES	29.89	14.10
06/07/21	PES	28.75	15.24					
MW-162	Property, NE quadrant	100 to 110	-61.6 to -71.6	–	03/14/19	PES	19.58	
Decommissioned March 2019								

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-163	Property, NW quadrant	100 to 110	-61.0 to -71.0	–	03/14/19	PES	21.61	
					Decommissioned March 2019			
MW-164	Property, SW quadrant	100 to 110	-59.9 to -69.9	–	03/14/19	PES	22.26	
					Decommissioned March 2019			
MW-304	Dexter Ave N ROW, E side	105.2 to 115.2	-47.6 to -57.6	57.23	10/21/19	PES	40.38	16.85
					01/13/20	PES	40.48	16.75
					05/11/20	PES	43.11	14.12
					07/13/20	PES	43.97	13.26
					11/16/20	PES	Inaccessible	
					02/01/21	PES	42.76	14.47
					06/07/21	PES	42.04	15.19
MW-319	9th Ave N ROW, W side	74.5 to 84.5	-42.8 to -52.8	31.31	10/21/19	PES	14.52	16.79
					01/13/20	PES	16.01	15.30
					01/30/20	PES	15.32	15.99
					02/19/20	PES	18.87	12.44
					05/11/20	PES	20.80	10.51
					07/13/20	PES	21.21	10.10
					11/16/20	PES	20.99	10.32
					02/01/21	PES	17.57	13.74
					06/07/21	PES	14.75	16.56
MW-323	9th Ave N ROW, W side	100 to 110	-65.4 to -75.4	34.38	10/21/19	PES	17.71	16.67
					01/13/20	PES	19.20	15.18
					01/30/20	PES	18.70	15.68
					05/11/20	PES	24.04	10.34
					07/13/20	PES	24.66	9.72
					11/16/20	PES	24.48	9.90
					02/01/21	PES	21.32	13.06
					06/07/21	PES	18.53	15.85
MW-324	Roy St ROW, N side	66.3 to 76.3	-32.1 to -42.1	33.71	10/21/19	PES	17.09	16.62
					01/13/20	PES	18.93	14.78
					01/31/20	PES	18.13	15.58
					05/11/20	PES	24.60	9.11
					07/13/20	PES	25.11	8.60
					09/21/20	PES	25.24	8.47
					11/16/20	PES	24.81	8.90
					02/01/21	PES	20.85	12.86
					06/07/21	PES	17.69	16.02
MW-326	Mercer St ROW, N side	90 to 100	-48.7 to -58.7	40.97	10/21/19	PES	24.22	16.75
					01/13/20	PES	26.40	14.57
					01/30/20	PES	26.22	14.75
					03/19/20	HC	31.50	9.47
					05/11/20	PES	32.44	8.53
					07/13/20	PES	33.37	7.60
					09/21/20	PES	33.27	7.70
					11/16/20	PES	33.09	7.88
					02/01/21	PES	29.85	11.12
					06/07/21	PES	27.02	13.95

Table F-1

**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
MW-328	Lake Union Park, S end	64.5 to 74.5	-36.1 to -46.1	28.09	10/21/19	PES	11.54	16.55
					01/13/20	PES	13.21	14.88
					01/30/20	PES	12.60	15.49
					02/19/20	PES	16.50	11.59
					05/11/20	PES	18.00	10.09
					07/13/20	PES	18.35	9.74
					09/21/20	PES	19.61	8.48
					11/16/20	PES	18.20	9.89
					02/01/21	PES	15.00	13.09
					06/07/21	PES	11.88	16.21
MW-329	Westlake Ave N ROW, E side	98.3 to 108.3	-69.0 to -79.0	28.93	10/21/19	PES	12.67	16.26
					01/13/20	PES	14.55	14.38
					01/30/20	PES	13.96	14.97
					02/19/20	PES	18.55	10.38
					05/11/20	PES	20.35	8.58
					07/13/20	PES	20.74	8.19
					09/21/20	PES	20.85	8.08
					11/16/20	PES	20.34	8.59
					02/01/21	PES	16.60	12.33
					06/07/21	PES	13.06	15.87
MW-336	Mercer St ROW, N side	85.3 to 95.3	-52.0 to -62.0	33.31	05/11/20	PES	29.31	4.00
					07/13/20	PES	30.00	3.31
					11/16/20	PES	29.11	4.20
					02/01/21	PES	23.57	9.74
					06/07/21	PES	18.97	14.34
MW-341	Lake Union Park, S end	95.2 to 105.2	-67.1 to -77.1	28.11	05/11/20	PES	18.08	10.03
					07/13/20	PES	18.43	9.68
					11/16/20	PES	18.30	9.81
					02/01/21	PES	15.05	13.06
					06/07/21	PES	11.95	16.16
MW-342	Valley St ROW, S side	60.1 to 70.1	-32.7 to -42.7	27.37	05/11/20	PES	17.92	9.45
					07/13/20	PES	18.22	9.15
					11/16/20	PES	18.02	9.35
					02/01/21	PES	14.81	12.56
					06/07/21	PES	11.43	15.94
MW-343	Valley St ROW, S side	99.1 to 109.1	-71.9 to -81.9	27.16	05/11/20	PES	17.63	9.53
					07/13/20	PES	17.96	9.20
					11/16/20	PES	17.76	9.40
					02/01/21	PES	Inaccessible	
					06/07/21	PES	11.55	15.61
TB-18	SDOT Mercer NE quadrant	93 to 118	–	–	06/04/98	B&V	30.05	
<b>South Lake Union</b>								
M.P. A	S. Lake Union Park Retaining Wall E of MW-327	–	–	20.21	12/04/19	PES	3.39	16.82

Table F-1



**Summary of Groundwater Elevations  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval (ft bgs)	Screen Interval Elevation (feet)	Top of Casing Elevation (feet)	Date	Measured By	Depth to Water <sup>a</sup>	Groundwater Elevation <sup>b</sup>
M.P. B	S. Lake Union Park Octagonal Landing SE of footbridge	-	-	23.94	12/04/19	PES	7.05	16.89
					01/13/20	PES	7.05	16.89
					05/11/20	PES	5.28	18.66
					07/13/20	PES	5.60	18.34
					08/04/20	PES	5.93	18.01
					08/17/20	PES	5.97	17.97
					09/21/20	PES	6.15	17.79
					11/16/20	PES	6.58	17.36
					02/01/21	PES	7.09	16.85
					06/07/21	PES	5.09	18.85

**NOTES:**

TOCs were surveyed relative to an established datum of 521.41 feet prior to 2012. TOCs were resurveyed by Axis Survey and Mapping of Kirkland, WA on March 16th, 2012, relative to an arbitrary benchmark of 499.89 feet above mean sea level, and by Bush, Roed & Hitchings, Inc. of Seattle, WA in multiple surveys since February 2012 using the North American Vertical Datum 1988.

<sup>a</sup> As measured in feet below a fixed spot on the well casing rim.

<sup>b</sup> Calculated by subtracting the depth to groundwater from the casing elevation. Groundwater elevation in angled monitoring well calculated subtracting the product of the measured depth to groundwater in the angled well by the sine of its angle.

\*\*Monitoring well was installed at a 25 degree angle from the vertical point of penetration. Depth to groundwater measurements and sample interval account for angled length of well, not vertical depth. Groundwater elevations corrected to account for angle.

- = unknown or not applicable

ROW = right-of-way

TOC = top of casing

B&V = Black & Veach

DOF = Dalton, Olmsted & Fuglevand, Inc.

EPJ = E.P. Johnson Construction, Inc.

TD = Total Depth

PES = PES Environmental, Inc.

GeoEngineers = GeoEngineers, Inc.

Retec = Remediation Technologies, Inc.

Roux = Roux Associates

SES = SoundEarth Strategies, Inc.

Urban = Urban Redevelopment

Windward = Windward Environmental LLC

HC = Hart Crowser

Table F-2

**Summary of Groundwater Elevations in CAA Monitoring Wells  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval Elevation (feet)	Top of Casing Elevation (Feet)	Date	Groundwater Pressure (PSI)	Groundwater Pressure (ft H2O)	Depth to Groundwater <sup>a</sup>	Groundwater Elevation <sup>b</sup>	Notes
<b>Treatment Zone A</b>									
MW-165	Property	1.3 to -8.8	13.58	10/21/19	–	–	–	–	
				05/11/20	–	–	4.34	9.24	
				07/13/20	–	–	4.40	9.18	
				09/03/20	2.0	4.6	–	18.20	Flowing
				09/21/20	2.75	6.4	–	19.93	Flowing
				10/01/20	4.0	9.2	–	22.82	Flowing
				11/16/20	4.5	10.4	–	23.98	Flowing
				02/01/21	6.0	13.9	–	27.44	Flowing
				06/07/21	3.5	8.1		21.67	Flowing
MW-169	Property	1.2 to -8.8	13.55	10/21/19	–	–	6.47	7.08	
				05/11/20	–	–	4.13	9.42	WL did not stabilize
				07/13/20	–	–	3.02	10.53	
				10/01/20	4.0	9.2	–	22.79	Flowing
				11/16/20	2.0	4.6	–	18.17	Flowing
				02/01/21	6.8	15.6	–	29.14	Flowing
				06/08/21	5.5	12.7	–	26.25	Flowing
MW-173	Property	2.2 to -7.8	13.56	10/21/19	–	–	–	–	
				01/13/20	–	–	3.88	9.68	
				05/11/20	–	–	4.39	9.17	
				07/13/20	–	–	4.75	8.81	
				09/03/20	1.1	2.5	–	16.11	Flowing
				09/21/20	2.0	4.6	–	18.18	Flowing
				10/01/20	4.0	9.2	–	22.80	Flowing
				11/16/20	4.0	9.2	–	22.80	Flowing
				02/01/21	9.8	22.5	–	36.09	Flowing
				06/07/21	4.5	10.4		23.96	Flowing

Table F-2

**Summary of Groundwater Elevations in CAA Monitoring Wells  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval Elevation (feet)	Top of Casing Elevation (Feet)	Date	Groundwater Pressure (PSI)	Groundwater Pressure (ft H2O)	Depth to Groundwater <sup>a</sup>	Groundwater Elevation <sup>b</sup>	Notes
MW-177	Property	2.3 to -7.7	13.61	10/21/19	–	–	6.57	7.04	
				01/13/20	–	–	0.55	13.06	
				05/11/20	–	–	2.21	11.40	
				07/13/20	–	–	0.46	13.15	
				10/01/20	9.6	22.2	–	35.79	Flowing
				11/16/20	6.0	13.9	–	27.47	Flowing
				02/01/21	7.5	17.3	–	30.93	
			06/08/21	6.0	13.9	–	27.47		
MW-181	Property	1.5 to -8.5	13.59	10/21/19	–	–	9.75	3.84	
				01/13/20	–	–	2.85	10.74	
				05/11/20	–	–	4.09	9.50	
				07/13/20	–	–	4.03	9.56	
				09/03/20	0.3	0.7	–	14.28	Flowing
				09/21/20	0.5	1.2	–	14.74	Flowing
				10/01/20	9.2	21.3	–	34.84	Flowing
				11/16/20	1.0	2.3	–	15.90	Flowing
				02/01/21	1.5	3.5	–	17.05	Flowing
			06/07/21	1.0	2.3	–	15.90	Flowing	
MW-185	Property	1.4 to -8.7	13.60	10/21/19	–	–	4.30	9.30	
				05/11/20	–	–	3.53	10.07	
				07/13/20	–	–	4.19	9.41	
				09/03/20	1.7	3.9	–	17.52	Flowing
				09/21/20	2.0	4.6	–	18.22	Flowing
				11/16/20	6.5	15.0	–	28.61	Flowing
				02/01/21	7.0	16.2	–	29.77	
			06/07/21	3.0	6.9	–	20.53		

Table F-2

**Summary of Groundwater Elevations in CAA Monitoring Wells  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval Elevation (feet)	Top of Casing Elevation (Feet)	Date	Groundwater Pressure (PSI)	Groundwater Pressure (ft H2O)	Depth to Groundwater <sup>a</sup>	Groundwater Elevation <sup>b</sup>	Notes
<b>Treatment Zone B</b>									
MW-166	Property	-12.6 to -22.6	13.58	10/21/19	–	–	–	–	
				05/11/20	–	–	4.20	9.38	
				07/13/20	–	–	4.24	9.34	
				11/16/20	4.0	9.24	–	22.82	Flowing
				02/01/21	6.0	13.86	–	27.44	Flowing
				06/07/21	3.5	8.085	–	21.67	Flowing
MW-170	Property	-12.8 to -22.8	13.56	10/21/19	–	–	4.94	8.62	
				05/11/20	–	–	2.69	10.87	
				07/13/20	–	–	2.80	10.76	
				11/16/20	3.0	6.93	–	20.49	Flowing
				02/01/21	6.0	13.86	–	27.42	Flowing
				06/08/21	4.0	9.24	–	22.80	Flowing
MW-174	Property	-12.3 to -22.3	13.57	10/21/19	–	–	–	–	
				01/13/20	–	–	2.68	10.89	
				05/11/20	–	–	3.67	9.90	
				07/13/20	–	–	4.05	9.52	
				11/16/20	3.5	8.09	–	21.65	Flowing
				02/01/21	6.5	15.02	–	28.58	Flowing
				06/07/21	4.5	10.40	–	23.96	Flowing
MW-178	Property	-11.7 to -21.7	13.61	10/21/19	–	–	2.27	11.34	
				01/13/20	–	–	0.55	13.06	
				05/11/20	–	–	3.16	10.45	
				07/13/20	–	–	1.92	11.69	
				11/16/20	3.0	6.93	–	20.54	Flowing
				02/01/21	5.0	11.55	–	25.16	Flowing
				06/08/21	6.0	13.86	–	27.47	Flowing

Table F-2

**Summary of Groundwater Elevations in CAA Monitoring Wells  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval Elevation (feet)	Top of Casing Elevation (Feet)	Date	Groundwater Pressure (PSI)	Groundwater Pressure (ft H2O)	Depth to Groundwater <sup>a</sup>	Groundwater Elevation <sup>b</sup>	Notes
MW-182	Property	-12.5 to -22.5	13.59	10/21/19	–	–	4.92	8.67	
				01/13/20	–	–	1.48	12.11	
				05/11/20	–	–	2.75	10.84	
				07/13/20	–	–	4.54	9.05	
				11/16/20	0.5	1.16	–	14.74	Flowing
				02/01/21	>15	>34.65	–	>48.28	Flowing; maxed gauge
				06/07/21	1	2.31	–	15.90	
MW-186	Property	-12.7 to -22.7	13.57	10/21/19	–	–	9.86	3.71	
				05/11/20	–	–	3.11	10.46	
				07/13/20	–	–	3.61	9.96	
				11/16/20	3.5	8.09	–	21.66	Flowing
				02/01/21	5.75	13.28	–	26.86	Flowing
				06/07/21	4	9.24	–	22.81	Flowing
				<b>Treatment Zone C</b>					
MW-167	Property	-27.9 to -37.9	13.58	10/21/19	–	–	–	–	
				05/11/20	–	–	7.43	6.15	WL did not stabilize
				07/13/20	–	–	4.30	9.28	
				11/16/20	–	–	4.86	8.72	
				02/01/21	3.25	7.51	–	21.09	Flowing
				06/07/21	–	–	2.26	11.31	
MW-171	Property	-27.6 to -37.6	13.49	10/21/19	–	–	1.14	12.35	
				05/11/20	–	–	4.62	8.87	WL did not stabilize
				07/13/20	–	–	5.13	8.36	WL did not stabilize (rising)
				11/16/20	–	–	4.66	8.83	Compost-like odor, under pressure
				02/01/21	–	–	1.28	12.21	
				06/08/21	–	–	3.73	9.76	Monument submerged

Table F-2

**Summary of Groundwater Elevations in CAA Monitoring Wells  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval Elevation (feet)	Top of Casing Elevation (Feet)	Date	Groundwater Pressure (PSI)	Groundwater Pressure (ft H2O)	Depth to Groundwater <sup>a</sup>	Groundwater Elevation <sup>b</sup>	Notes
MW-175	Property	-27.8 to -37.8	13.56	10/21/19	–	–	–	–	
				01/13/20	–	–	6.52	7.04	
				05/11/20	–	–	5.21	8.35	WL did not stabilize
				07/13/20	–	–	4.56	9.00	WL did not stabilize (rising)
				11/16/20	–	–	0.00	13.56	
				02/01/21	4	9.24	–	22.80	Flowing
				06/07/21	3	6.93	–	20.49	Flowing
MW-179	Property	-27.2 to -37.2	13.62	10/21/19	–	–	4.37	9.25	
				01/13/20	–	–	3.82	9.80	
				05/11/20	–	–	4.50	9.12	
				07/13/20	–	–	1.79	11.83	WL did not stabilize (rising)
				11/16/20	–	–	19.12	-5.50	Compost-like odor, under pressure
				02/01/21	>15	>34.65	–	>48.27	Flowing; maxed gauge
				06/07/21	–	–	10.12	3.50	WL did not stabilize
MW-183	Property	-27.4 to -37.4	13.55	10/21/19	–	–	0.75	12.80	
				01/13/20	–	–	0.00	13.55	
				05/11/20	–	–	1.55	12.00	
				07/13/20	–	–	2.38	11.17	
				11/16/20	0.5	1.16	–	14.70	Flowing
				02/01/21	–	–	2.17	11.38	
				06/07/21	1	–	3.17	10.38	Flowing
MW-187	Property	27.0 to -37.0	13.56	10/21/19	–	–	0.78	12.78	
				05/11/20	–	–	7.70	5.86	
				07/13/20	–	–	6.97	6.59	
				11/16/20	–	–	3.95	9.61	

Table F-2

**Summary of Groundwater Elevations in CAA Monitoring Wells  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval Elevation (feet)	Top of Casing Elevation (Feet)	Date	Groundwater Pressure (PSI)	Groundwater Pressure (ft H2O)	Depth to Groundwater <sup>a</sup>	Groundwater Elevation <sup>b</sup>	Notes
MW-187 (continued)				02/01/21	–	–	3.06	10.50	Flowing
				06/07/21	1	–	4.06	9.50	
<b>Treatment Zone D</b>									
MW-168	Property	-43.0 to -53.0	13.55	10/21/19	–	–	–	–	DTW measured using 5 ft PVC extension; GW elevation adjusted accordingly
				05/11/20	–	–	0.30	13.25	
				07/13/20	–	–	0.97	12.58	
				11/16/20	–	–	0.98	12.57	
				02/01/21	1	2.31	–	15.86	
				06/07/21	–	–	3.47	15.08	
MW-172	Property	-42.5 to -52.5	13.54	10/21/19	1.25	2.89	–	16.43	Flowing
				05/11/20	–	–	0.00	13.54	Flowing
				07/13/20	–	–	0.75	12.79	
				11/16/20	–	–	0.35	13.19	
				02/01/21	0.5	1.16	–	14.69	
				06/08/21	–	–	3.69	14.85	DTW measured using 5 ft PVC extension; GW elevation adjusted accordingly
MW-176	Property	-42.7 to -52.7	13.55	10/21/19	–	–	–	–	Flowing
				01/13/20	1.2	2.77	–	16.32	
				05/11/20	–	–	0.73	12.82	
				07/13/20	–	–	1.27	12.28	
				11/16/20	–	–	0.59	12.96	
				02/01/21	0.5	1.16	–	14.70	

**Table F-2**

**Summary of Groundwater Elevations in CAA Monitoring Wells  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval Elevation (feet)	Top of Casing Elevation (Feet)	Date	Groundwater Pressure (PSI)	Groundwater Pressure (ft H2O)	Depth to Groundwater <sup>a</sup>	Groundwater Elevation <sup>b</sup>	Notes
MW-176 (continued)				06/07/21	–	–	3.48	15.07	DTW measured using 5 ft PVC extension; GW elevation adjusted accordingly
MW-180	Property	-42.7 to -52.7	13.61	10/21/19	0.75	1.73	–	15.34	Flowing
				01/13/20	0.7	1.62	–	15.23	Flowing
				05/11/20	0.25	0.58	–	14.19	Flowing
				07/13/20	–	–	0.64	14.25	
				11/16/20	–	–	0.39	14.00	Compost-like odor, under pressure
				02/01/21	0.5	1.16	–	14.76	Flowing
				06/08/21	–	–	3.45	15.16	DTW measured using 5 ft PVC extension; GW elevation adjusted accordingly
MW-184	Property	-42.5 to -52.5	13.58	10/21/19	0.5	1.16	–	14.73	Flowing
				05/11/20	–	–	0.50	13.08	
				07/13/20	–	–	1.28	12.30	
				11/16/20	–	–	0.41	13.17	
				02/01/21	0.25	0.58	–	14.15	Flowing
				06/07/21	–	–	3.65	14.93	DTW measured using 5 ft PVC extension; GW elevation adjusted accordingly
MW-188	Property	-42.2 to -52.2	13.59	10/21/19	1.25	2.89	–	16.48	Flowing
				05/11/20	–	–	0.40	13.19	

Table F-2

**Summary of Groundwater Elevations in CAA Monitoring Wells  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Sample Location	Property	Screen Interval Elevation (feet)	Top of Casing Elevation (Feet)	Date	Groundwater Pressure (PSI)	Groundwater Pressure (ft H2O)	Depth to Groundwater <sup>a</sup>	Groundwater Elevation <sup>b</sup>	Notes
MW-188 (continued)				07/13/20	-	-	1.02	12.57	
				11/16/20	-	-	0.51	13.08	
				02/01/21	7.00	16.17	-	29.76	Flowing
				06/07/21	-	-	3.65	14.94	DTW measured using 5 ft PVC extension; GW elevation adjusted accordingly
<p><b>NOTES:</b>            Top of Casing elevations were surveyed relative to NAVD 1988.            MW-165, MW-166, MW-167, and MW-168 were installed after October 21, 2019            - = Not measured or not applicable.            Depth to groundwater for flowing wells is calculated from the observed well pressure.            All water levels were measured by PES Environmental.</p>									

**Table F-3**

**Summary of Pressure Transducer Data: 2017 to 2021  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Monitoring Well	Unpumped Conditions							Pumped Conditions						
	Measurement Period		Groundwater Elevation					Measurement Period		Groundwater Elevation				
	Start	End	Maximum	Minimum	Mean	Median	Range	Start	End	Maximum	Minimum	Mean	Median	Range
<b>Shallow Zone</b>														
R-MW3	2/1/18	3/14/19	34.92	25.56	29.81	29.55	9.36	4/18/17	12/17/17	33.87	25.60	30.20	30.25	8.37
MW121	-	-	-	-	-	-	-	9/21/20	3/24/21	27.61	18.62	23.12	22.58	8.99
MW-154	-	-	-	-	-	-	-	8/7/19	9/15/19	23.87	22.54	23.20	23.21	1.33
MW-155	7/3/19	8/5/19	23.48	21.94	22.68	22.64	1.55	8/7/19	11/16/20	23.83	18.86	20.28	20.12	4.98
MW-312	-	-	-	-	-	-	-	7/17/20	3/24/21	21.96	10.83	14.95	13.12	11.13
MW-320	-	-	-	-	-	-	-	10/10/19	2/1/21	18.94	10.79	13.72	12.07	8.15
<b>Intermediate A Zone</b>														
MW116	2/1/18	3/14/19	19.02	16.10	17.44	17.48	2.92	4/18/17	12/17/17	16.49	1.66	5.05	3.86	14.83
MW119	2/1/18	8/5/19	19.21	12.17	14.62	13.31	7.04	4/18/17	12/17/17	18.31	-1.65	5.66	4.05	19.96
MW107	7/3/19	8/5/19	23.53	18.78	20.90	20.65	4.75	8/7/19	10/9/19	18.71	7.60	13.92	12.69	11.11
MW108	-	-	-	-	-	-	-	8/7/19	10/9/19	18.58	17.37	17.84	17.80	1.20
MW110	-	-	-	-	-	-	-	8/7/19	10/9/19	18.58	17.47	18.02	17.98	1.11
MW-142	-	-	-	-	-	-	-	8/7/19	3/24/21	26.40	11.83	18.52	19.20	14.58
MW-146	-	-	-	-	-	-	-	8/7/19	10/9/19	20.62	18.04	18.99	18.60	2.58
MW-156	-	-	-	-	-	-	-	8/7/19	10/9/19	20.50	15.23	16.07	15.82	5.27
MW-306	-	-	-	-	-	-	-	10/10/19	3/24/21	34.01	28.91	30.40	29.89	5.10
MW-308	-	-	-	-	-	-	-	1/28/20	3/24/21	18.01	11.06	12.62	11.96	6.96
MW-325	-	-	-	-	-	-	-	10/10/19	3/25/21	18.91	6.49	10.31	8.06	12.42
MW-327	-	-	-	-	-	-	-	10/10/19	3/24/21	20.09	13.83	16.35	16.19	6.27
<b>Intermediate B Zone</b>														
MW130	2/1/18	9/14/18	18.15	13.65	17.08	17.06	4.50	4/18/17	12/17/17	15.63	10.24	13.28	13.02	5.39
MW109	7/3/19	8/5/19	19.14	18.39	18.76	18.78	0.75	8/7/19	11/16/20	18.41	9.55	13.22	12.26	8.86
MW111	-	-	-	-	-	-	-	7/17/20	3/24/21	15.00	8.89	11.00	10.13	6.12
MW126	-	-	-	-	-	-	-	2/19/20	3/24/21	14.41	11.18	12.32	11.95	3.23
MW-143	-	-	-	-	-	-	-	2/24/20	11/16/20	20.57	10.36	13.02	12.89	10.21
W-MW-02	-	-	-	-	-	-	-	11/20/20	2/1/21	24.71	20.27	22.66	22.67	4.44
MW-190	-	-	-	-	-	-	-	2/2/21	3/24/21	26.53	23.38	24.77	24.70	3.15
MW-147	-	-	-	-	-	-	-	8/7/19	10/9/19	18.95	15.29	16.93	16.58	3.66
MW-307	-	-	-	-	-	-	-	10/10/19	3/24/21	19.99	14.78	17.24	17.51	5.21
MW-309	-	-	-	-	-	-	-	10/10/19	1/13/20	17.93	15.82	17.02	16.94	2.12
MW-316	-	-	-	-	-	-	-	10/10/19	3/24/21	19.45	9.50	12.77	11.24	9.95
MW-322	-	-	-	-	-	-	-	10/10/19	3/24/21	17.87	8.85	11.89	10.24	9.02

**Table F-3**

**Summary of Pressure Transducer Data: 2017 to 2021  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North, Seattle, Washington**

Monitoring Well	Unpumped Conditions							Pumped Conditions						
	Measurement Period		Groundwater Elevation					Measurement Period		Groundwater Elevation				
	Start	End	Maximum	Minimum	Mean	Median	Range	Start	End	Maximum	Minimum	Mean	Median	Range
<b>Deep Zone</b>														
MW102	2/1/18	3/14/19	18.77	15.20	16.49	16.46	3.57	4/18/17	12/17/17	14.79	11.16	12.34	11.99	3.63
MW105	2/1/18	3/14/19	19.02	16.36	17.60	17.64	2.66	4/18/17	12/17/17	15.34	3.25	7.30	6.28	12.10
MW113	2/1/18	3/14/19	18.75	16.05	17.31	17.34	2.71	4/18/17	12/17/17	15.33	-0.59	3.91	1.95	15.92
MW122	2/1/18	3/14/19	18.35	15.91	17.07	17.17	2.45	4/18/17	12/17/17	15.19	2.92	6.28	5.08	12.27
MW124	-	-	-	-	-	-	-	2/19/20	3/24/21	15.93	12.14	13.92	13.90	3.79
MW-153	-	-	-	-	-	-	-	2/19/20	3/24/21	15.37	12.01	13.51	13.28	3.37
MW-160	-	-	-	-	-	-	-	2/19/20	3/3/21	15.55	12.27	13.27	13.06	3.28
MW-319	-	-	-	-	-	-	-	2/19/20	2/1/21	13.83	9.72	10.84	10.46	4.10
MW-324	-	-	-	-	-	-	-	1/28/20	3/24/21	17.49	8.27	9.97	9.08	9.23
MW-326	-	-	-	-	-	-	-	1/30/20	3/24/21	14.92	7.37	8.99	8.29	7.55
MW-328	-	-	-	-	-	-	-	2/19/20	3/24/21	13.52	9.25	10.60	10.08	4.27
MW-329	-	-	-	-	-	-	-	2/19/20	2/1/21	12.35	7.83	8.87	8.56	4.52
<b>Lake Union</b>														
Lake <sup>a</sup>	2/1/18	3/14/19	18.97	16.91	17.65	17.36	2.06	2/19/20	3/24/21	19.12	17.01	17.92	17.87	2.11
Notes:														
Elevations in feet and relative to the North American Vertical Datum of 1988 (NAVD 88).														
Deep zone well FMW-129 data not summarized since the transducer stopped collecting data on June 27, 2017.														
"-" = no data or not enough data available for the period.														
Transducer data after March 24, 2021 excluded from table due to unknown status and discharge of pumping at 400 Westlake Ave N (Block 39W).														
<sup>a</sup> Lake Union data from the USACE Lake Washington monitoring station located in Kenmore; water elevations recorded hourly.														

**APPENDIX F FIGURES**

Figure F-1	Transducer Hydrographs – Shallow Zone Wells
Figure F-2	Transducer Hydrographs – Intermediate A Zone Wells
Figure F-3	Transducer Hydrographs – Intermediate B Zone Wells
Figure F-4	Transducer Hydrographs – Deep Zone Wells
Figure F-5	Groundwater Elevation Contours : March 14, 2019
Figure F-6	Groundwater Elevation Contours : April 22, 2019
Figure F-7	Groundwater Elevation Contours : January 13, 2020
Figure F-8	Groundwater Elevation Contours : July 13, 2020
Figure F-9	Groundwater Elevation Contours : November 16, 2020
Figure F-10	Groundwater Elevation Contours : February 2, 2021
Figure F-11	Groundwater Elevation Contours : June 7, 2021

**Figure F-1**  
**Hydrographs - Shallow Zone Wells**  
**American Linen Supply Co Dexter Ave Site**  
**Seattle, Washington**

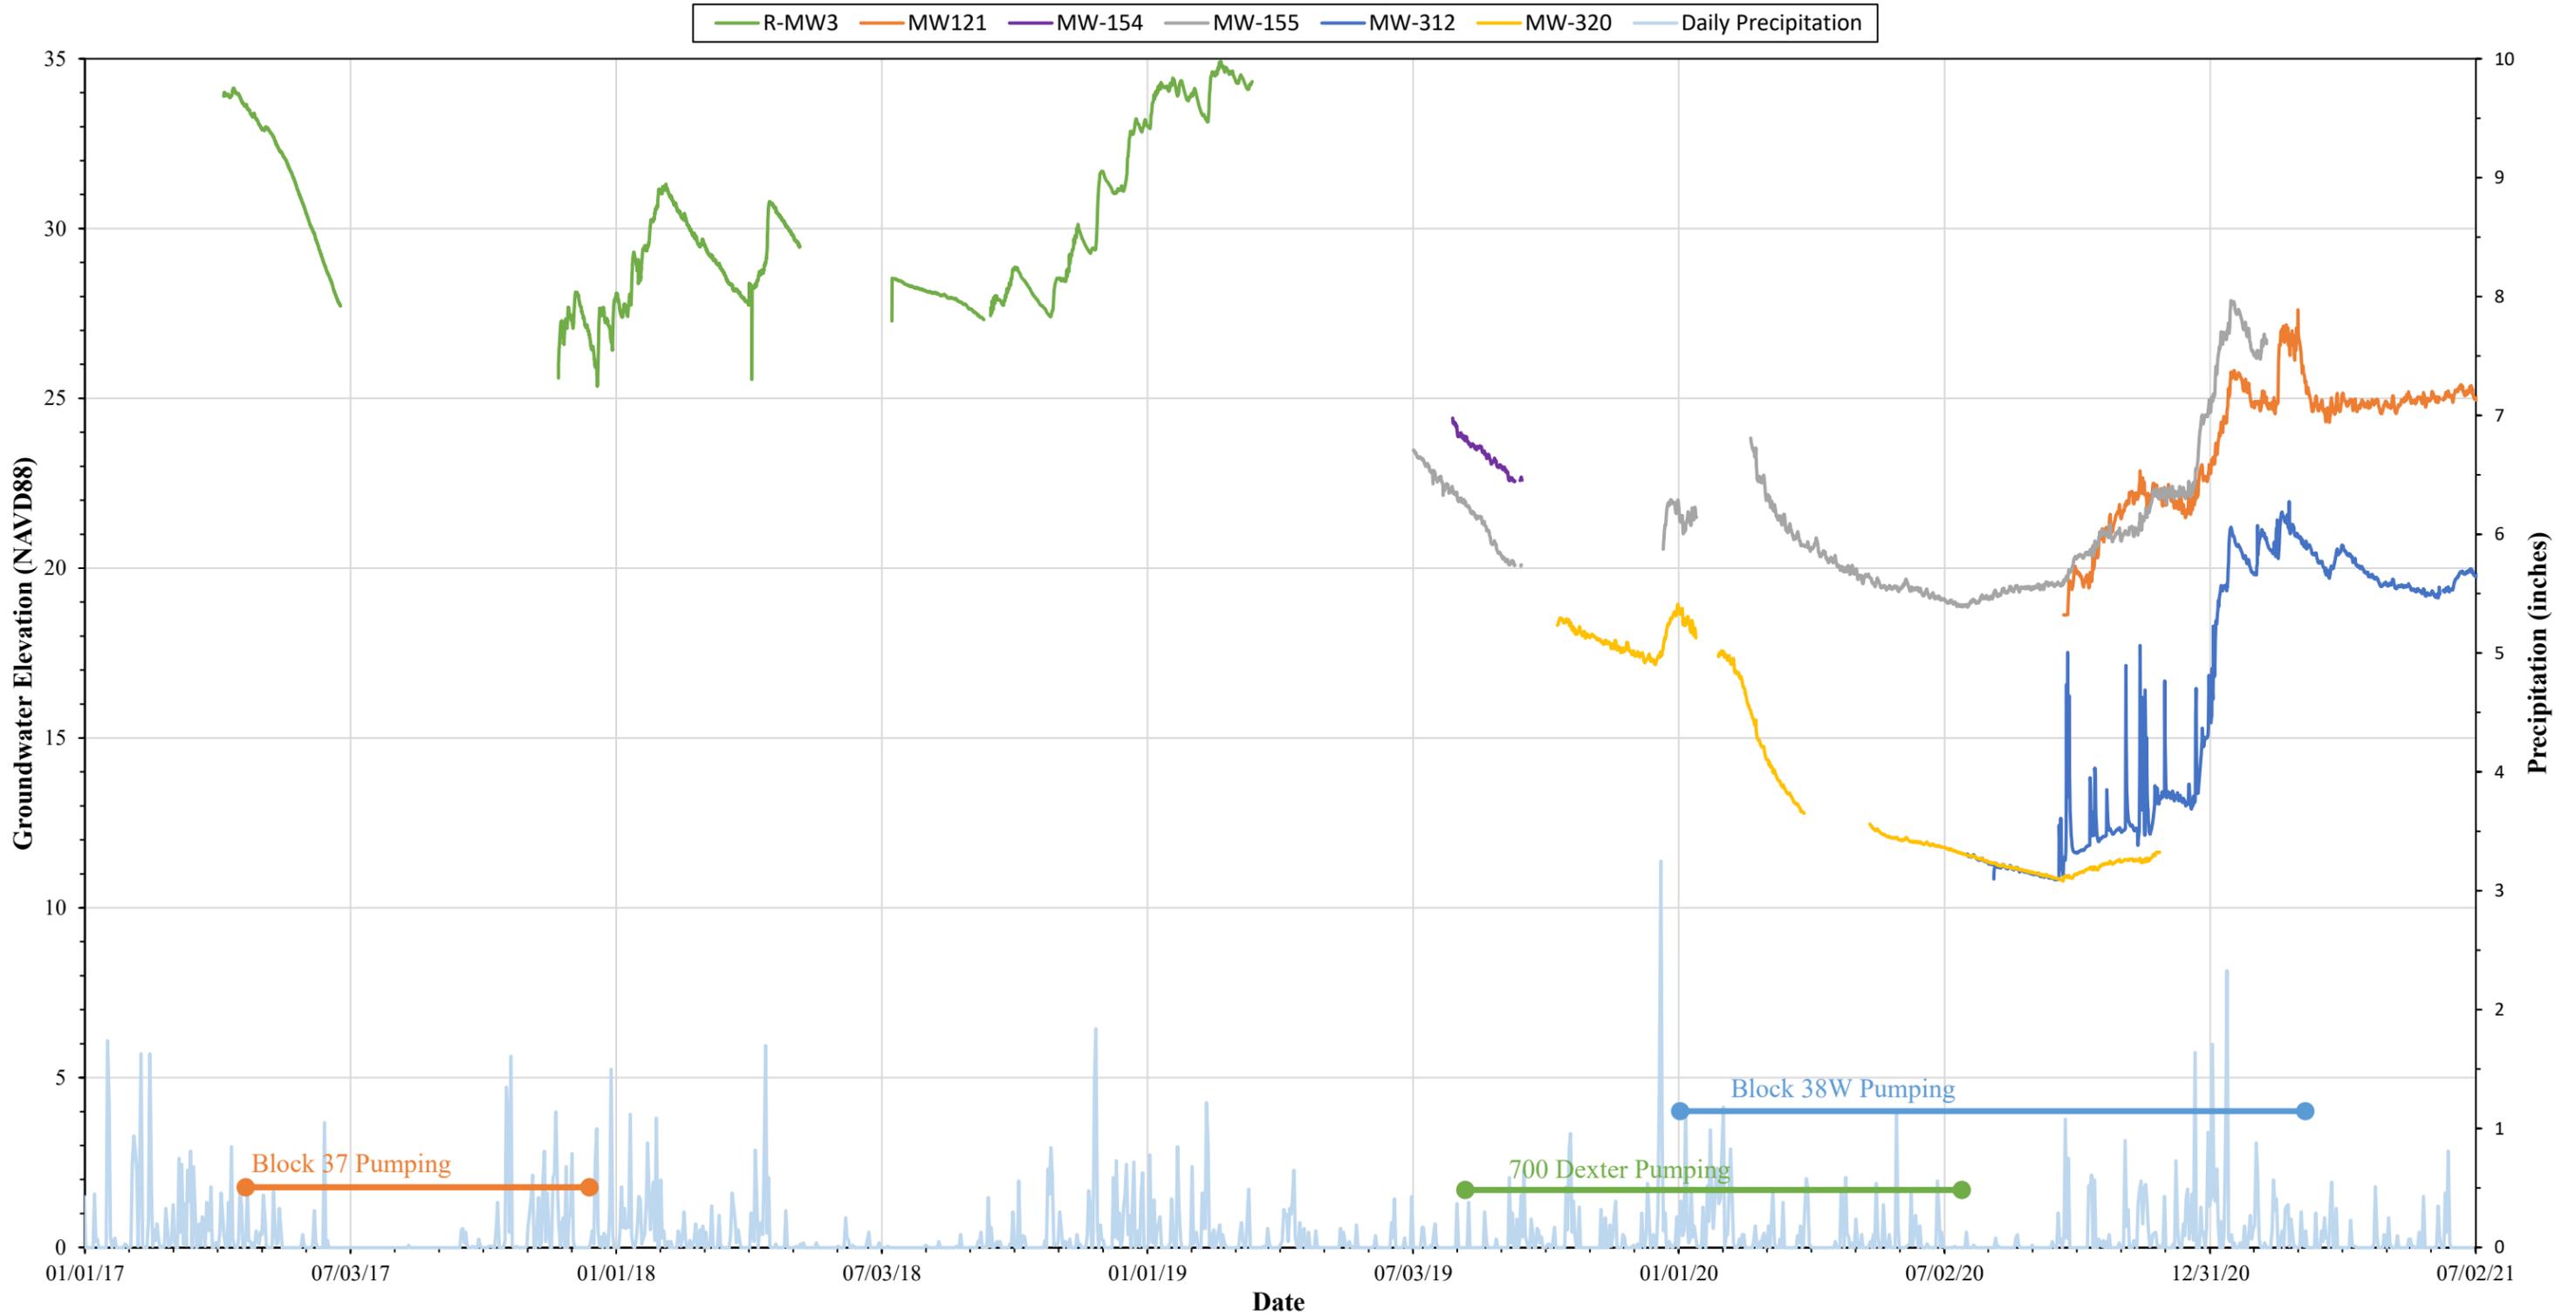
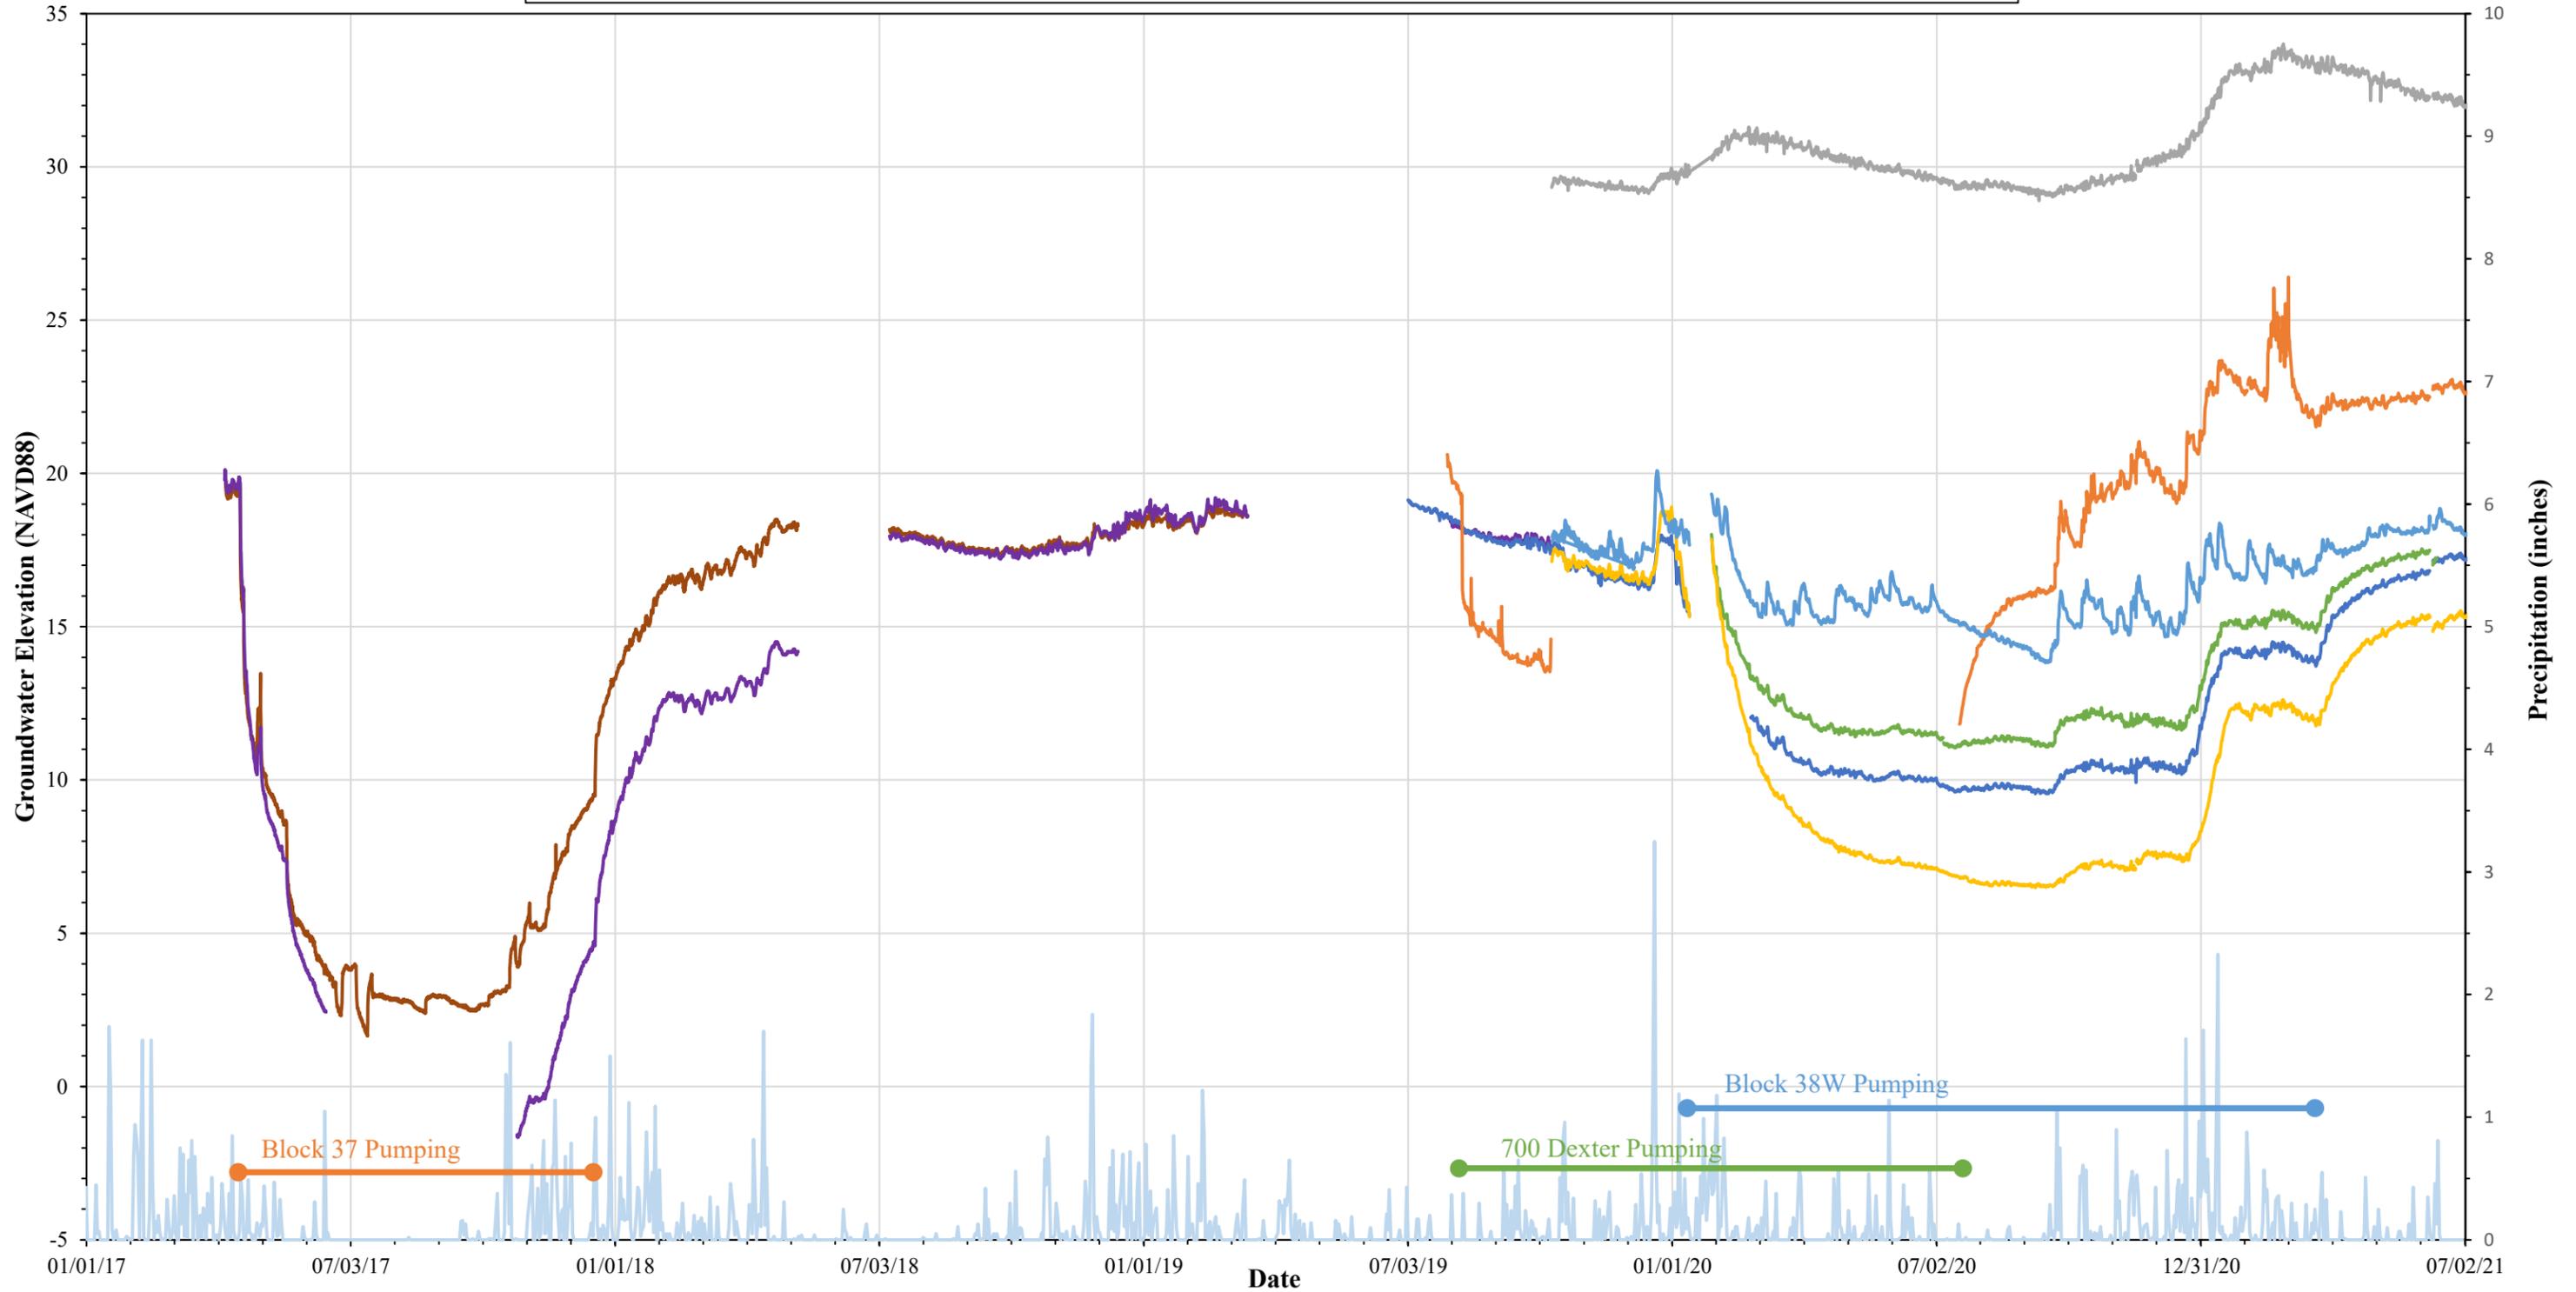


Figure F-2  
Hydrographs - Intermediate A Zone Wells  
American Linen Supply Co Dexter Ave Site  
Seattle, Washington


MW116 MW119 MW109 MW-142 MW-306 MW-308 MW-325 MW-327 Daily Precipitation







**Figure F-3**  
**Hydrographs - Intermediate B Zone Wells**  
**American Linen Supply Co Dexter Ave Site**  
**Seattle, Washington**




**Figure F-4**  
**Hydrographs - Deep Zone Wells**  
**American Linen Supply Co Dexter Ave Site**  
**Seattle, Washington**

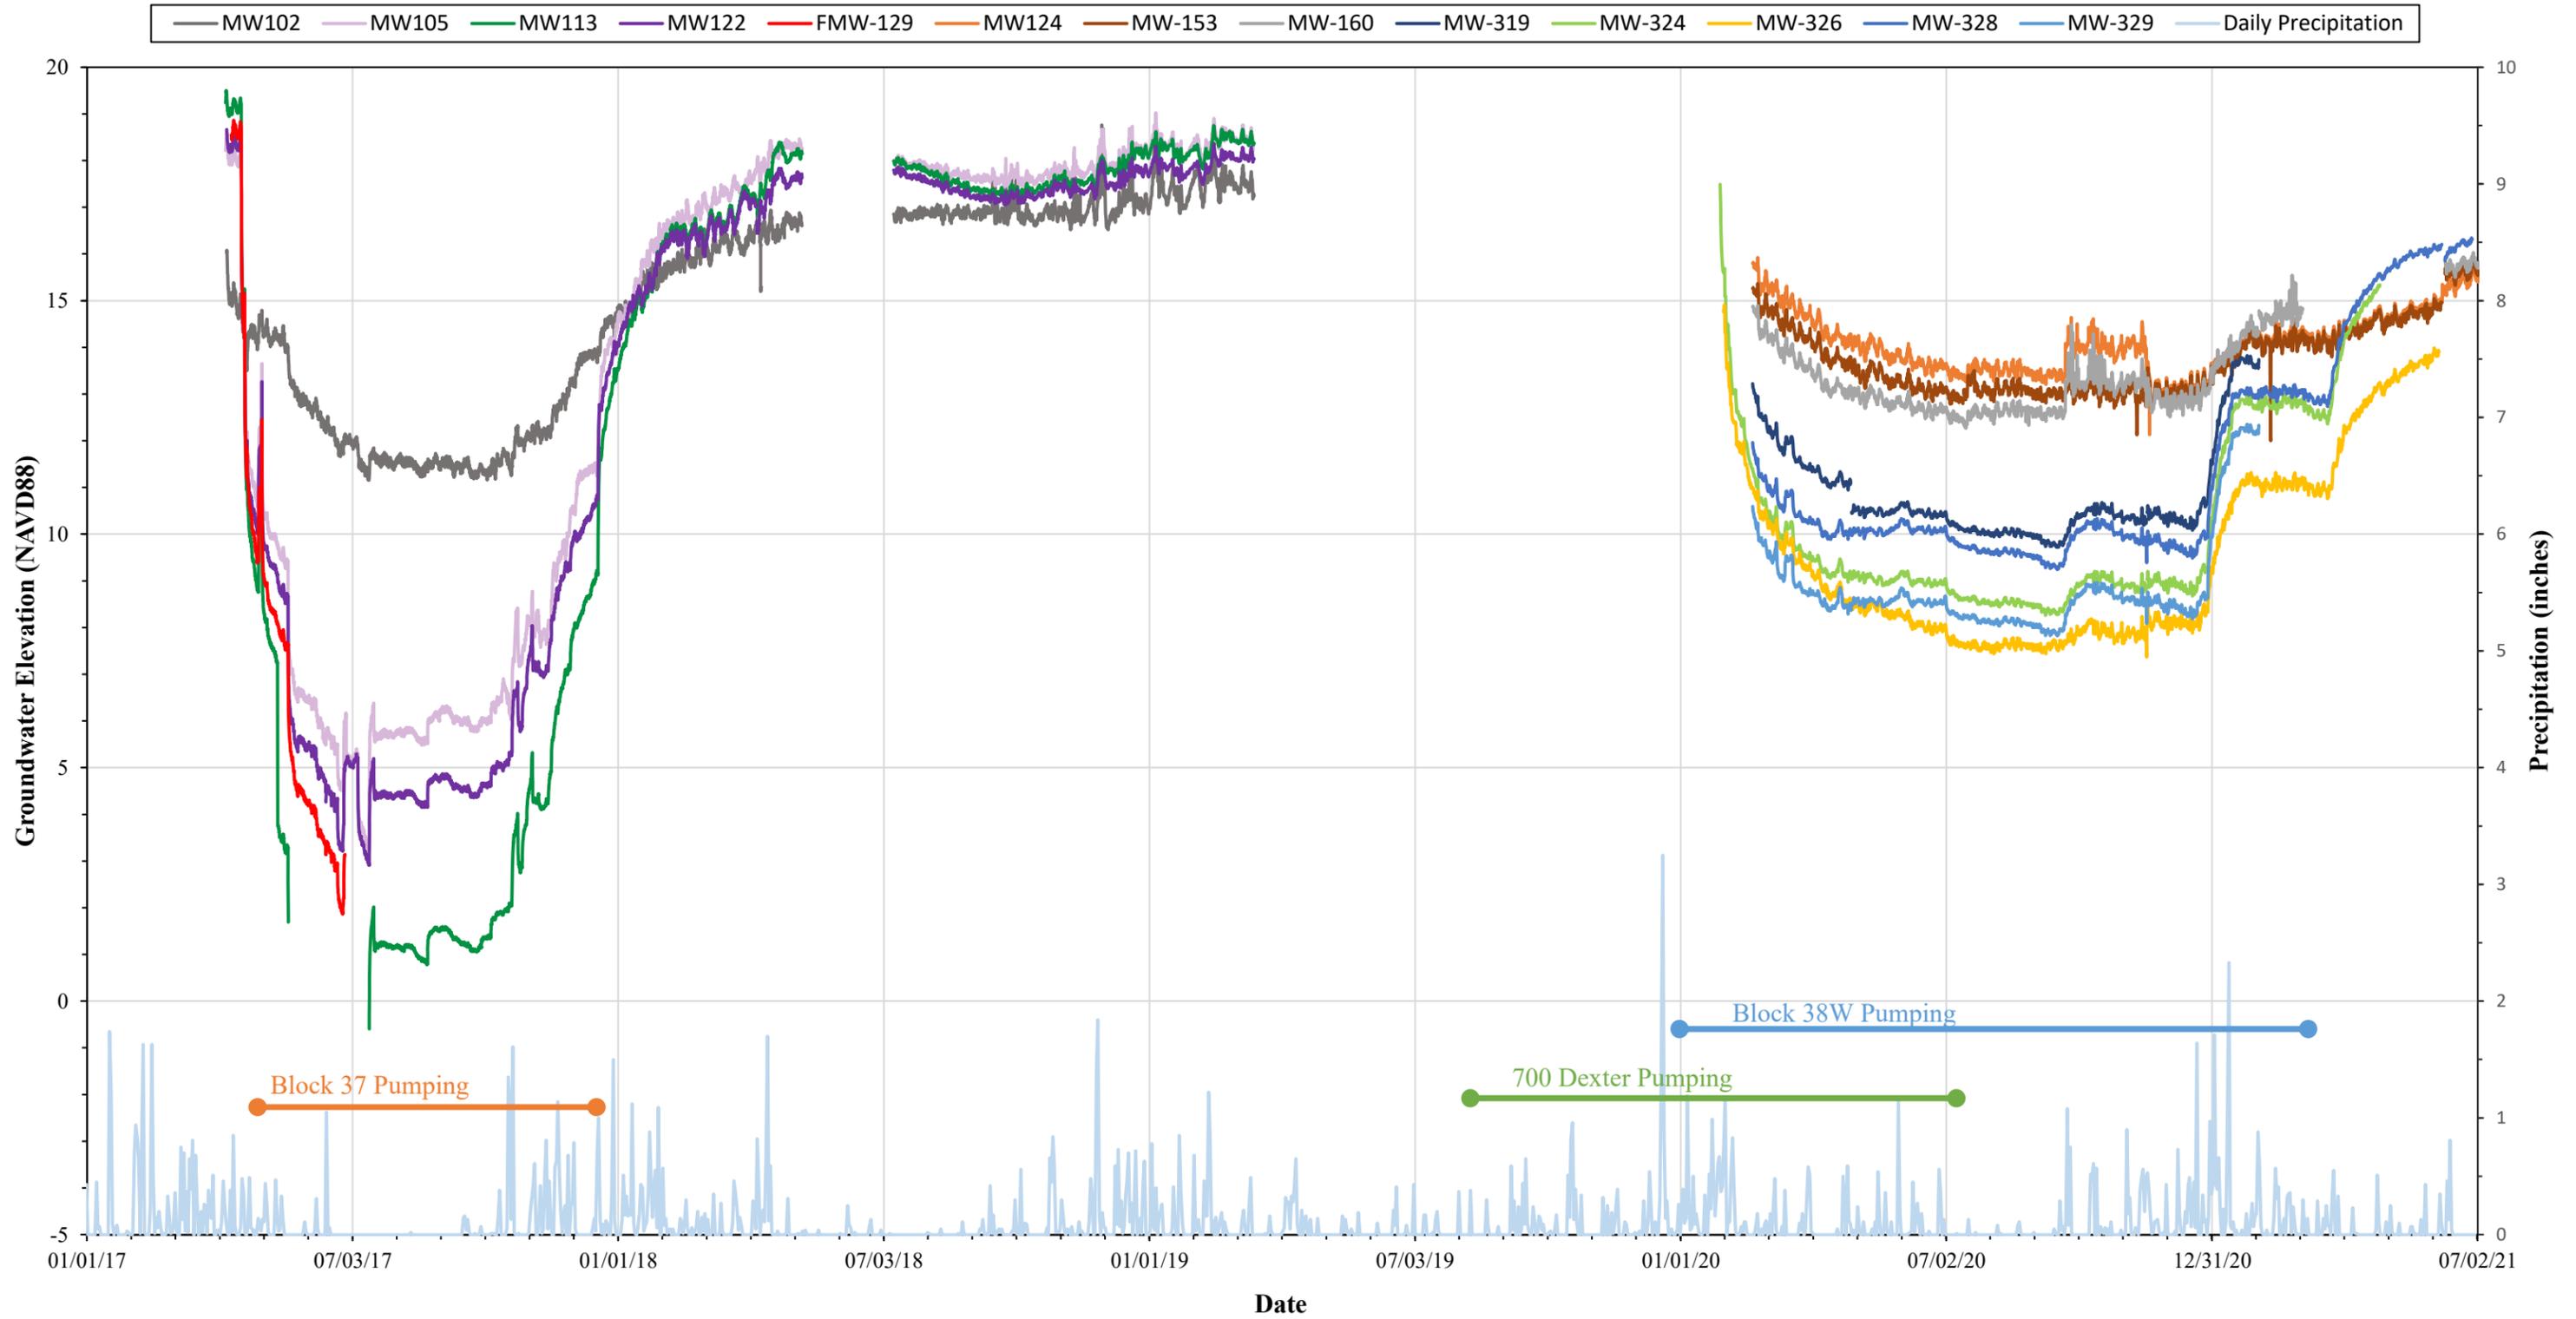

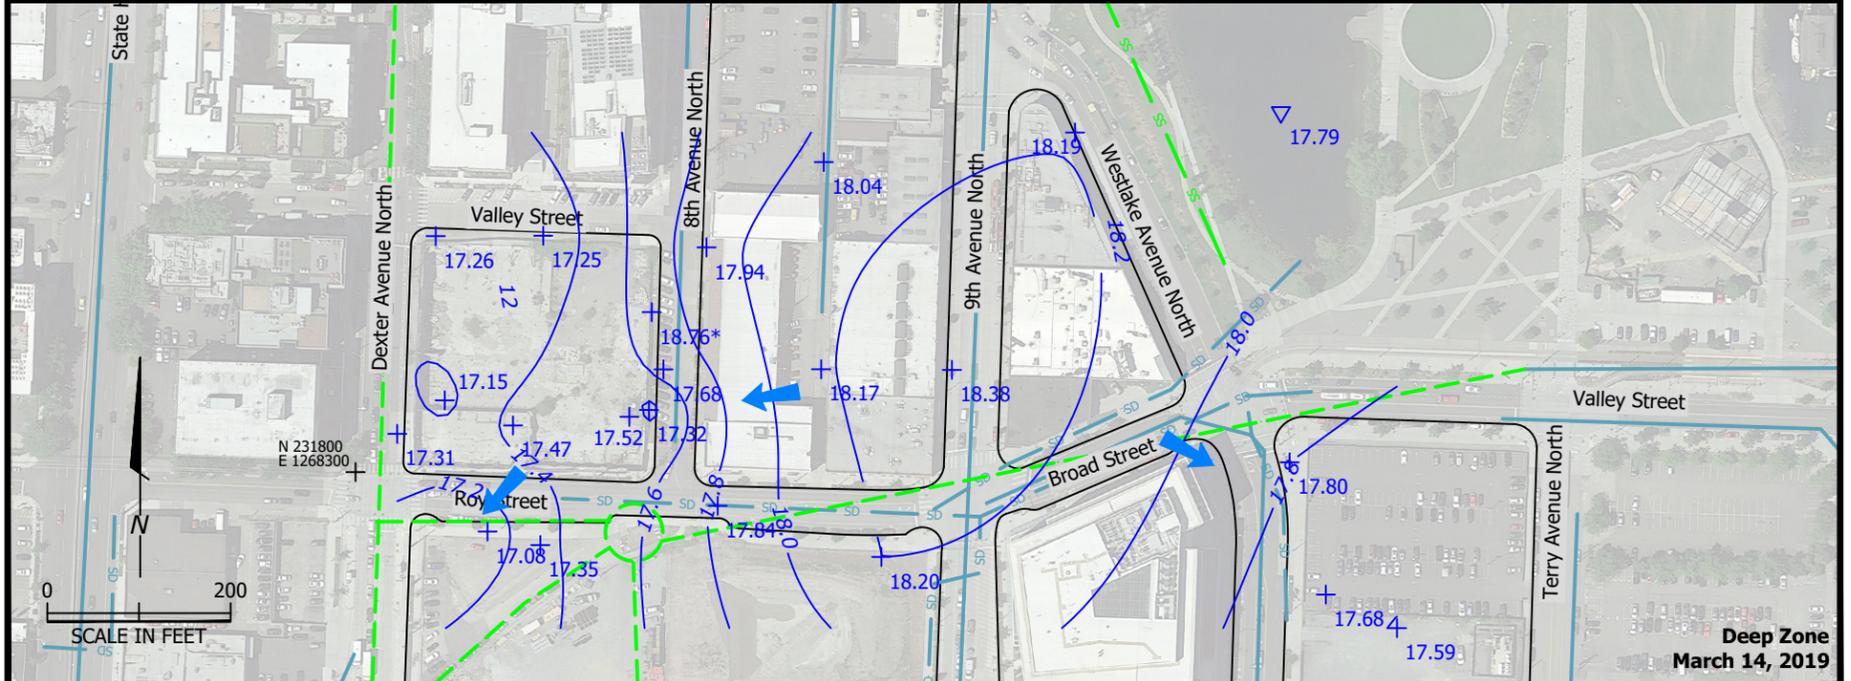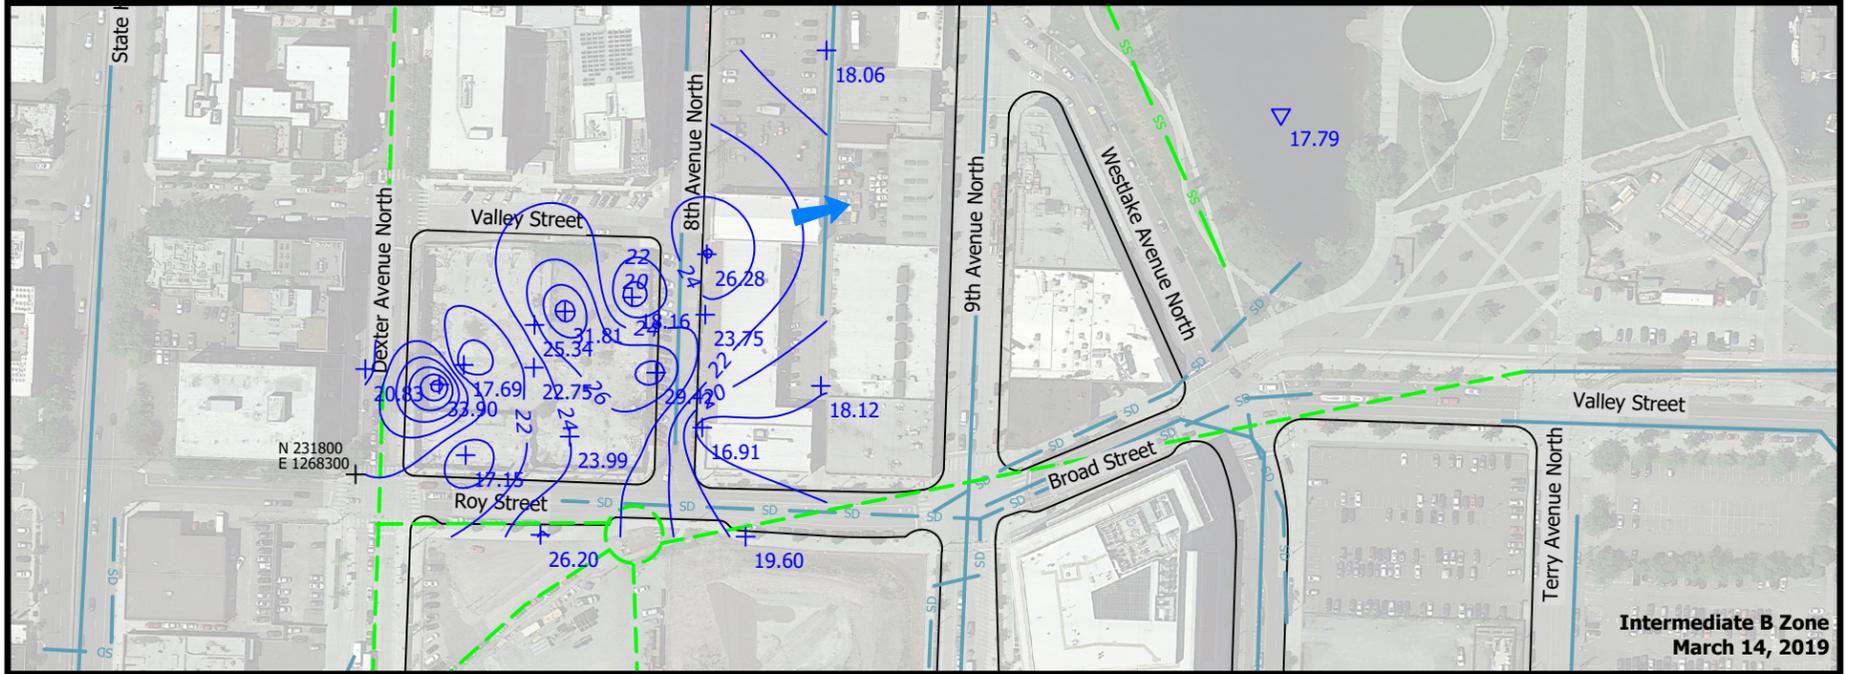
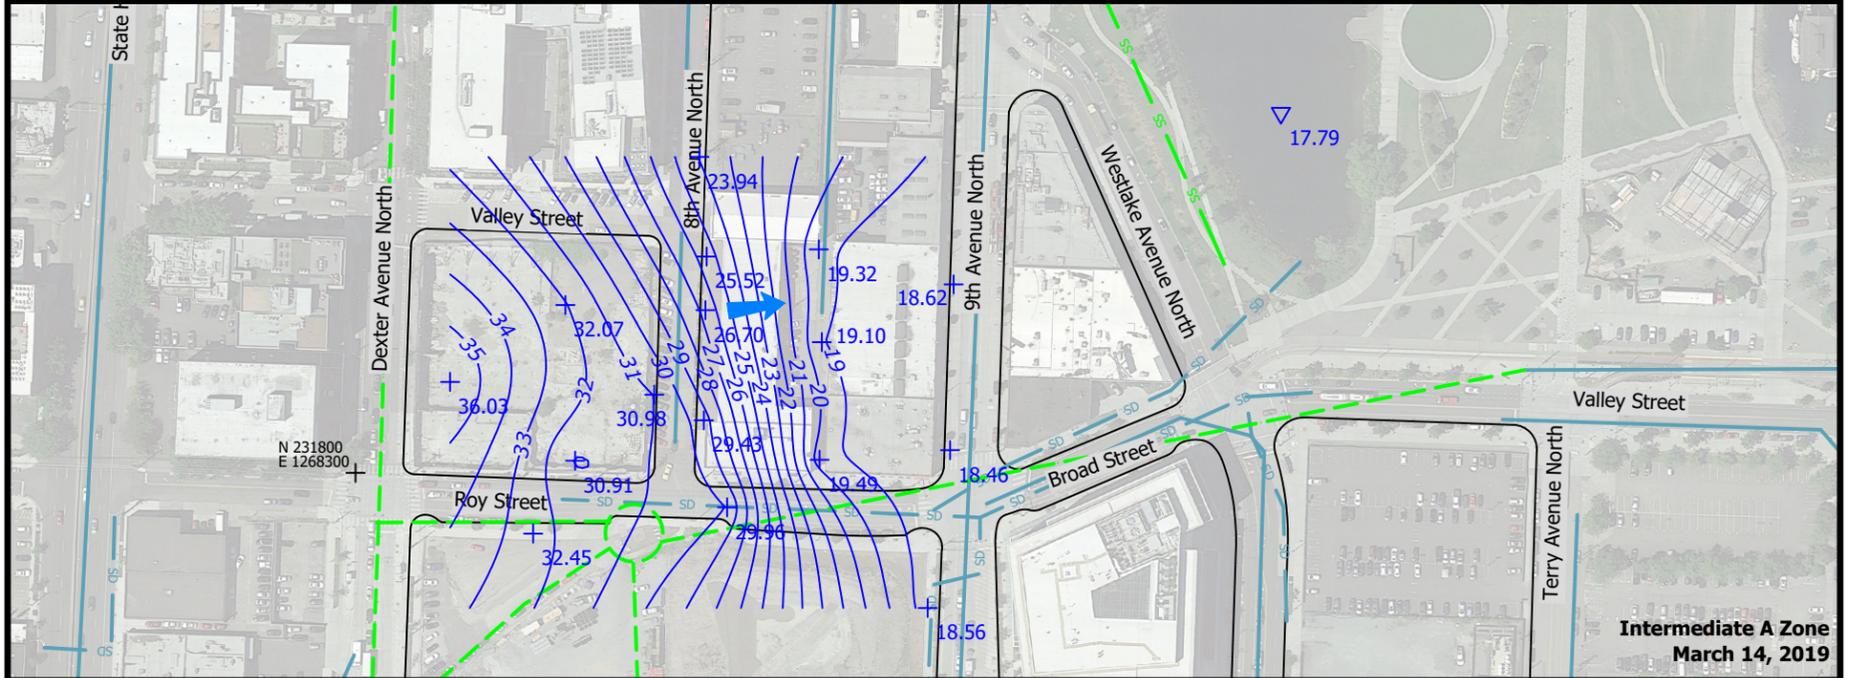
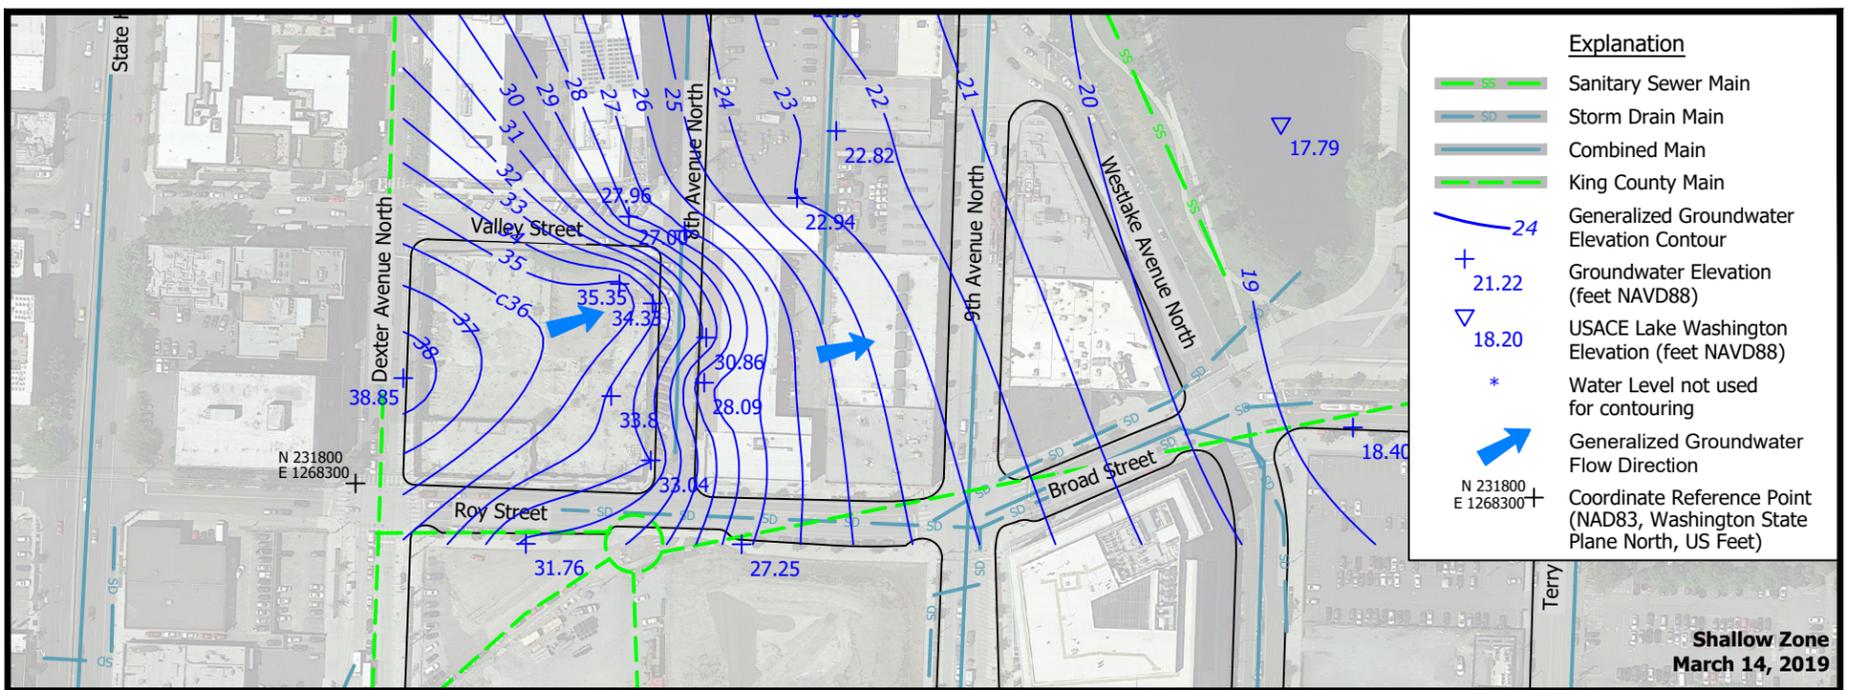


**Groundwater Elevation Contours  
March 14, 2019 (No Dewatering in Area)**  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North  
Seattle, Washington

FIGURE  
**F-5**

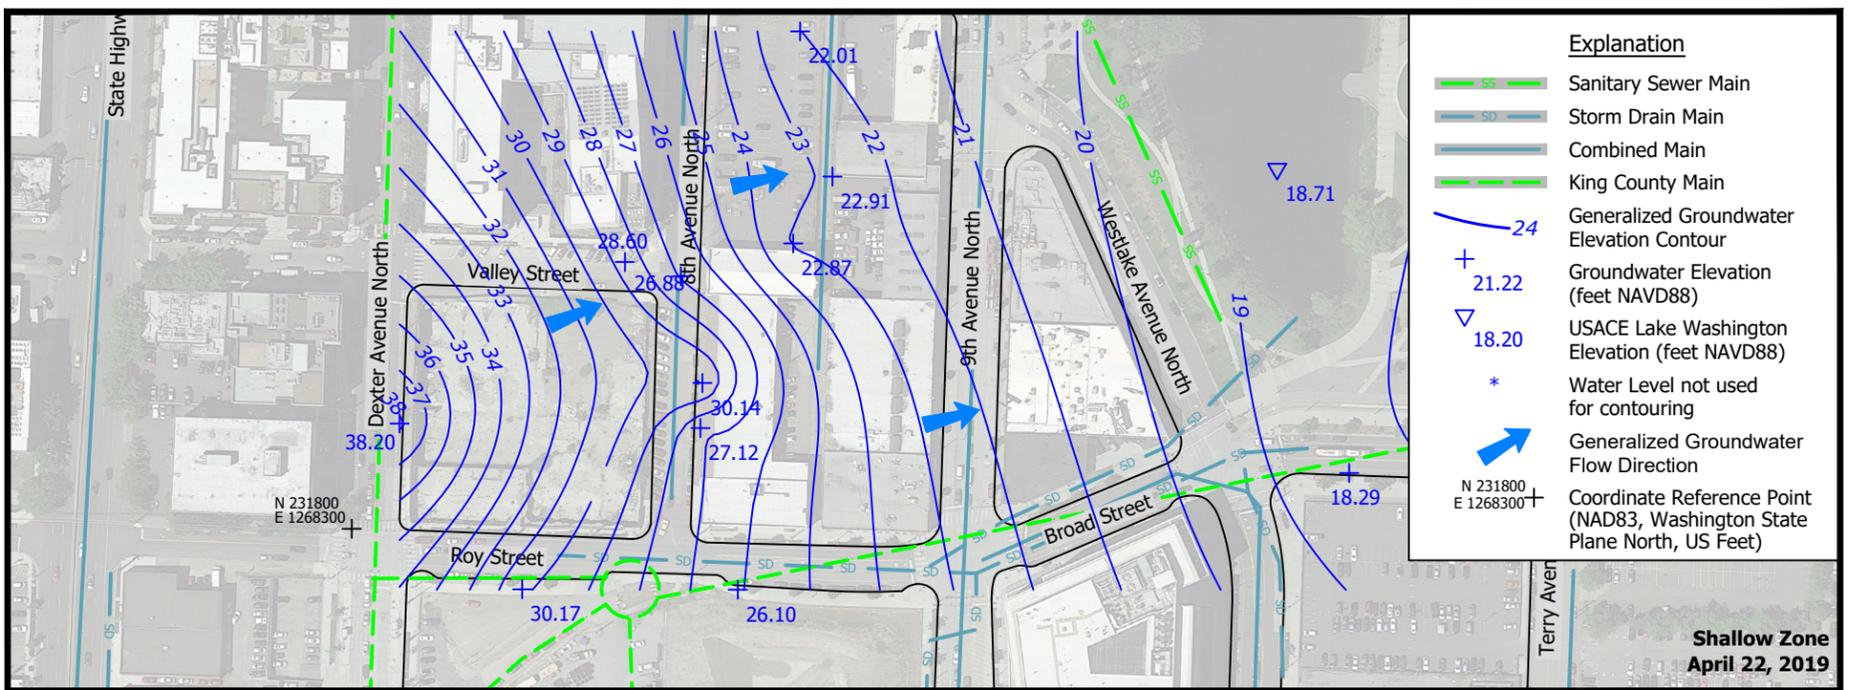


Explanation	
	Sanitary Sewer Main
	Storm Drain Main
	Combined Main
	King County Main
	Generalized Groundwater Elevation Contour
	Groundwater Elevation (feet NAVD88)
	USACE Lake Washington Elevation (feet NAVD88)
	Water Level not used for contouring
	Generalized Groundwater Flow Direction
	Coordinate Reference Point (NAD83, Washington State Plane North, US Feet)

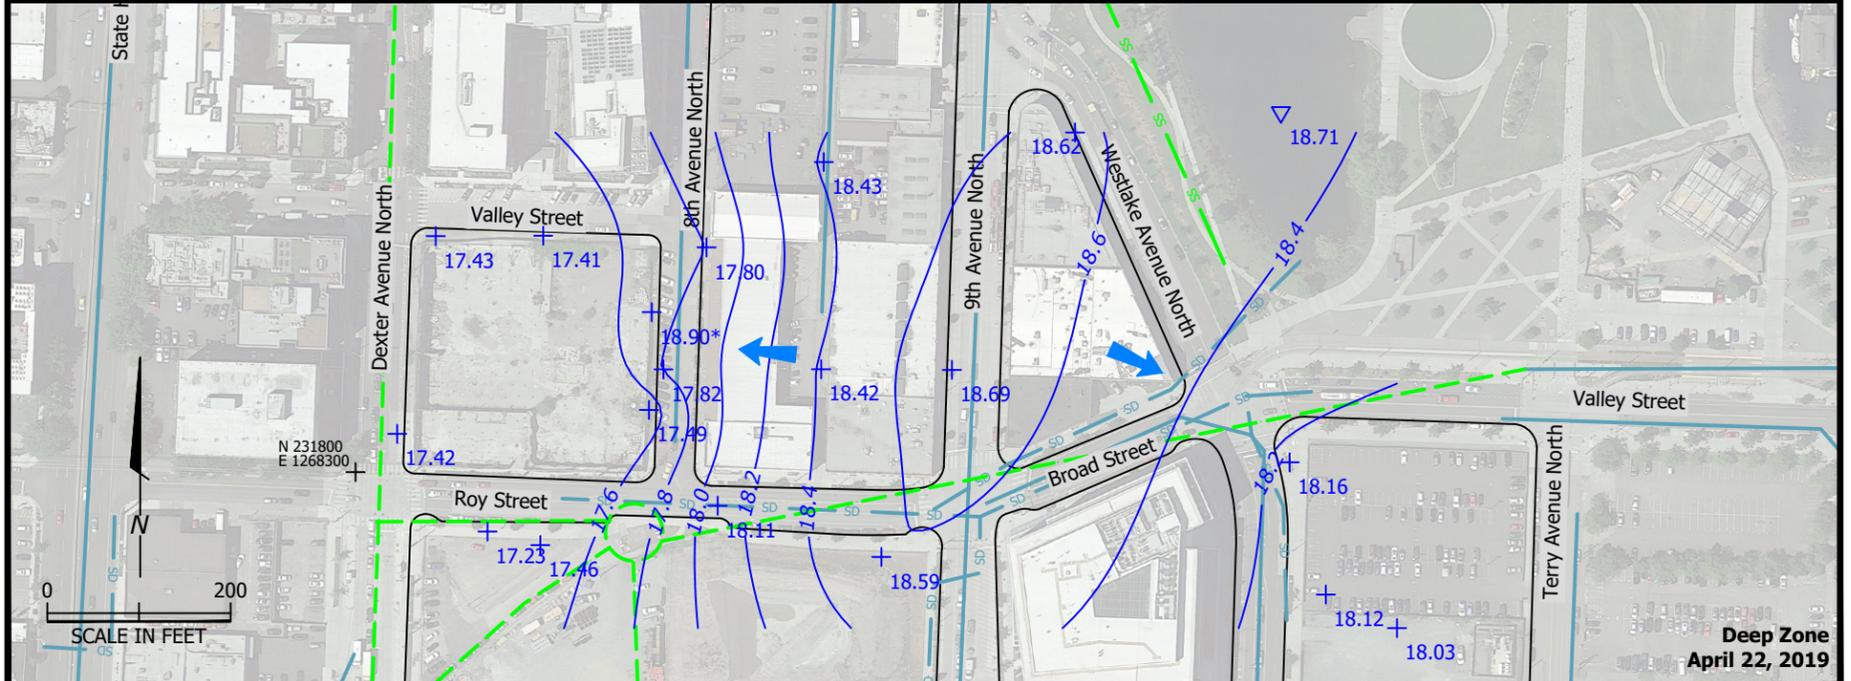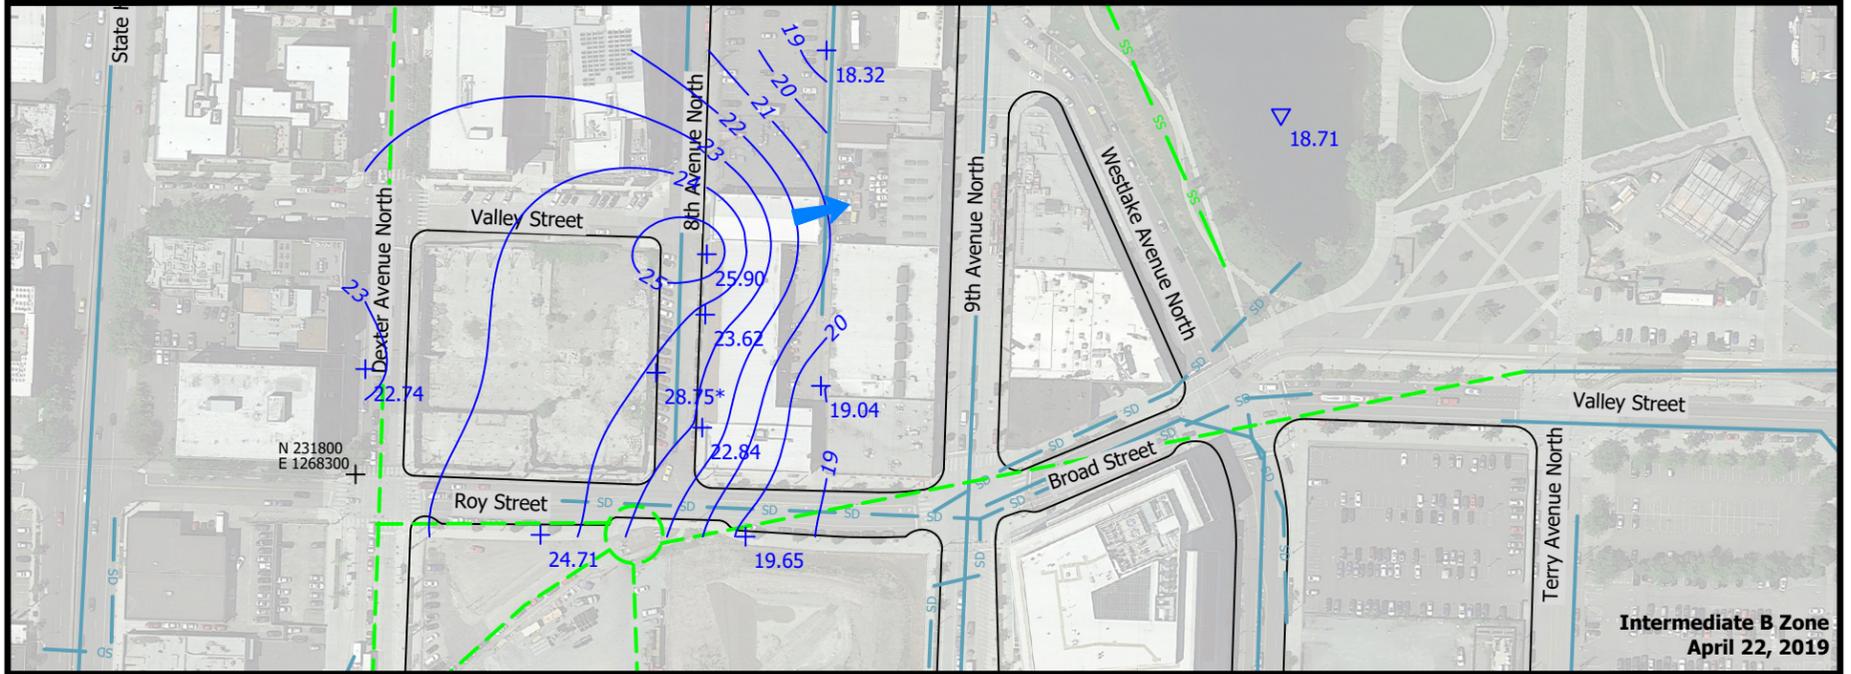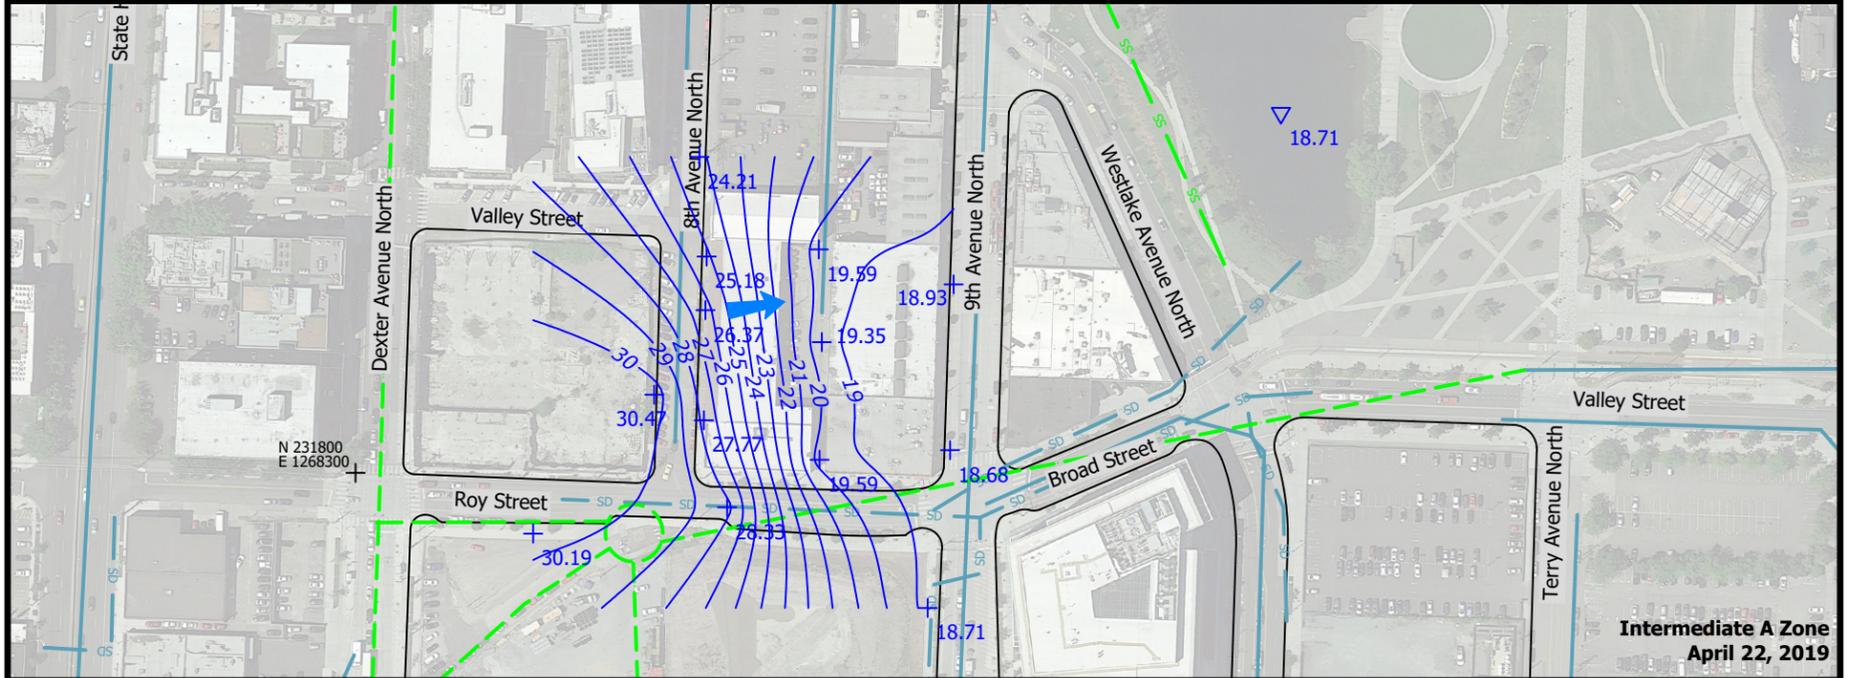

**Groundwater Elevation Contours  
April 22, 2019 (No Dewatering in Area)**  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North  
Seattle, Washington


FIGURE  
**F-6**

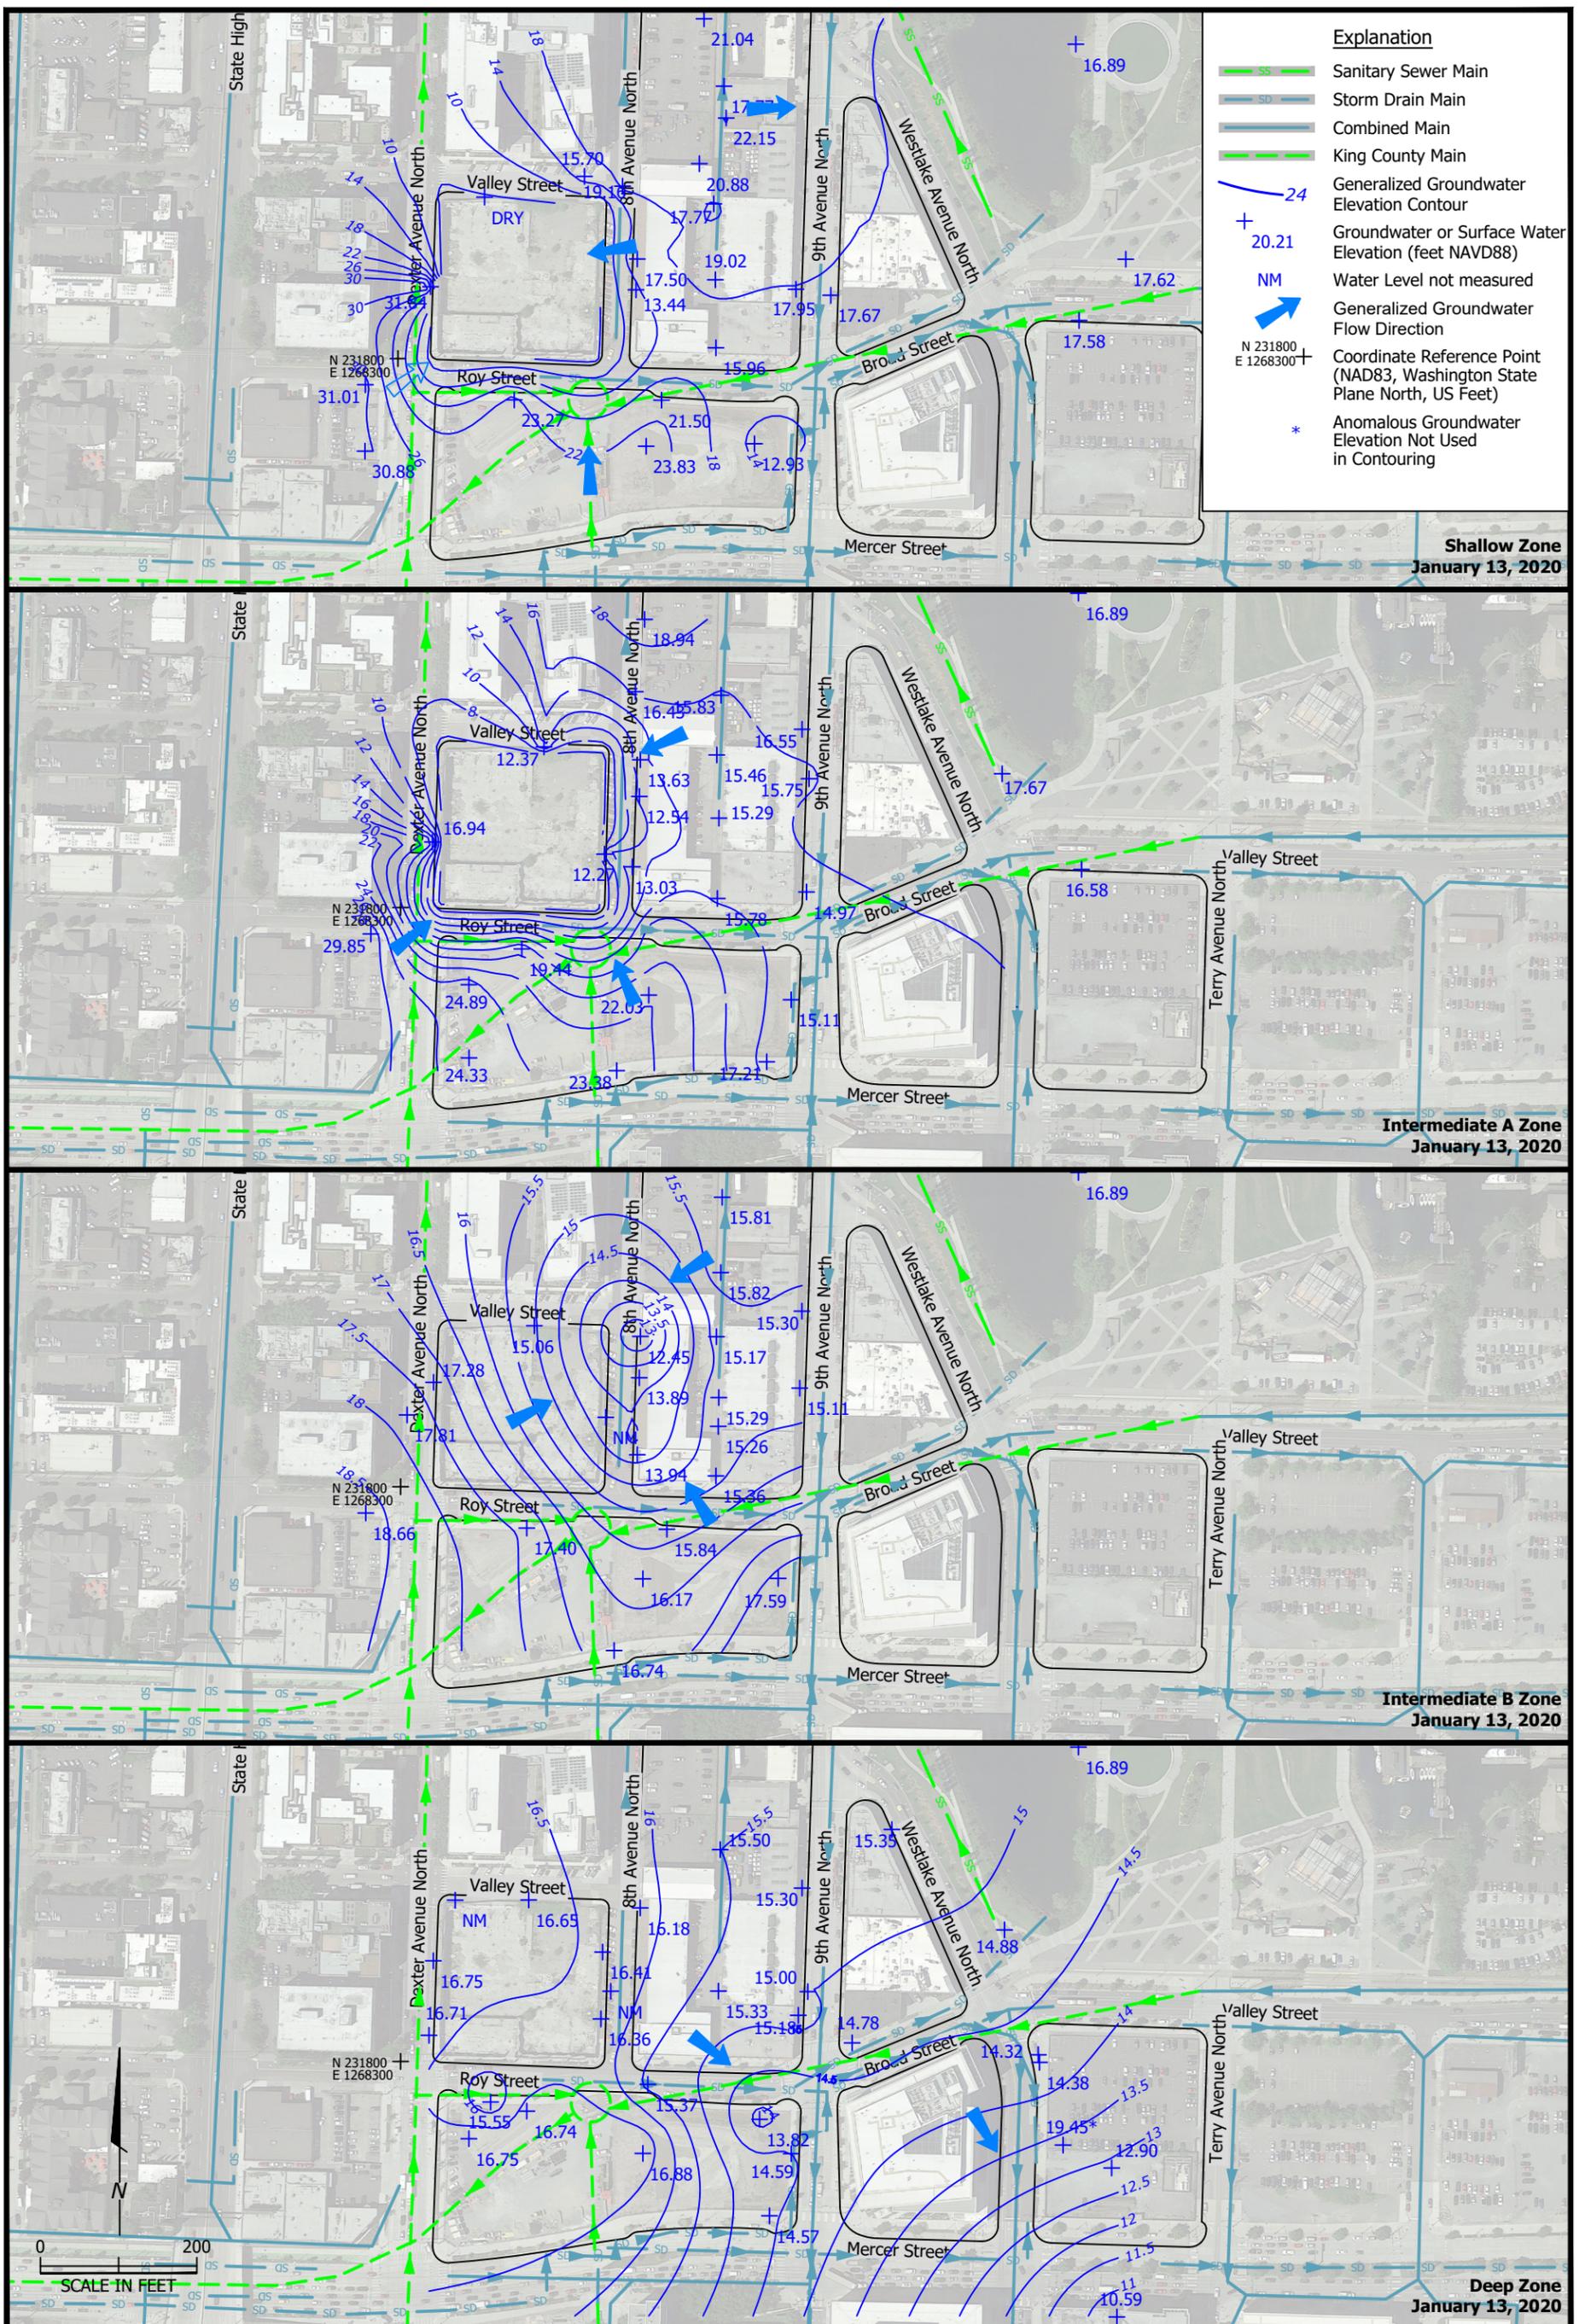

**Groundwater Elevation Contours**  
**January 13, 2020 (Dewatering in Area)**  
 American Linen Supply Co Dexter Ave Site  
 700 Dexter Avenue North  
 Seattle, Washington

FIGURE


**F-7**

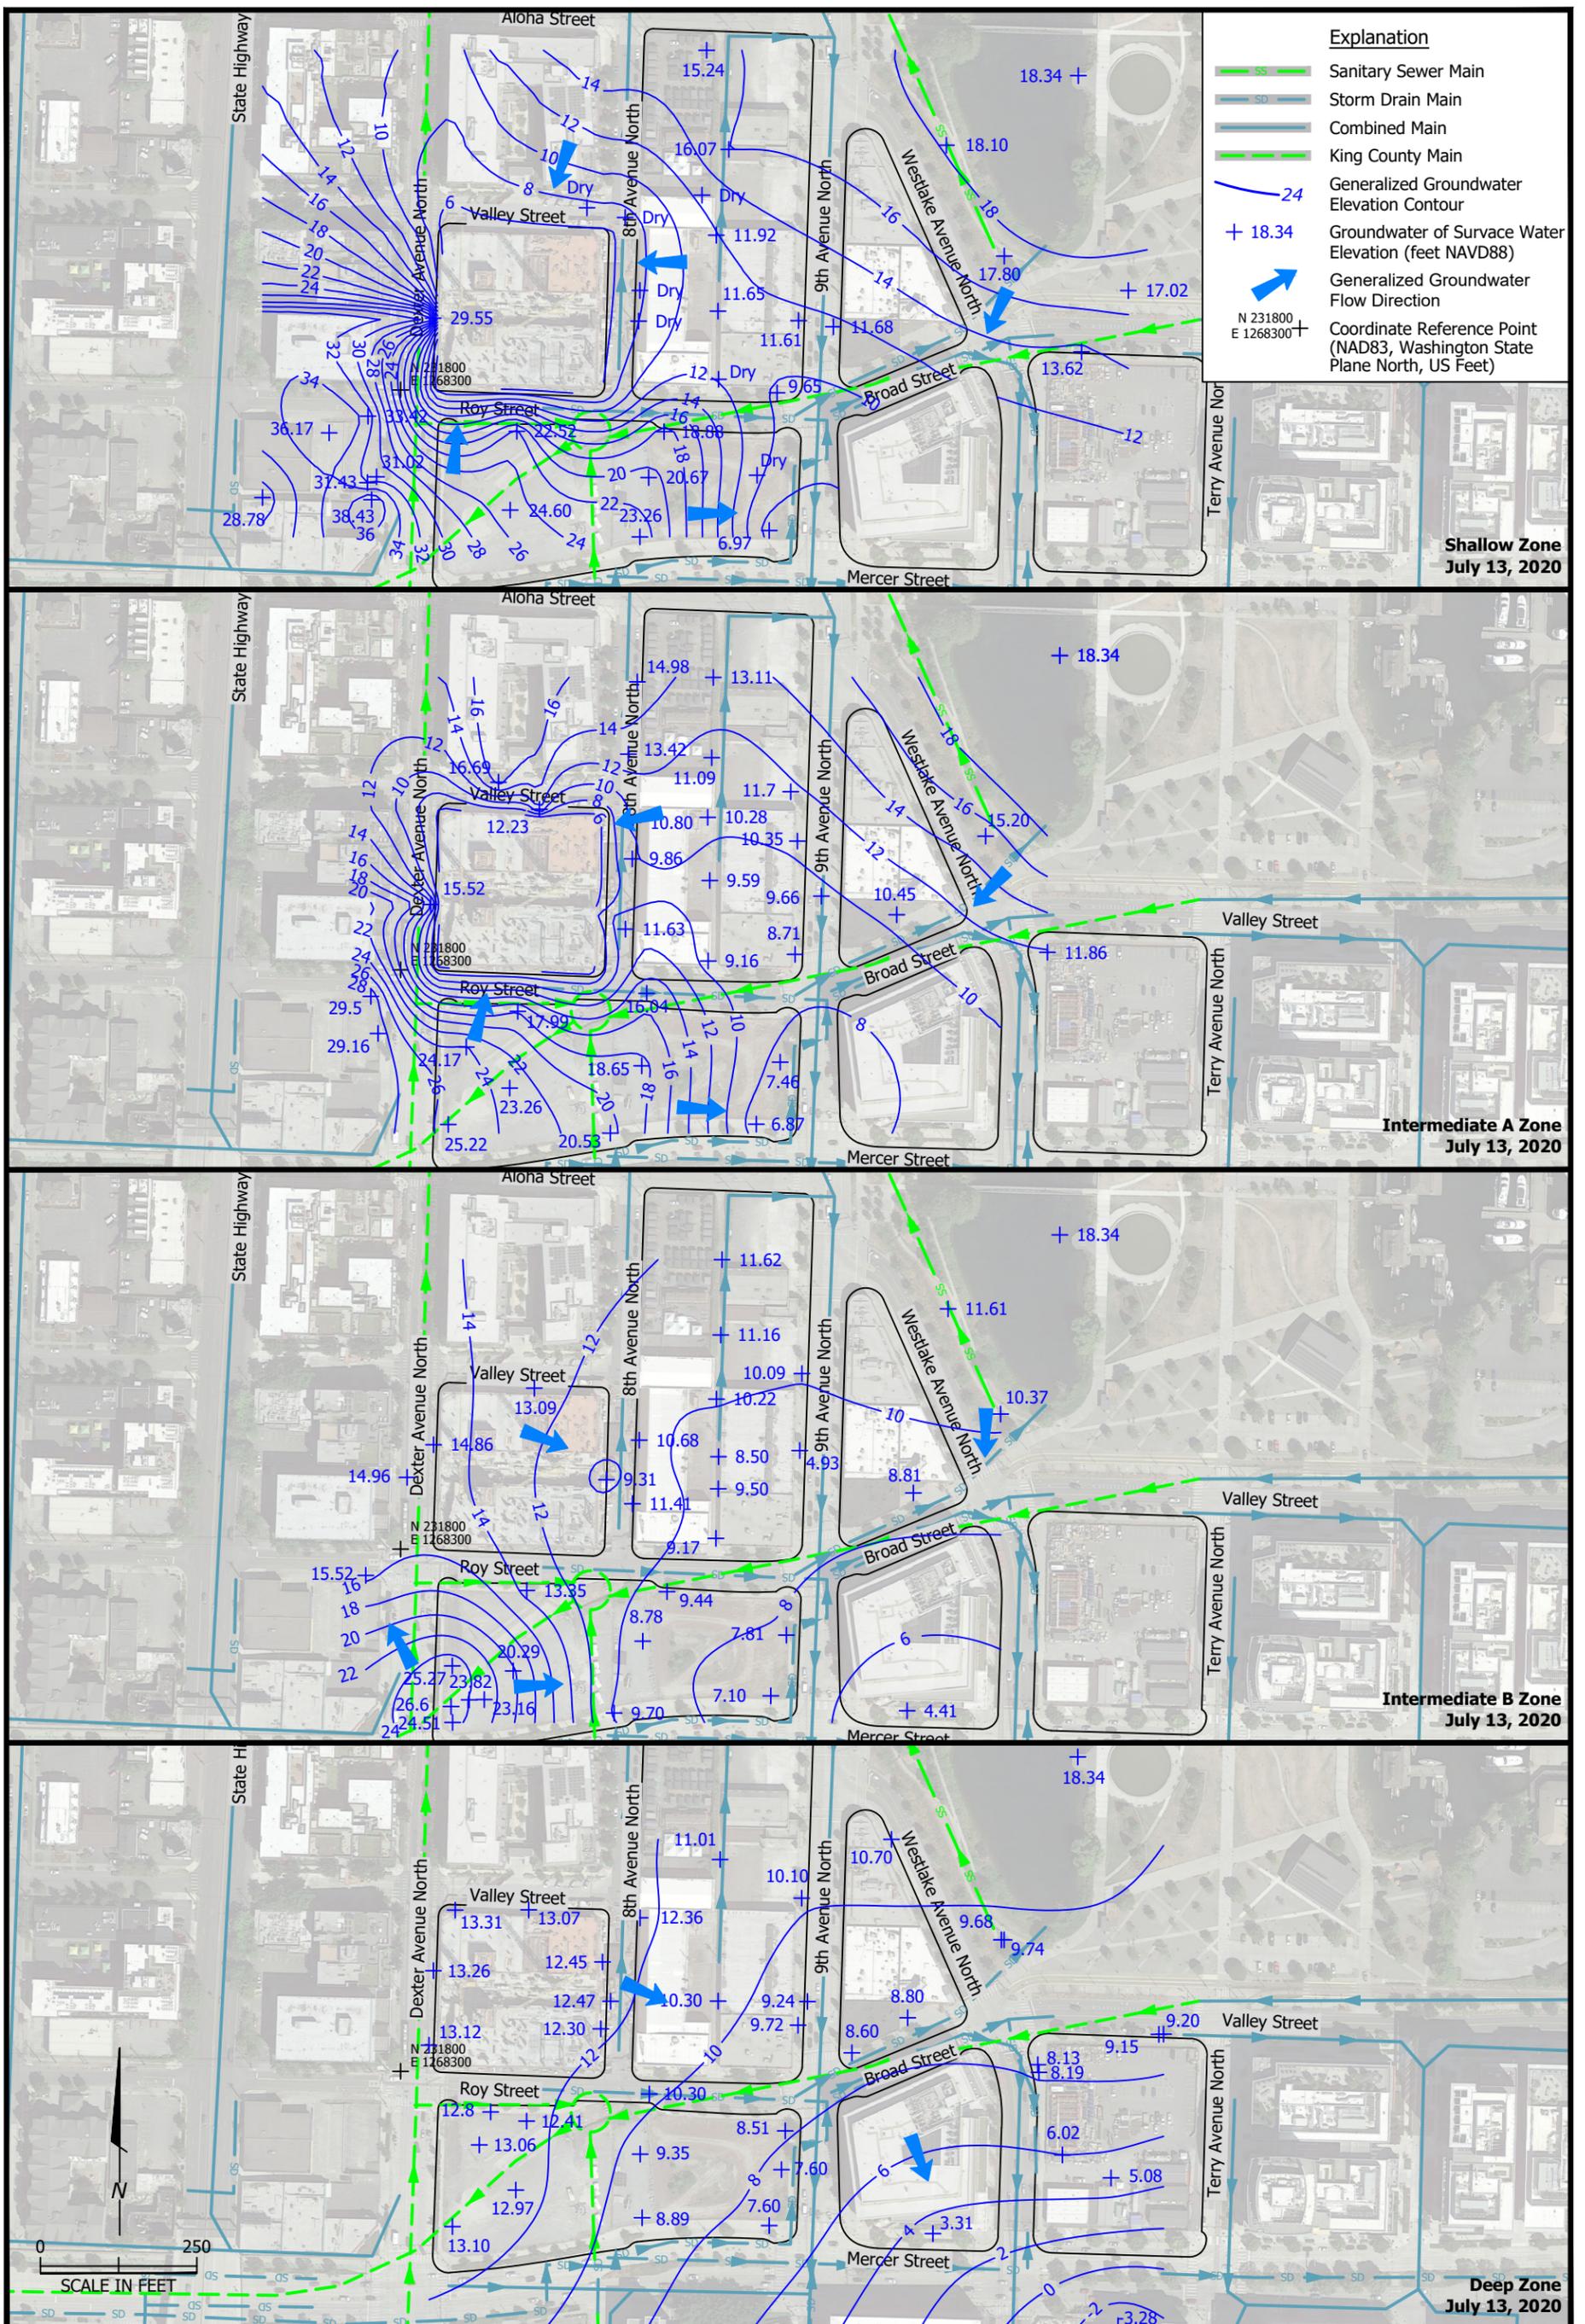

**Groundwater Elevation Contours  
July 13, 2020 (Dewatering in Area)**  
Former American Linen Supply  
700 Dexter Avenue North  
Seattle, Washington

FIGURE


**F-8**

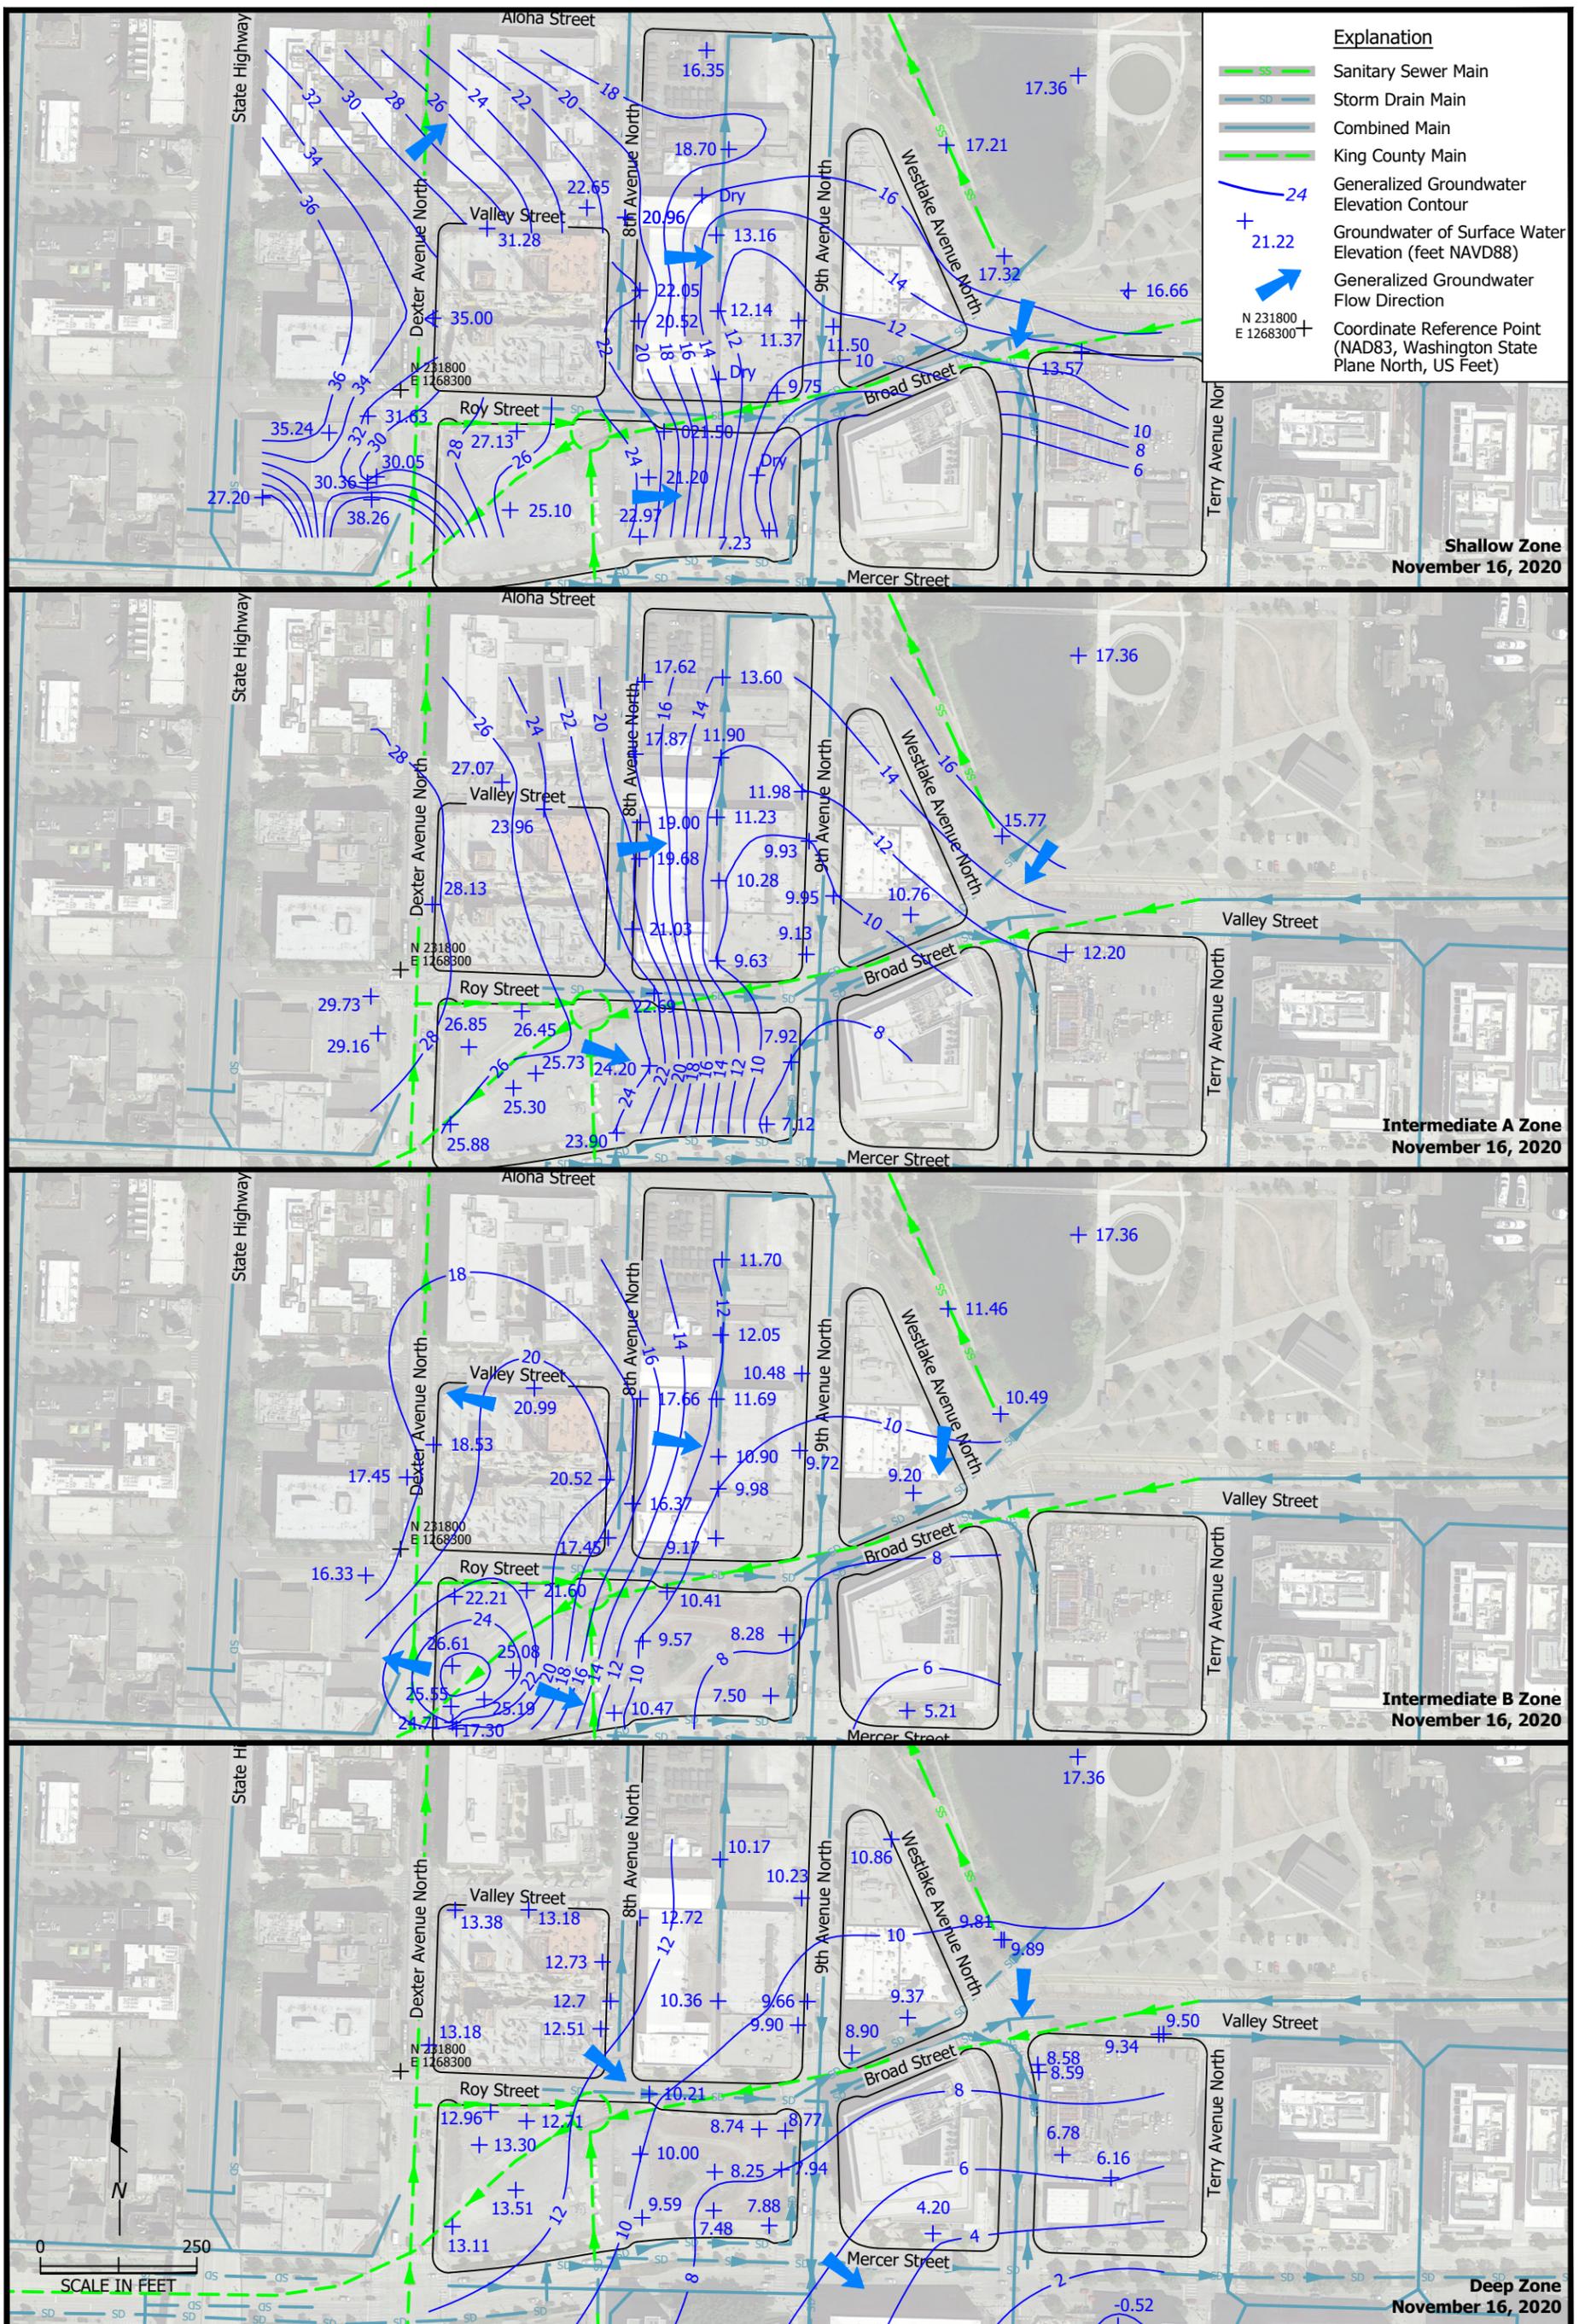

**Groundwater Elevation Contours**  
**November 16, 2020 (Dewatering in Area)**  
 American Linen Supply Co Dexter Ave Site  
 700 Dexter Avenue North  
 Seattle, Washington

FIGURE


**F-9**

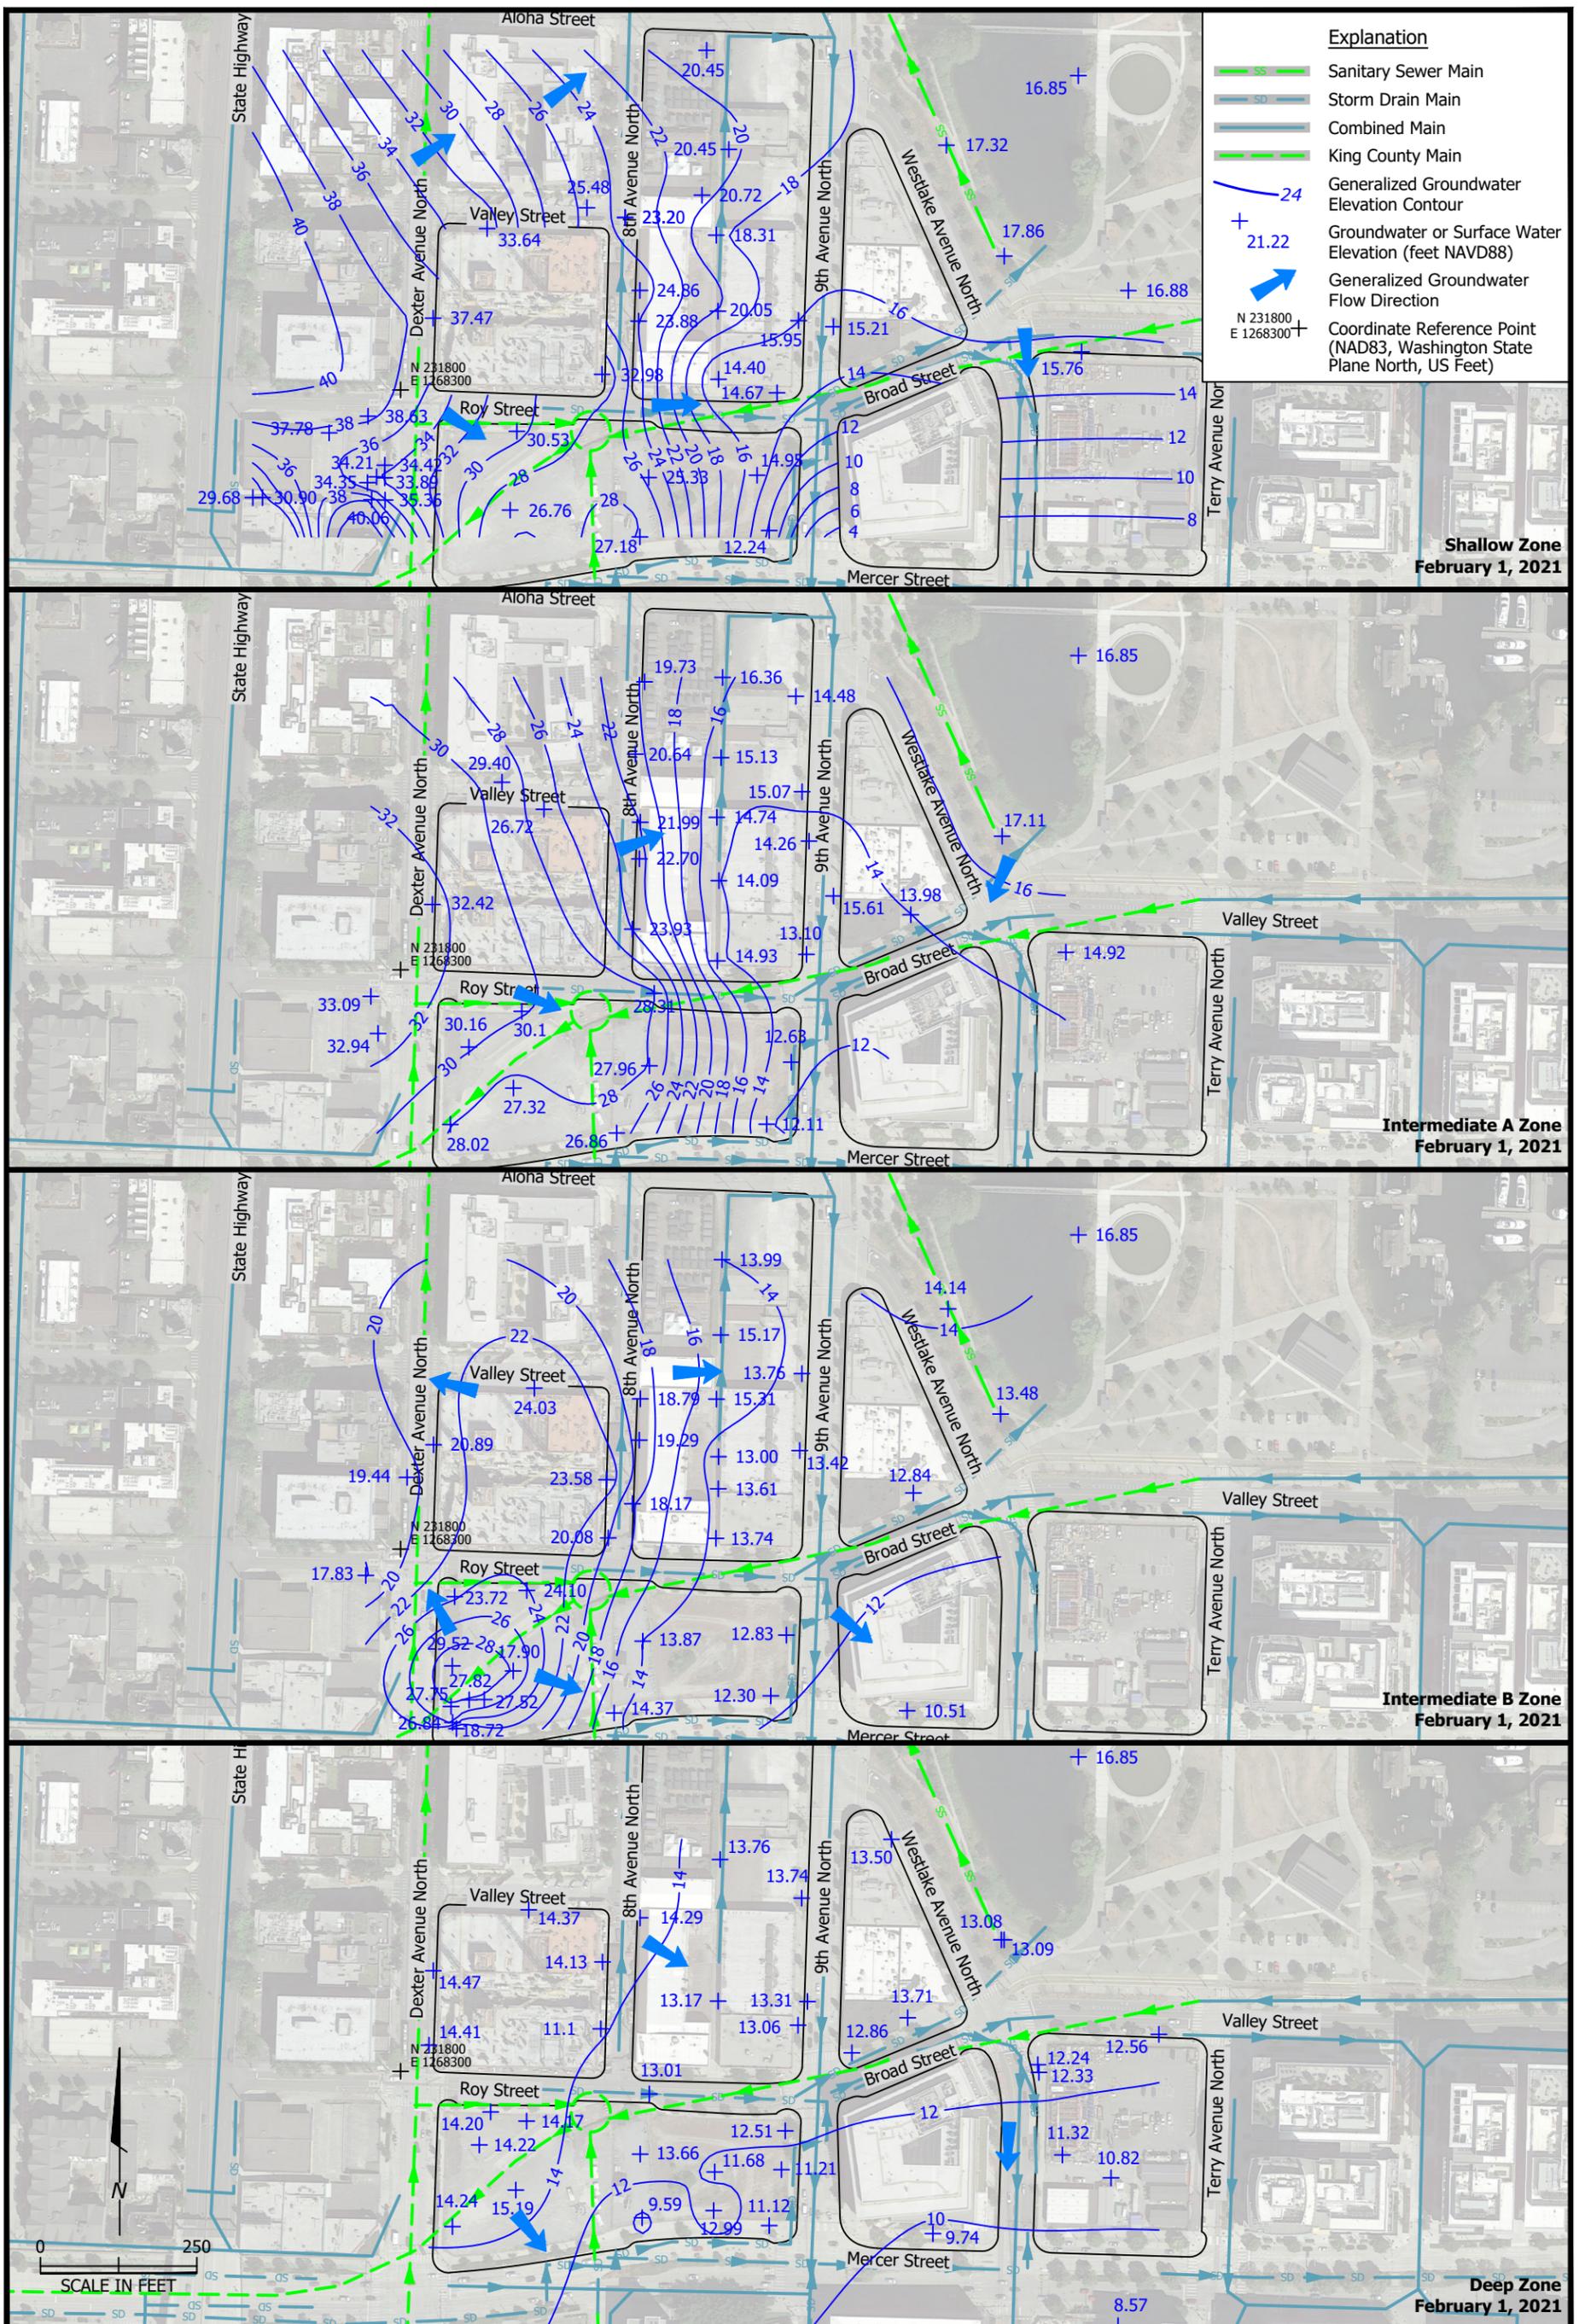

**Groundwater Elevation Contours**  
**February 1, 2021 (Dewatering in Area)**  
 American Linen Supply Co Dexter Ave Site  
 700 Dexter Avenue North  
 Seattle, Washington

FIGURE

**F-10**

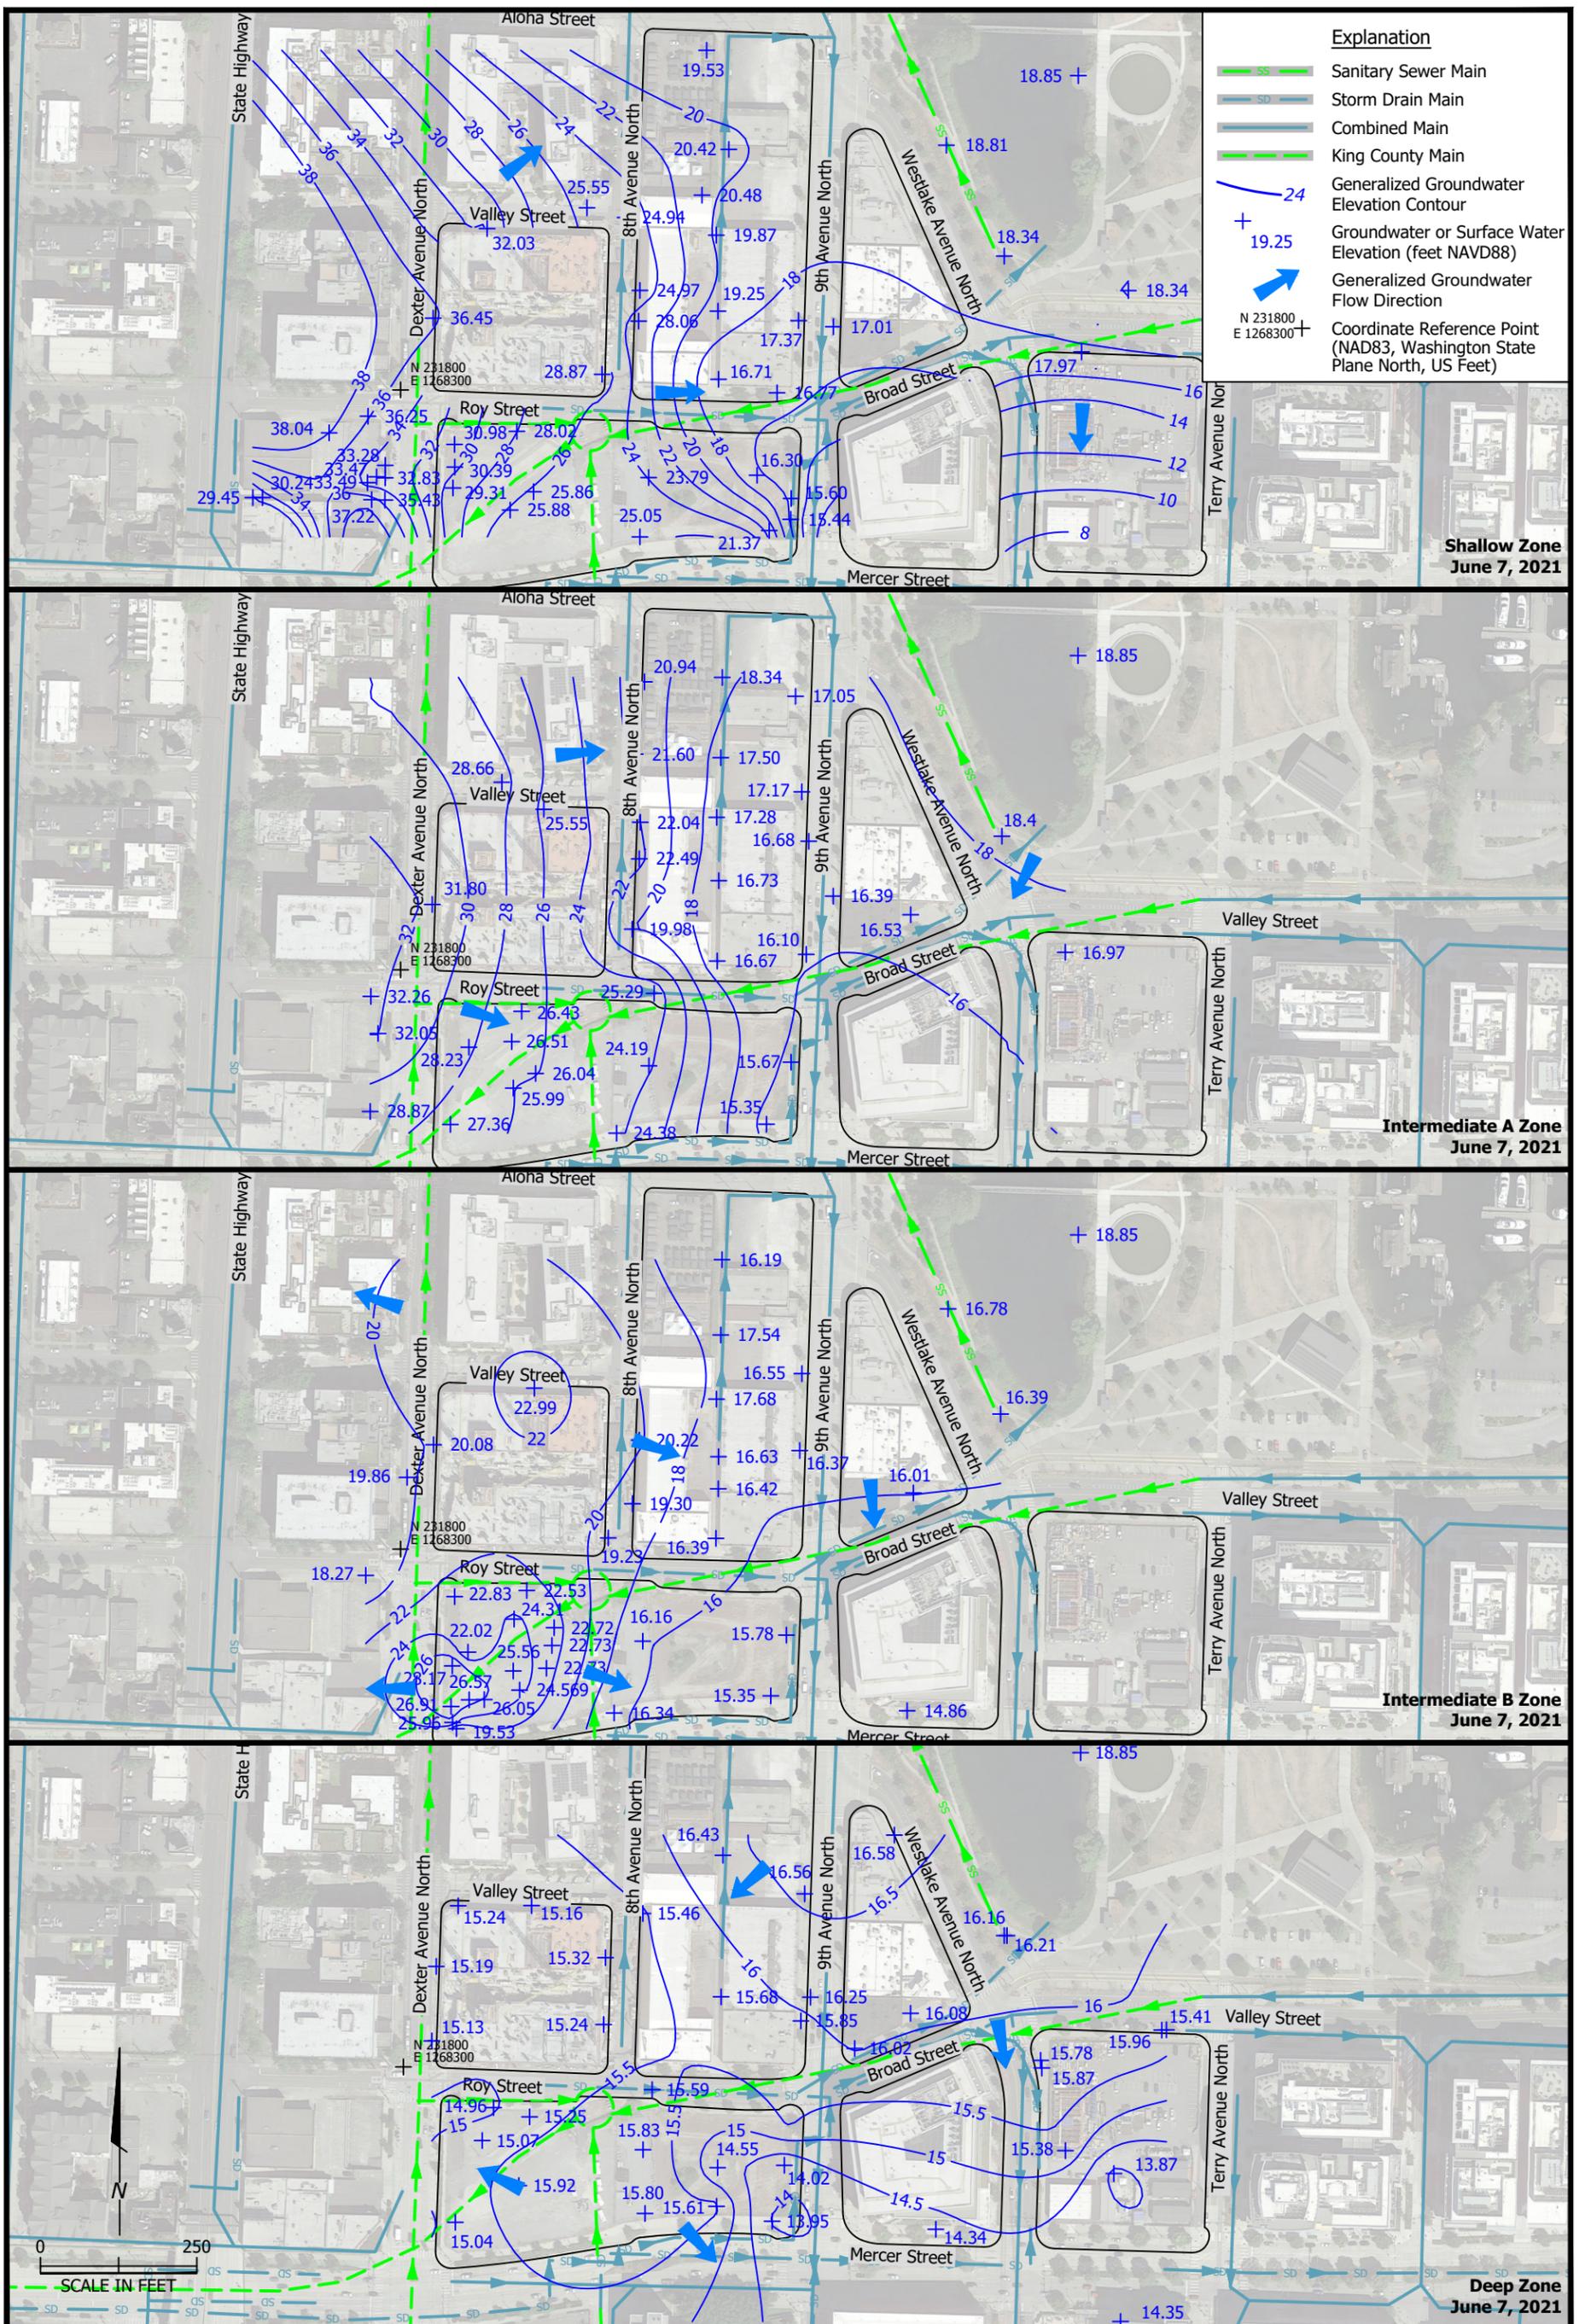

**Groundwater Elevation Contours  
June 7, 2021 (Dewatering in Area)**  
American Linen Supply Co Dexter Ave Site  
700 Dexter Avenue North  
Seattle, Washington


FIGURE

**F-11**

# Hydrograph

## Lake Washington and Lake Union


### American Linen Supply Co Dexter Ave Site

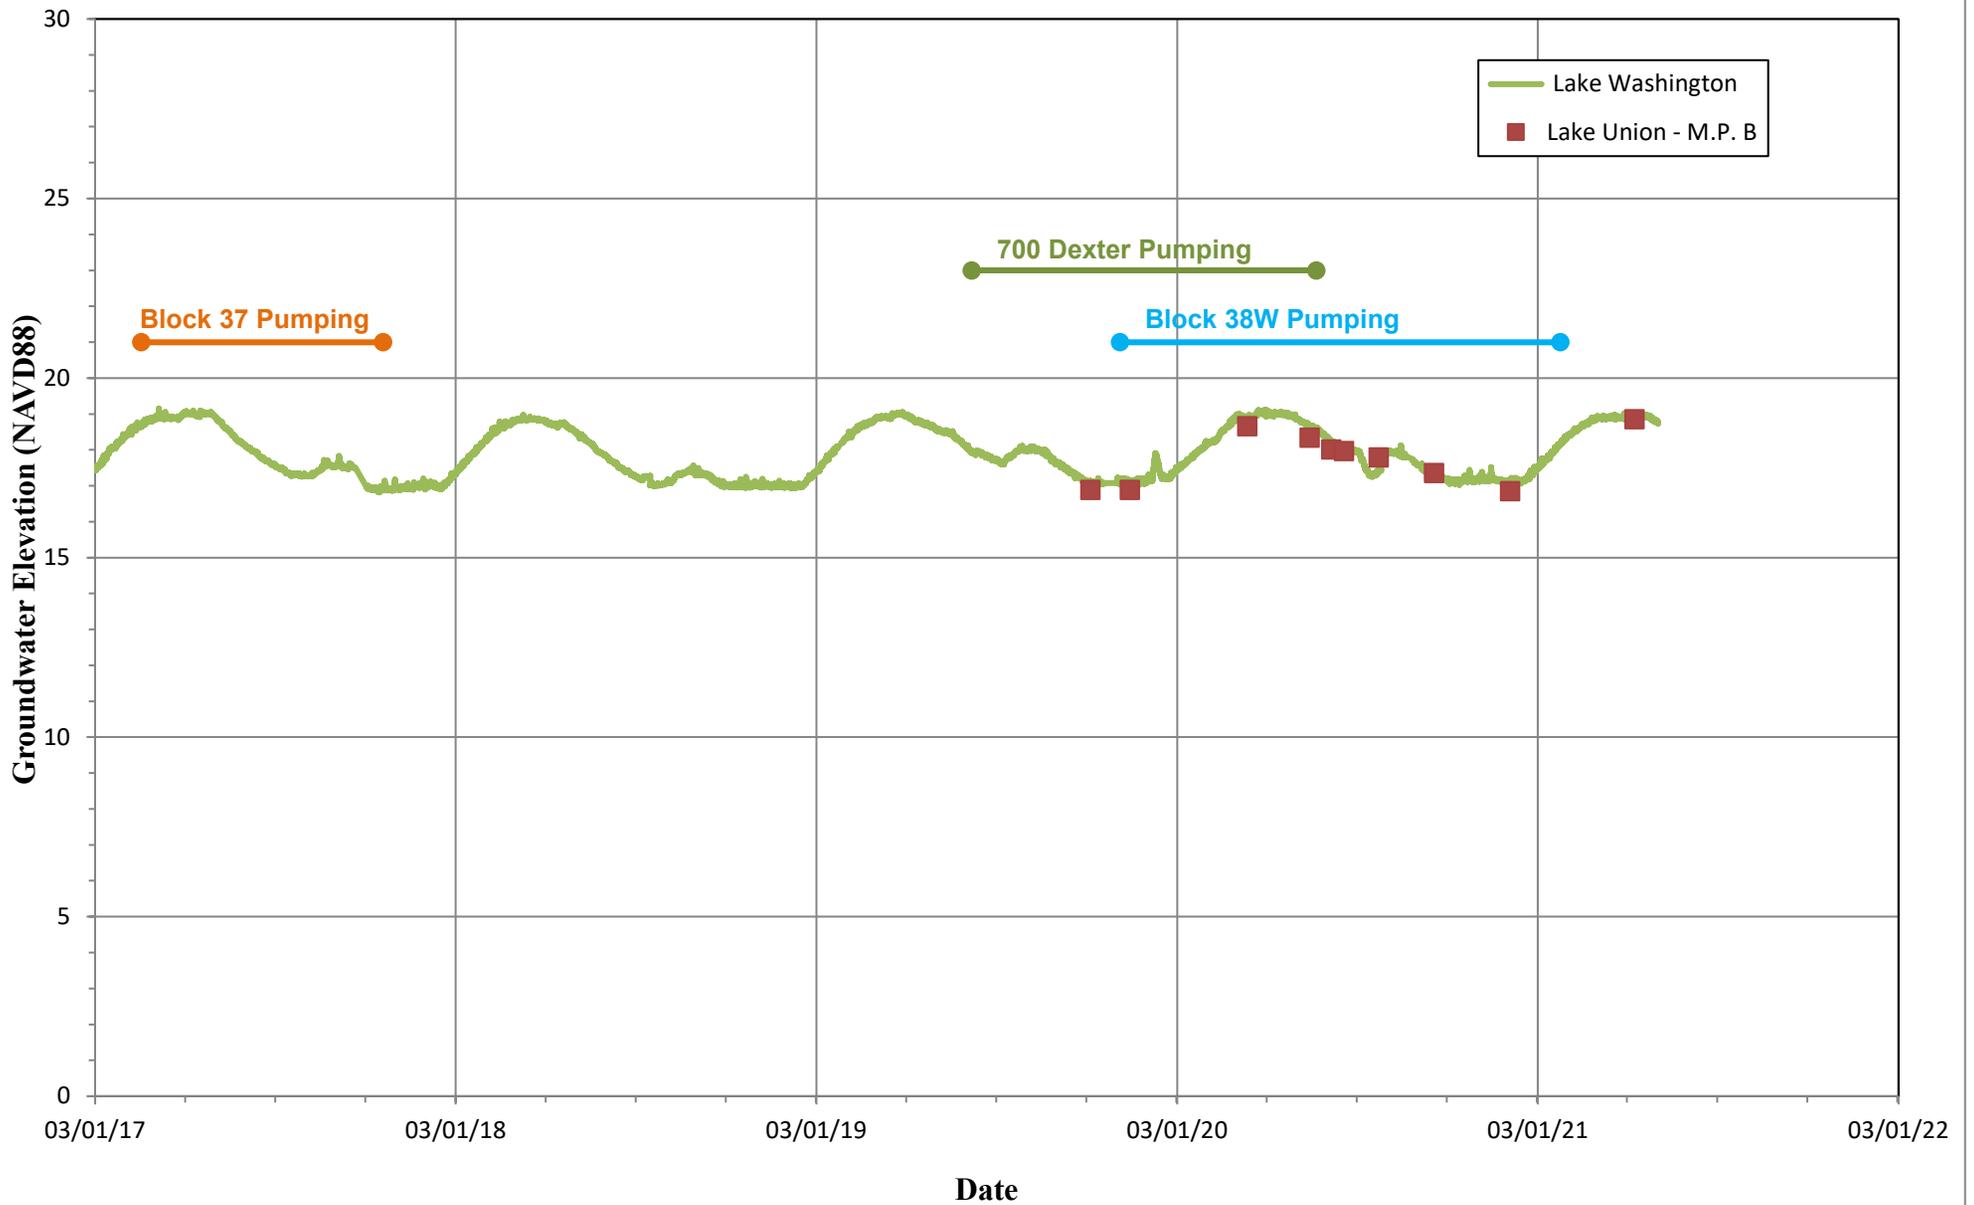

# Hydrographs

## MW123, MW128, MW-328, Lake Washington


### American Linen Supply Co Dexter Ave Site

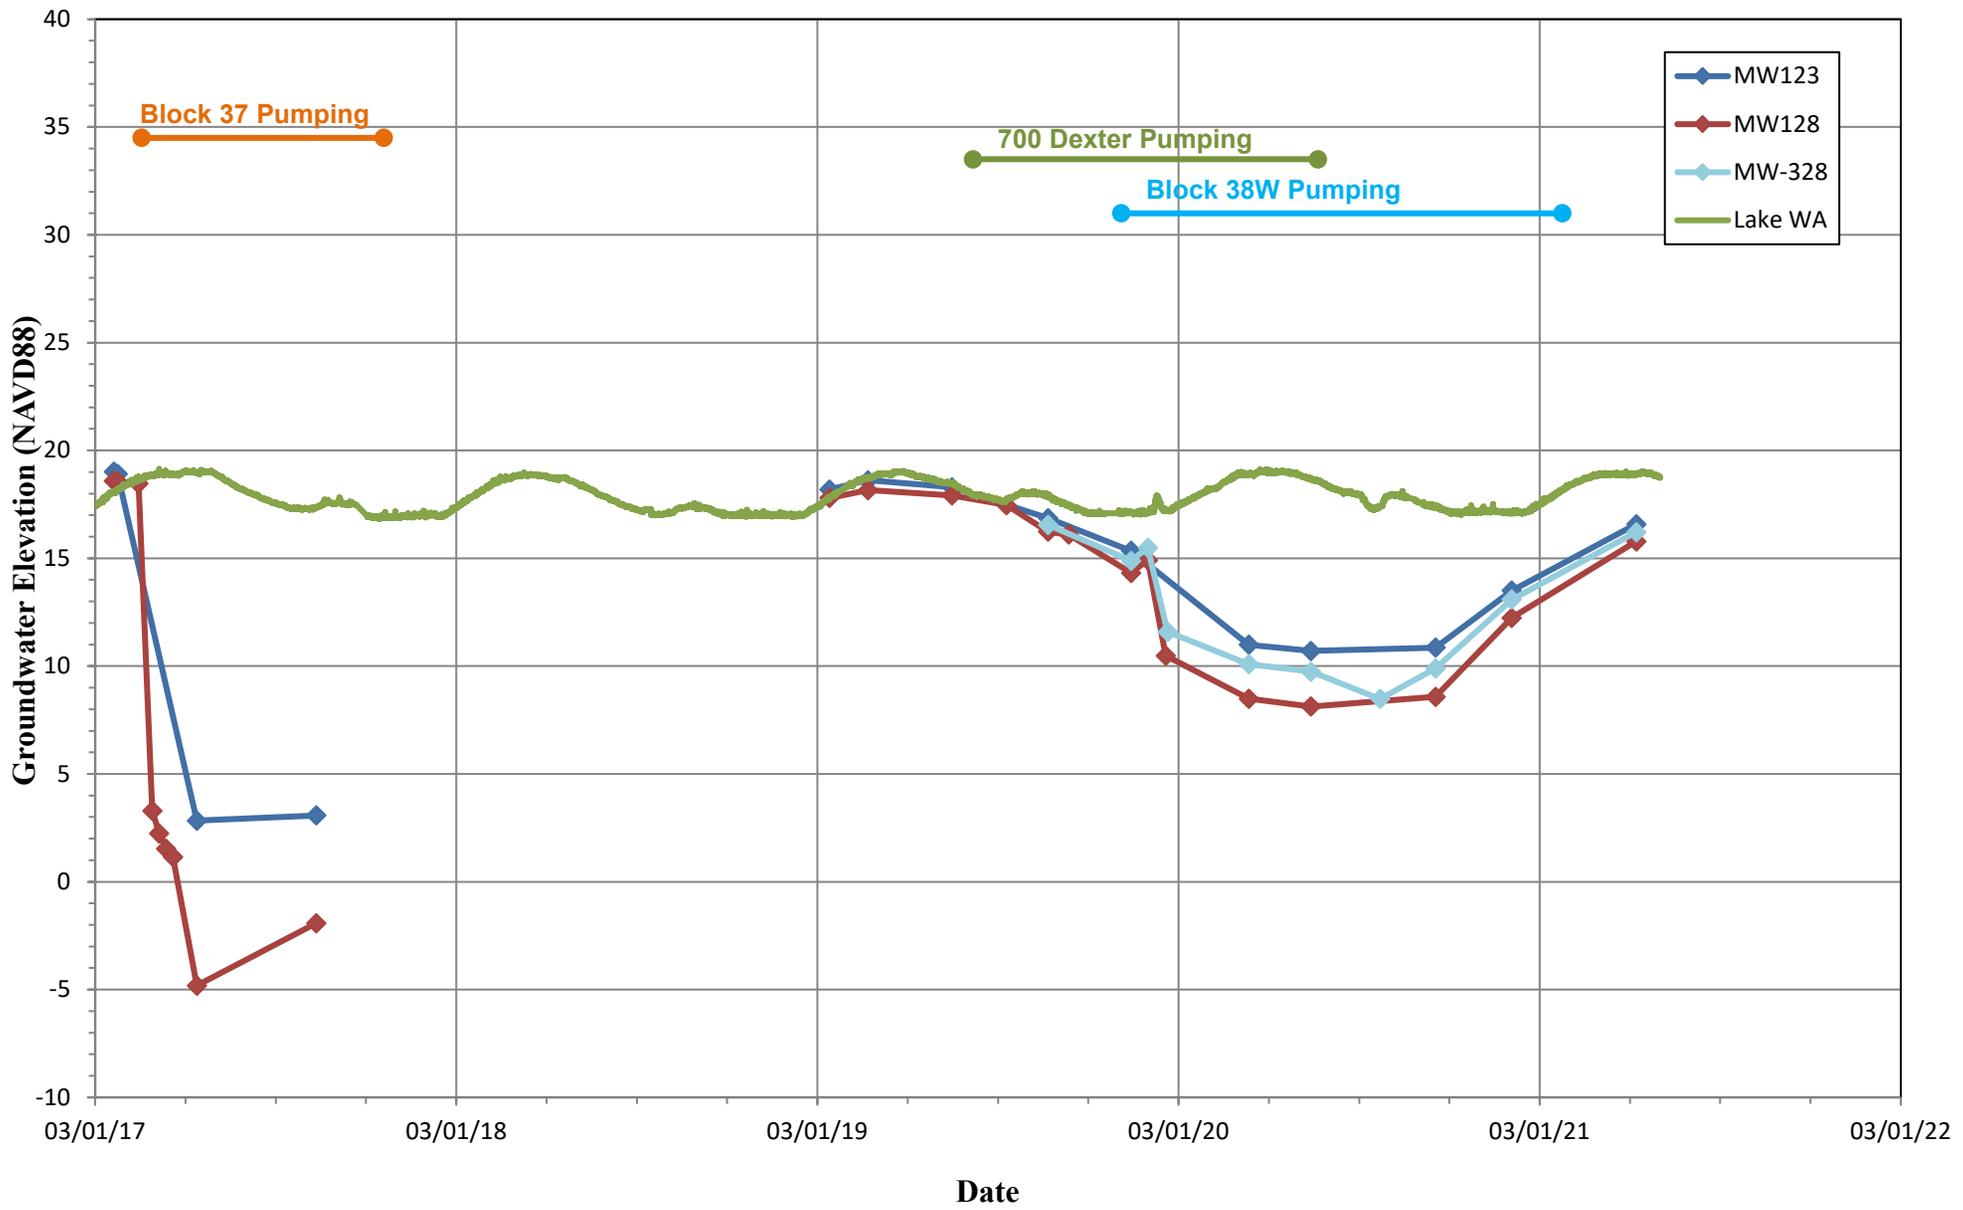

# Hydrographs

## 9th Avenue North


### American Linen Supply Co Dexter Ave Site

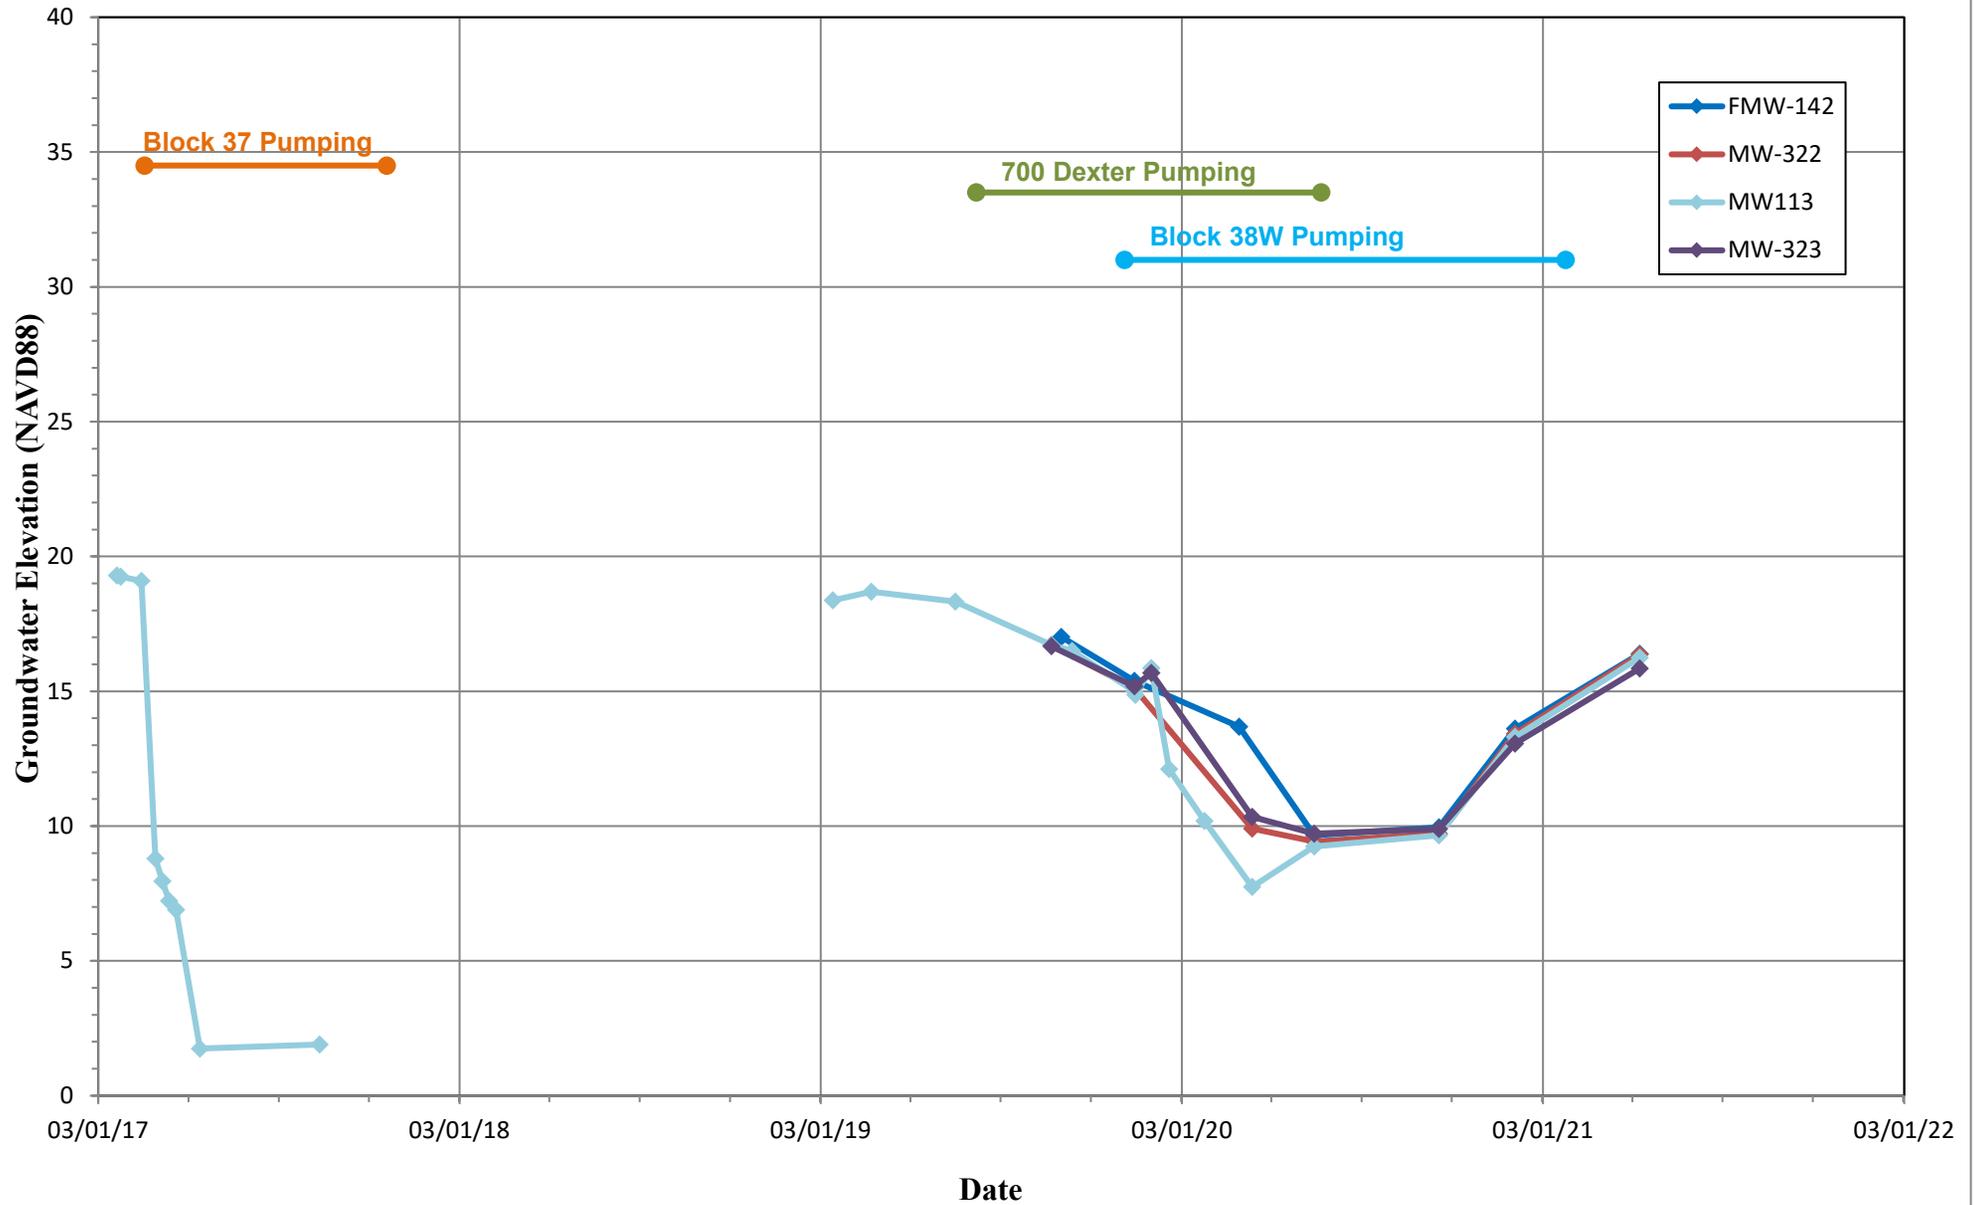

# Hydrographs


## 8th Avenue North

### American Linen Supply Co Dexter Ave Site

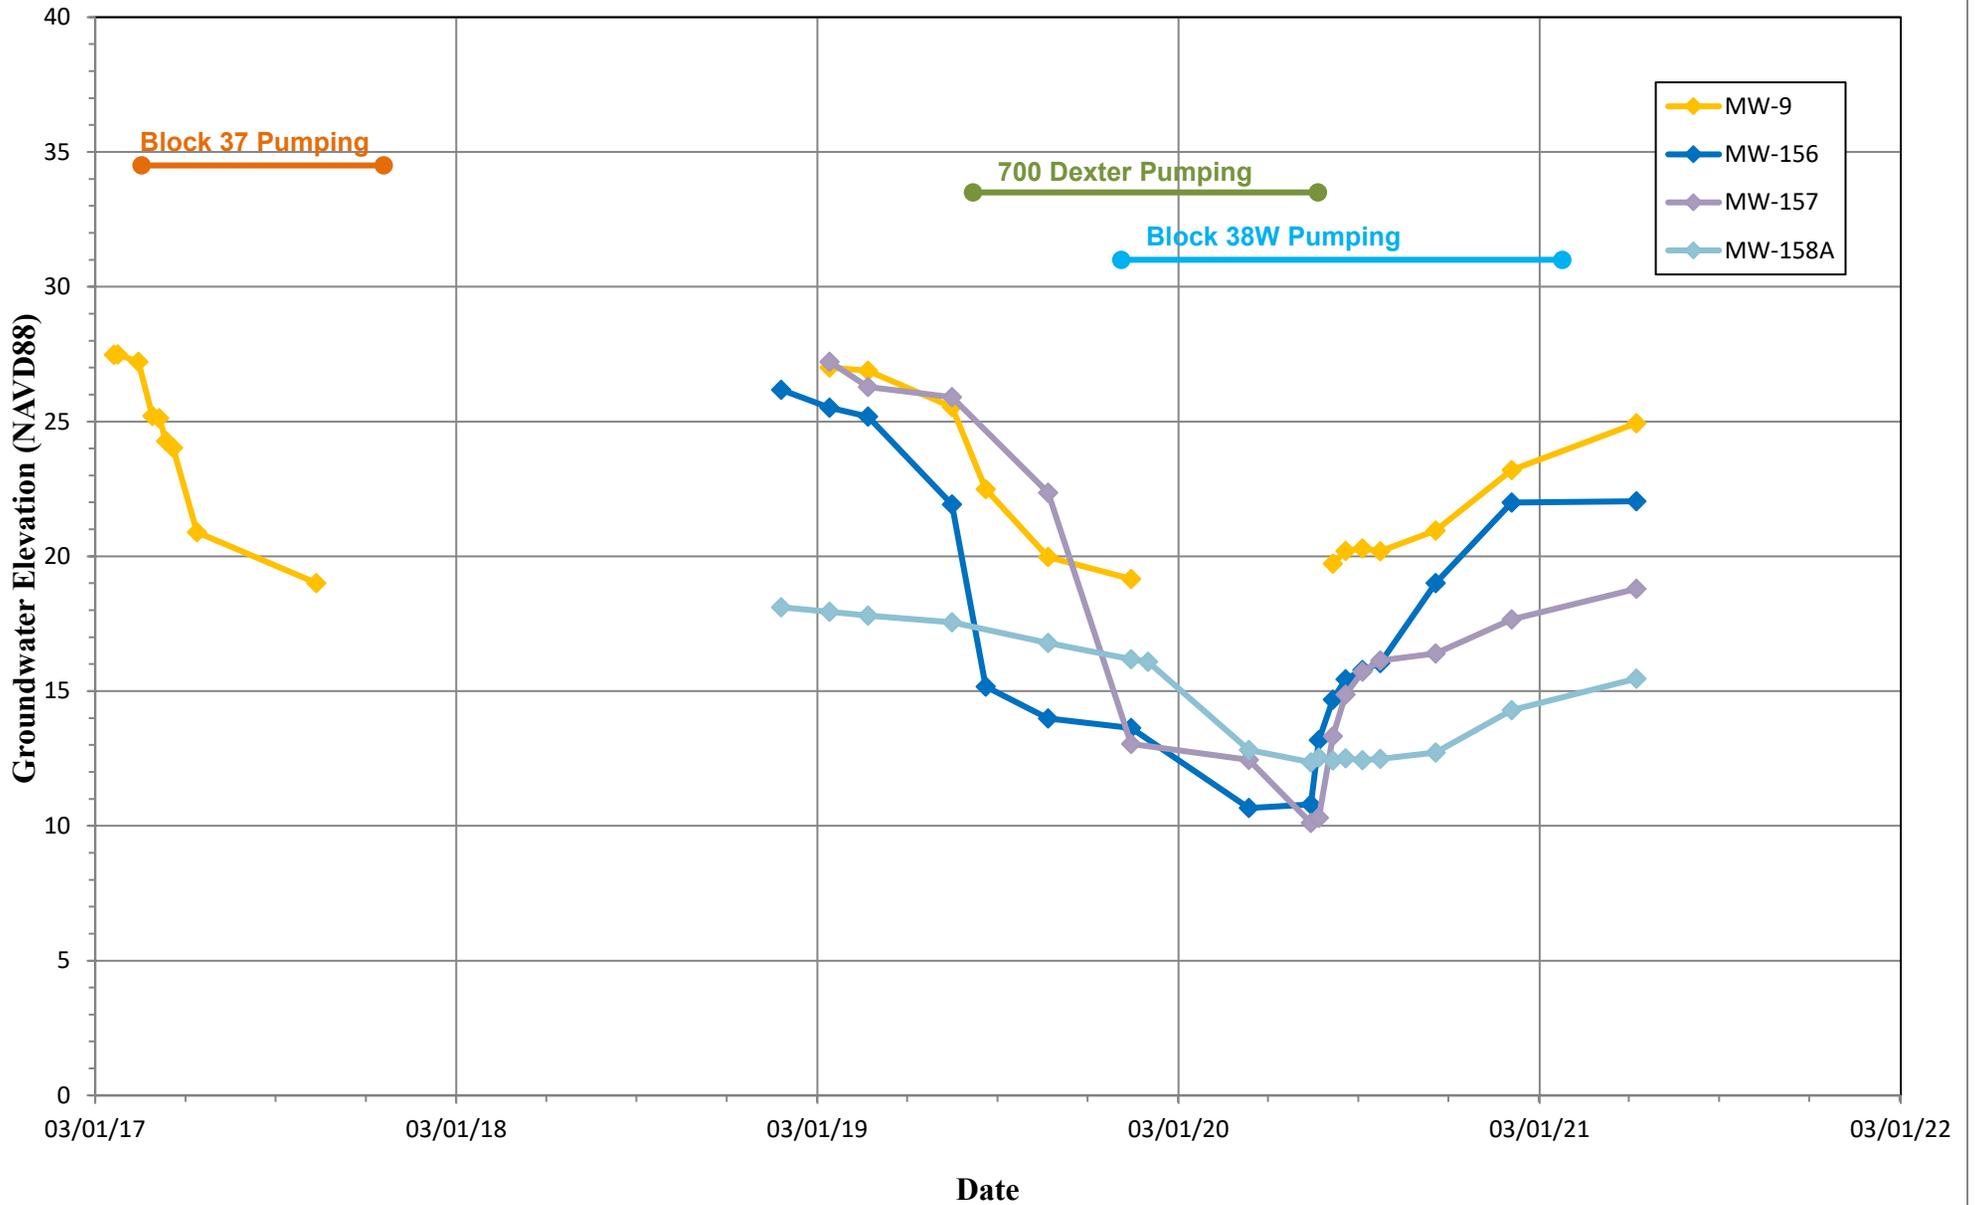


# Hydrograph


## MW-8, Seattle Roy Aloha Shops, N end American Linen Supply Co Dexter Ave Site

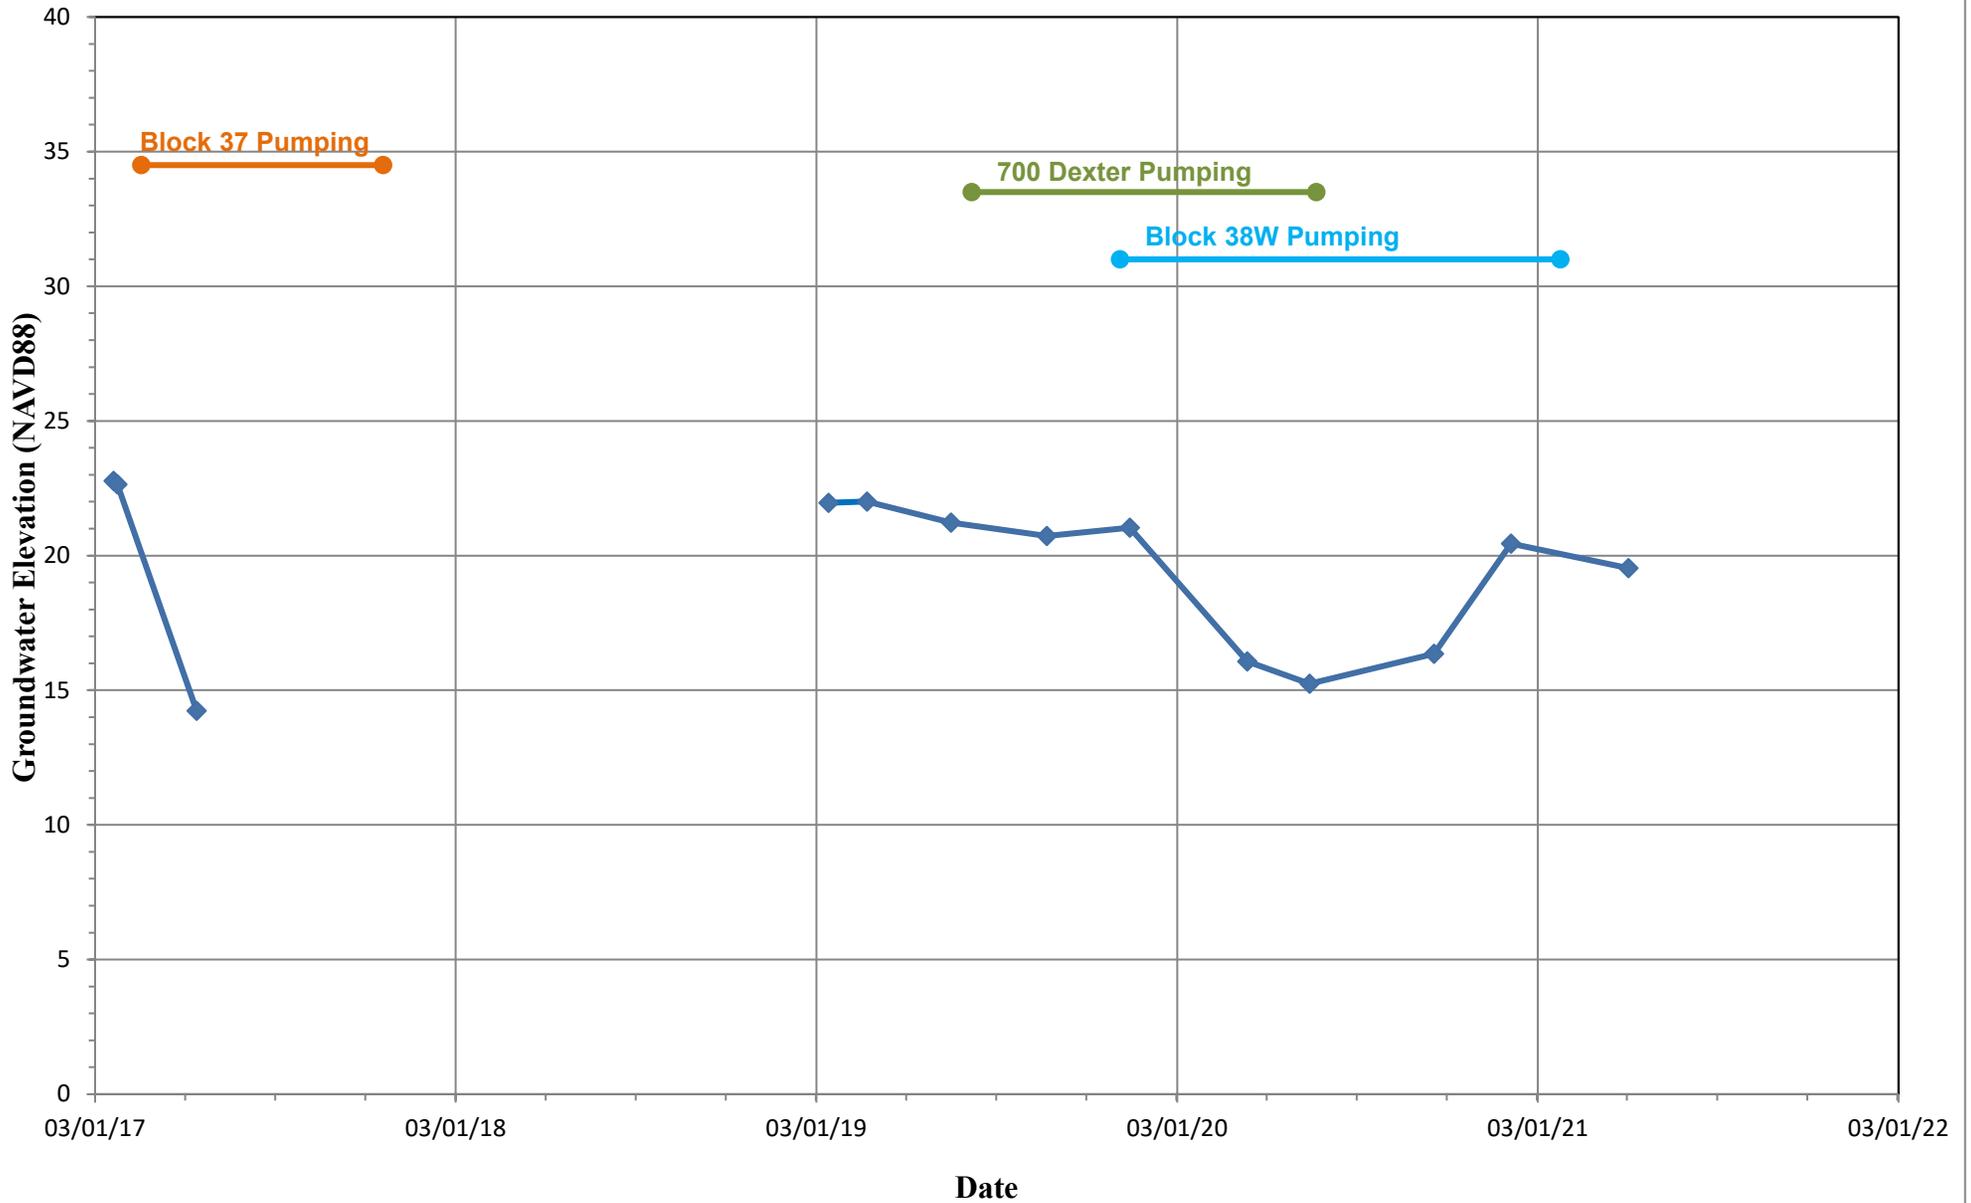


**Hydrograph**  
**MW-9, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

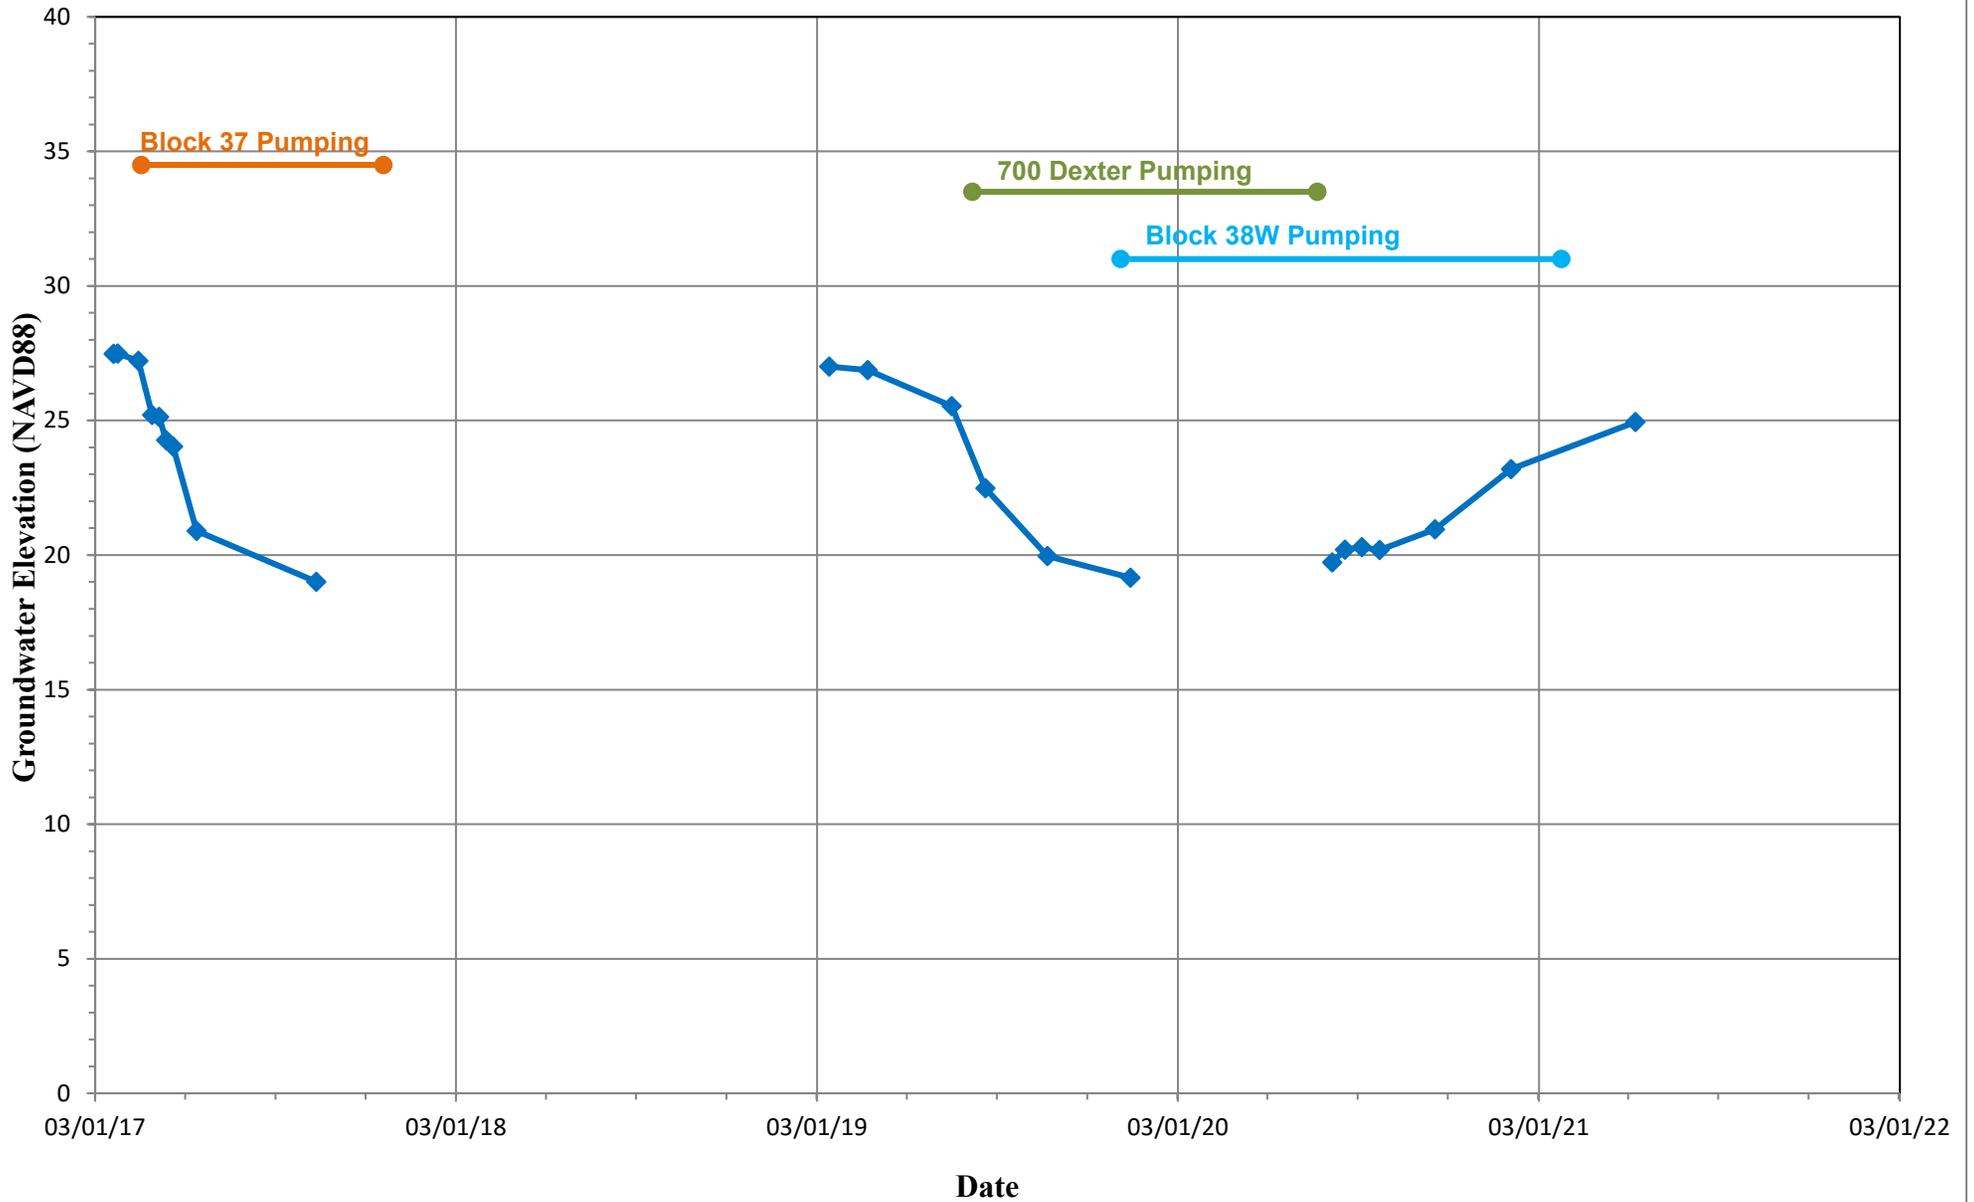

**Hydrograph**  
**MW121, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

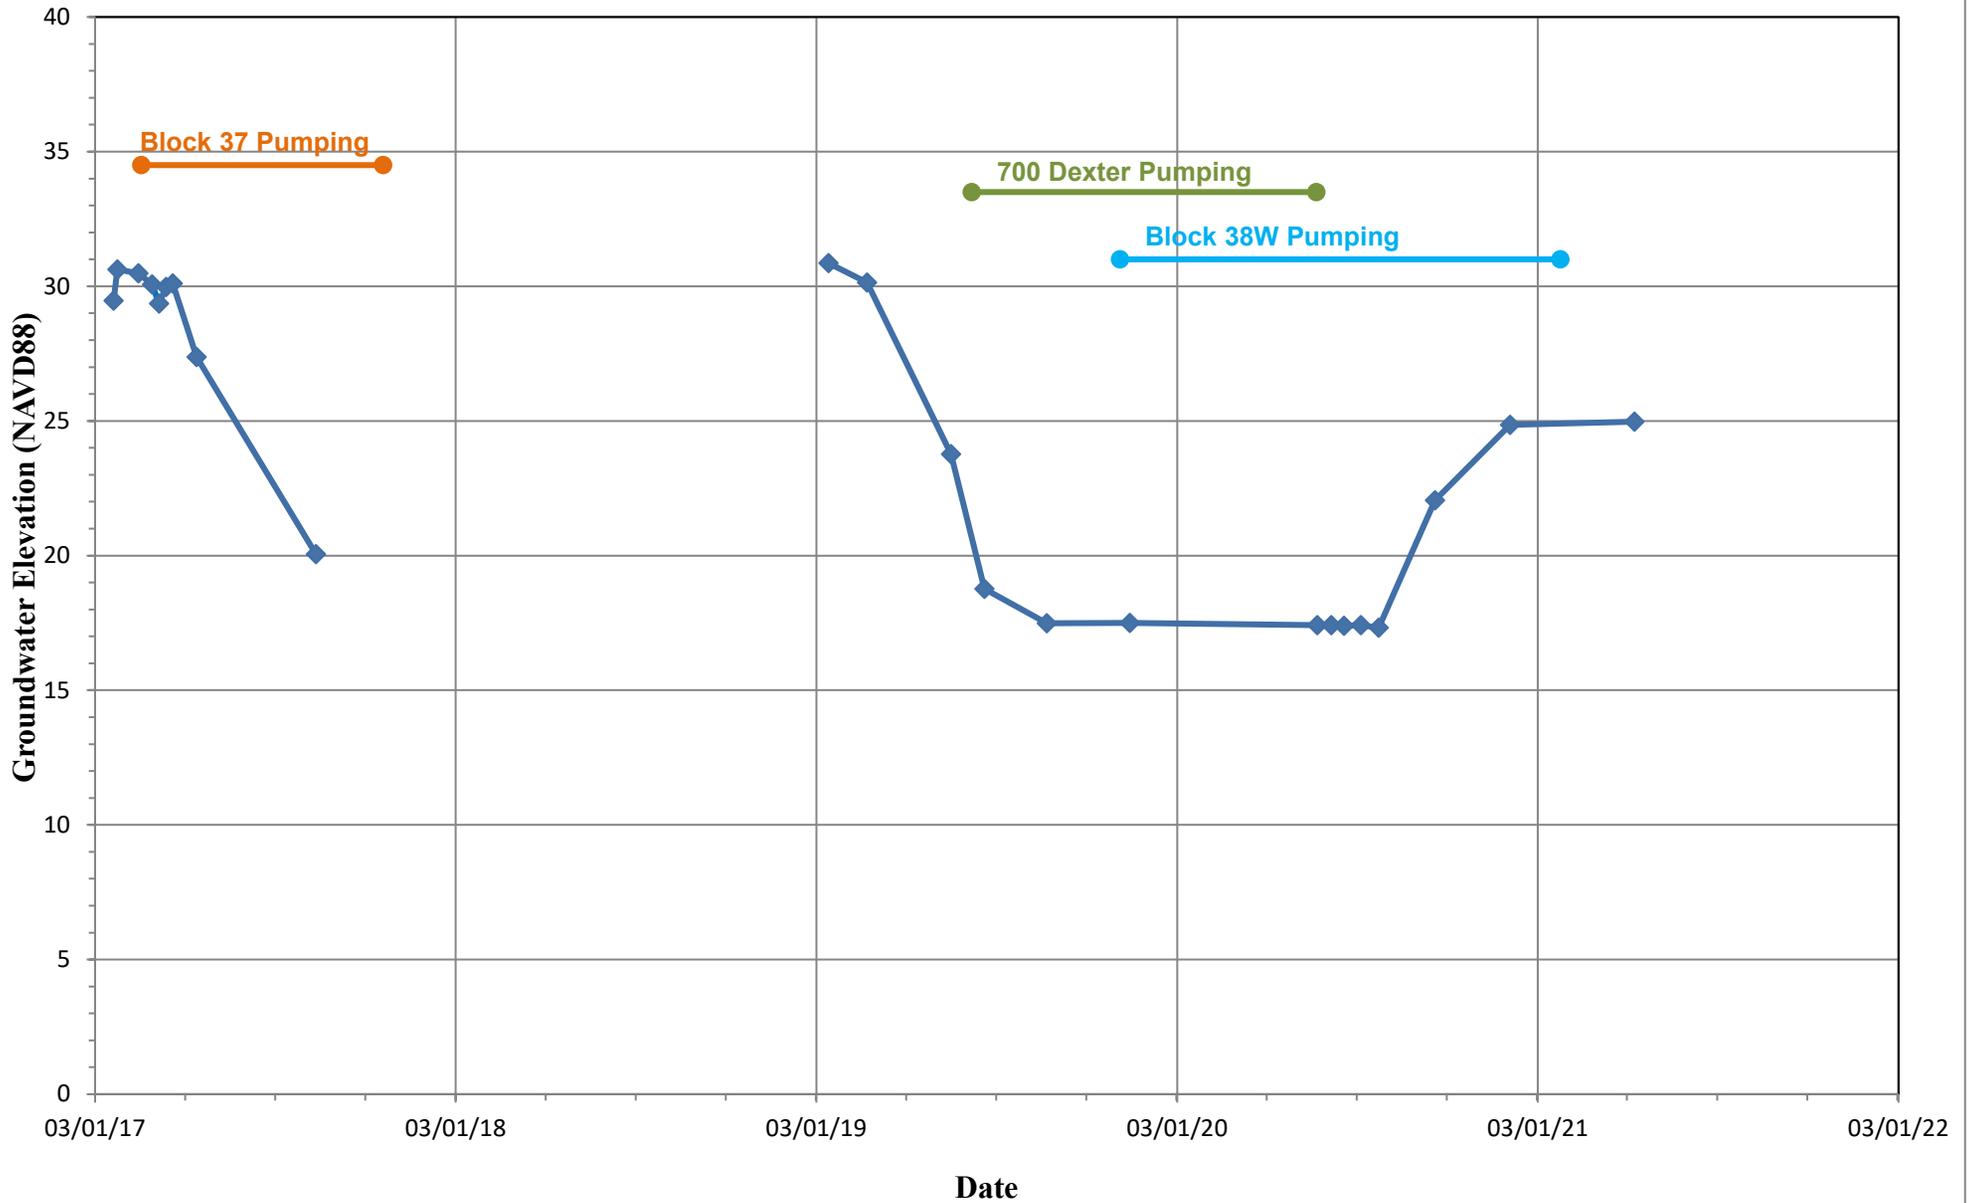


**Hydrograph**  
**MW125, Valley St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

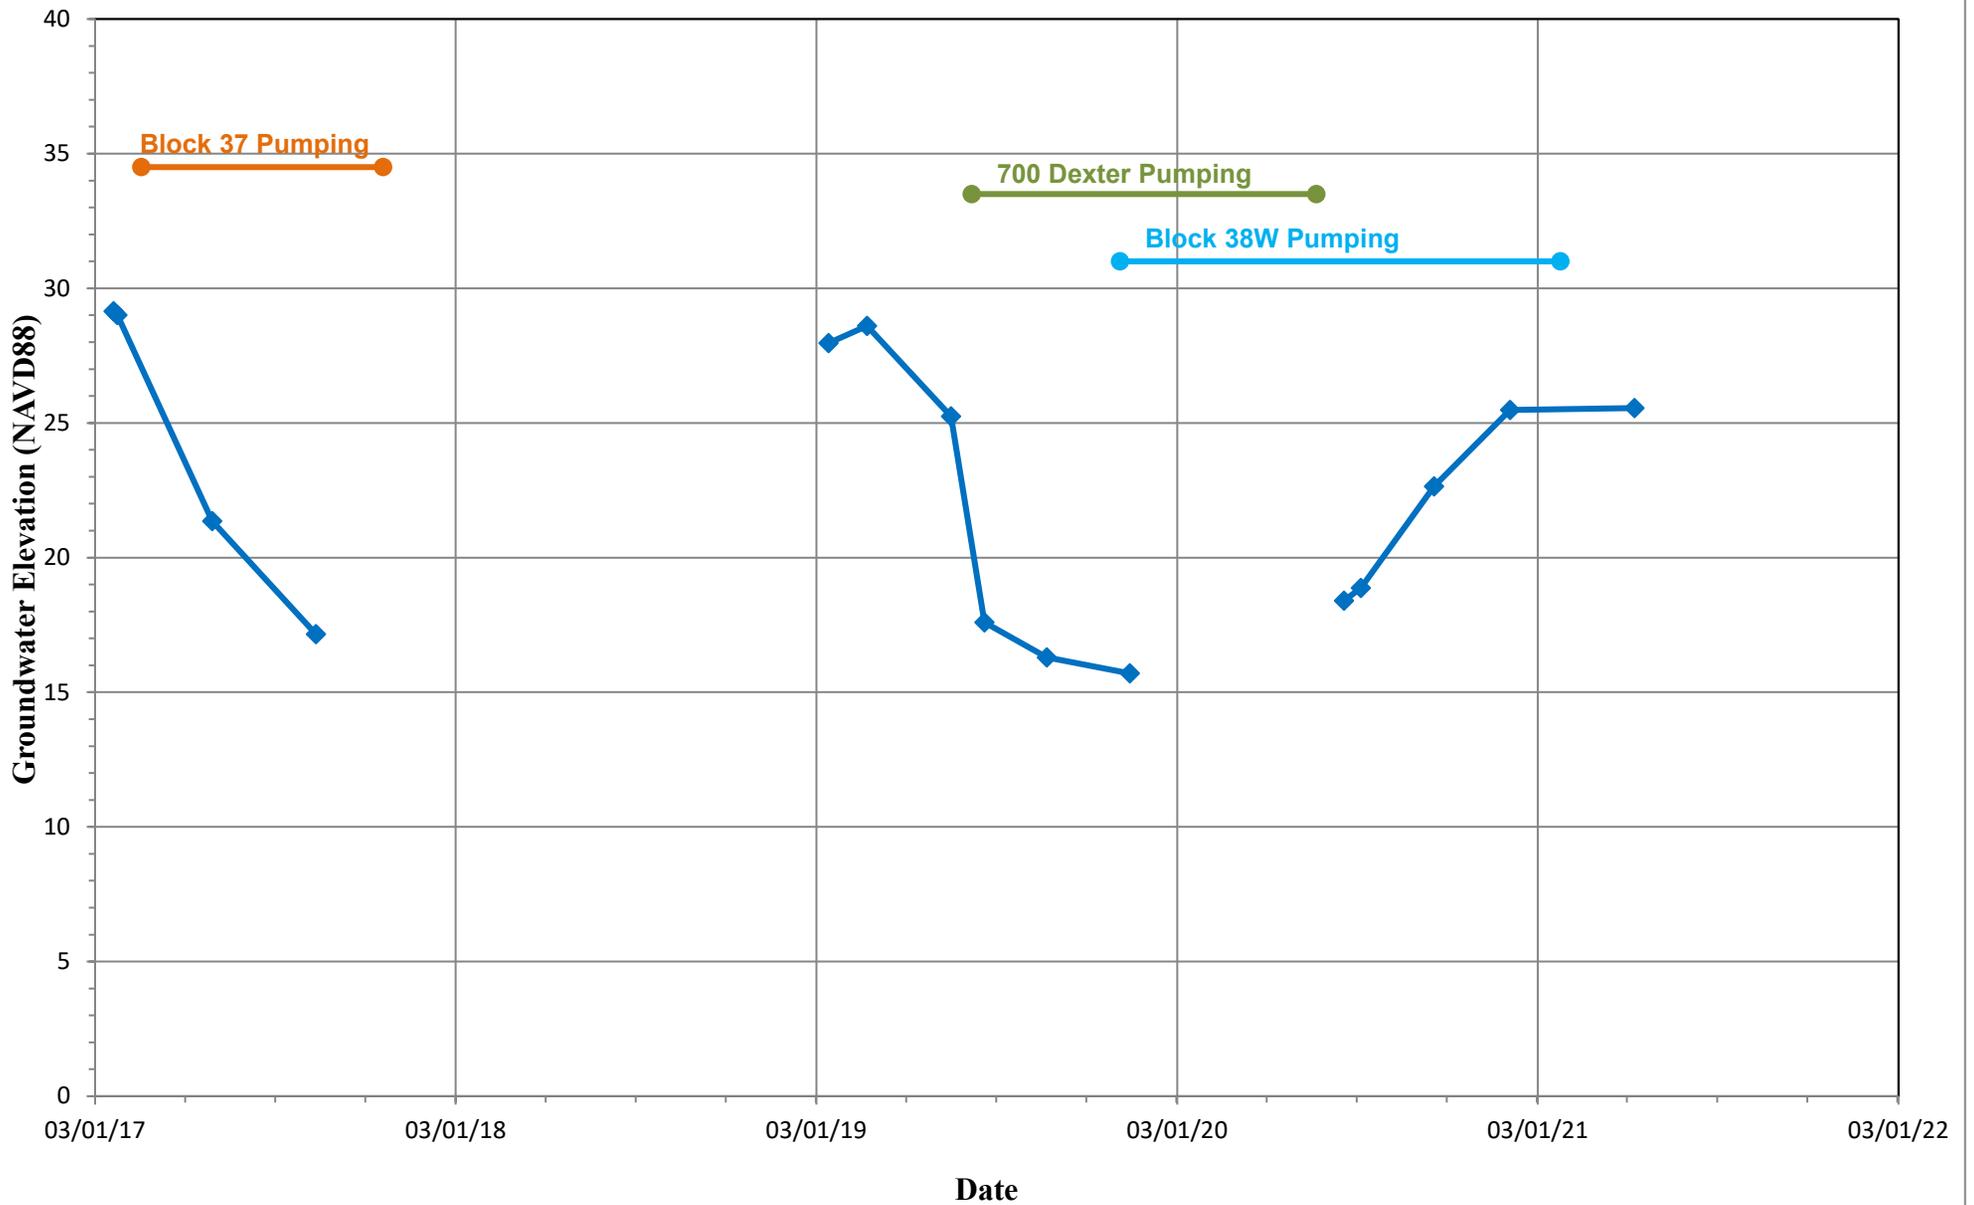


# Hydrograph

## MW126, Alley E of Seattle Roy Aloha Shops


### American Linen Supply Co Dexter Ave Site

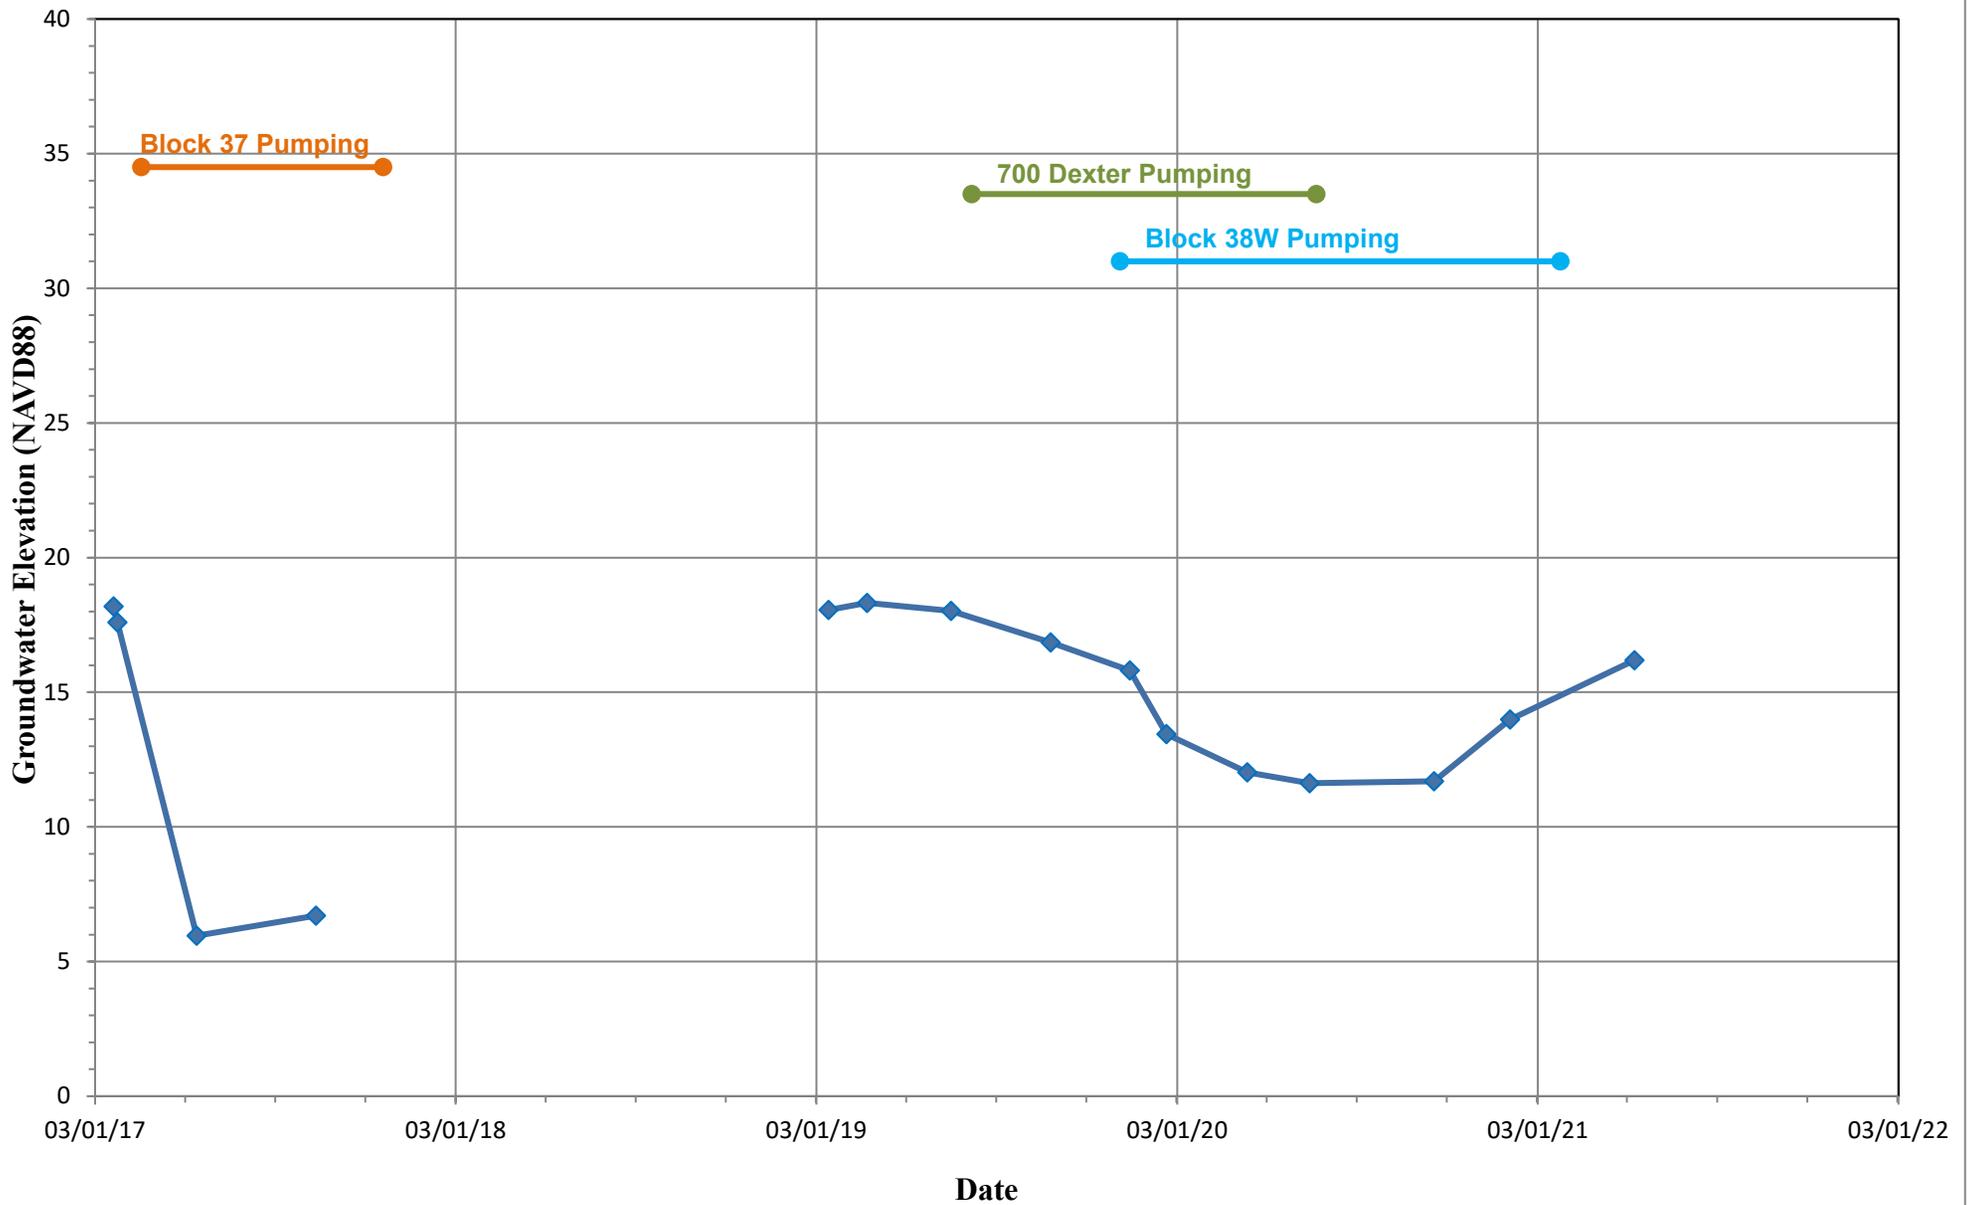


**Hydrograph**  
**MW-154, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

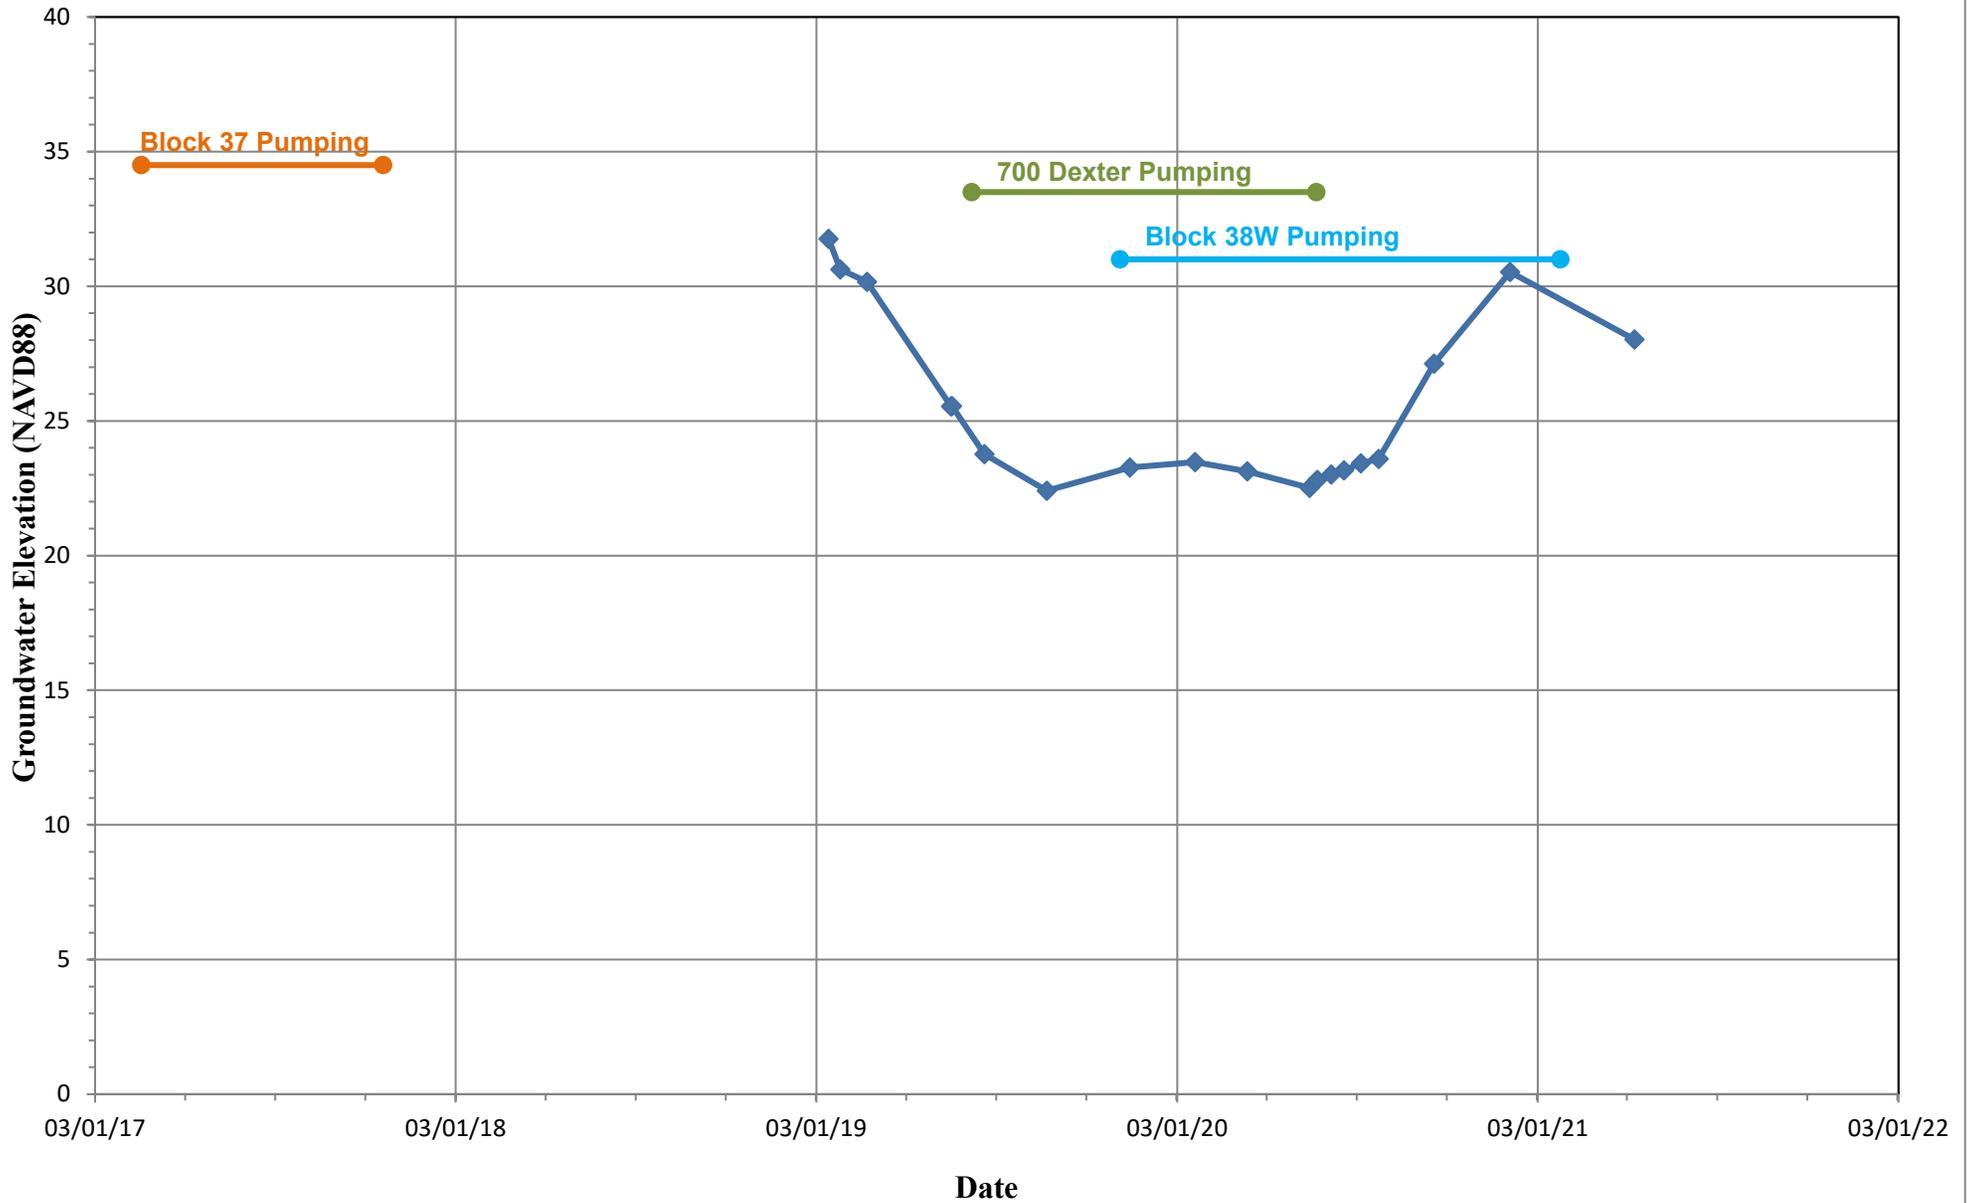


**Hydrograph**  
**MW-155, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

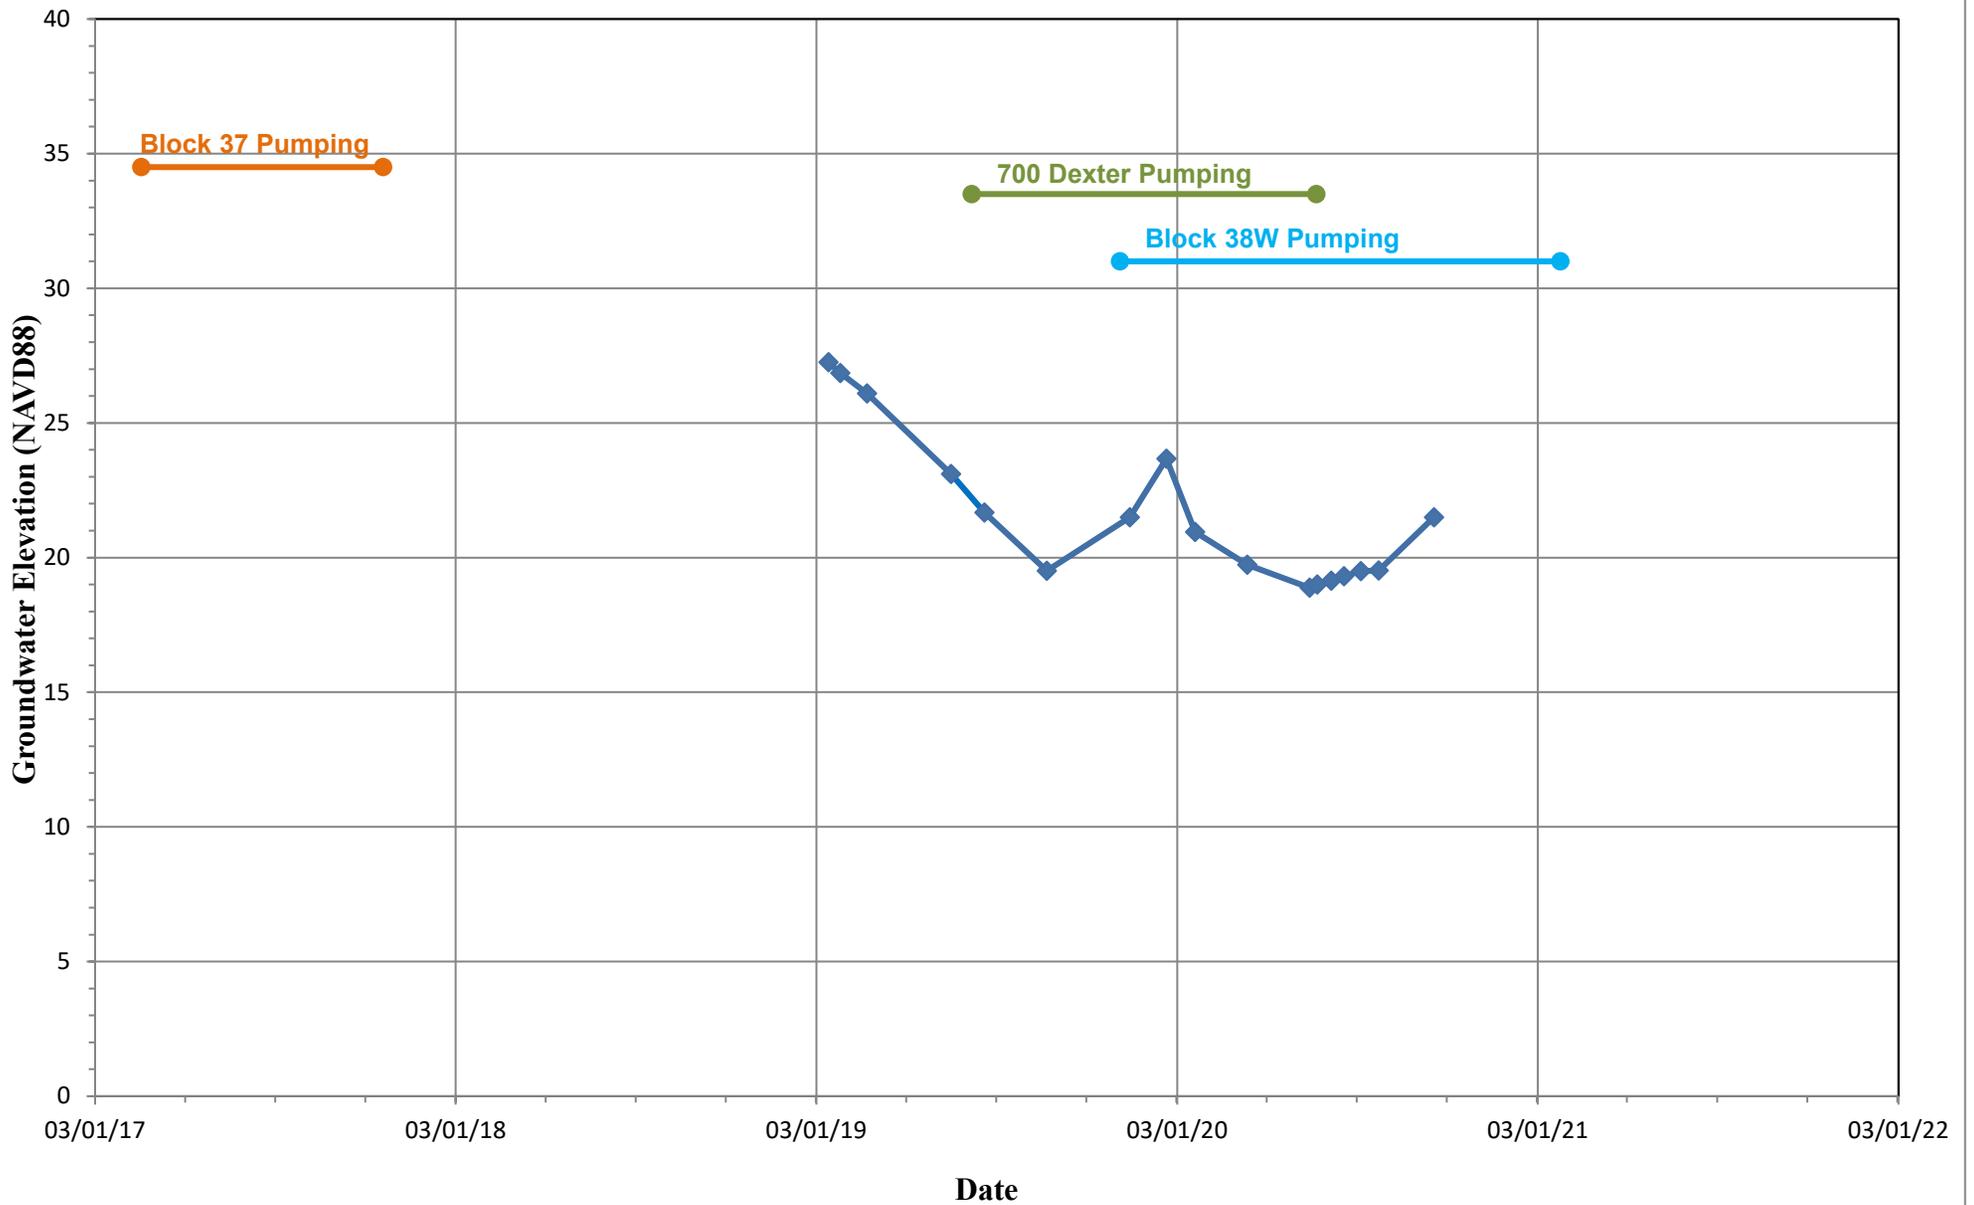


**Hydrograph**  
**MW-159, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

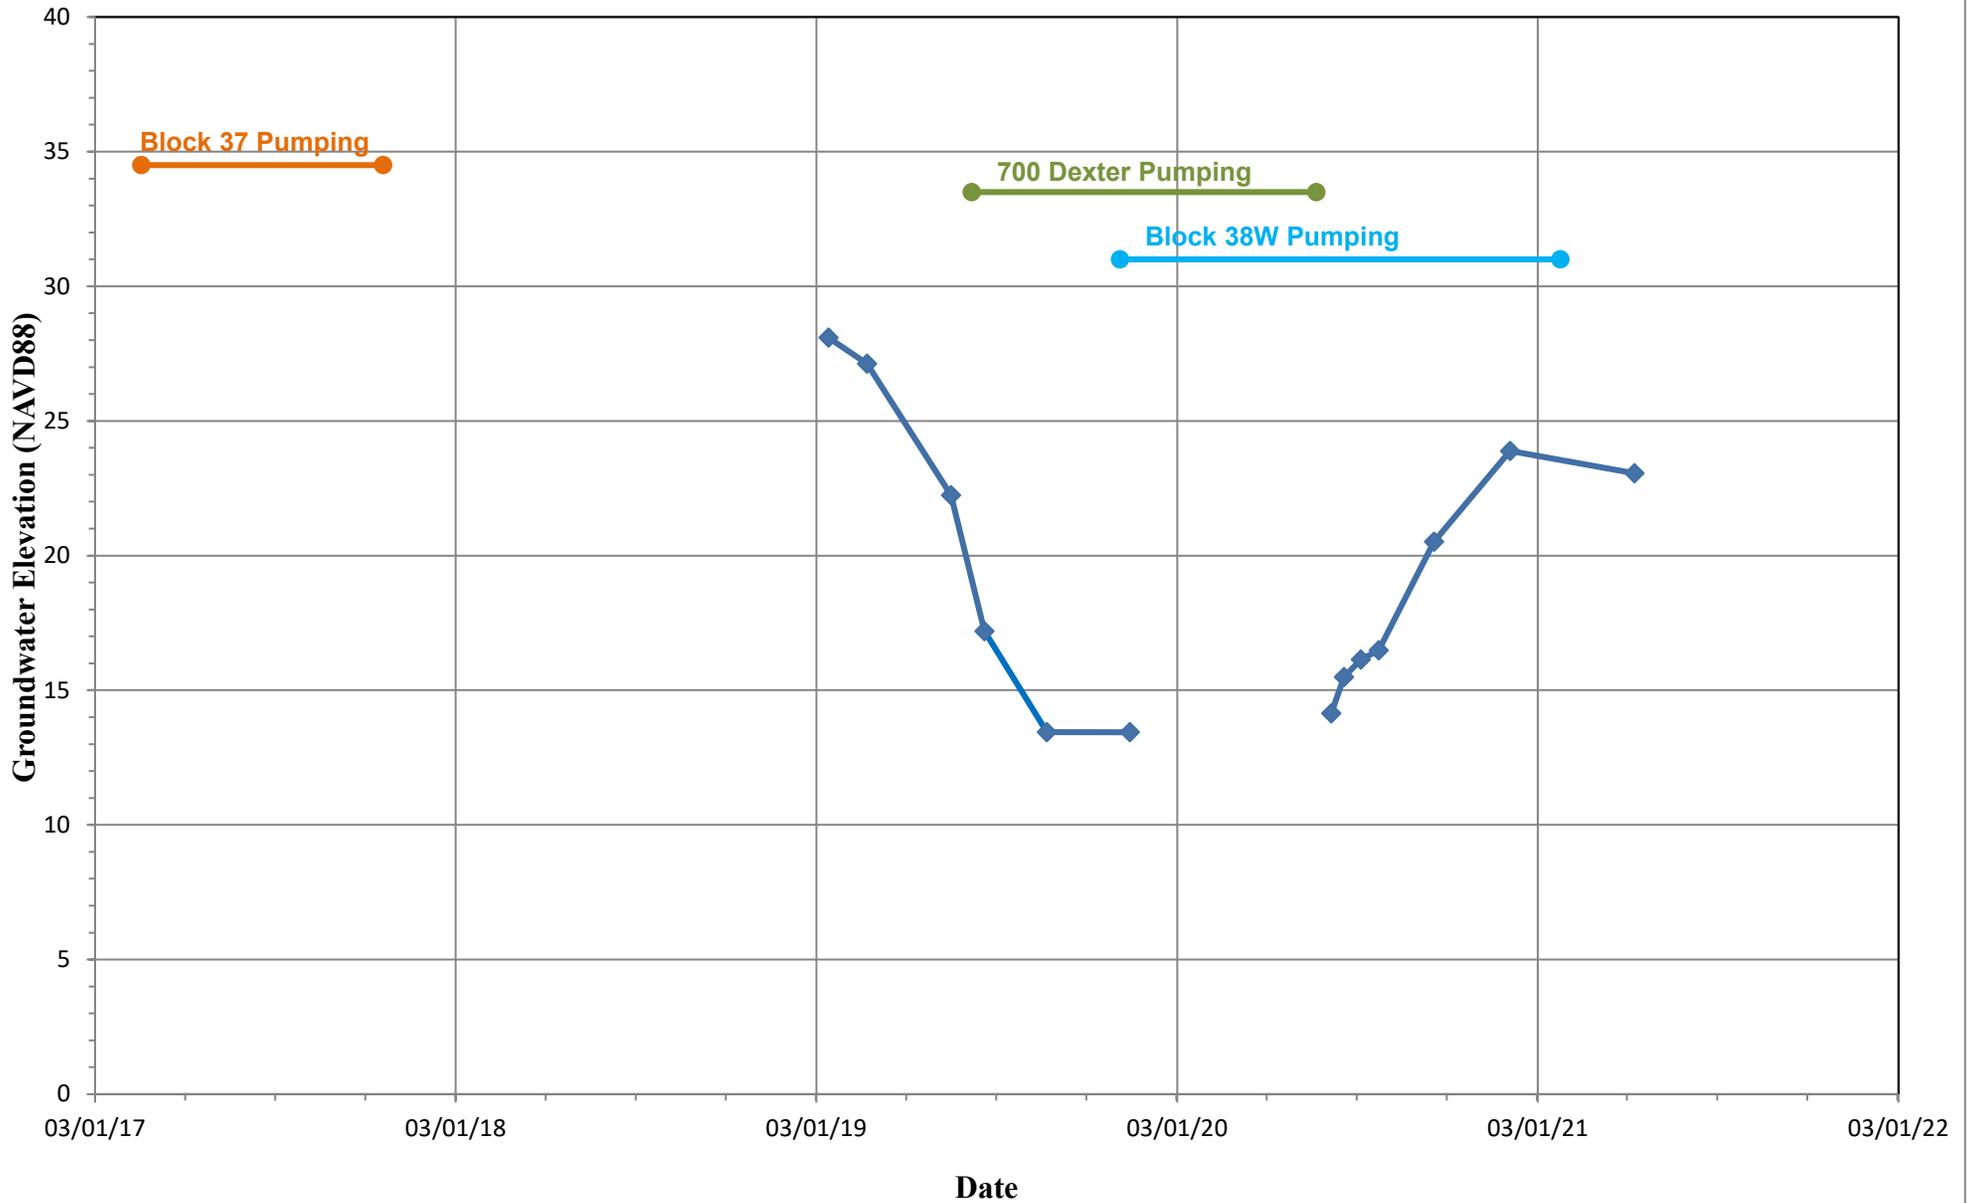


**Hydrograph**  
**MW-305, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

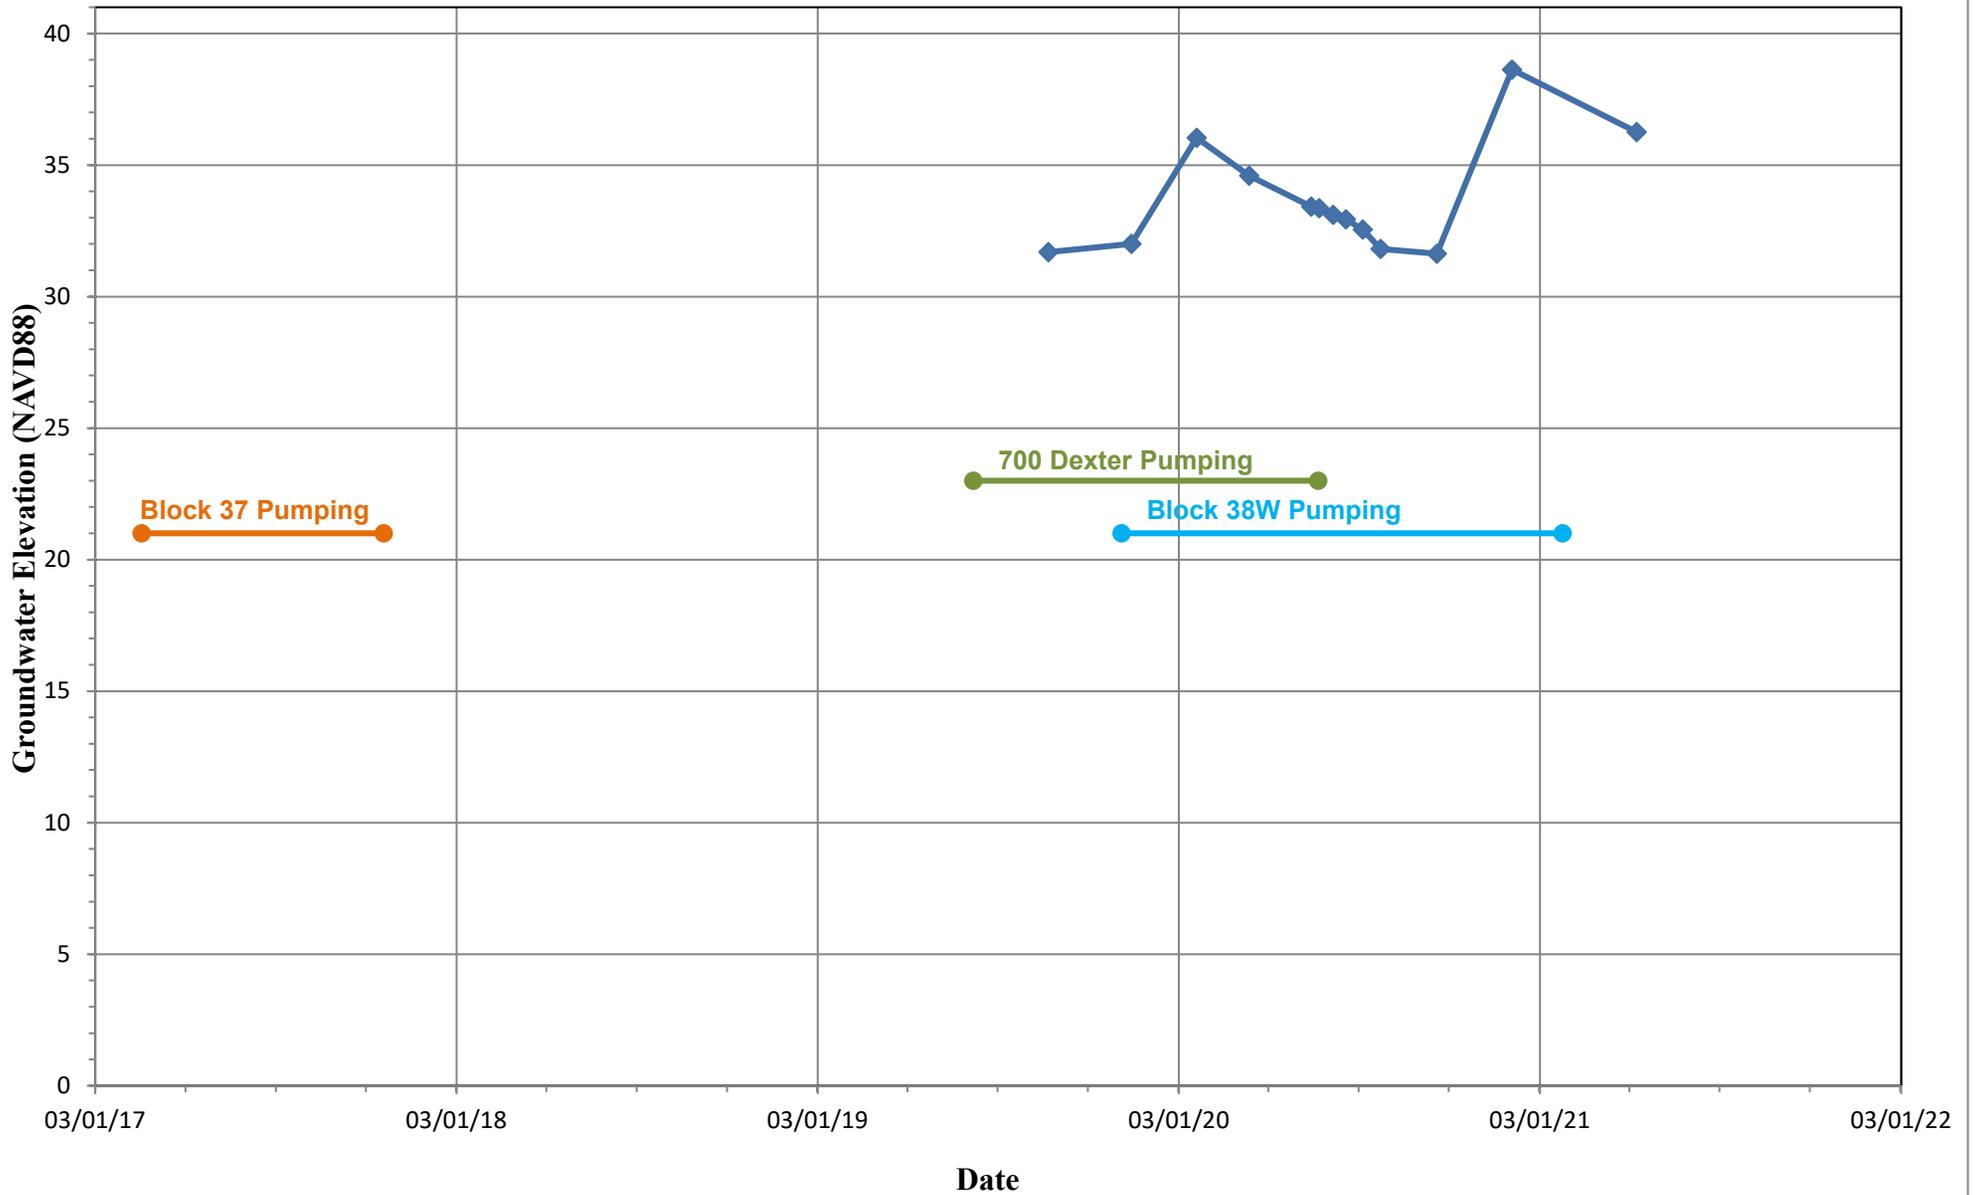


**Hydrograph**  
**MW-310, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

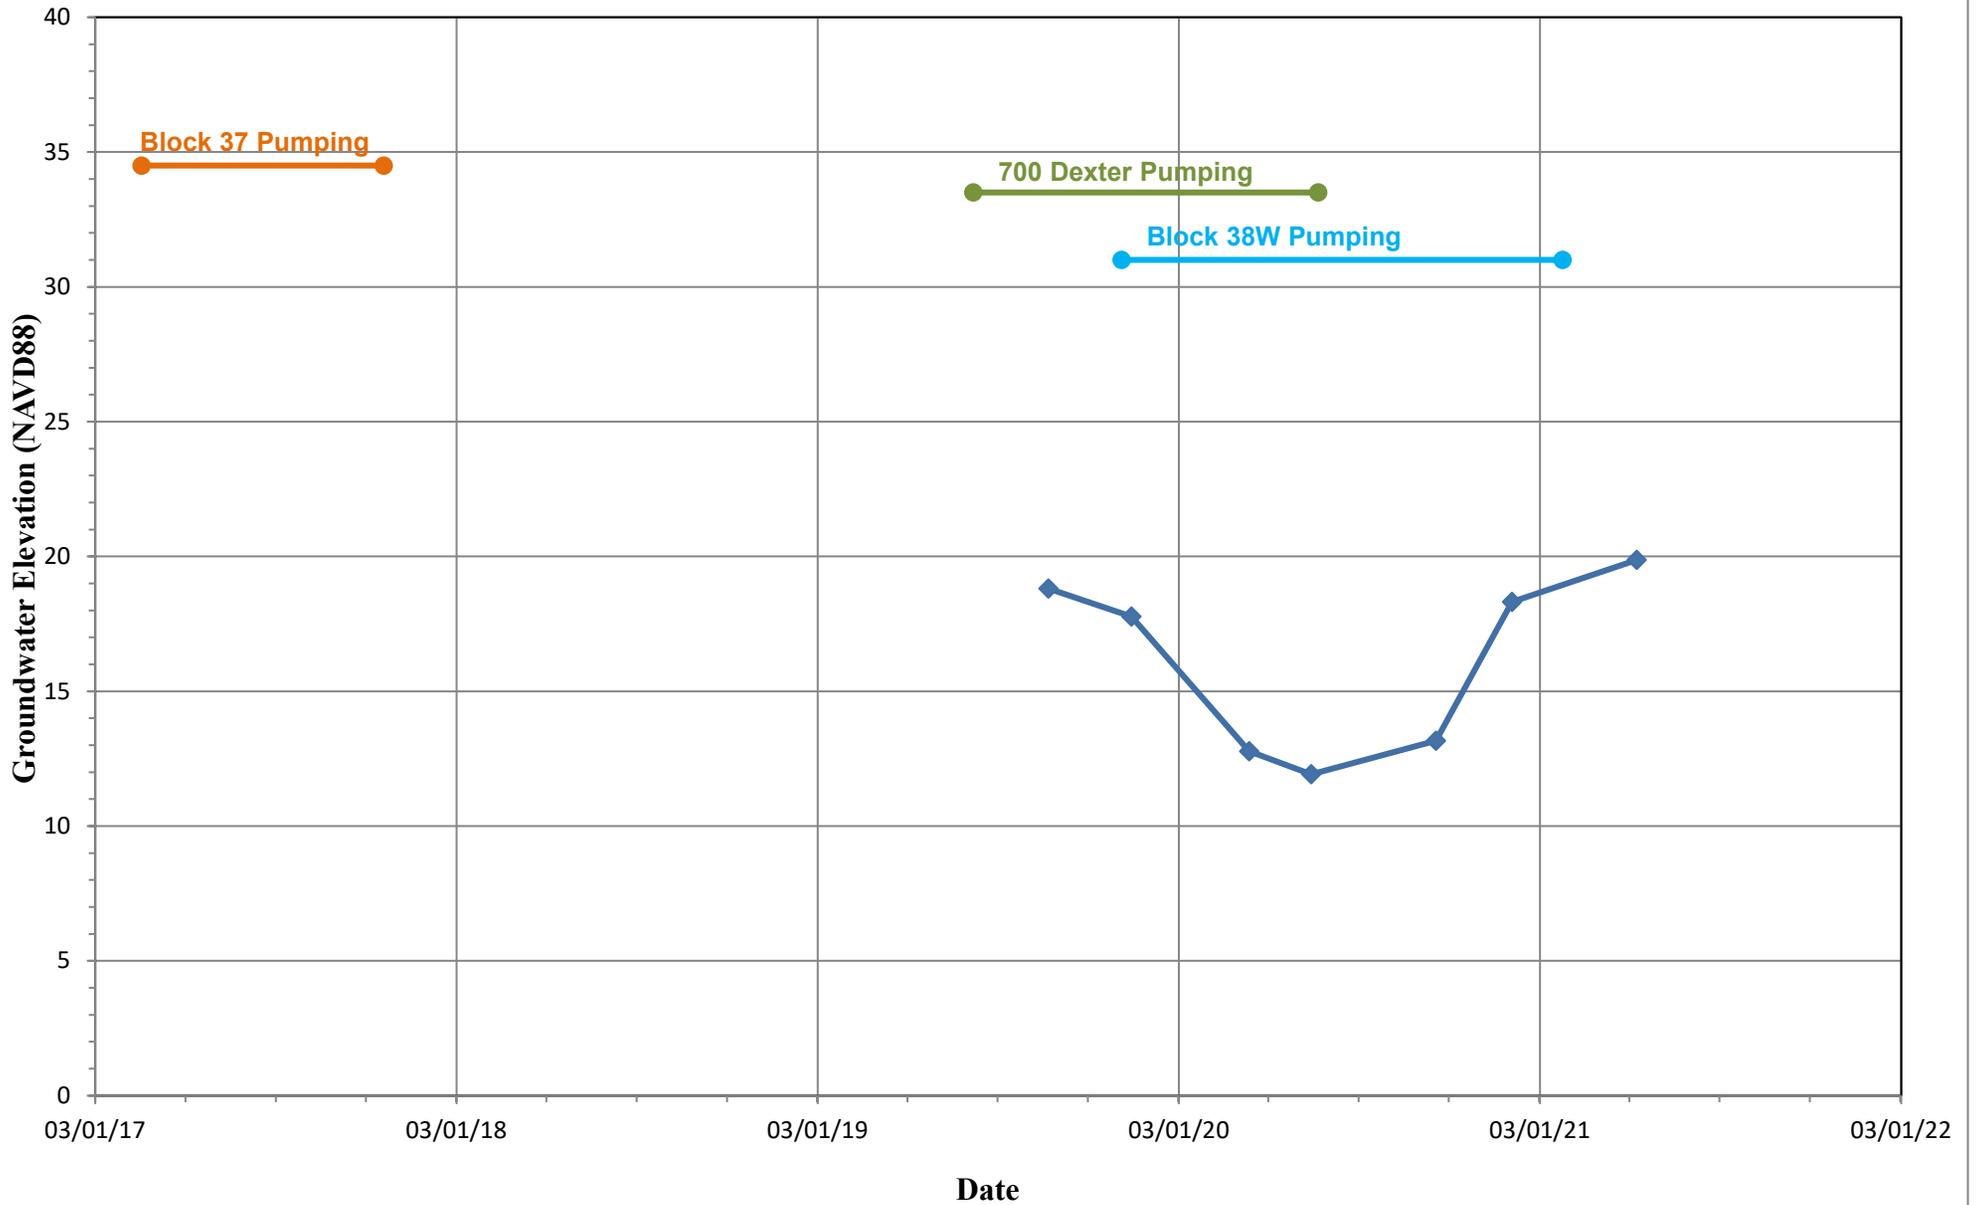


**Hydrograph**  
**MW-312, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

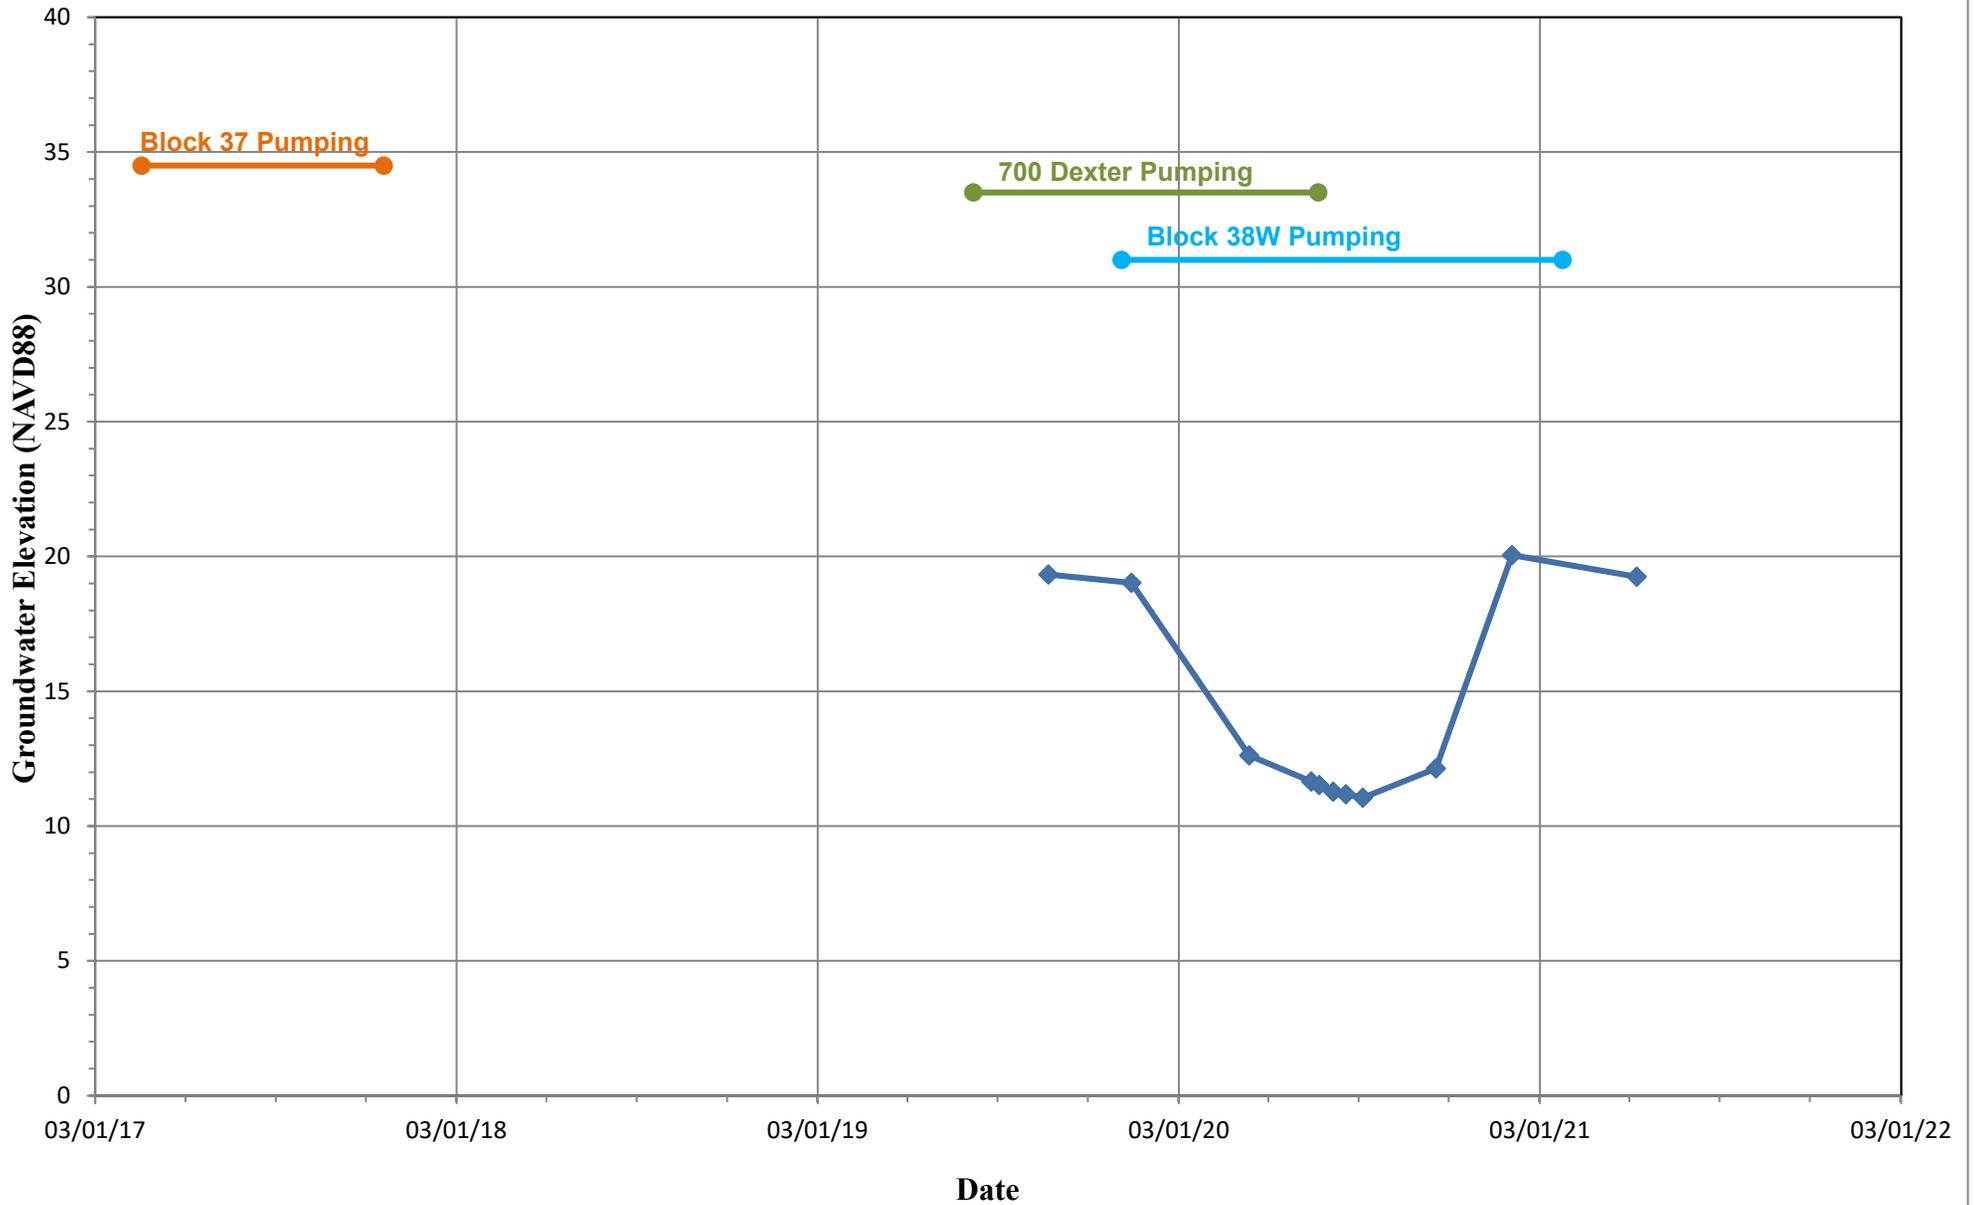


**Hydrograph**  
**MW-313, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

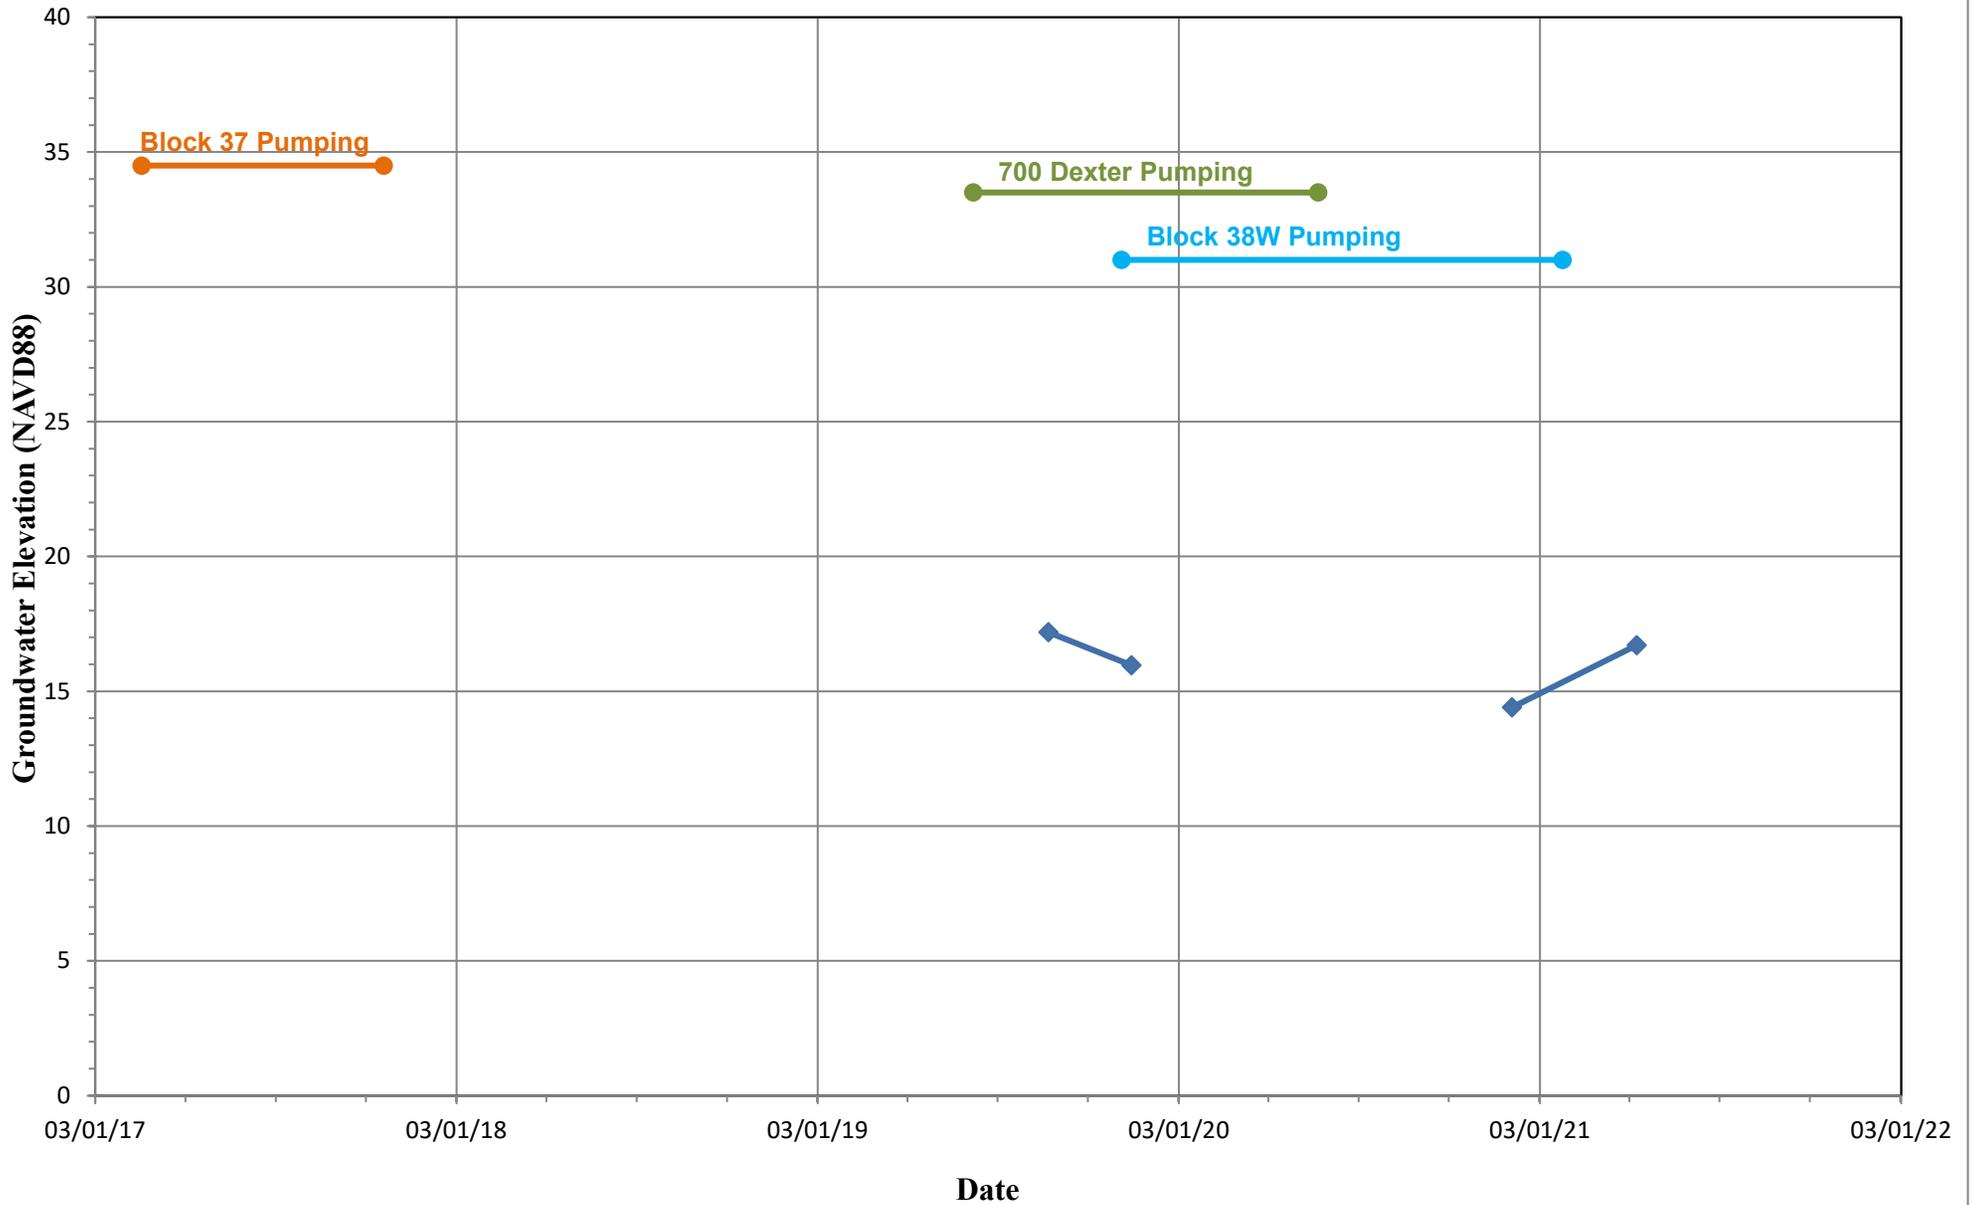

**Hydrograph**  
**MW-320, 9th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

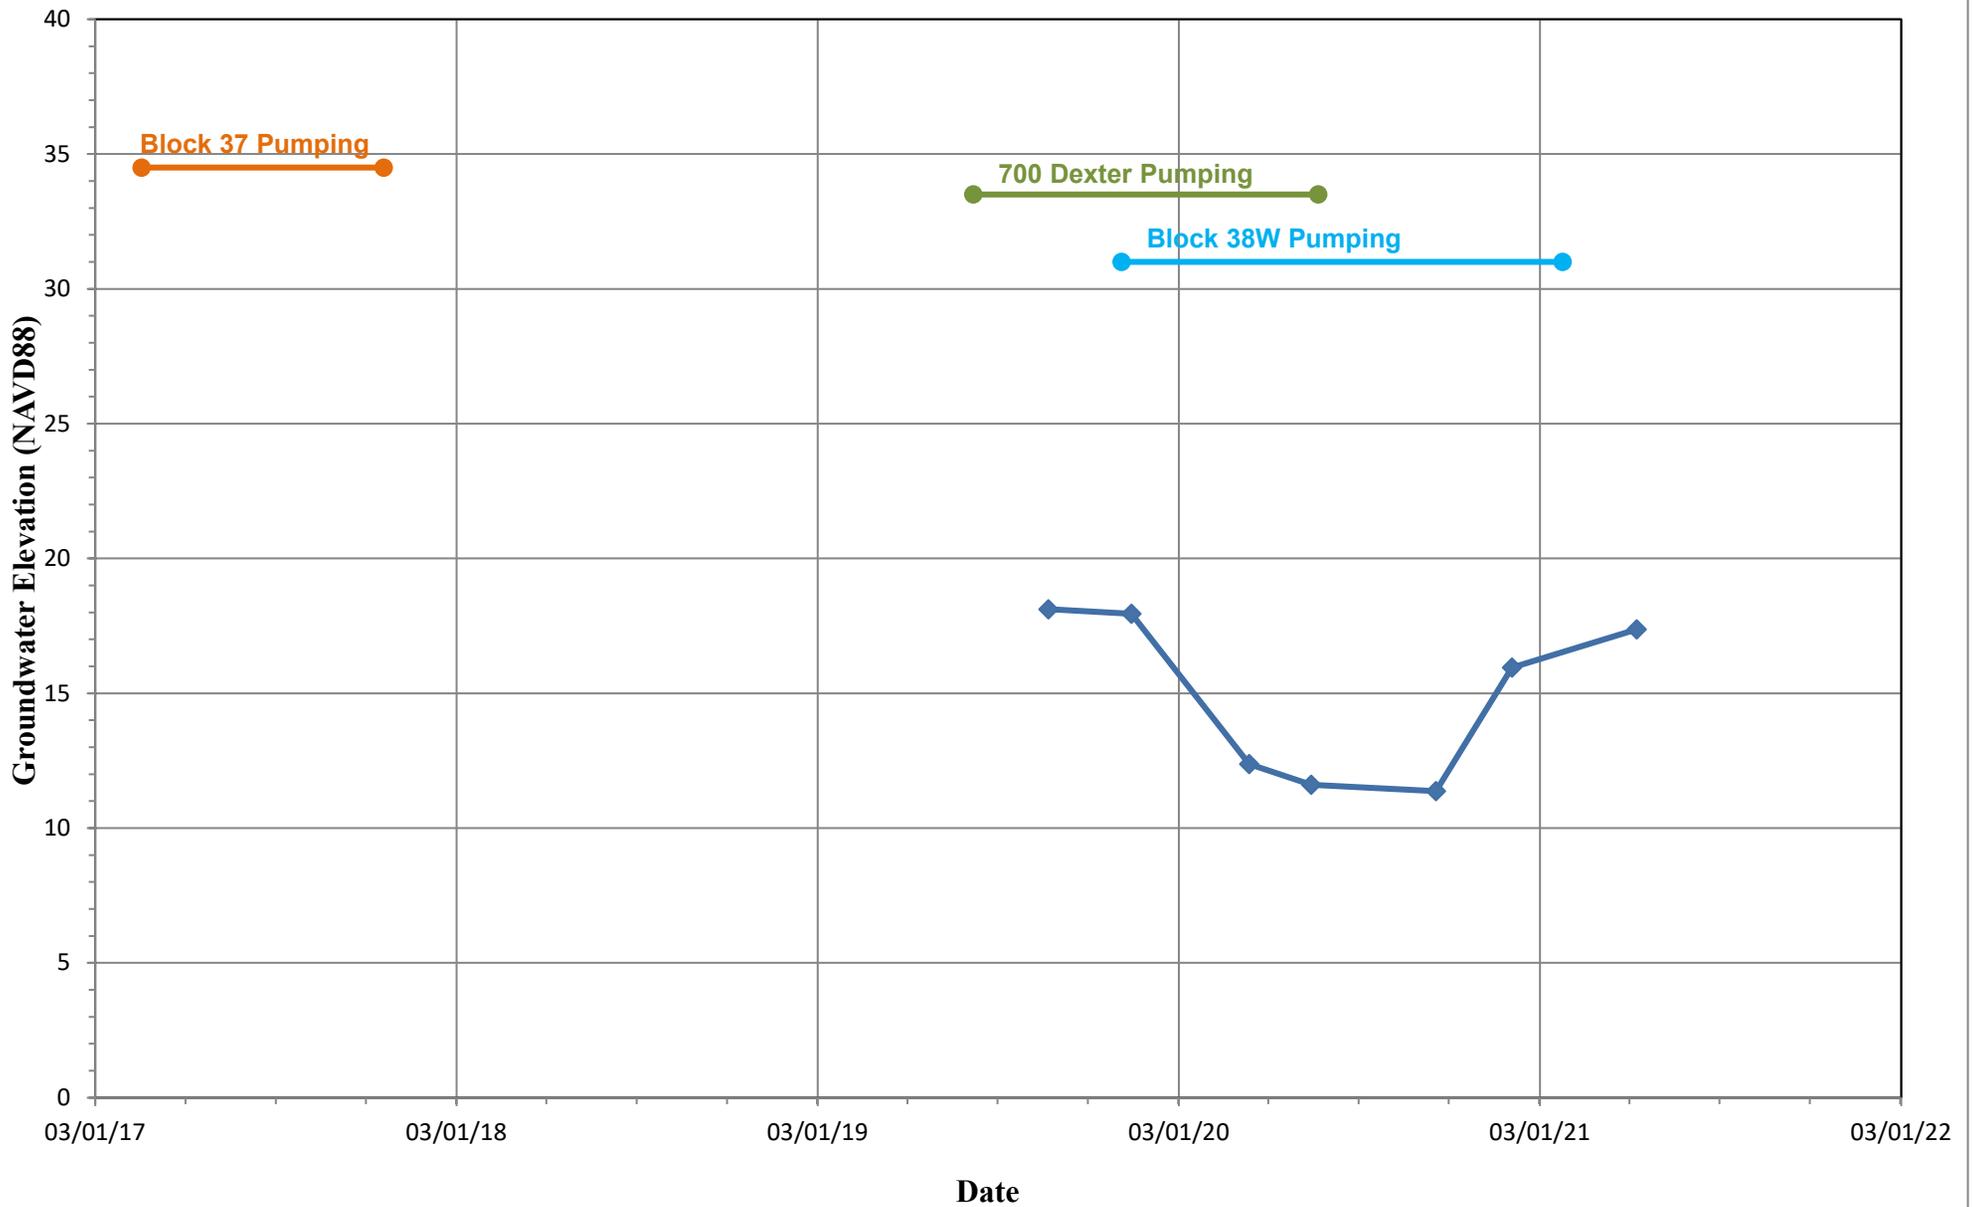


**Hydrograph**  
**MW-332, Roy St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

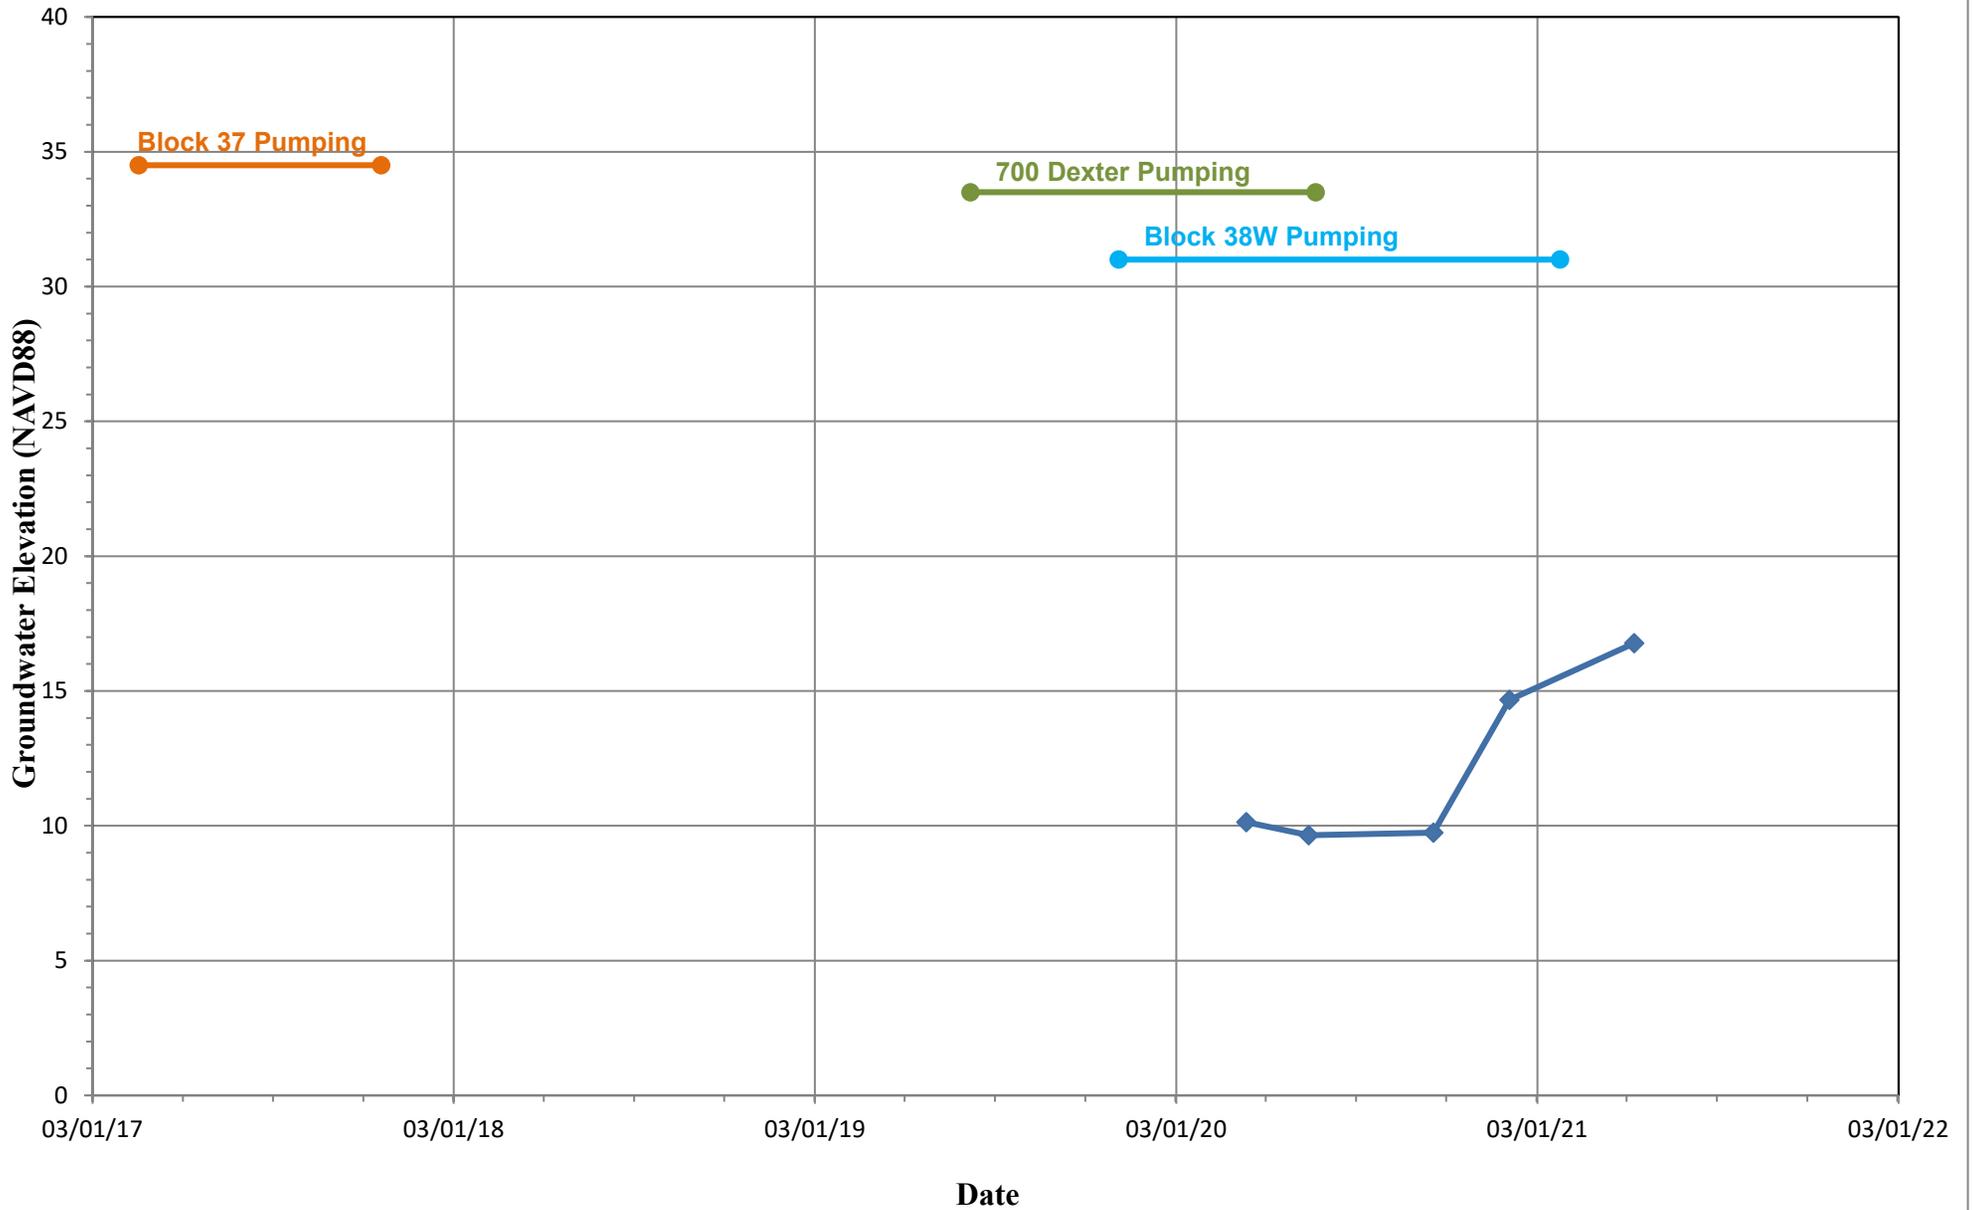


# Hydrograph

## MW-337, Lake Union Park, N end

### American Linen Supply Co Dexter Ave Site

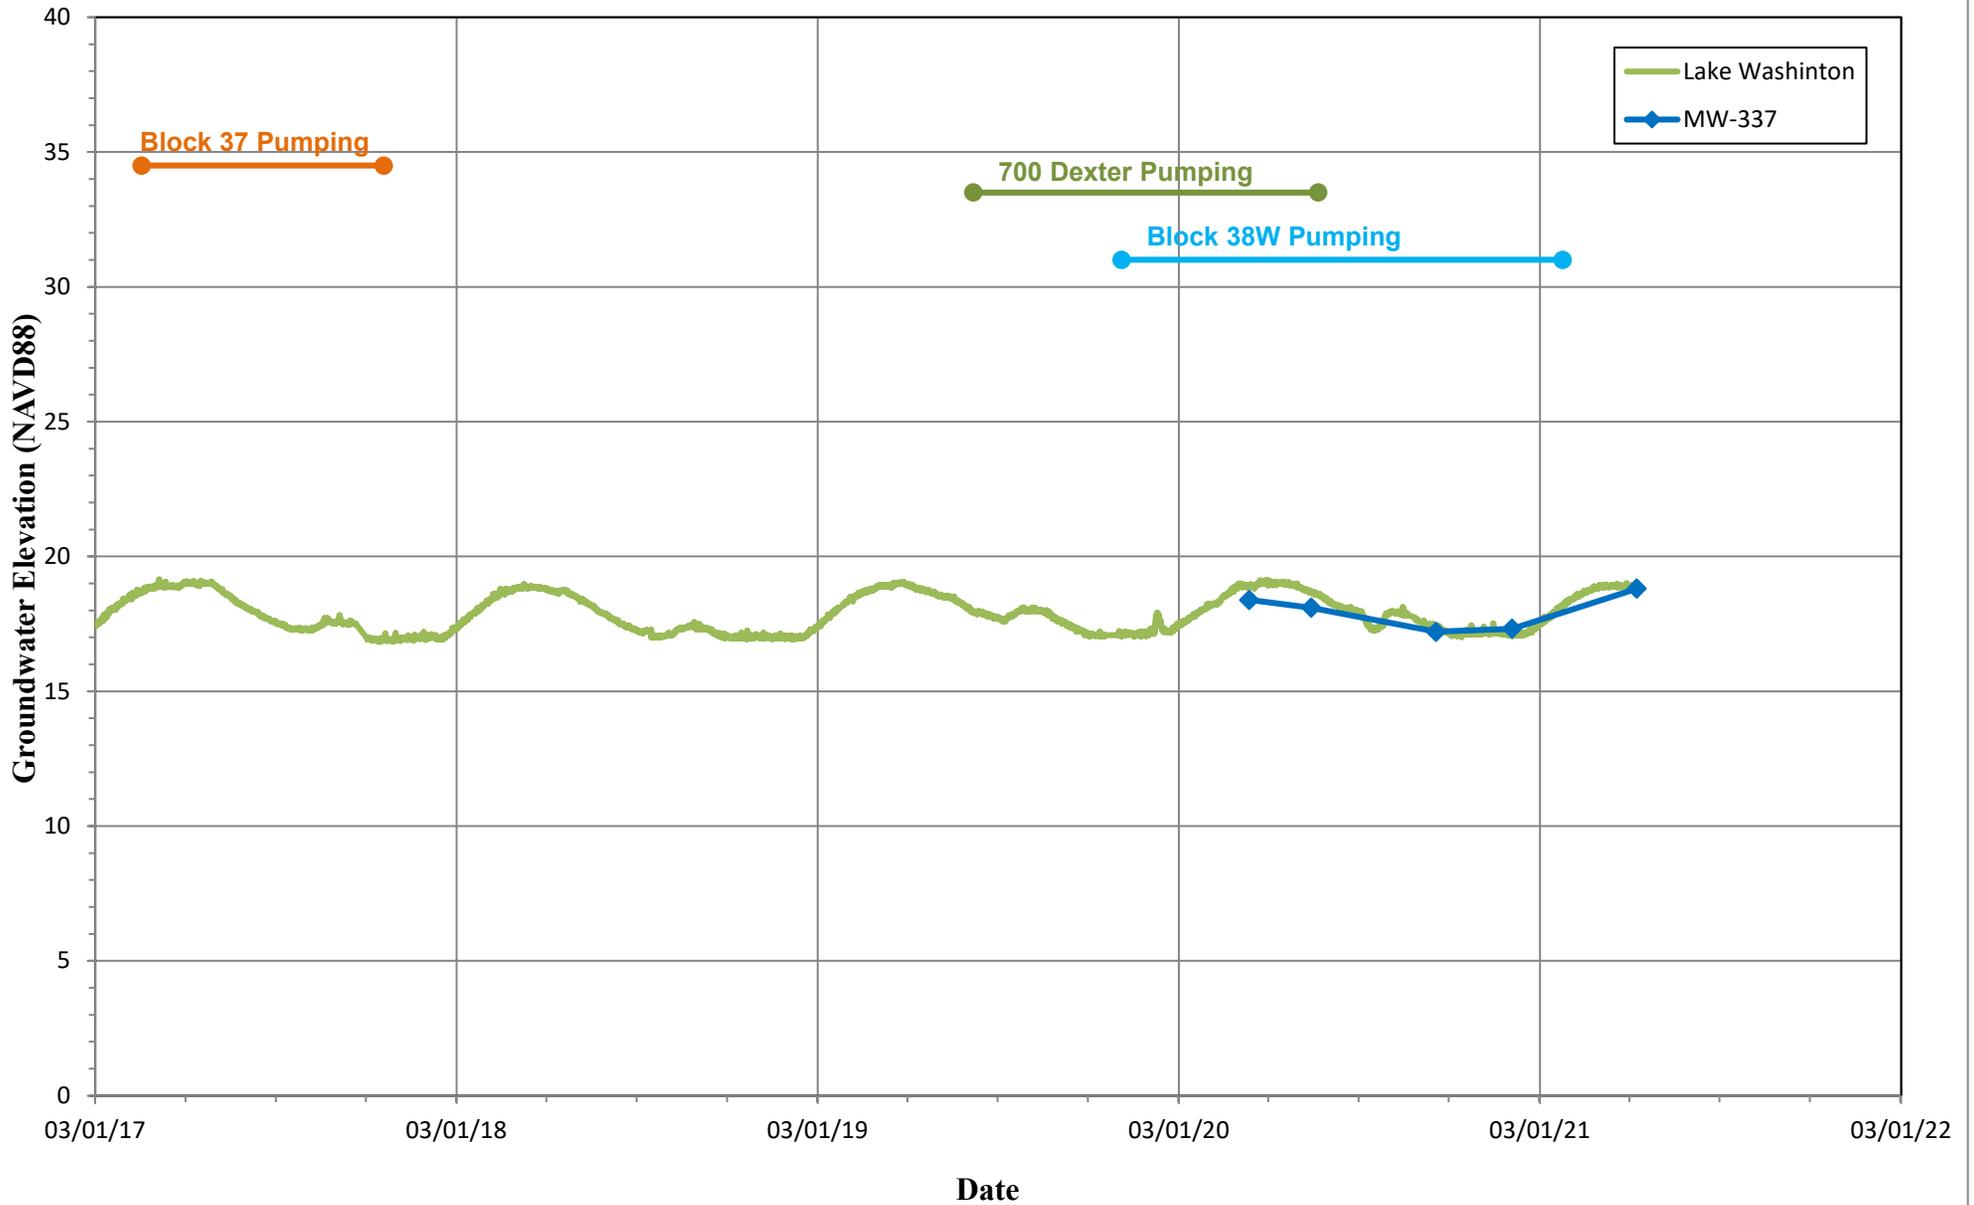


**Hydrograph**  
**MW-339, Lake Union Park, S end**  
**American Linen Supply Co Dexter Ave Site**

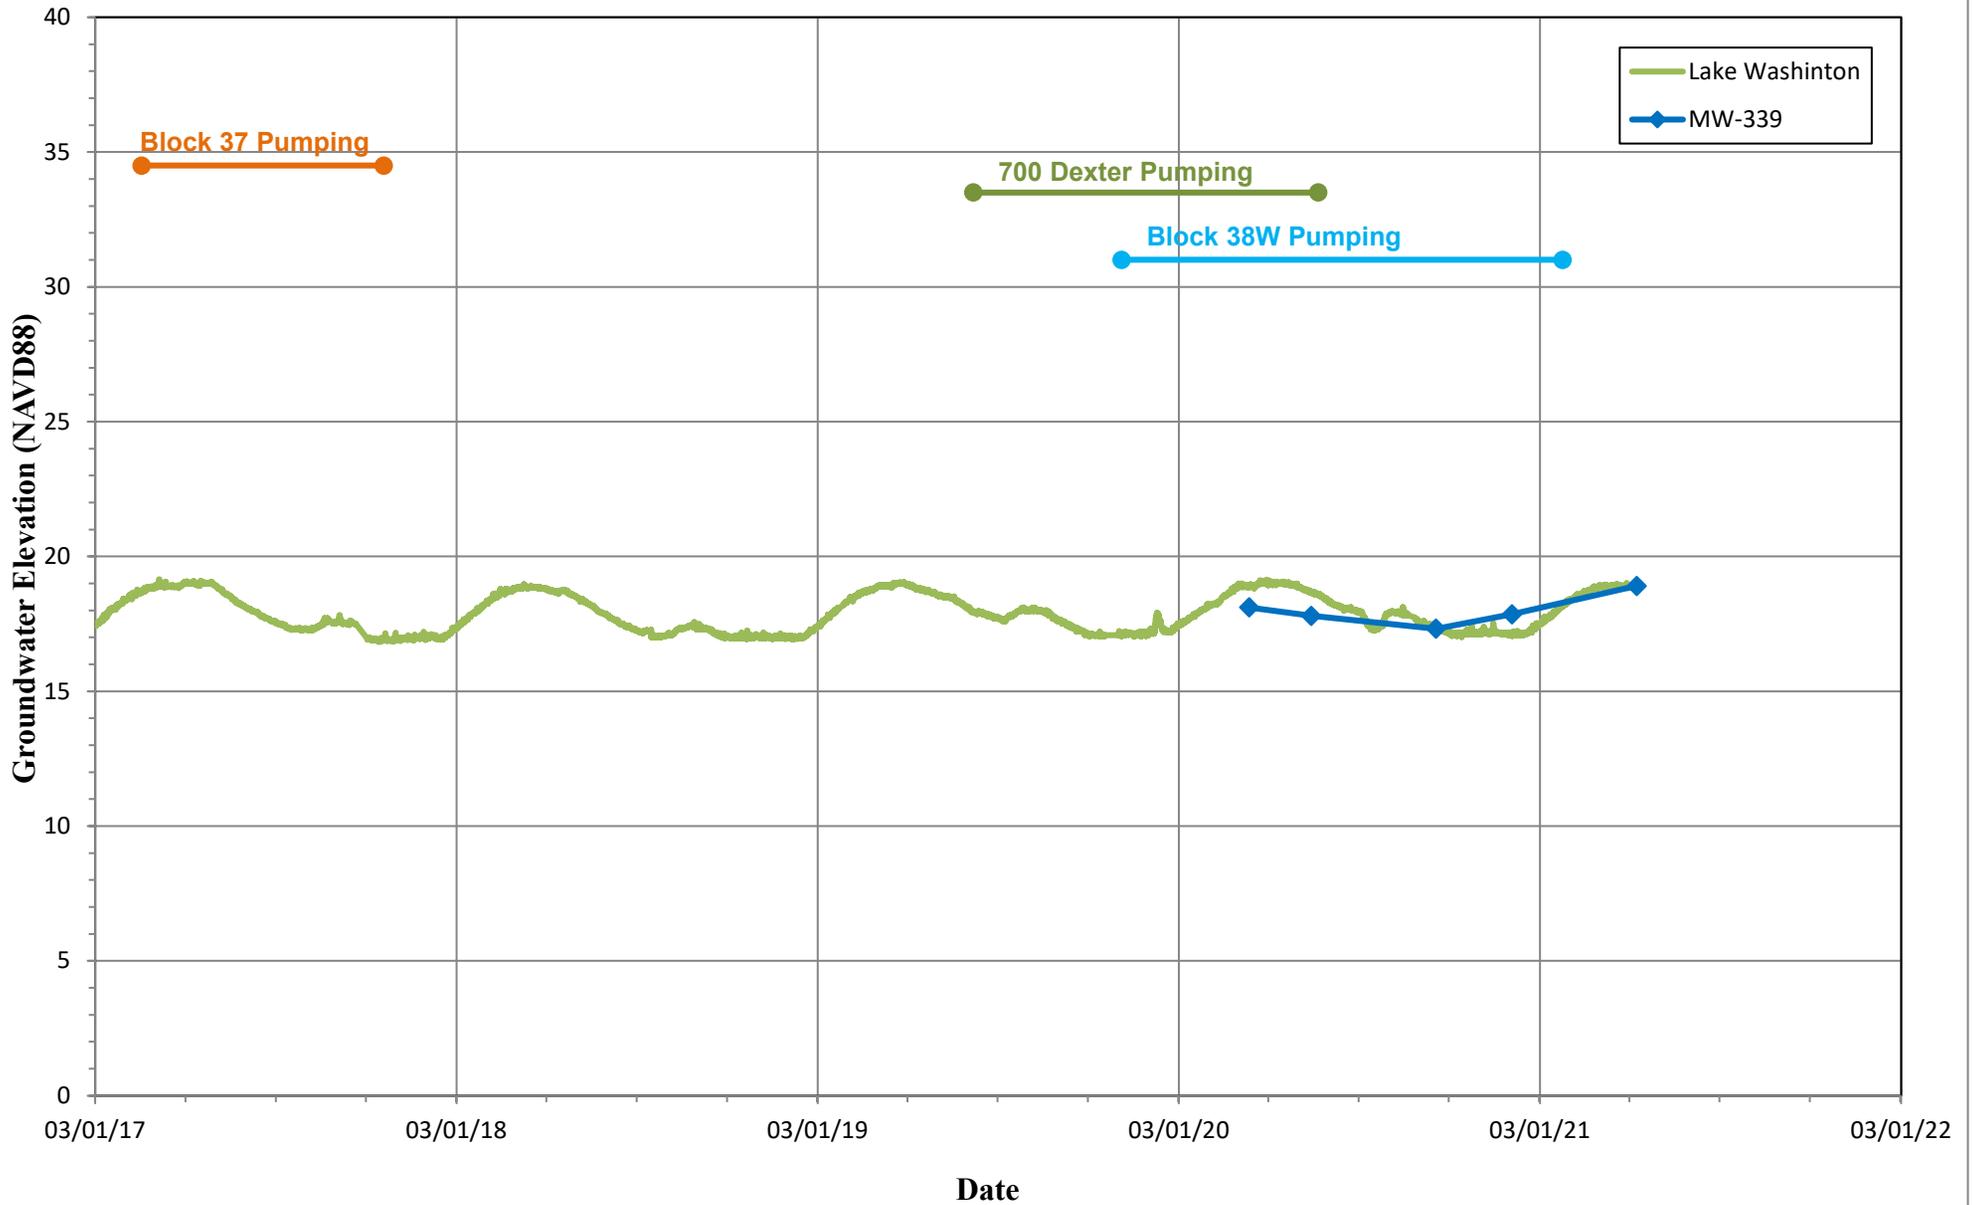


# Hydrograph

## R-MW5, Dexter Ave N ROW, E side


### American Linen Supply Co Dexter Ave Site

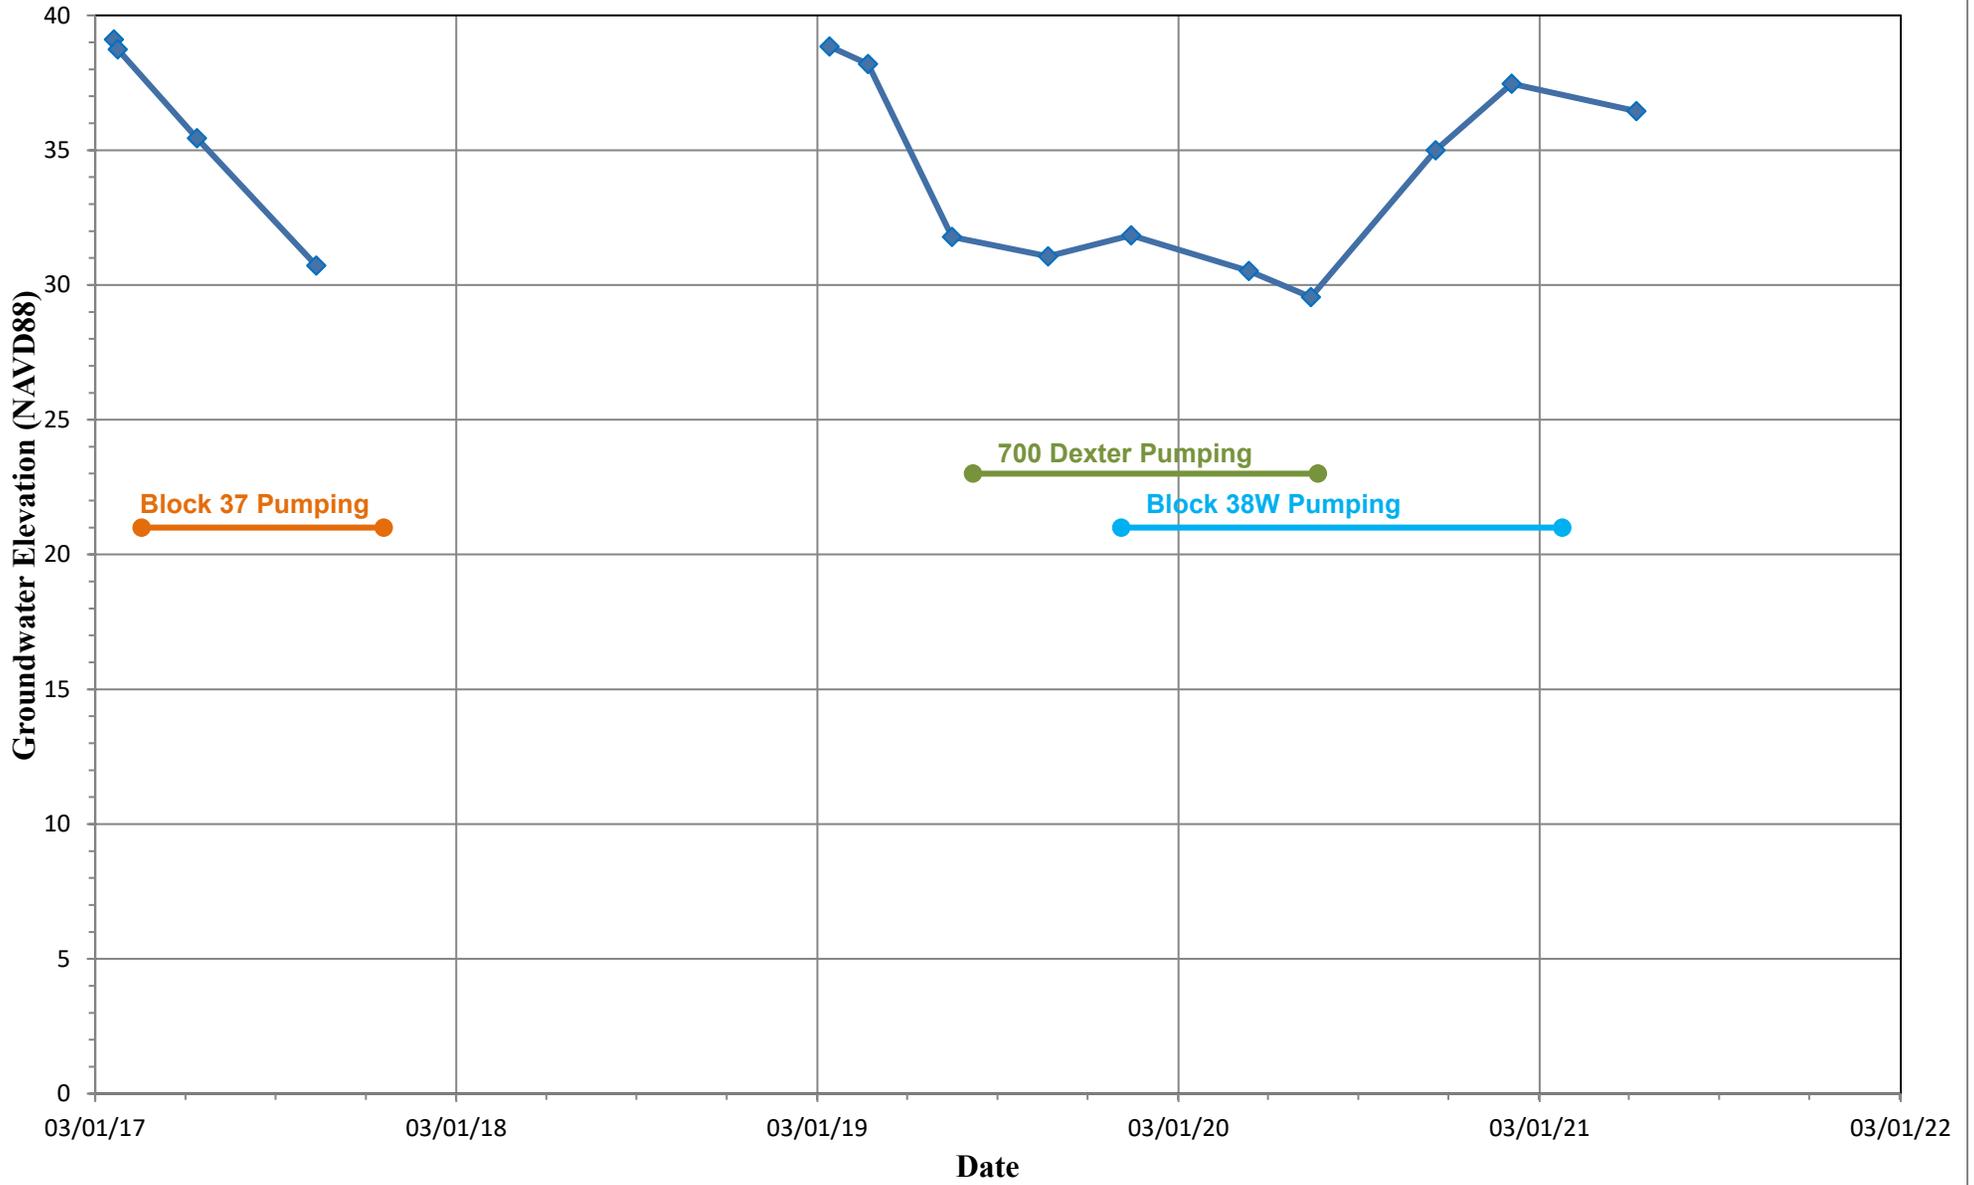


**Hydrograph**  
**R-MW6, 8th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

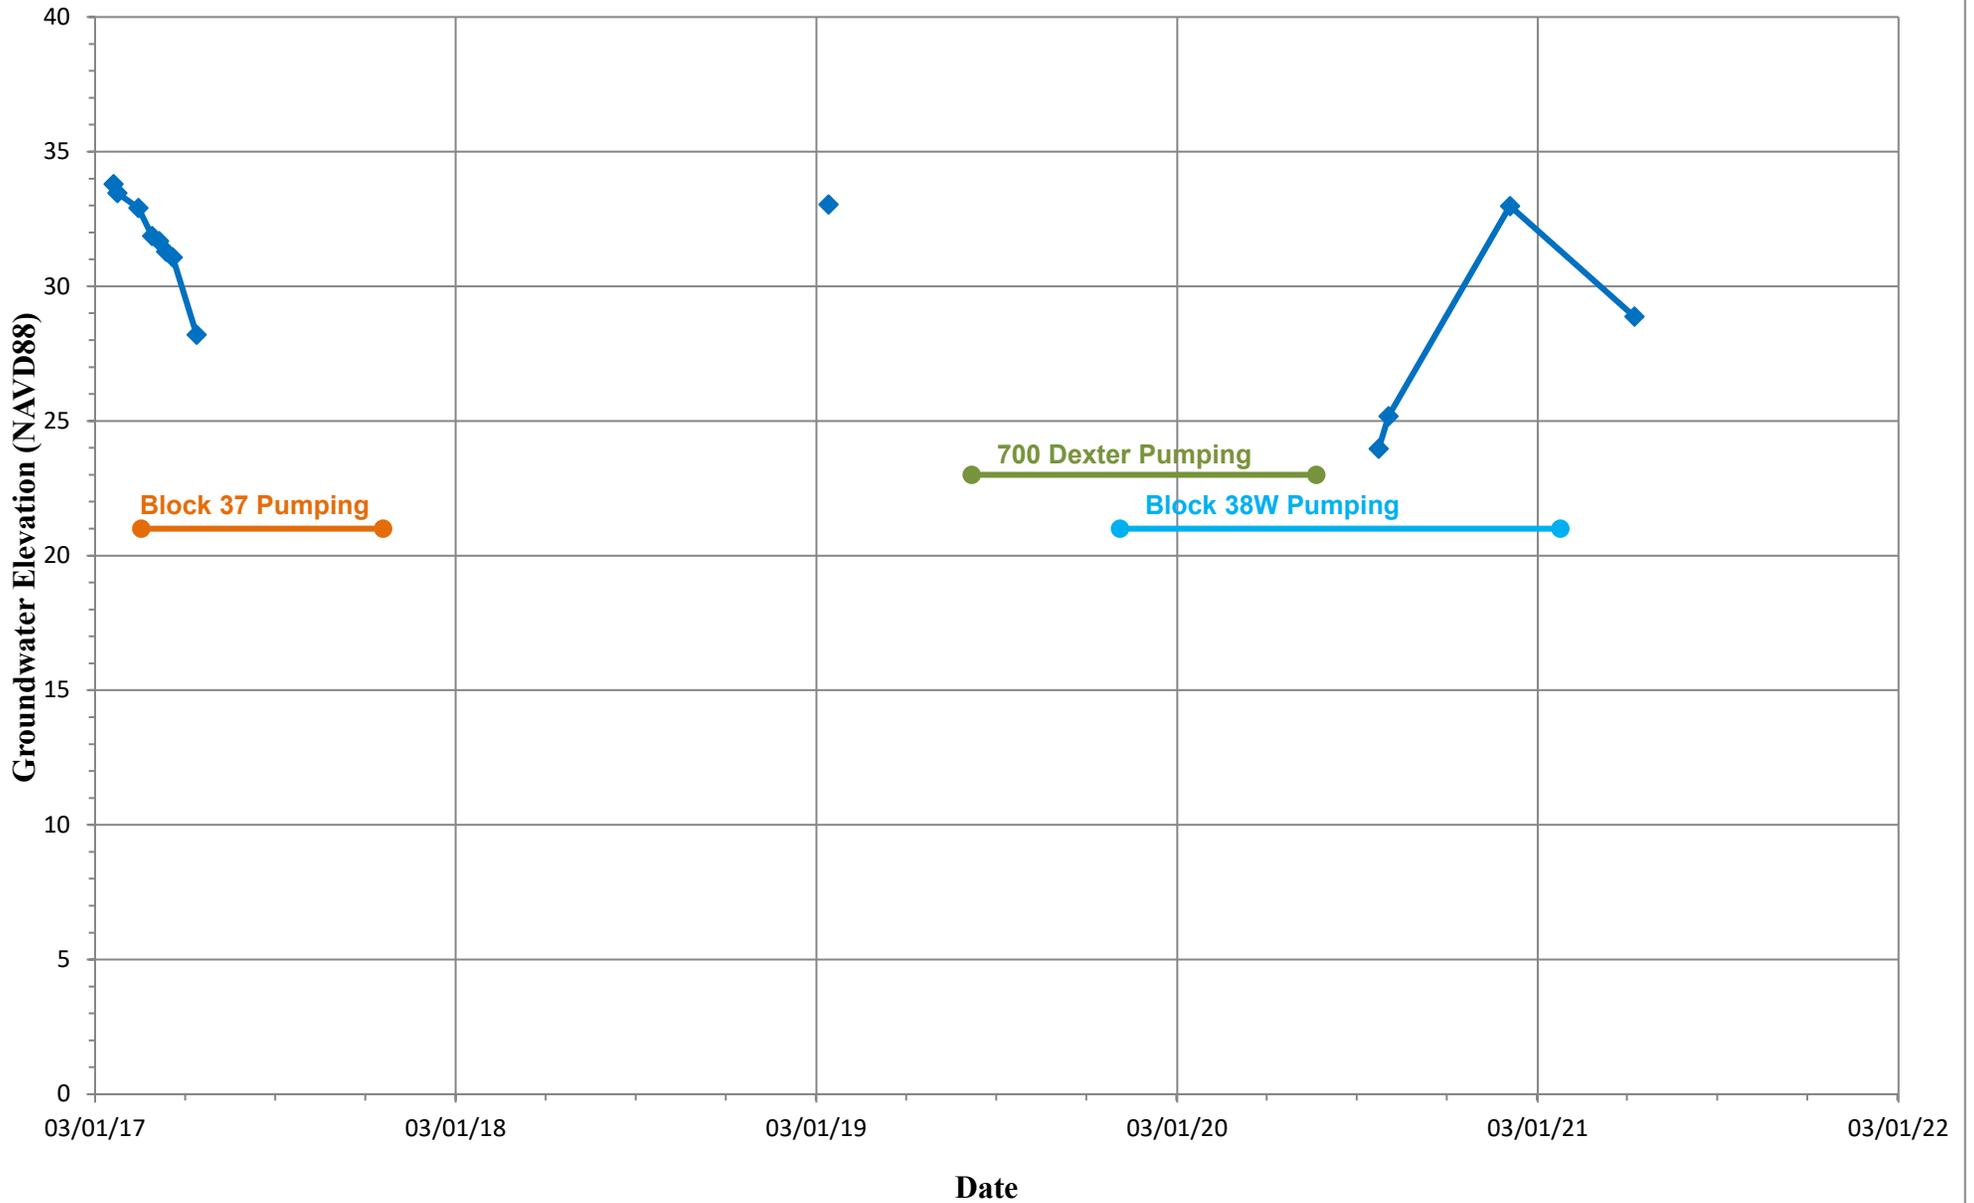


**Hydrograph**  
**SCL-MW101, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

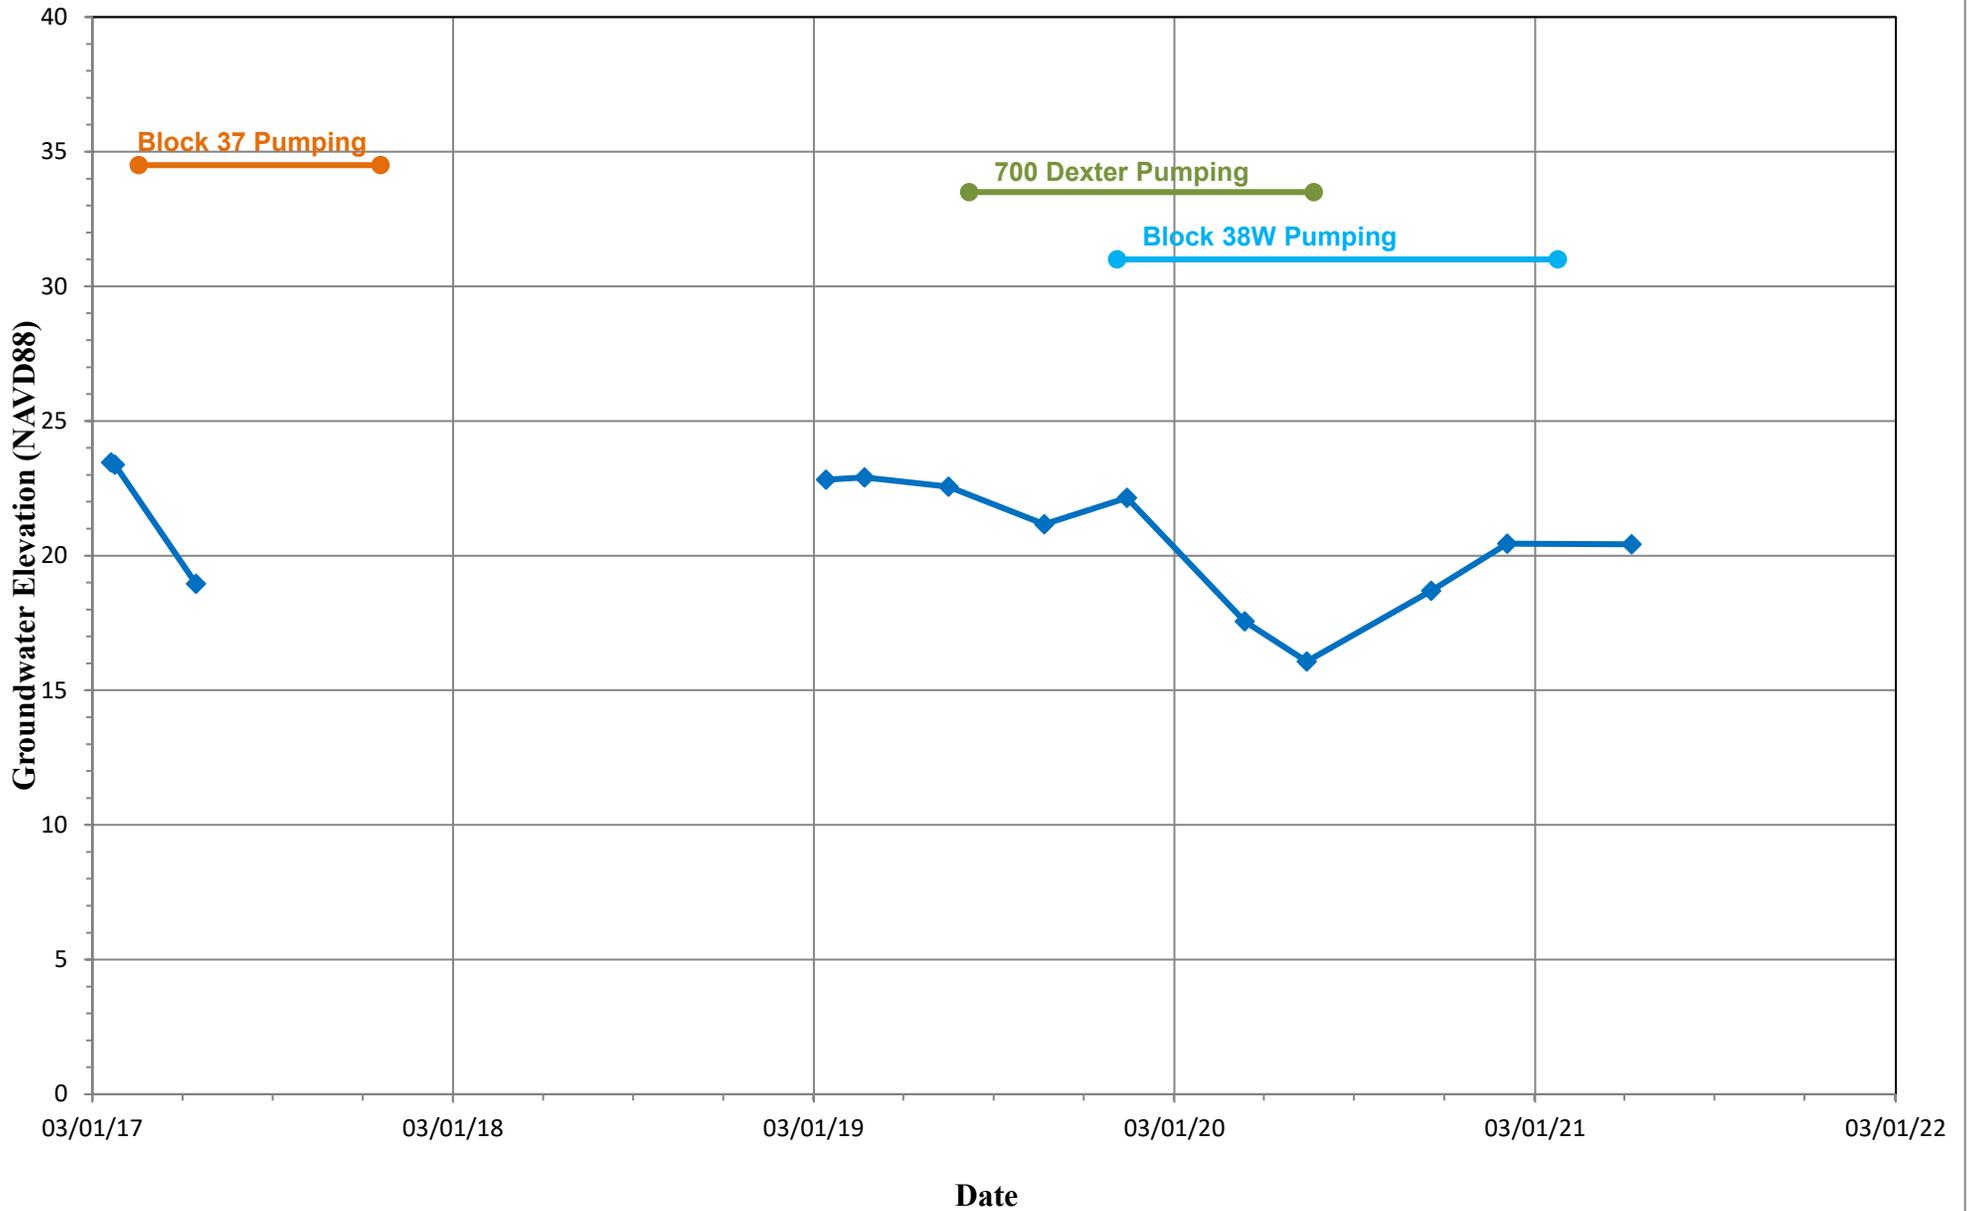


**Hydrograph**  
**SCL-MW105, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

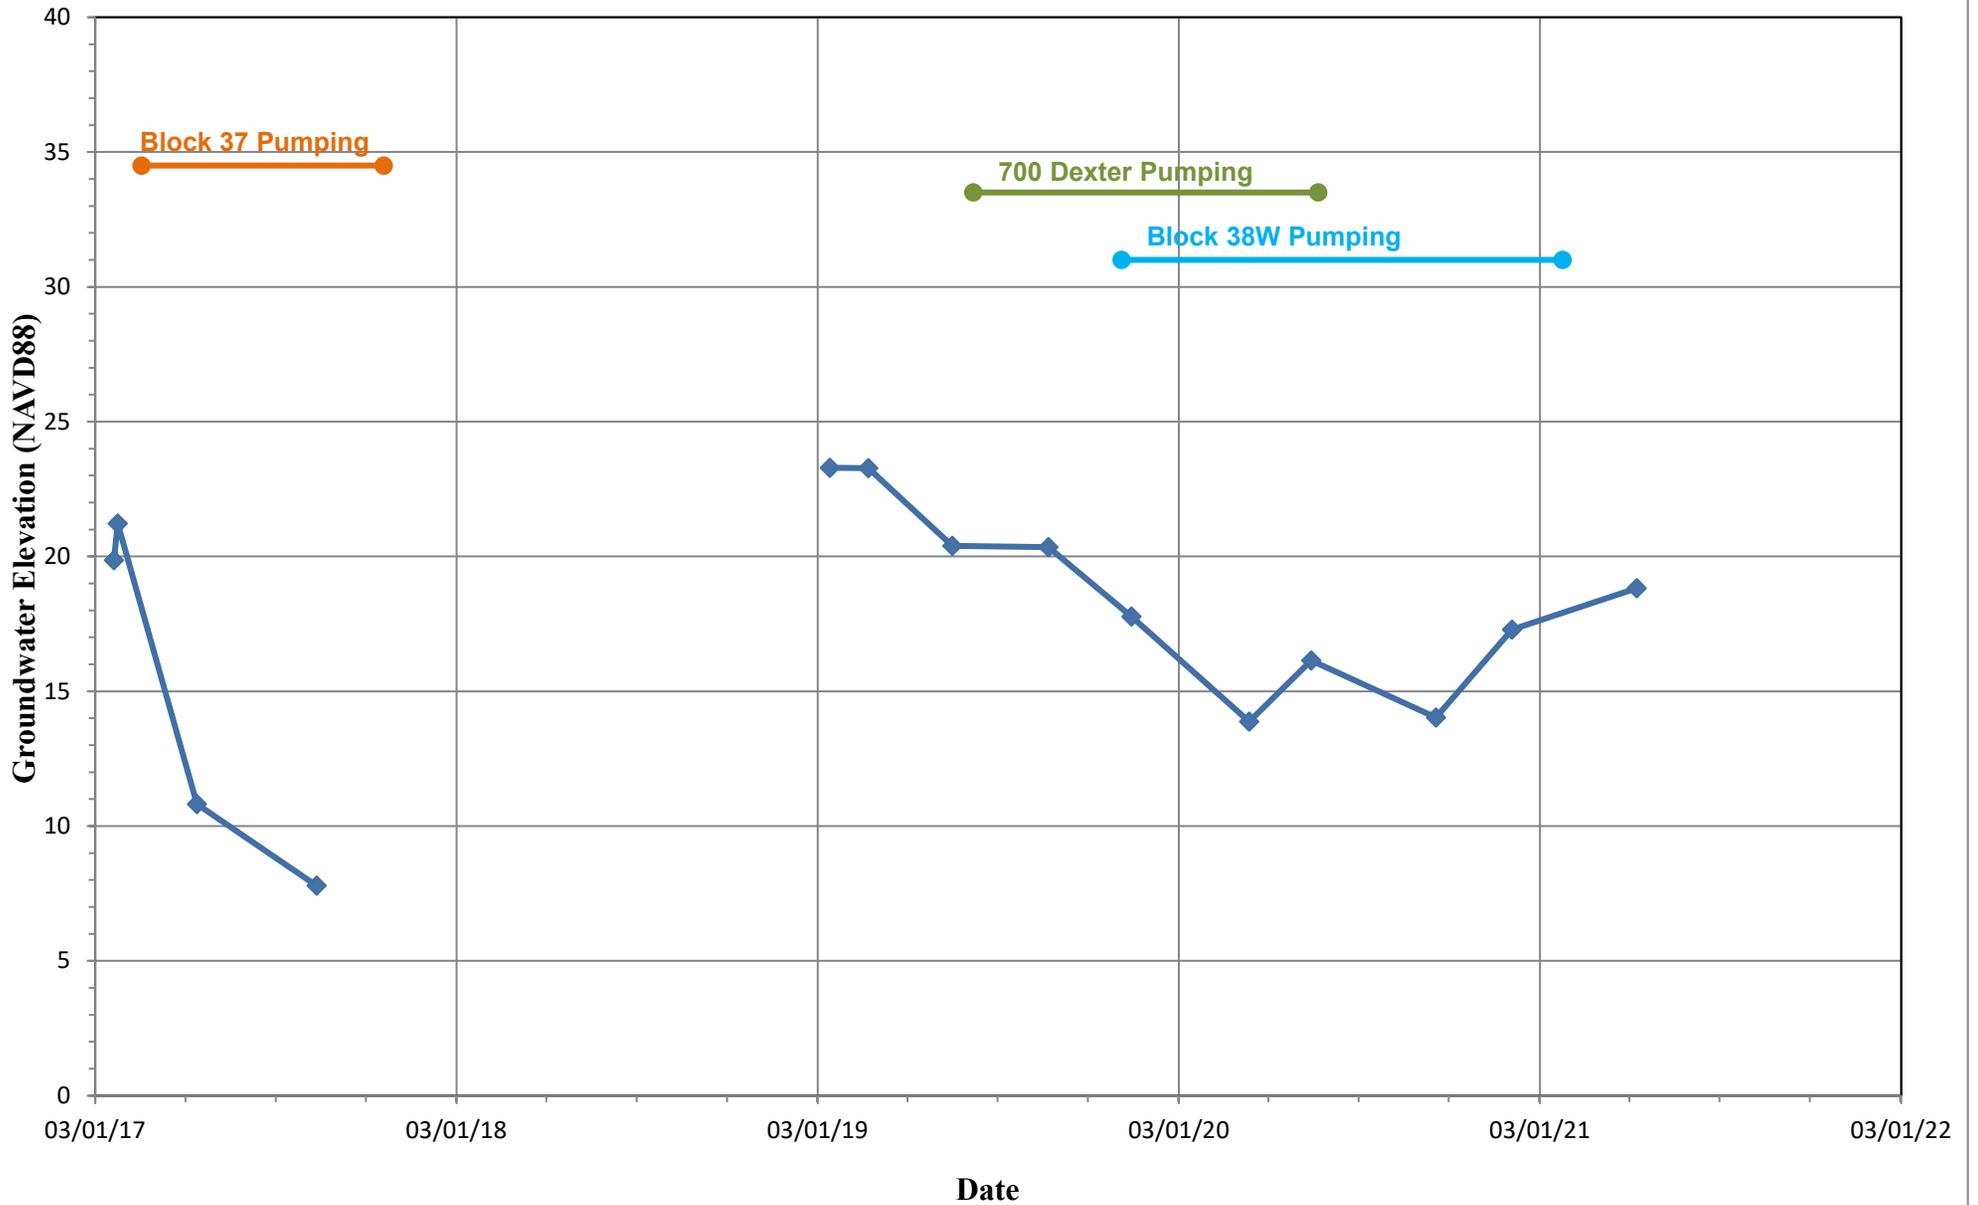


**Hydrograph**  
**SCS-2, Seattle Roy Aloha Shops, N end**  
**American Linen Supply Co Dexter Ave Site**

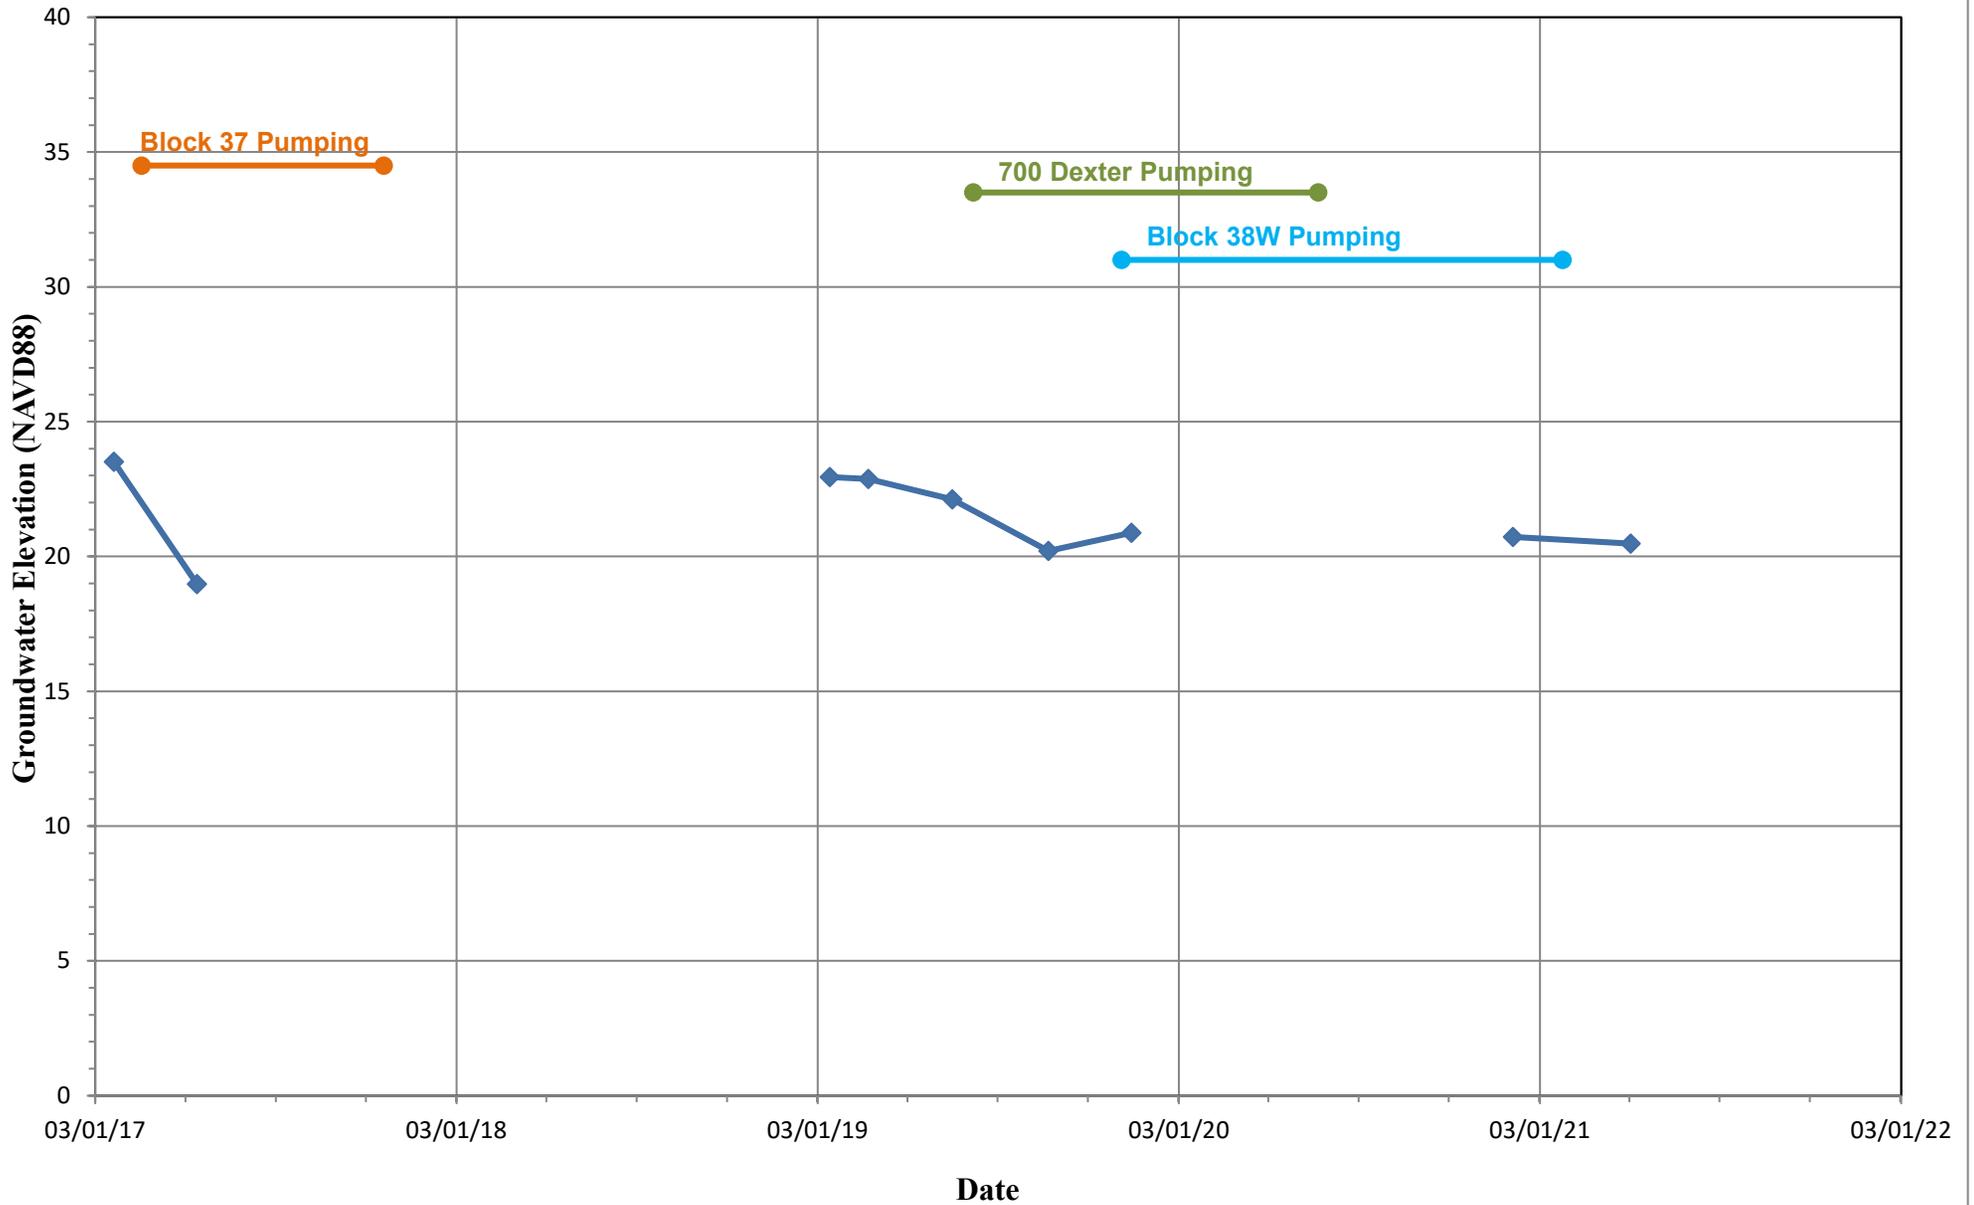


**Hydrograph**  
**BB-8, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

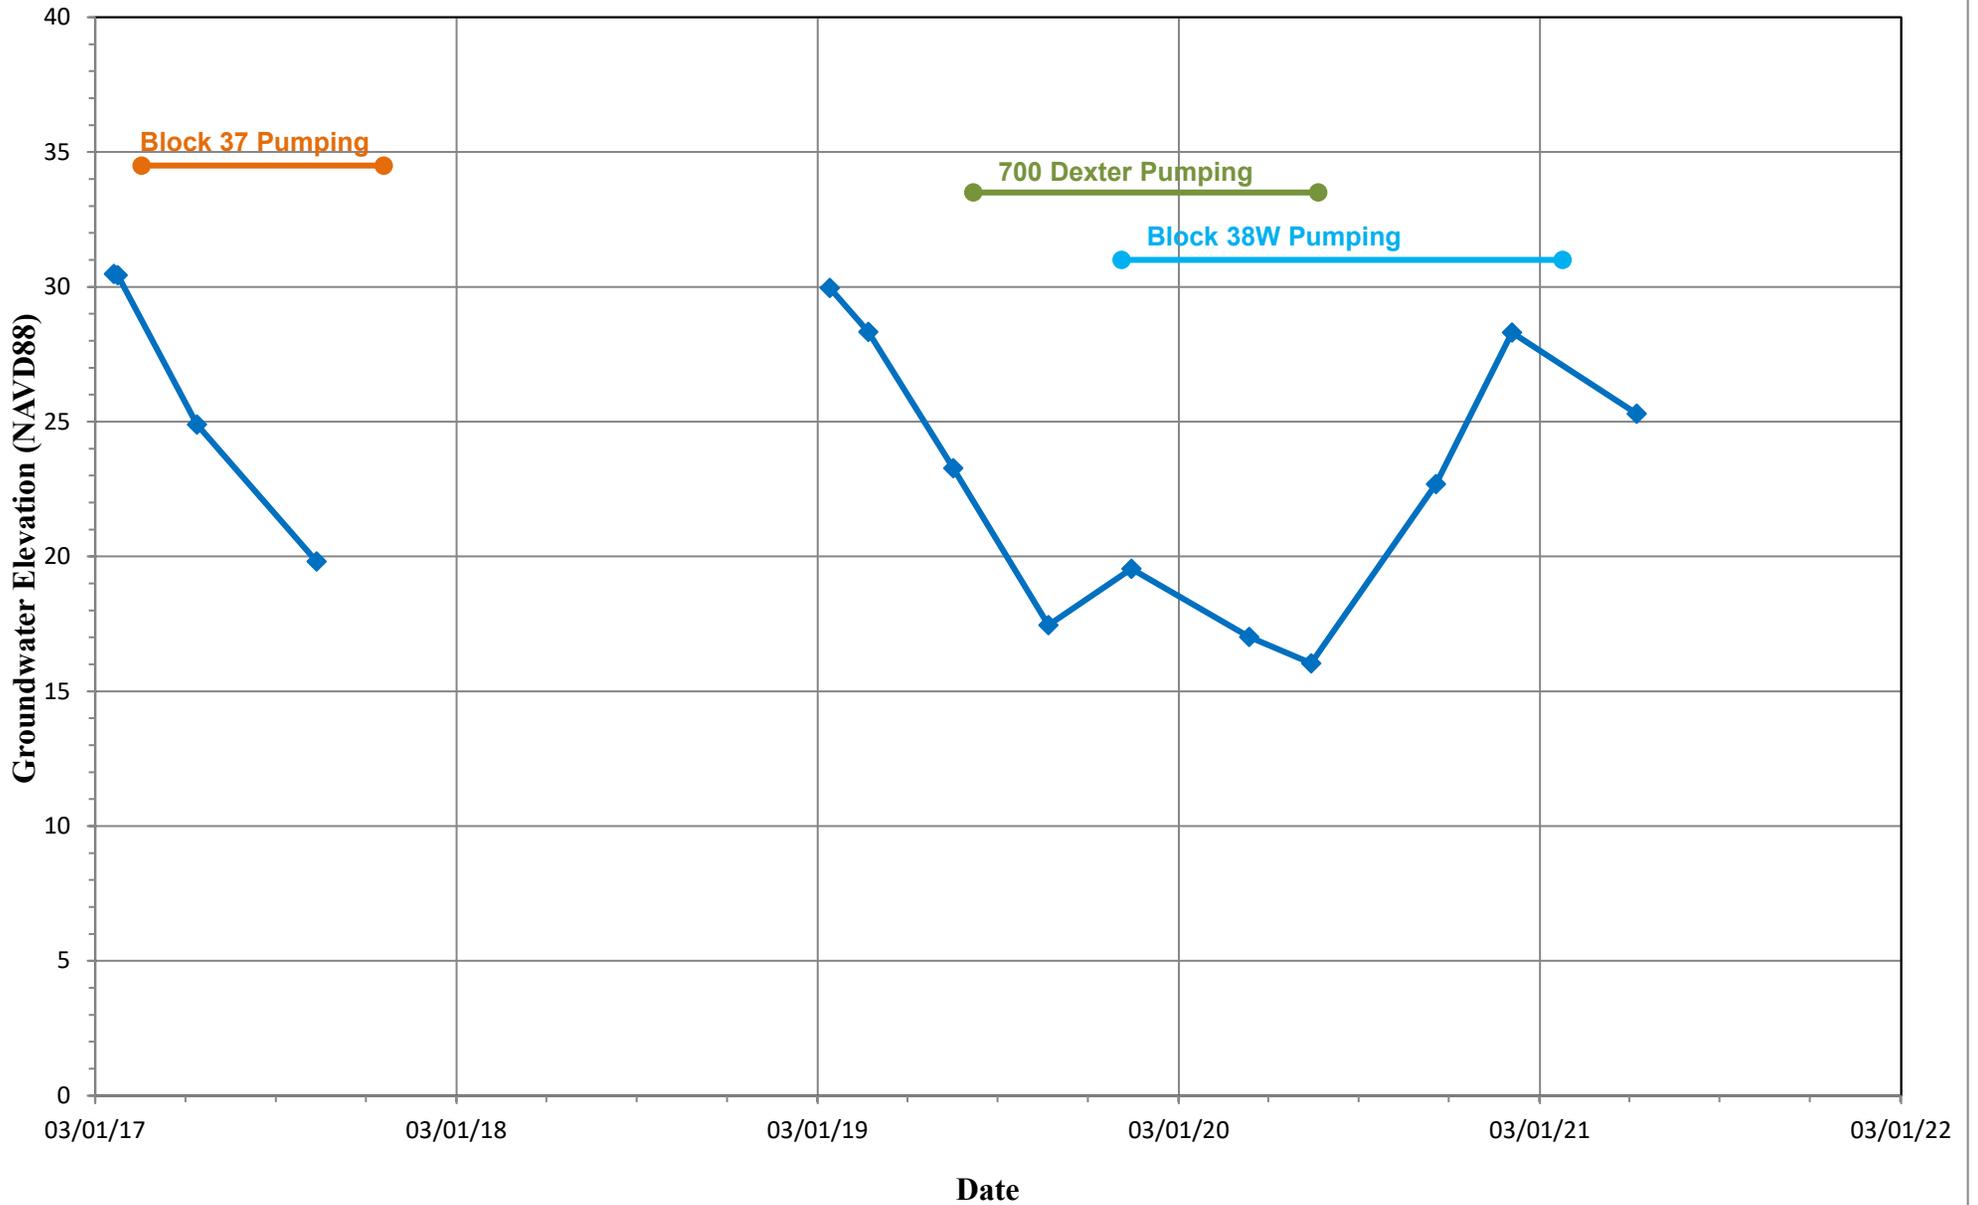


**Hydrograph**  
**MW107, 8th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

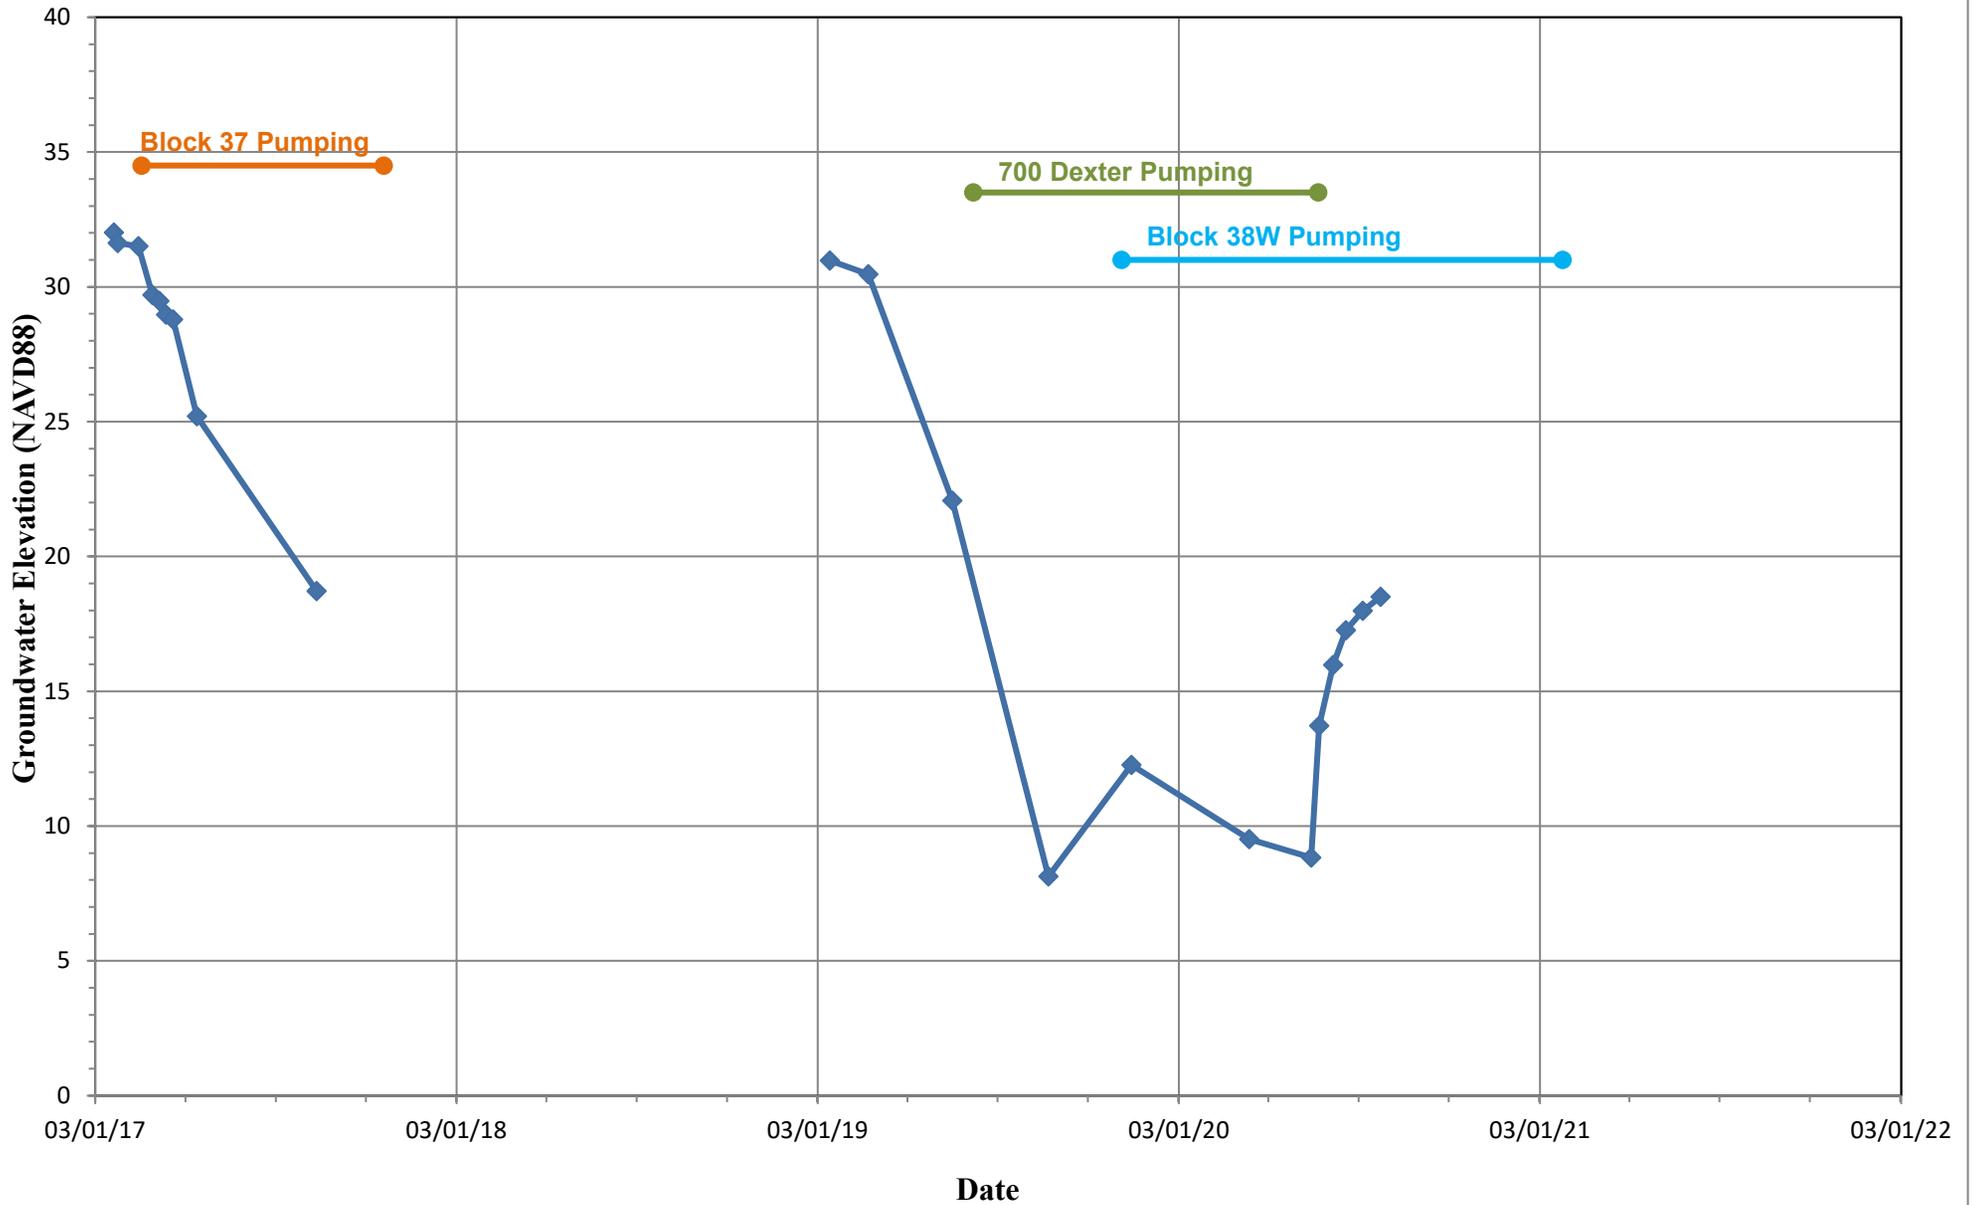


**Hydrograph**  
**MW108, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

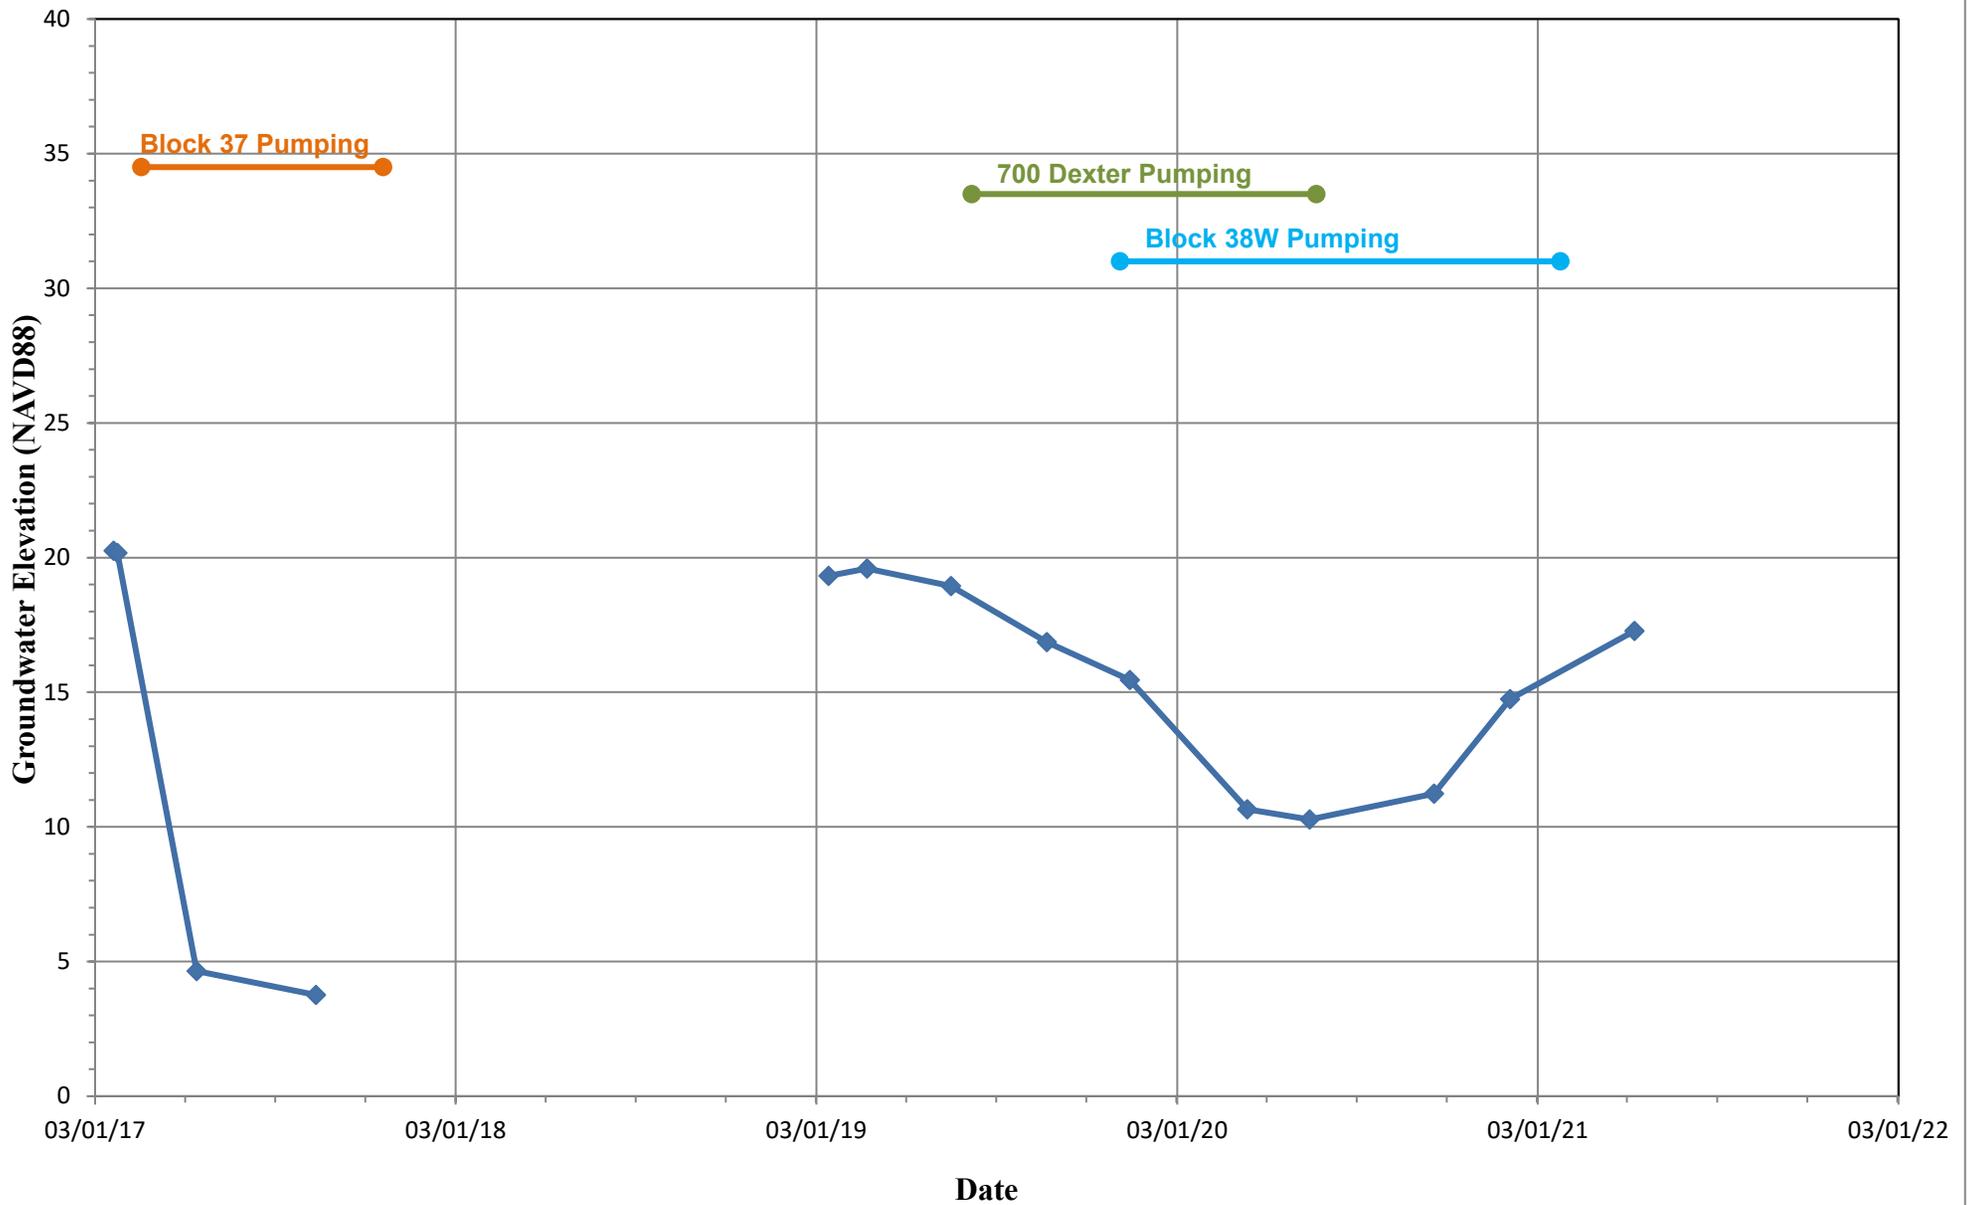


**Hydrograph**  
**MW109, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

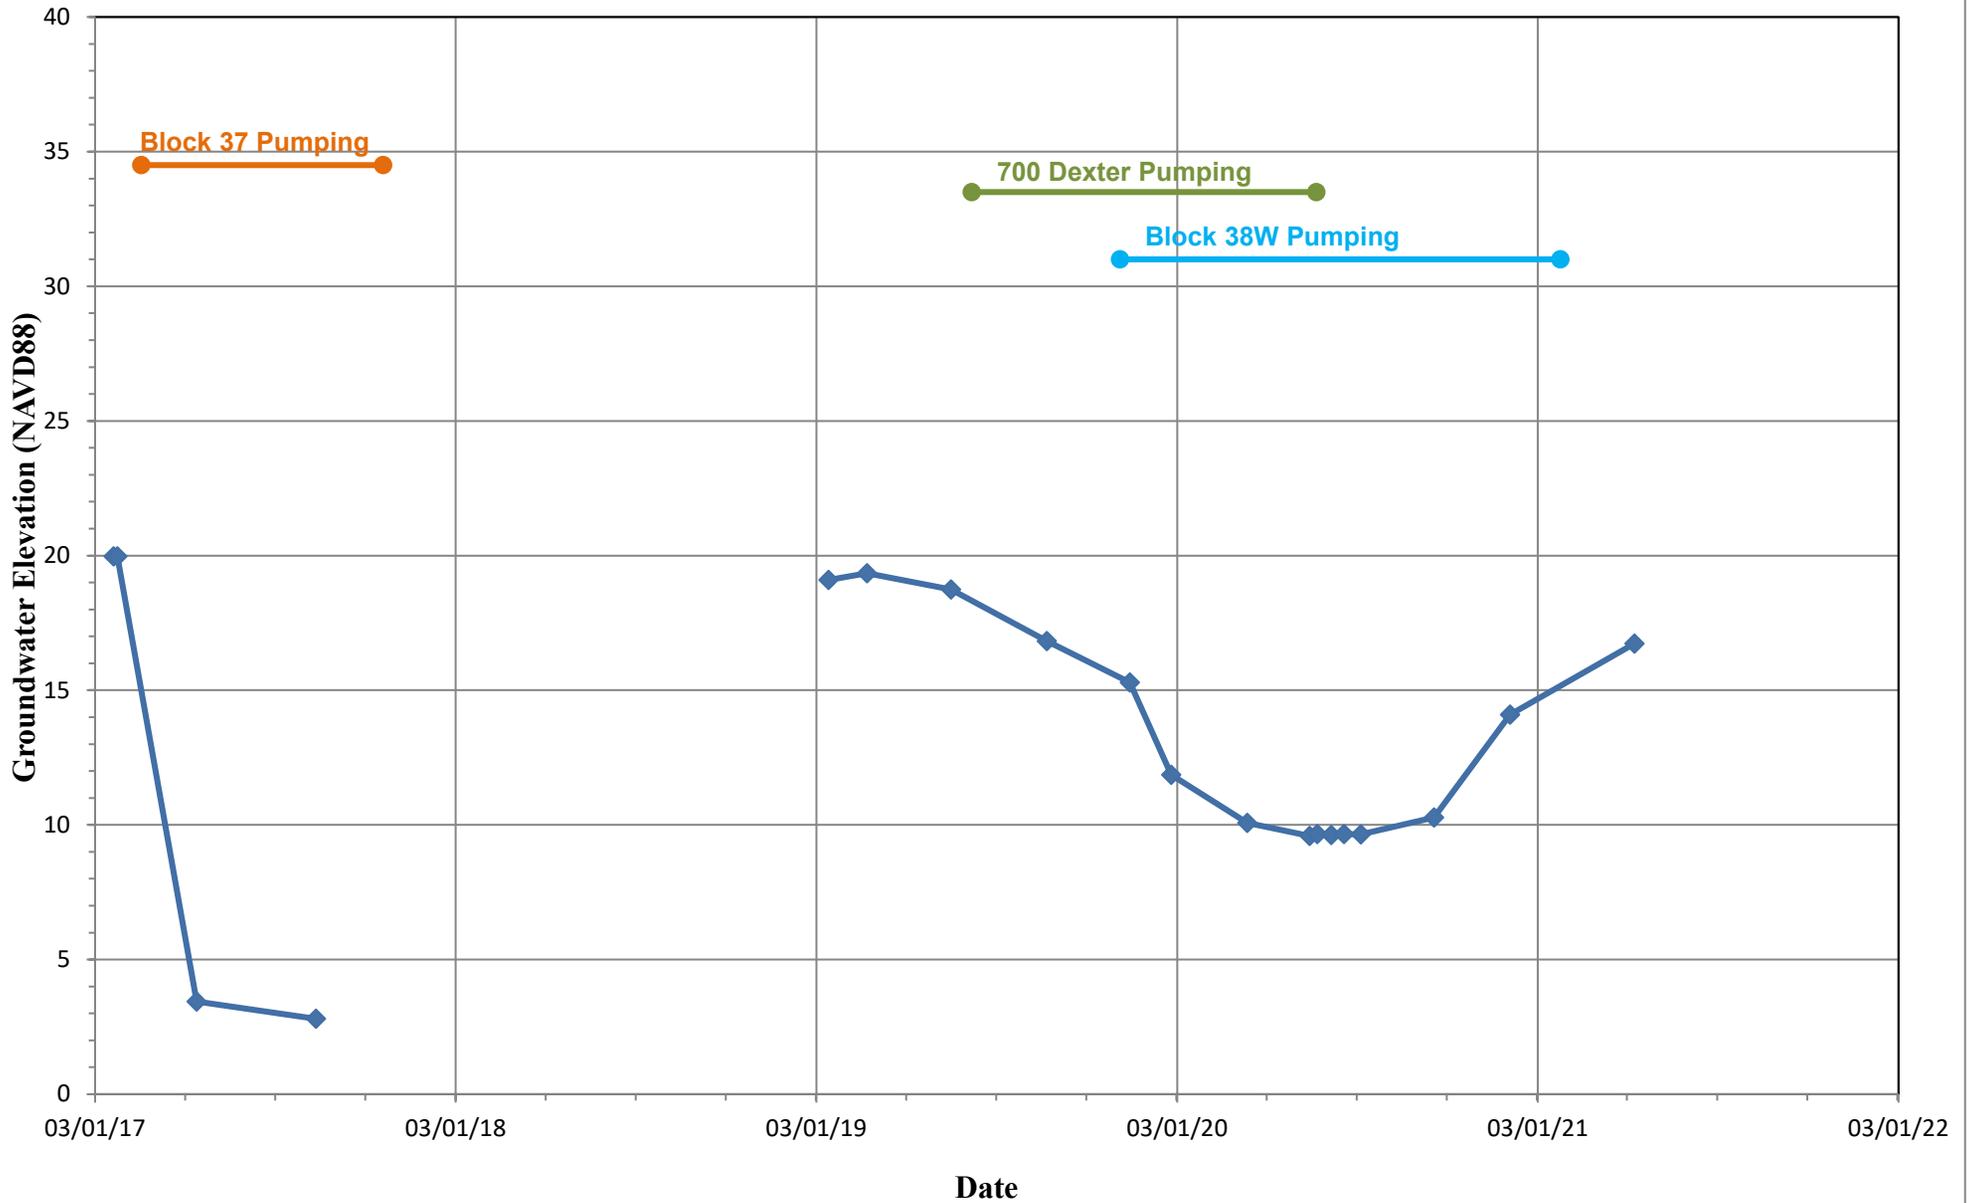


**Hydrograph**  
**MW110, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

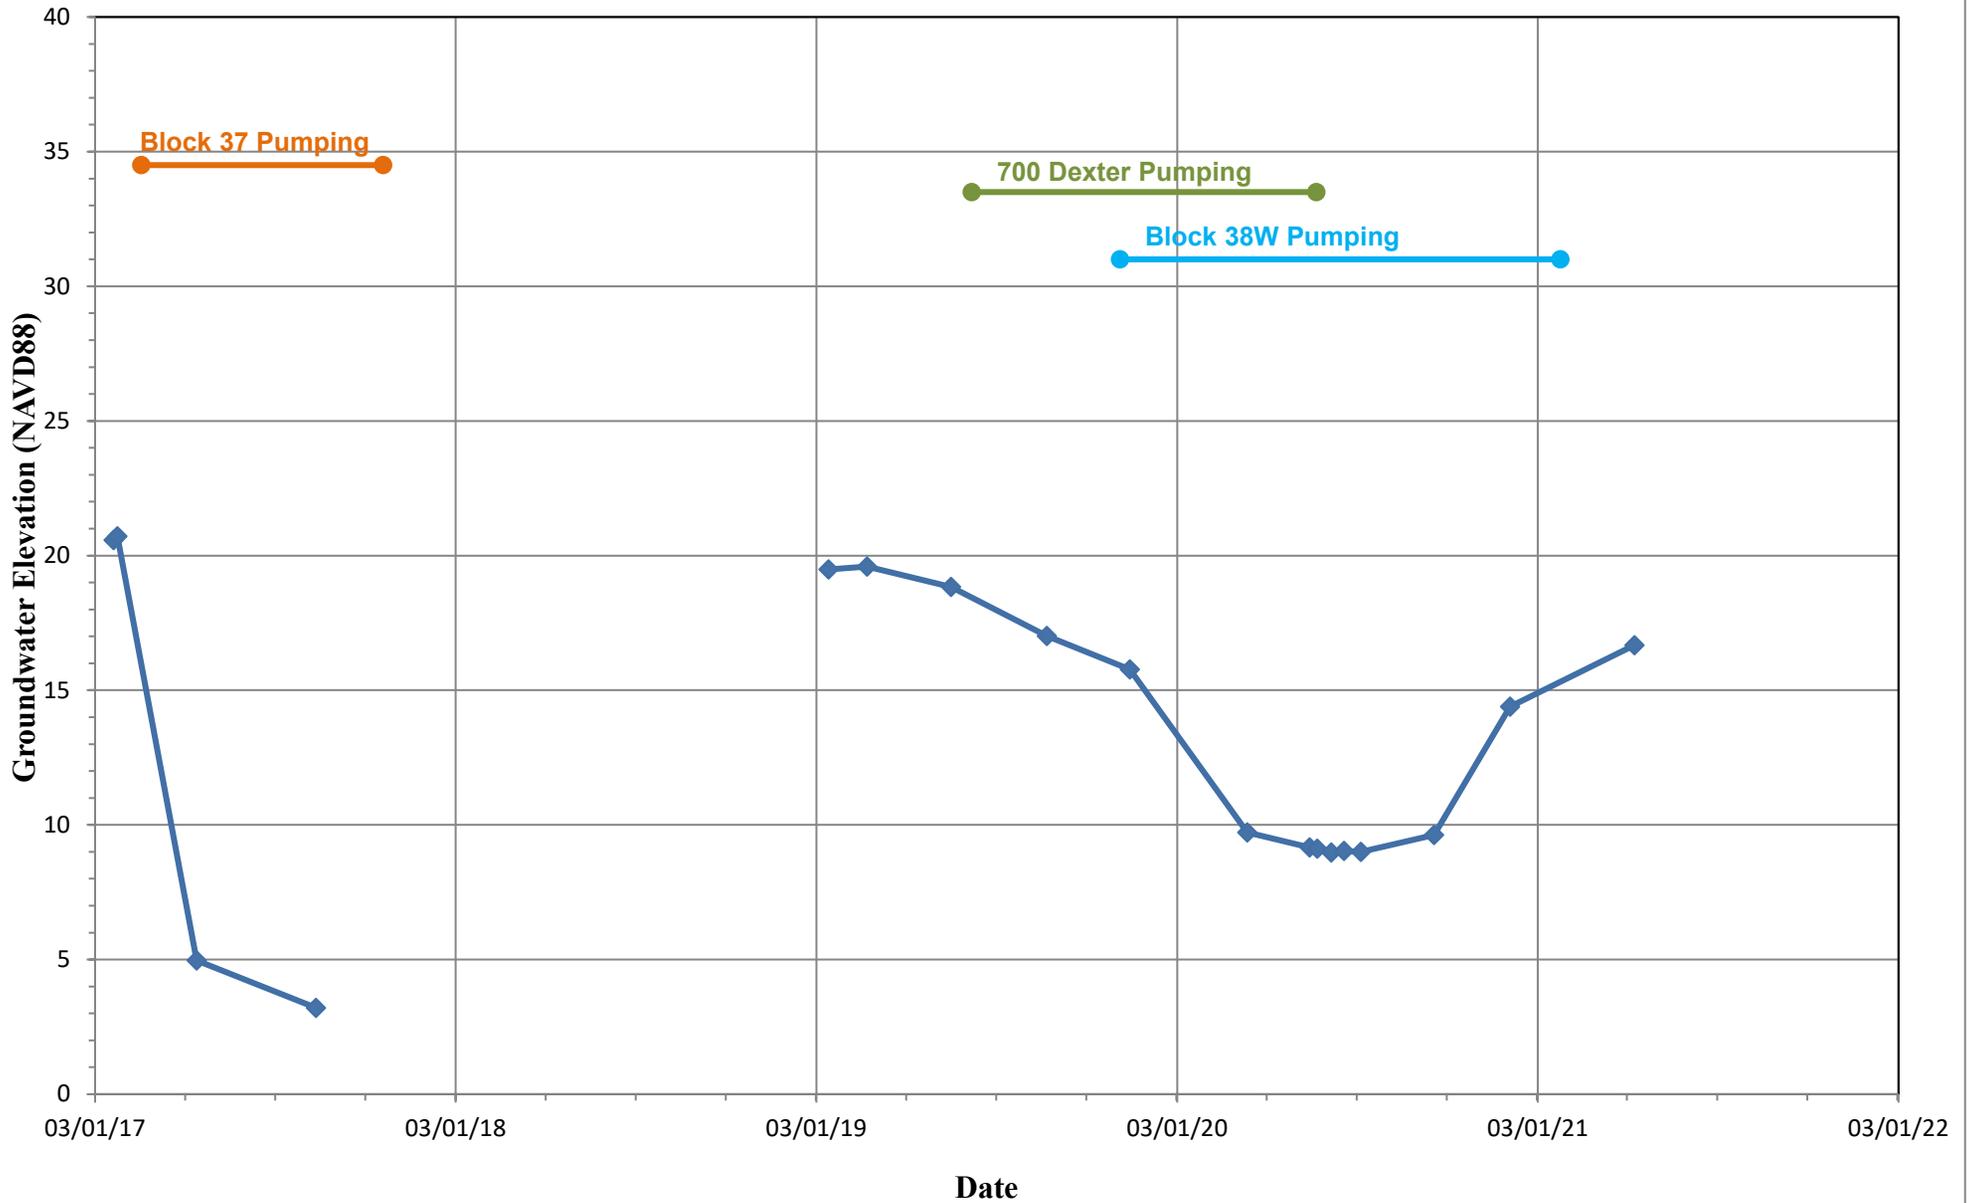


**Hydrograph**  
**MW115, 9th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

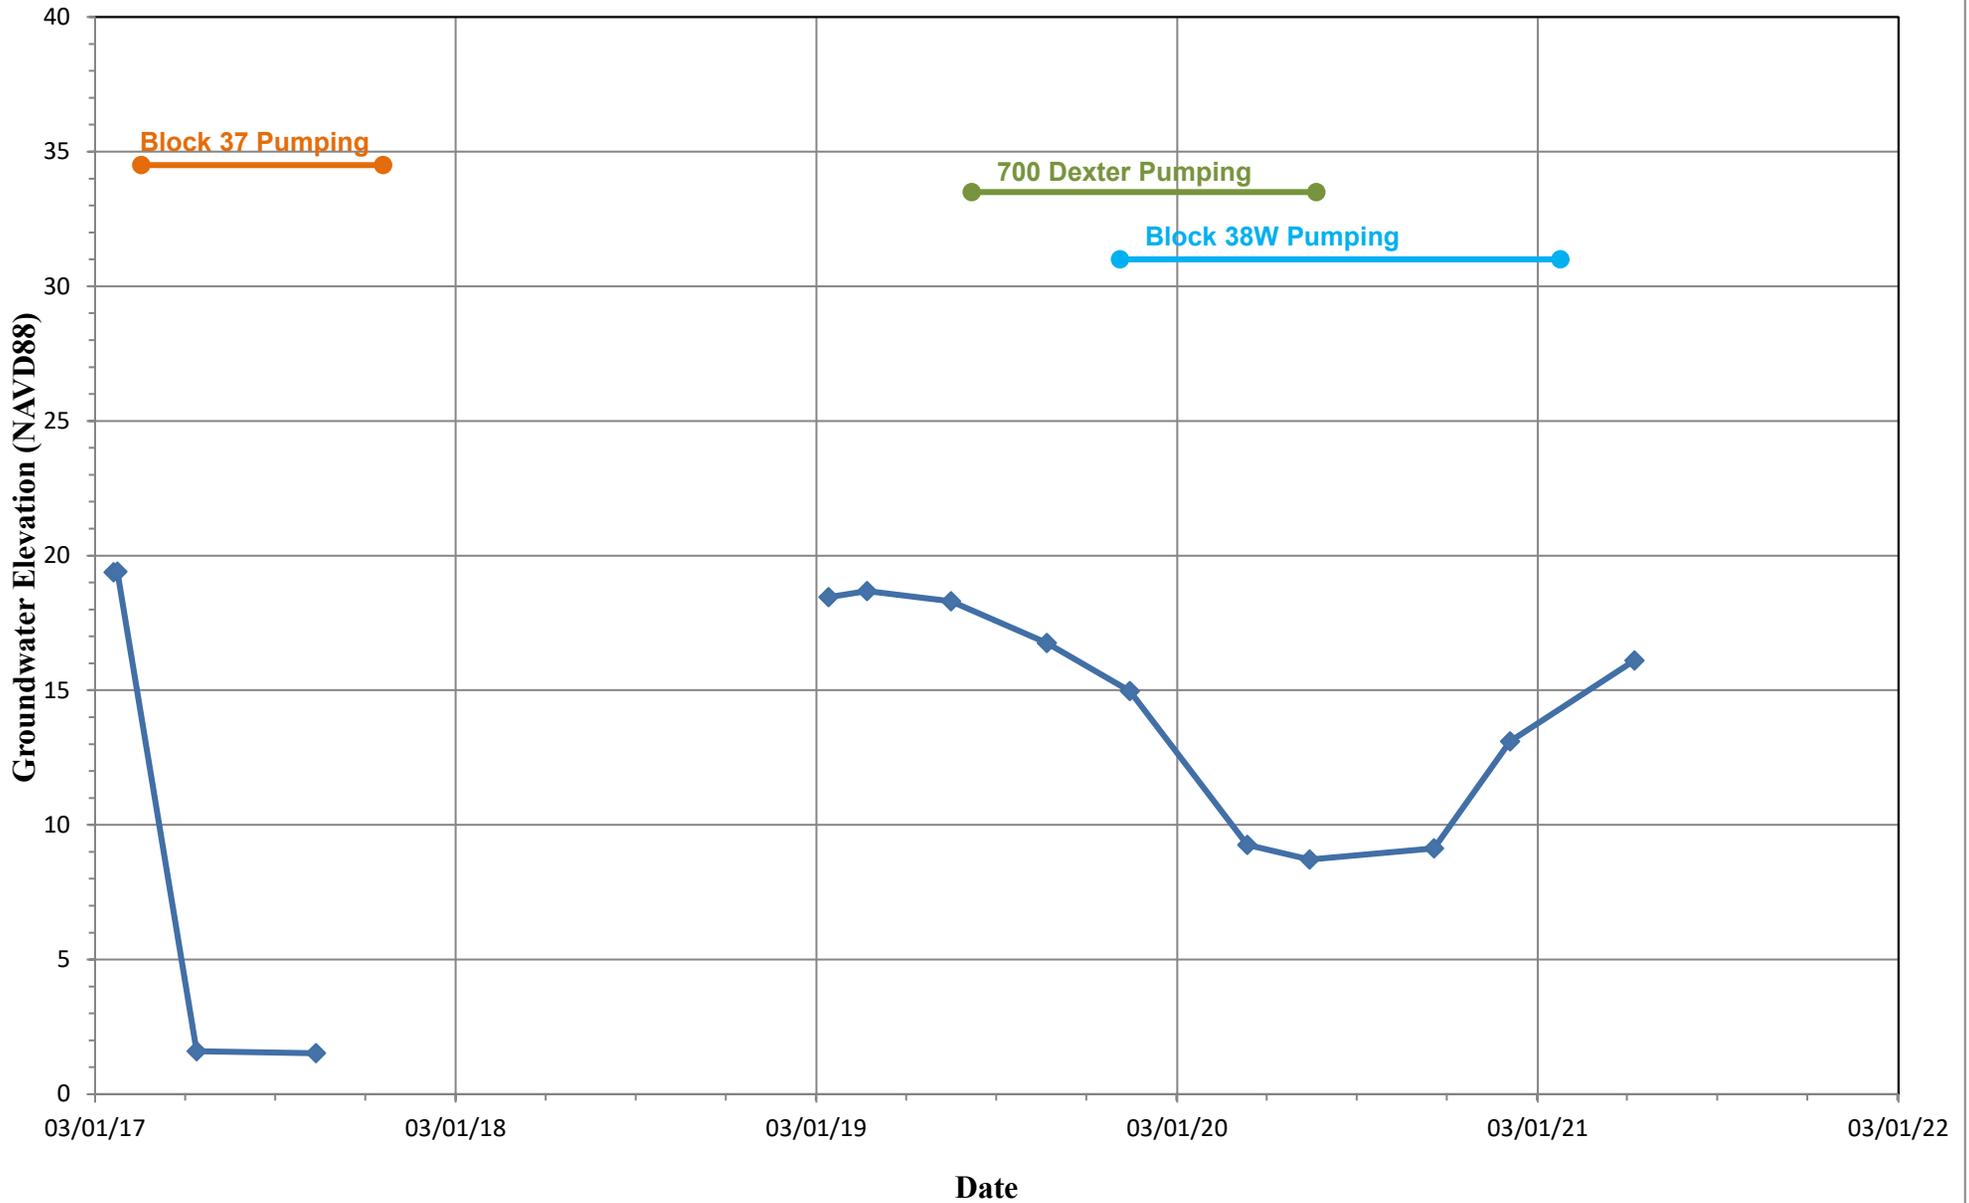


**Hydrograph**  
**MW116, 9th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

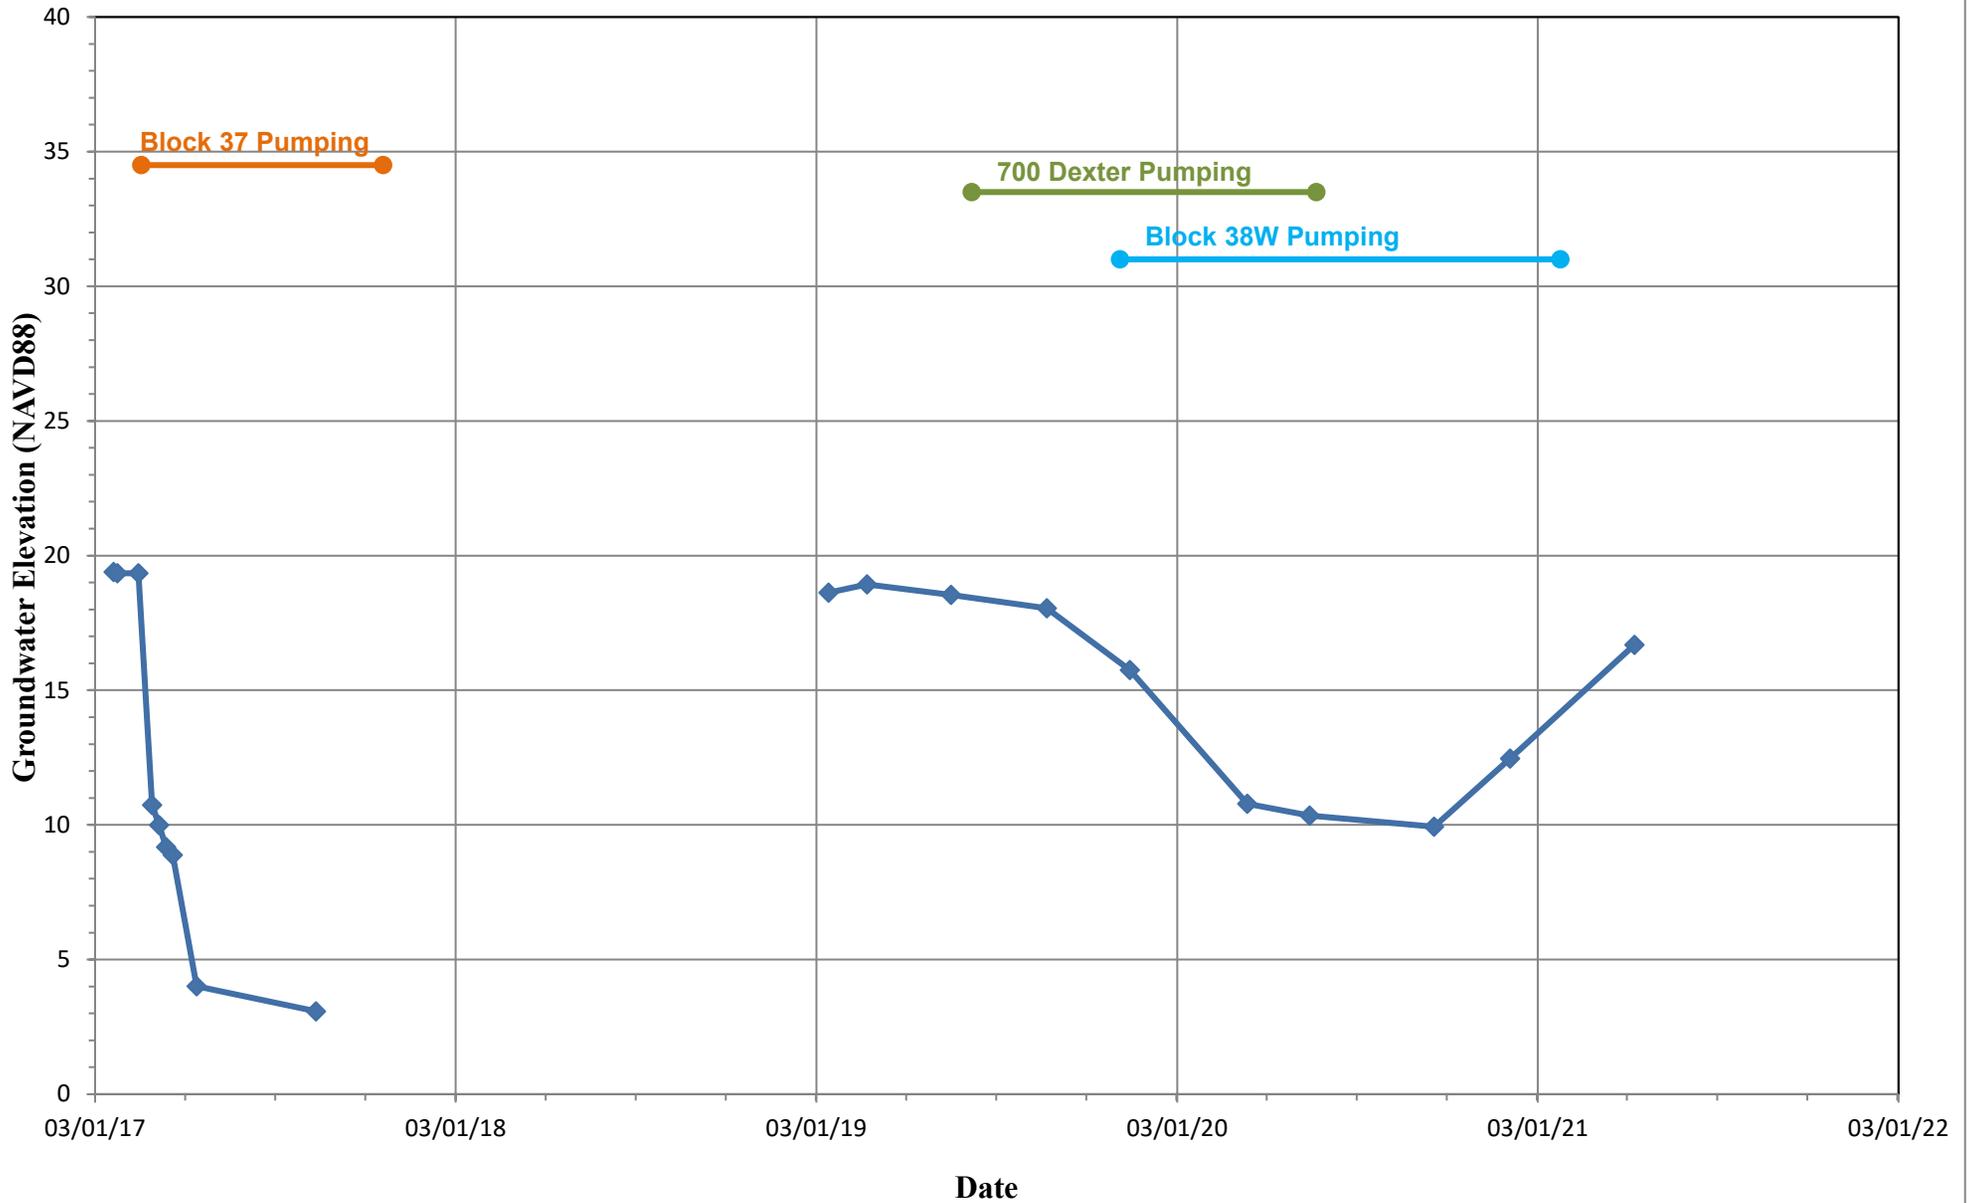


**Hydrograph**  
**MW119, 9th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

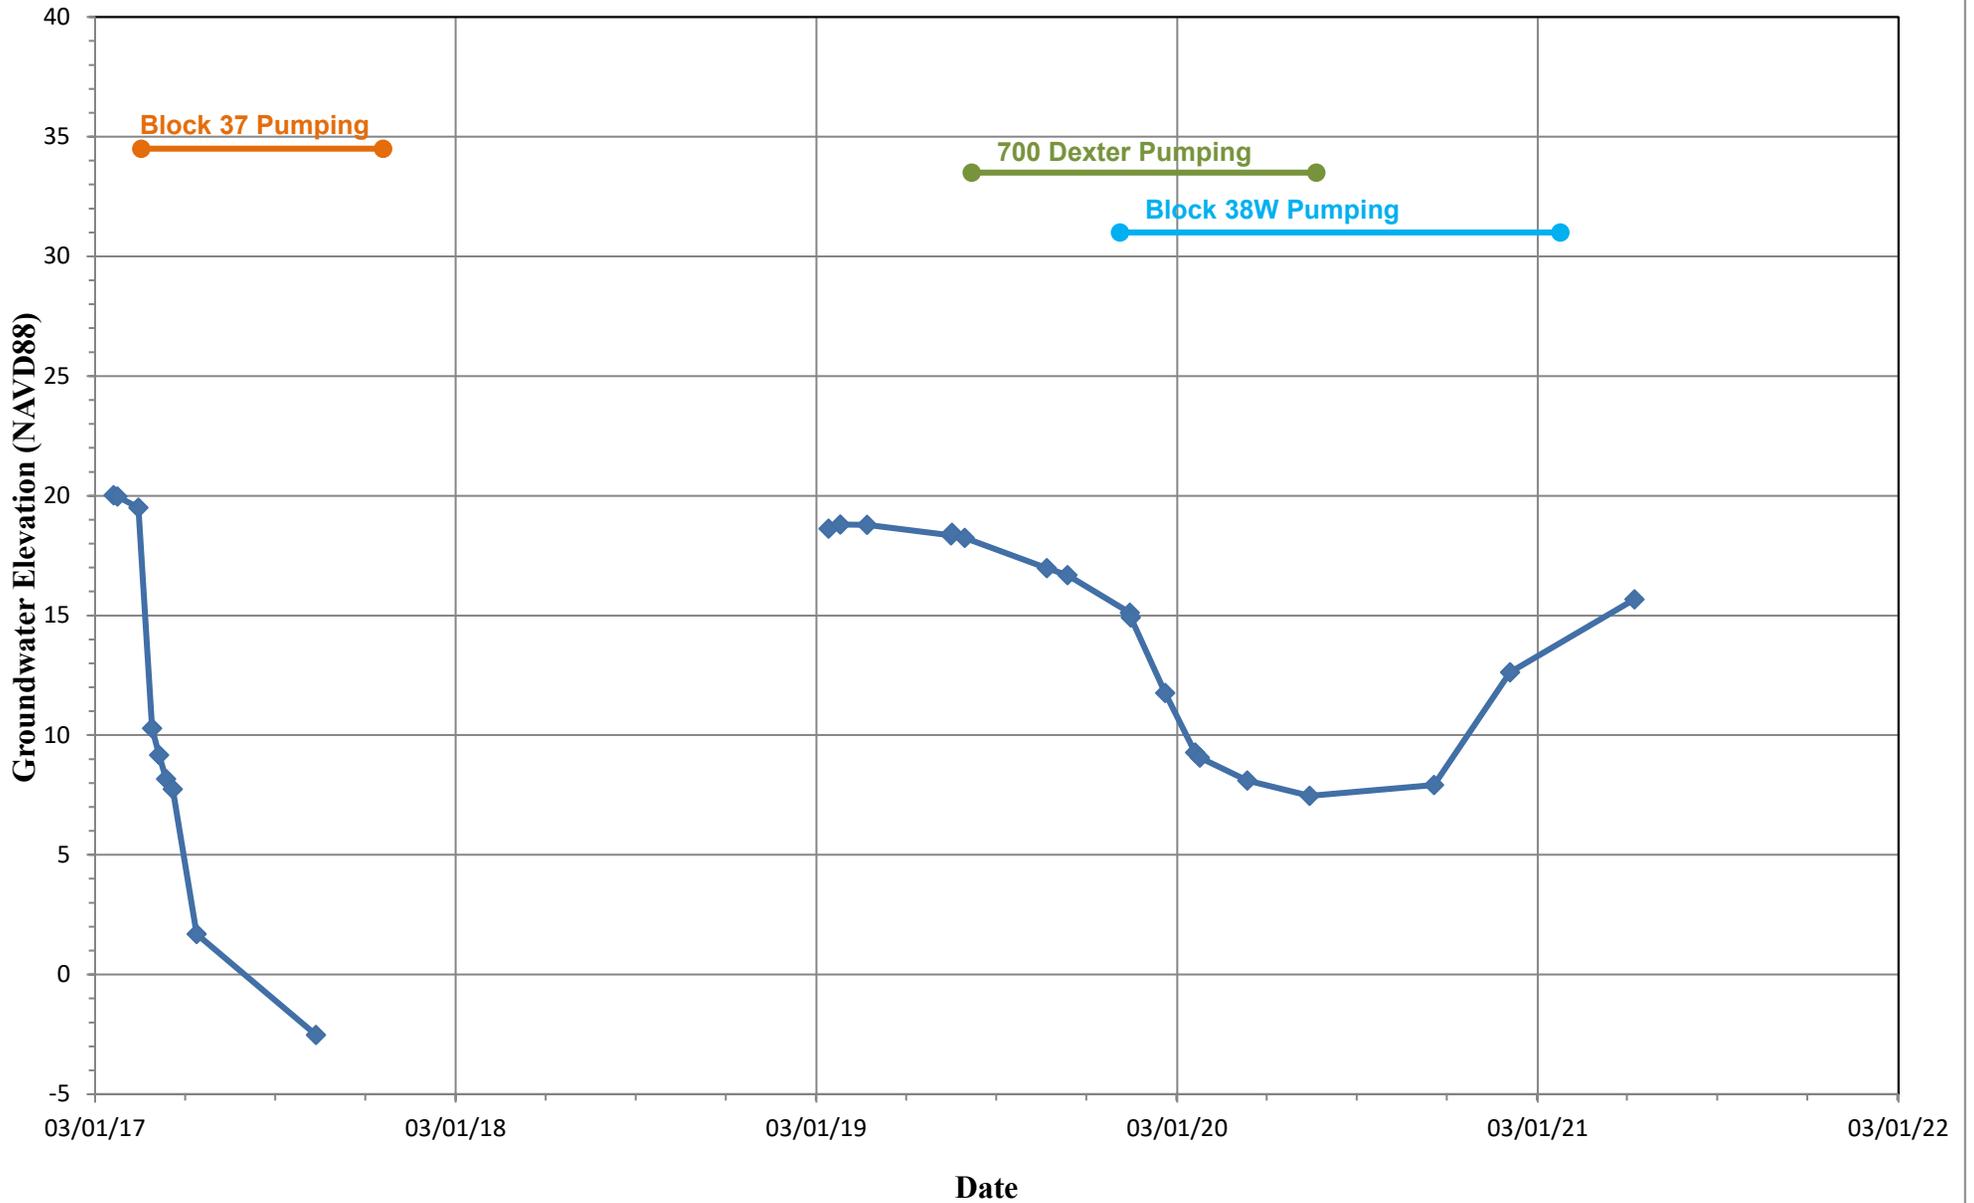


**Hydrograph**  
**MW120, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

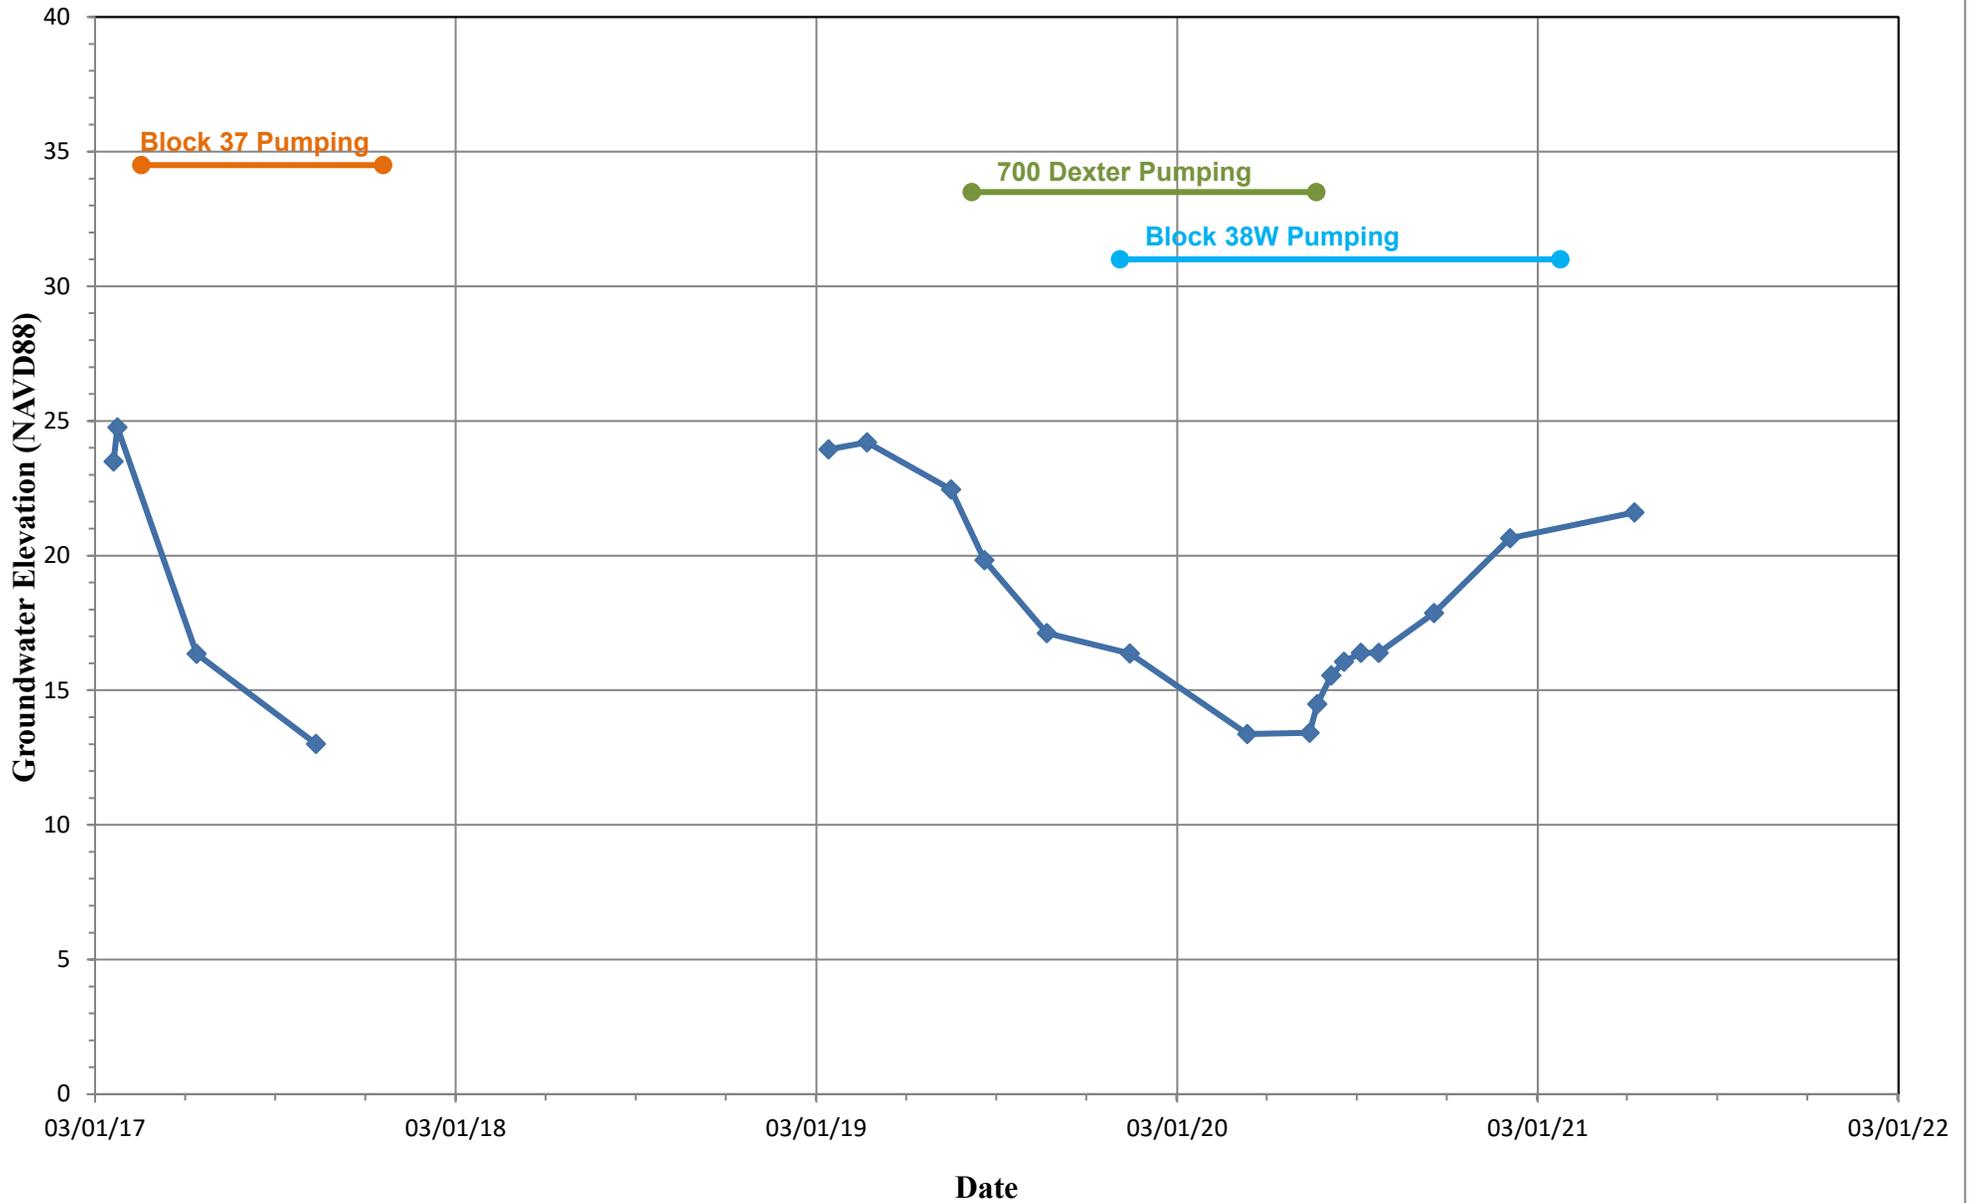


**Hydrograph**  
**MW127, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

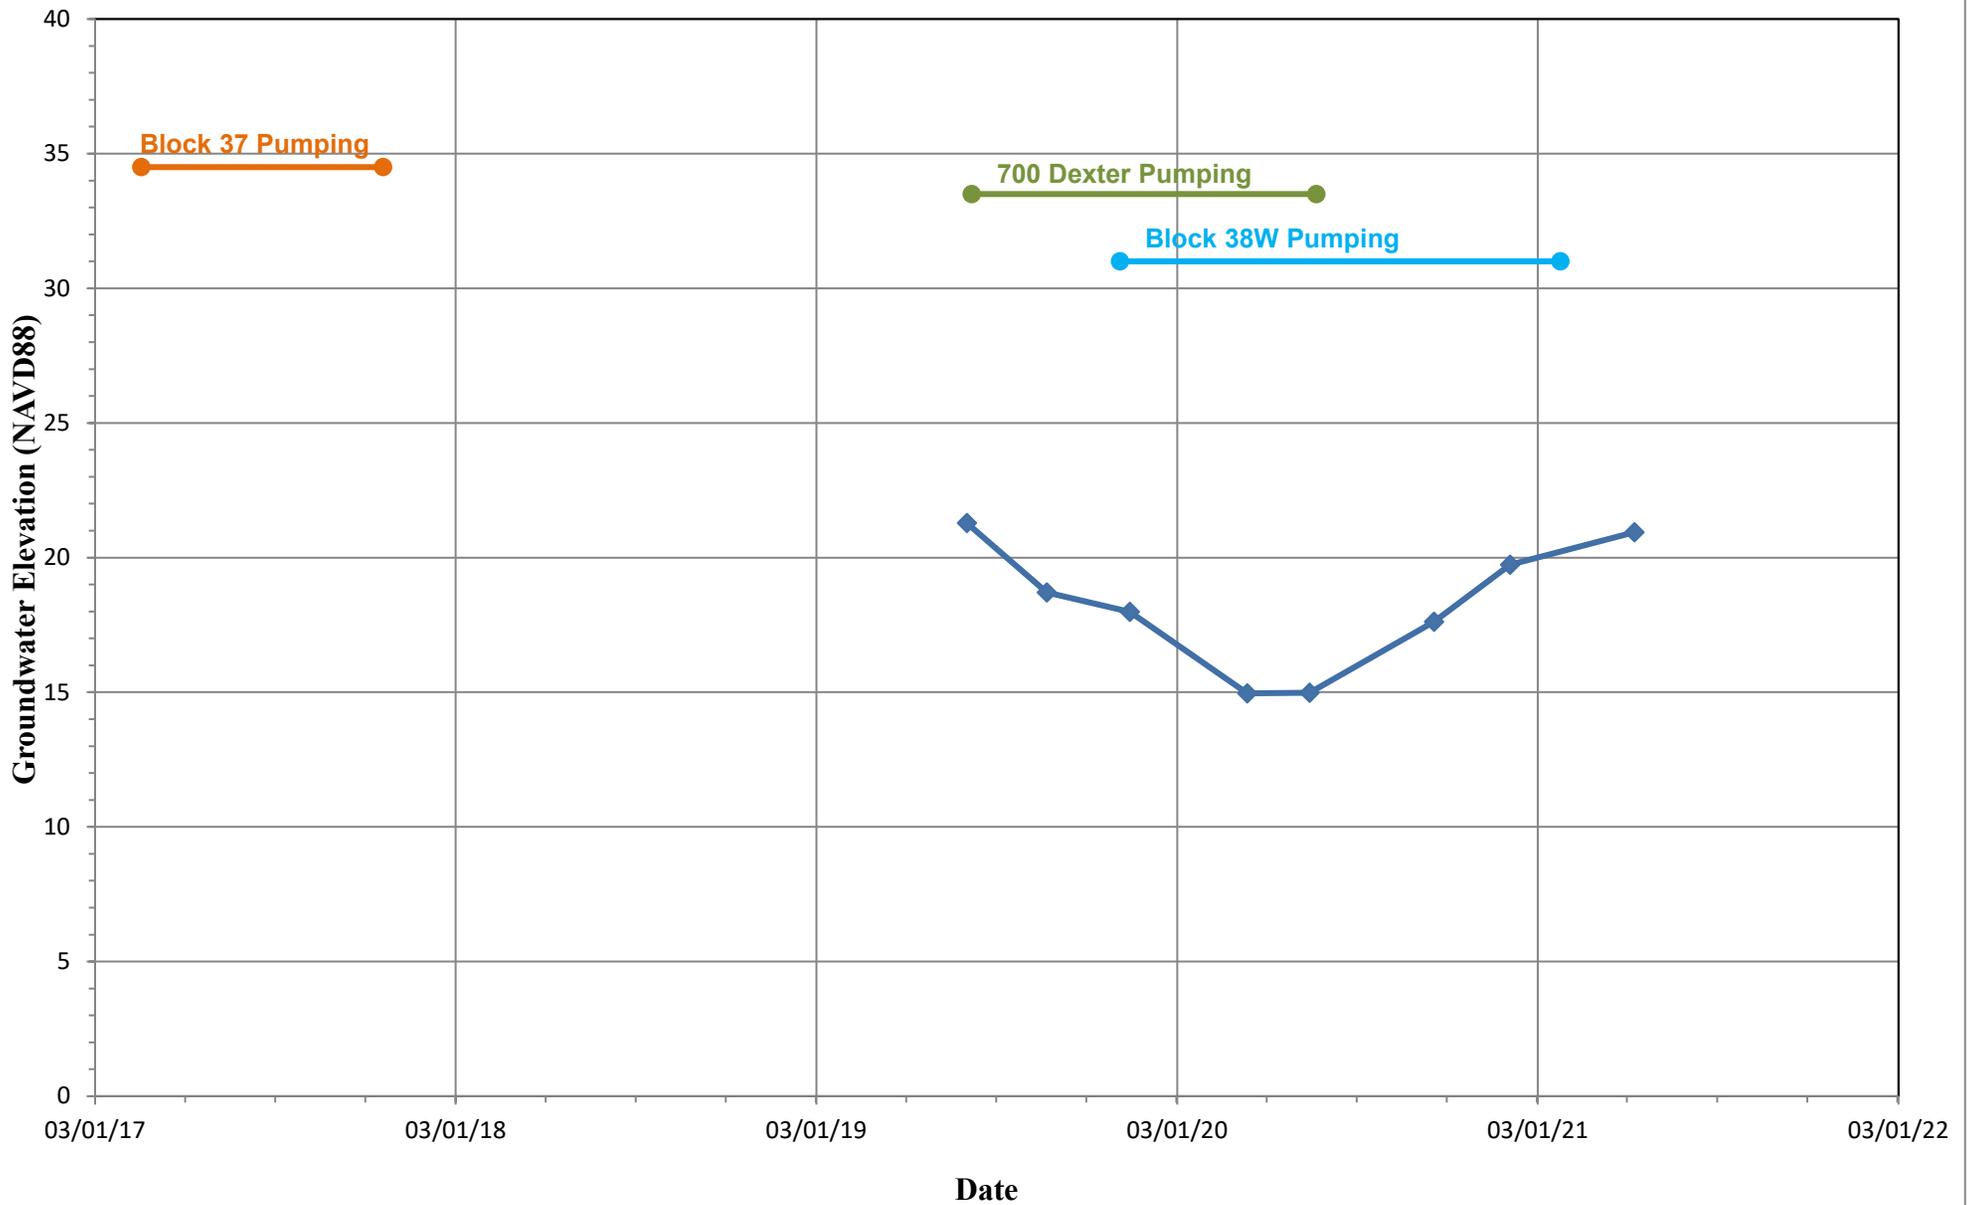


**Hydrograph**  
**MW-142, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

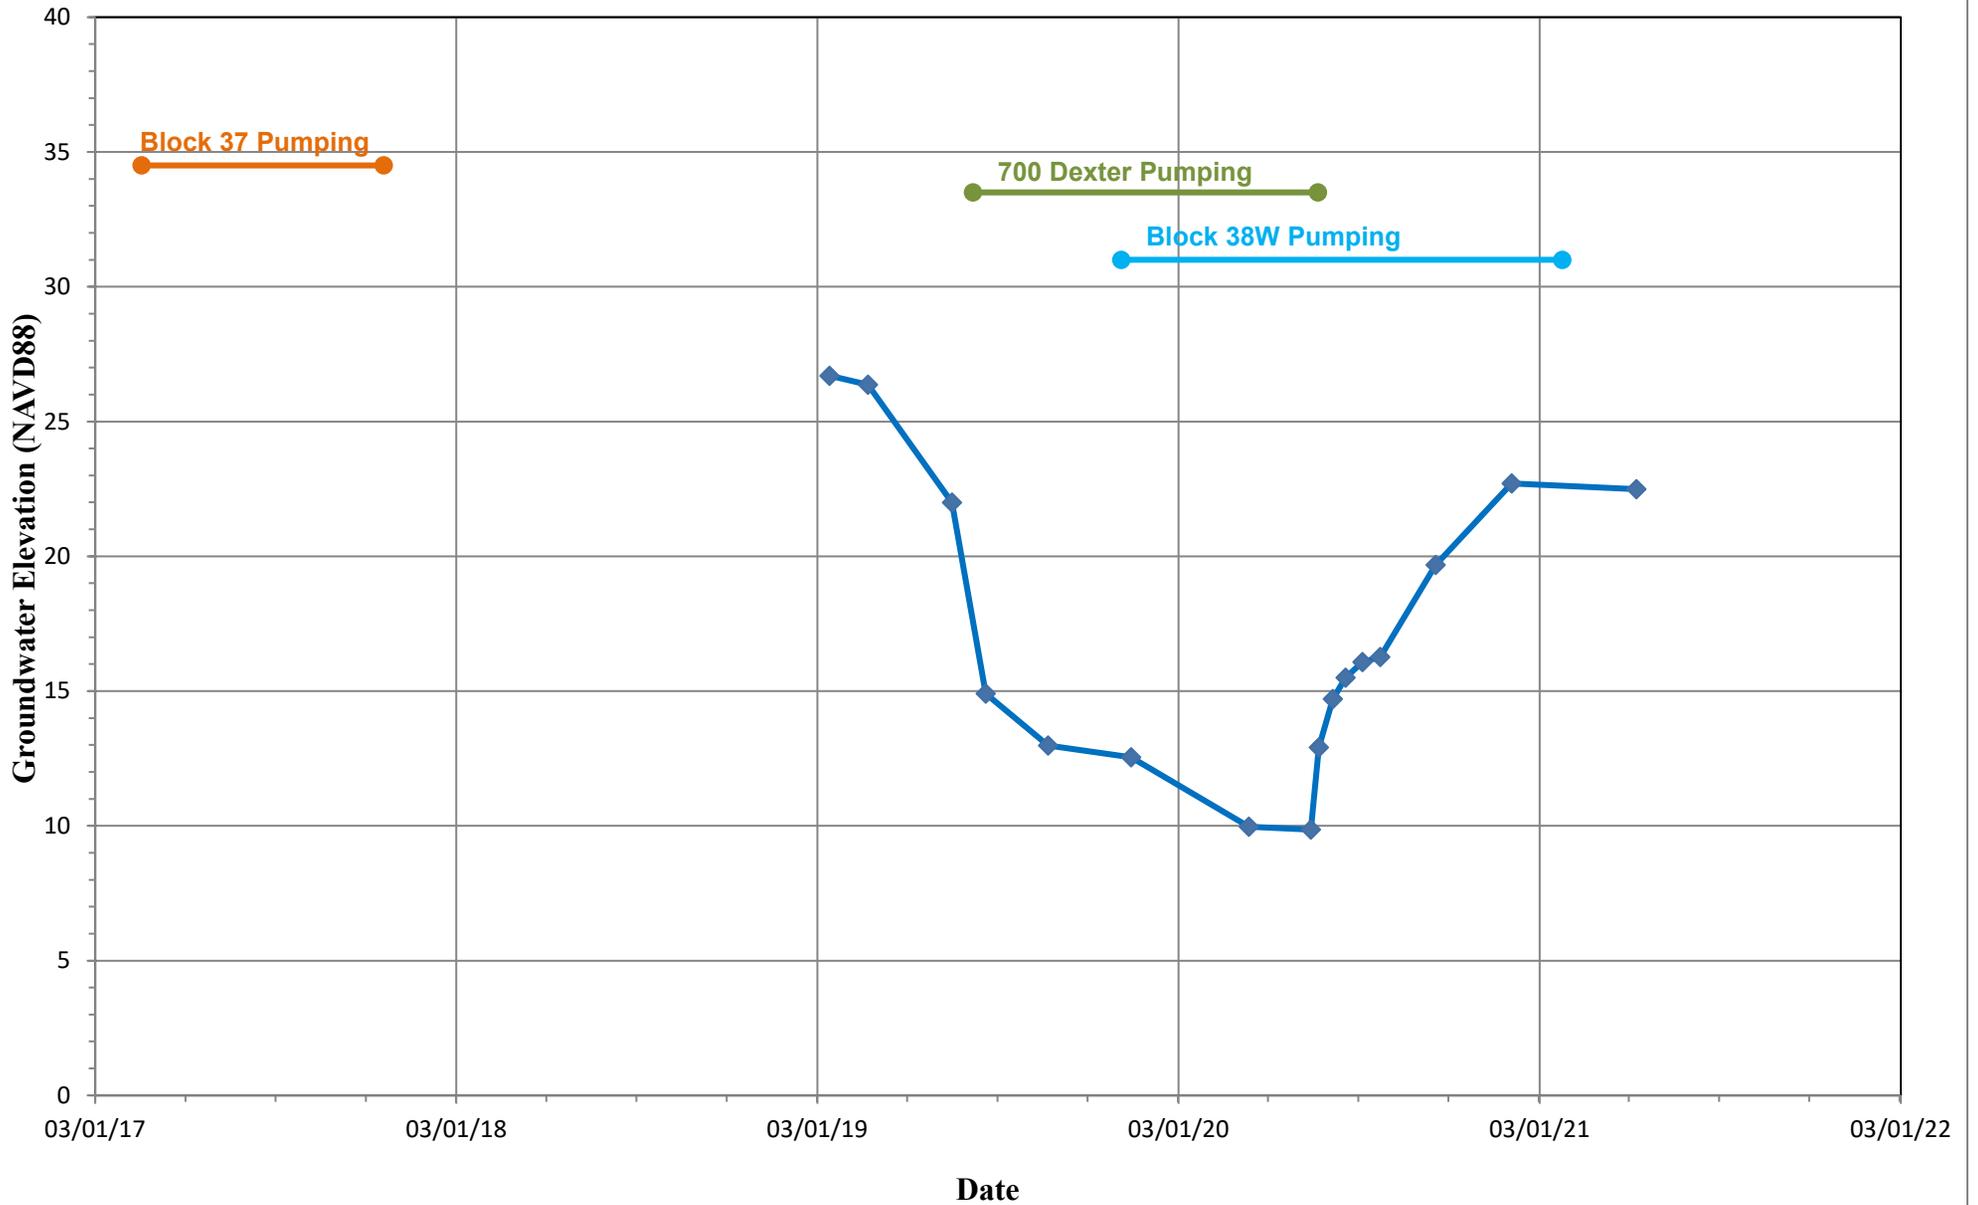


**Hydrograph**  
**MW-144R, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

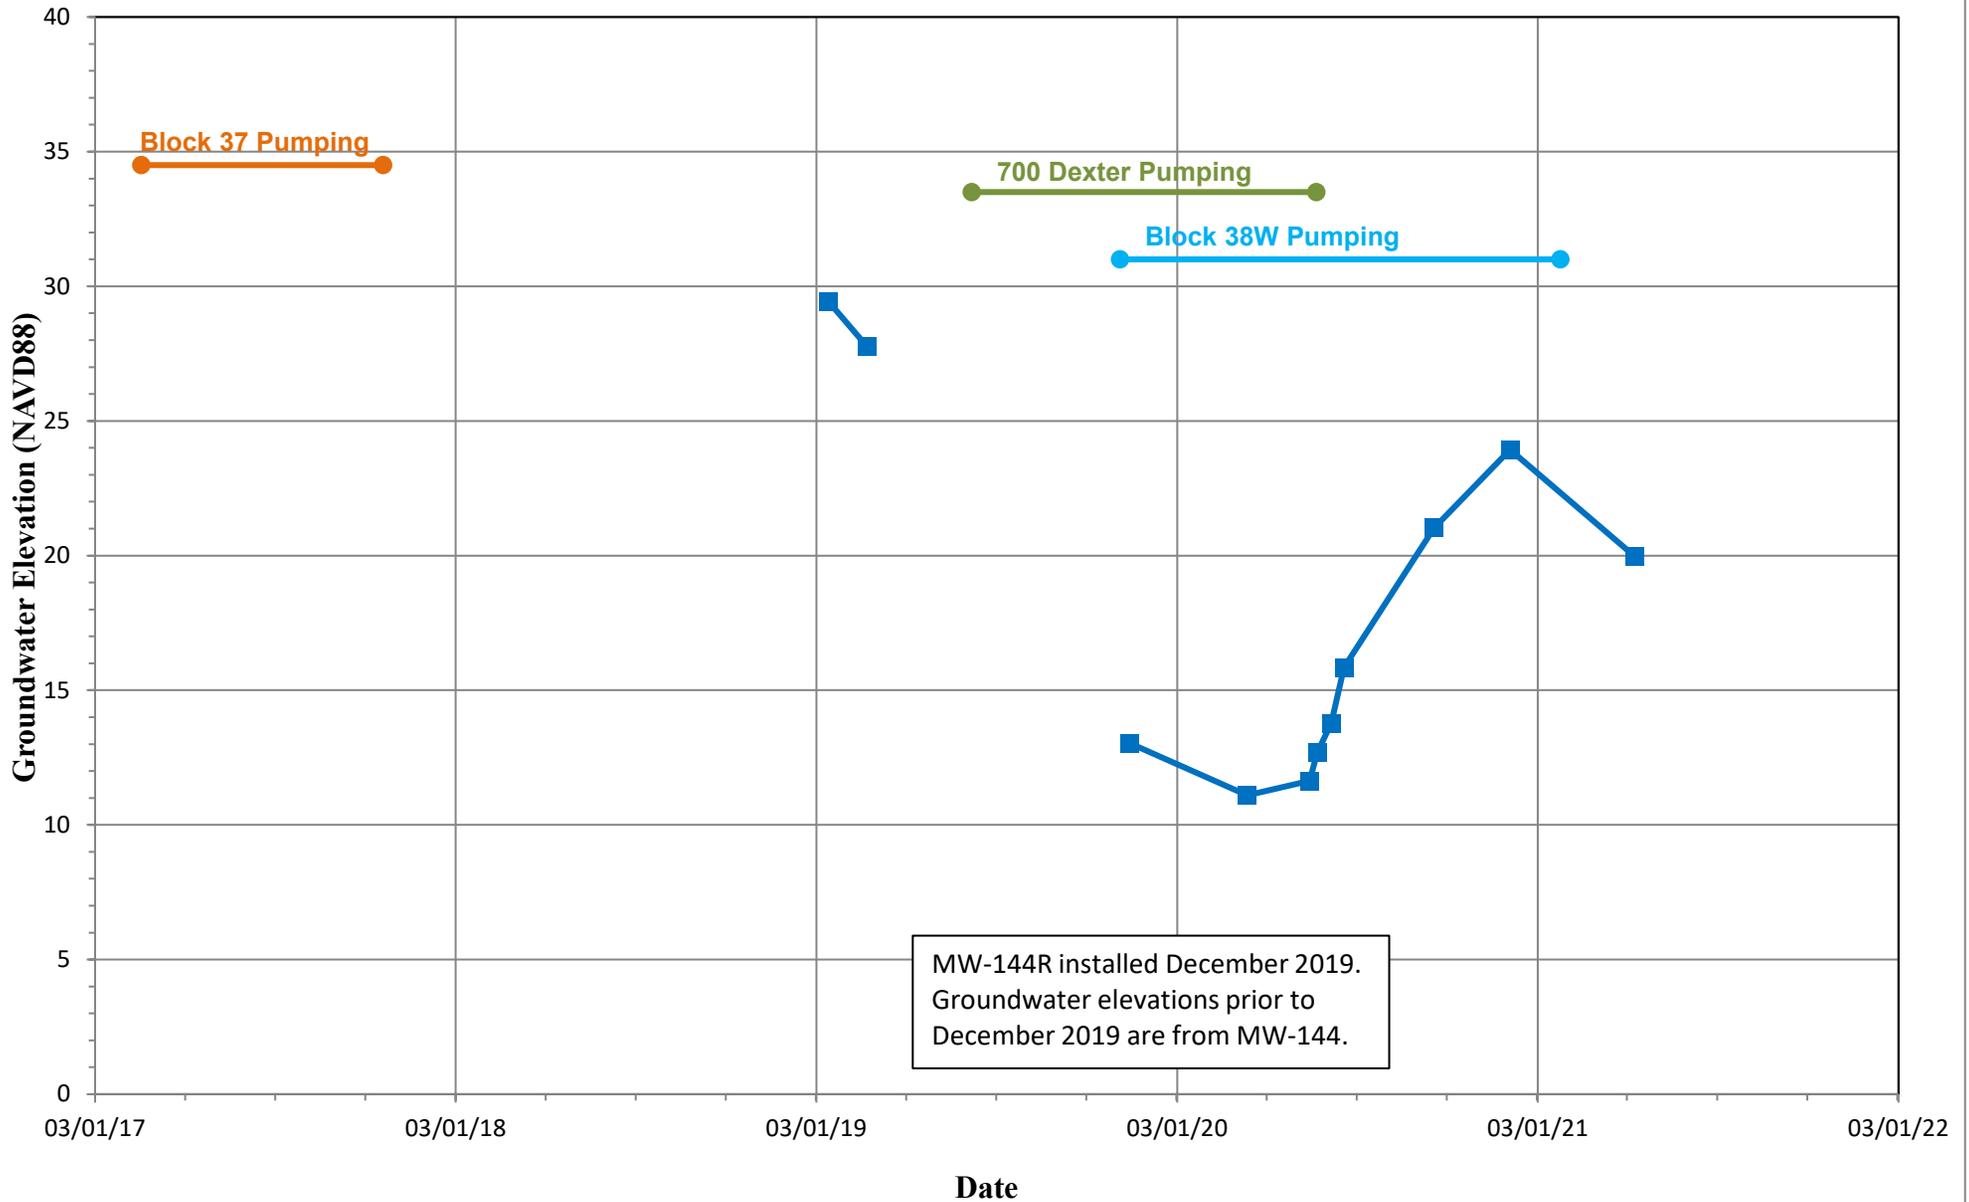


**Hydrograph**  
**MW-146, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

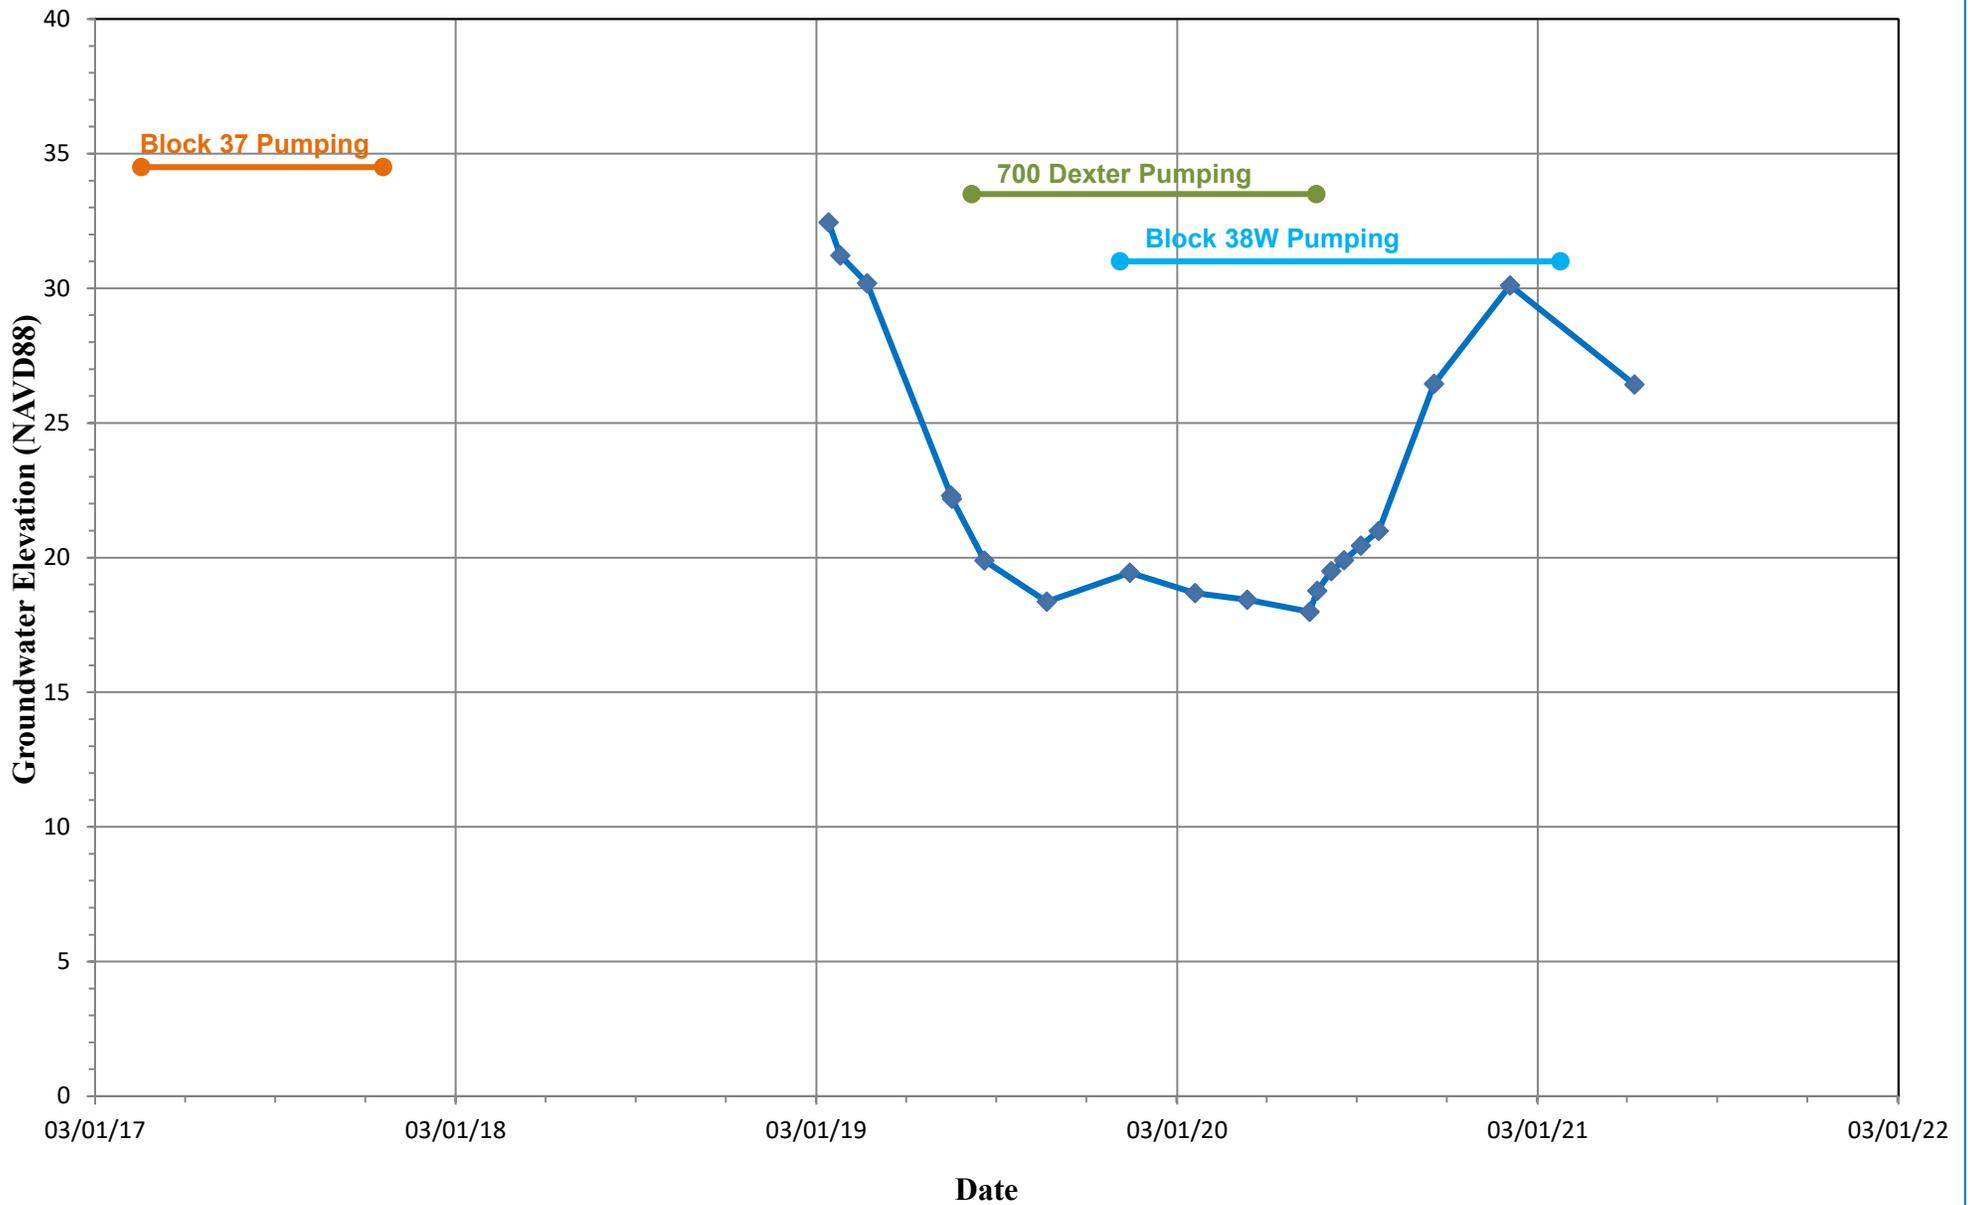


**Hydrograph**  
**MW-156, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

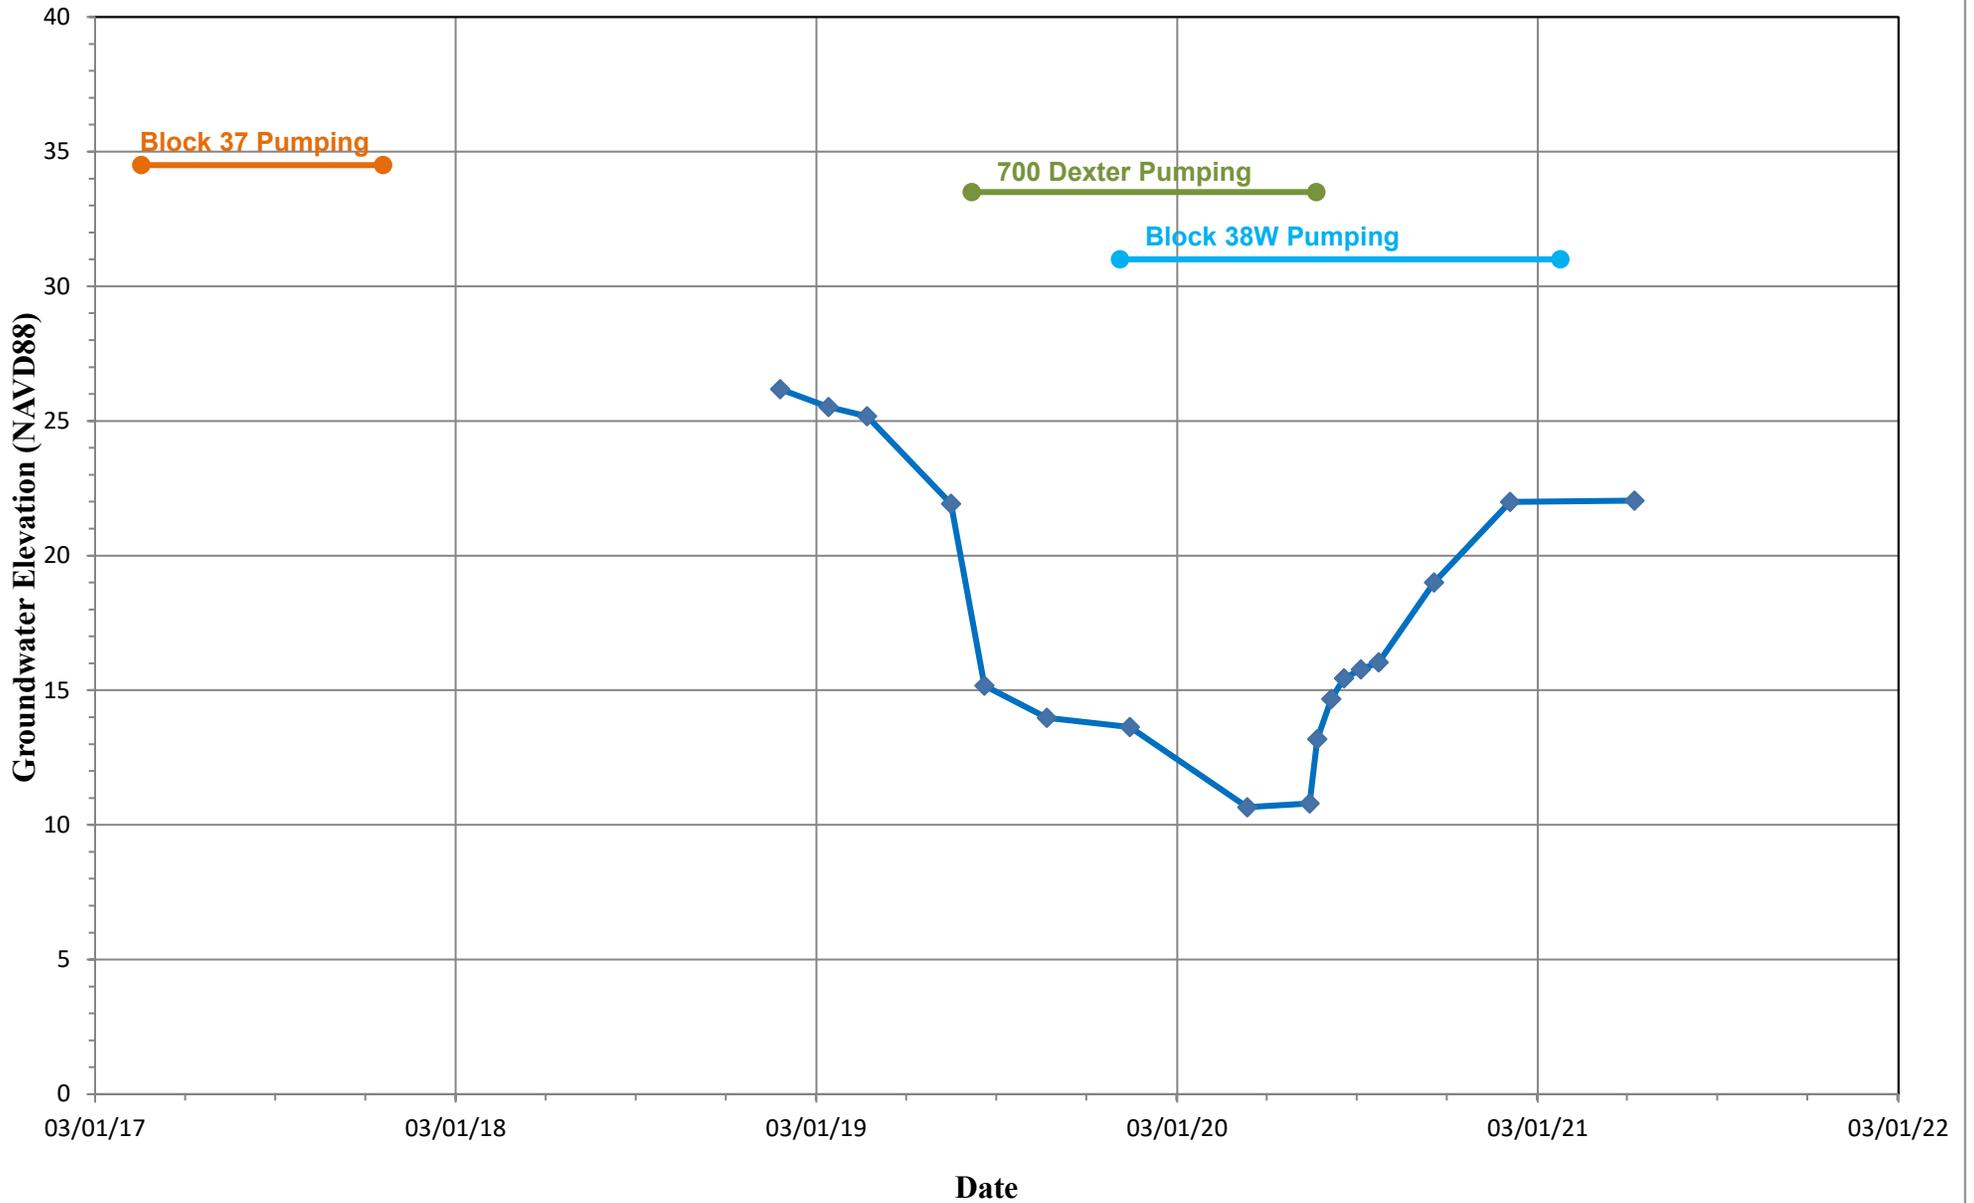


**Hydrograph**  
**MW-189, Valley St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

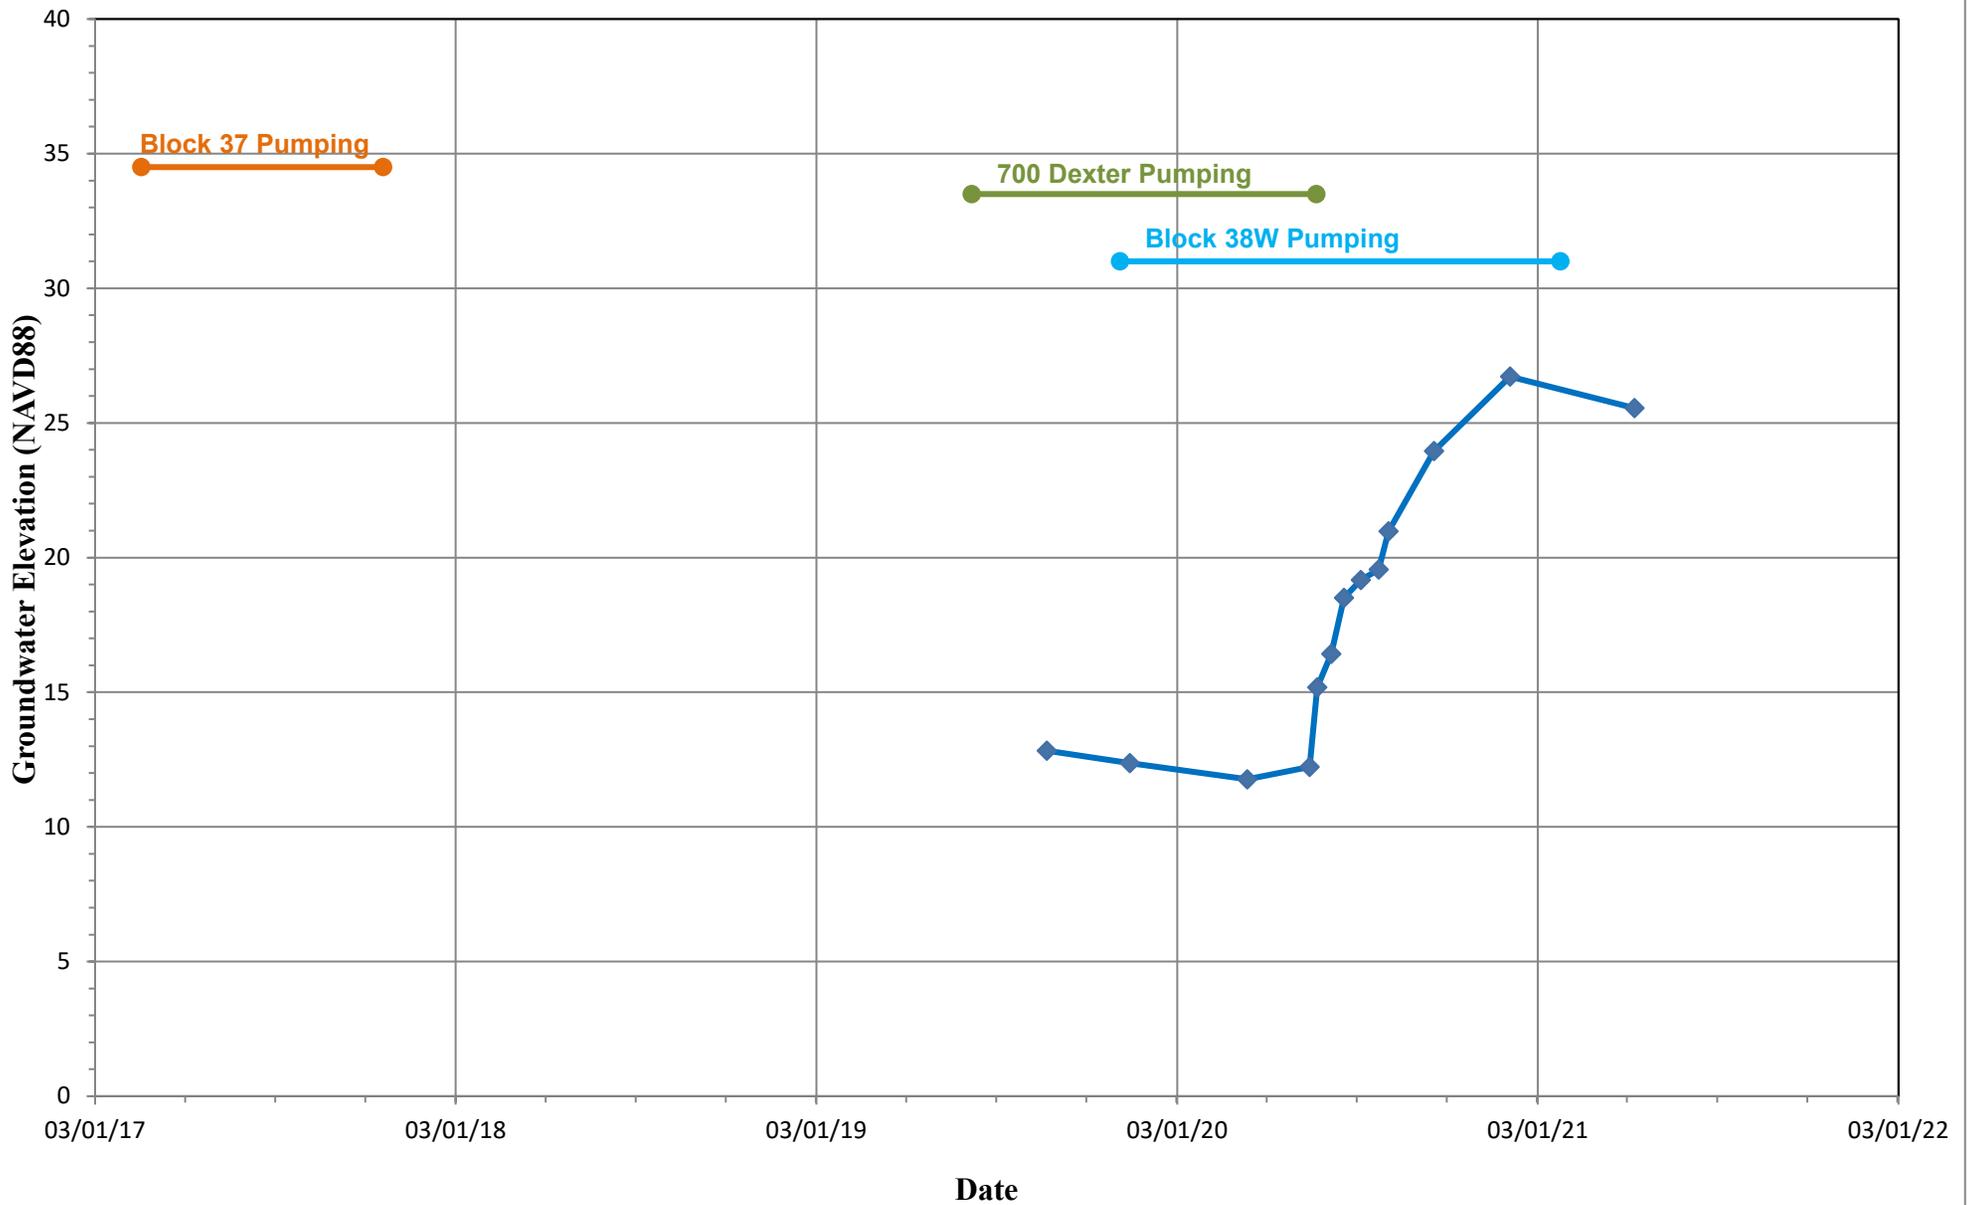


**Hydrograph**  
**MW-302, Dexter Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

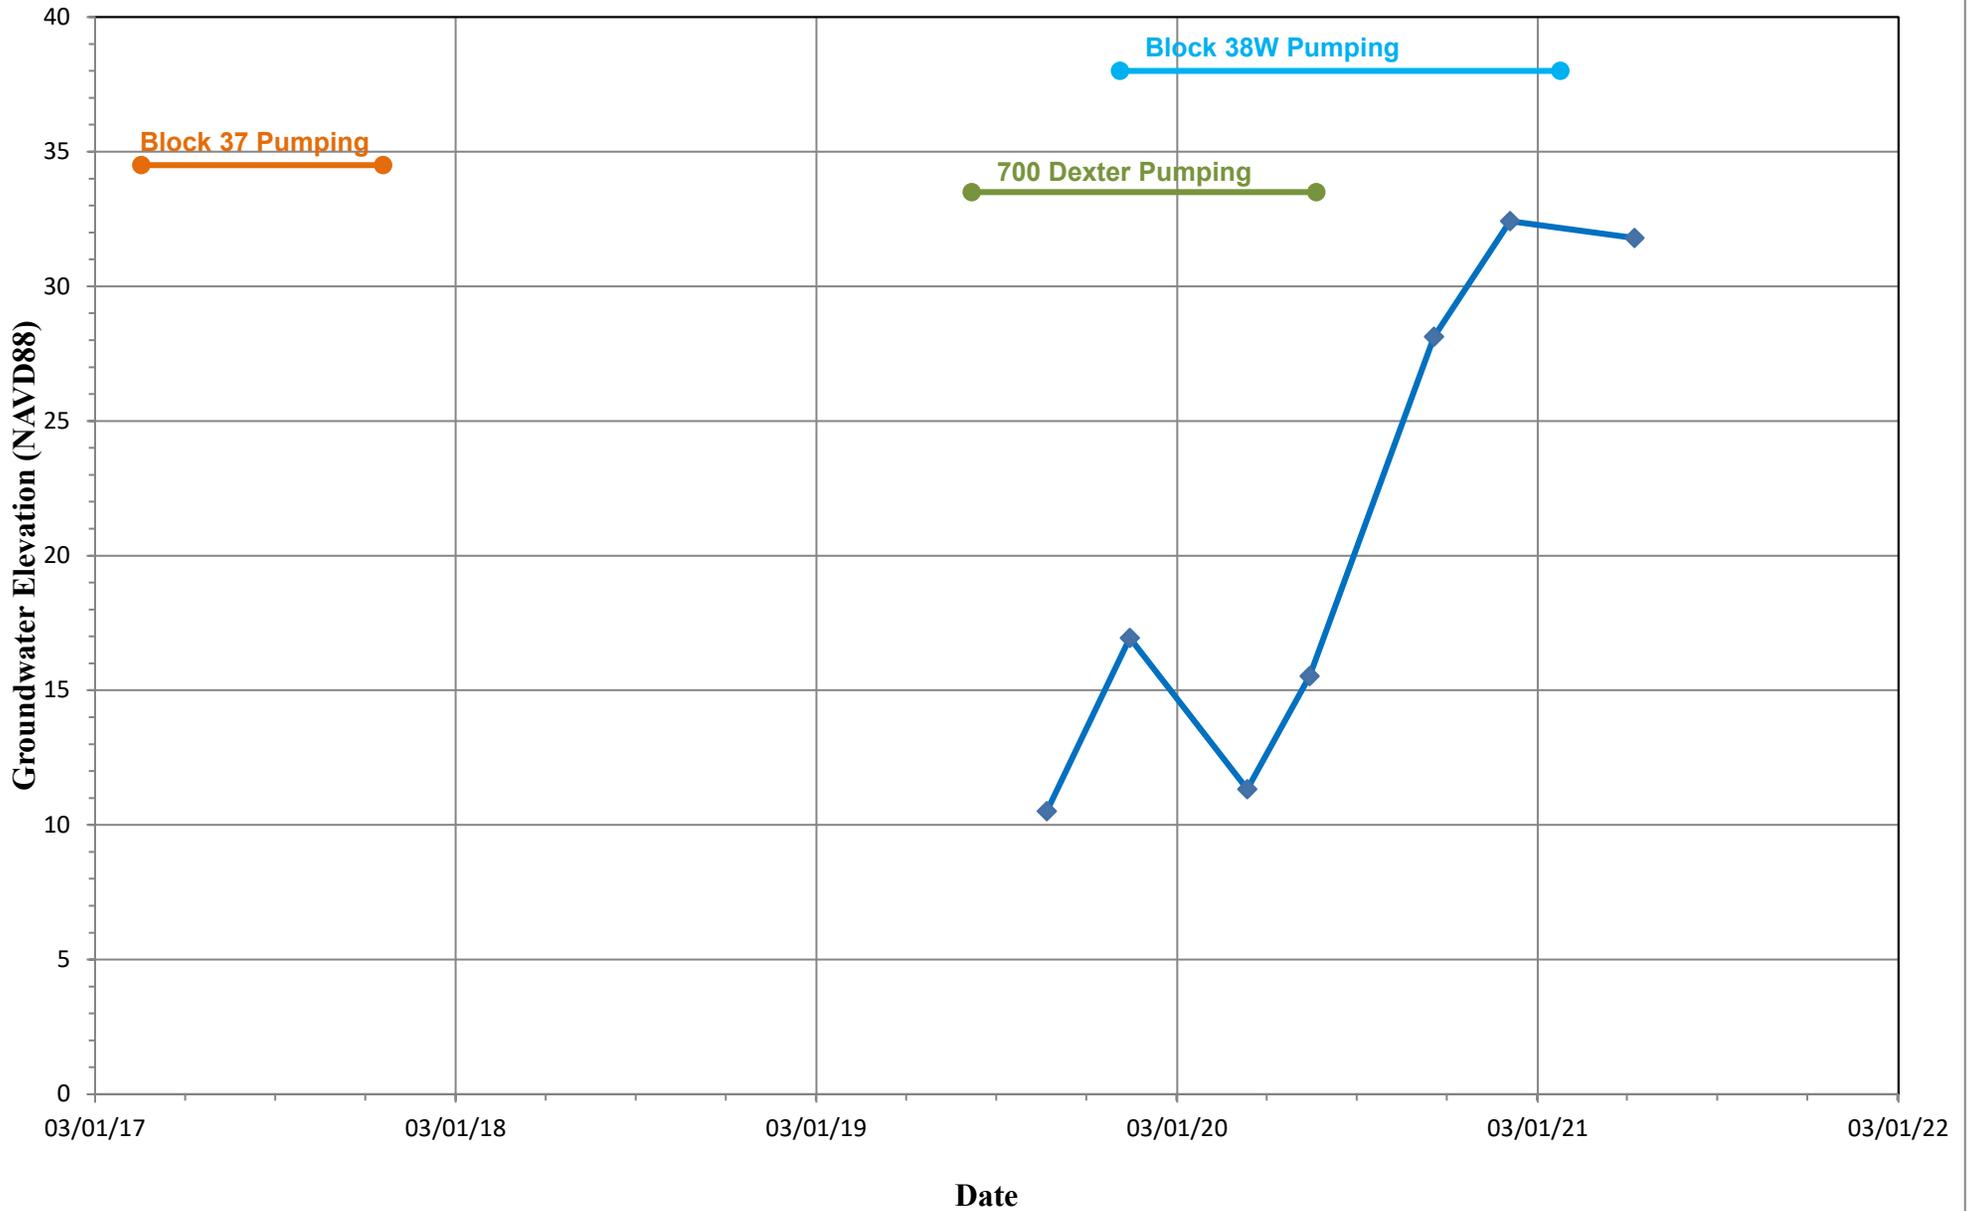


**Hydrograph**  
**MW-306, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

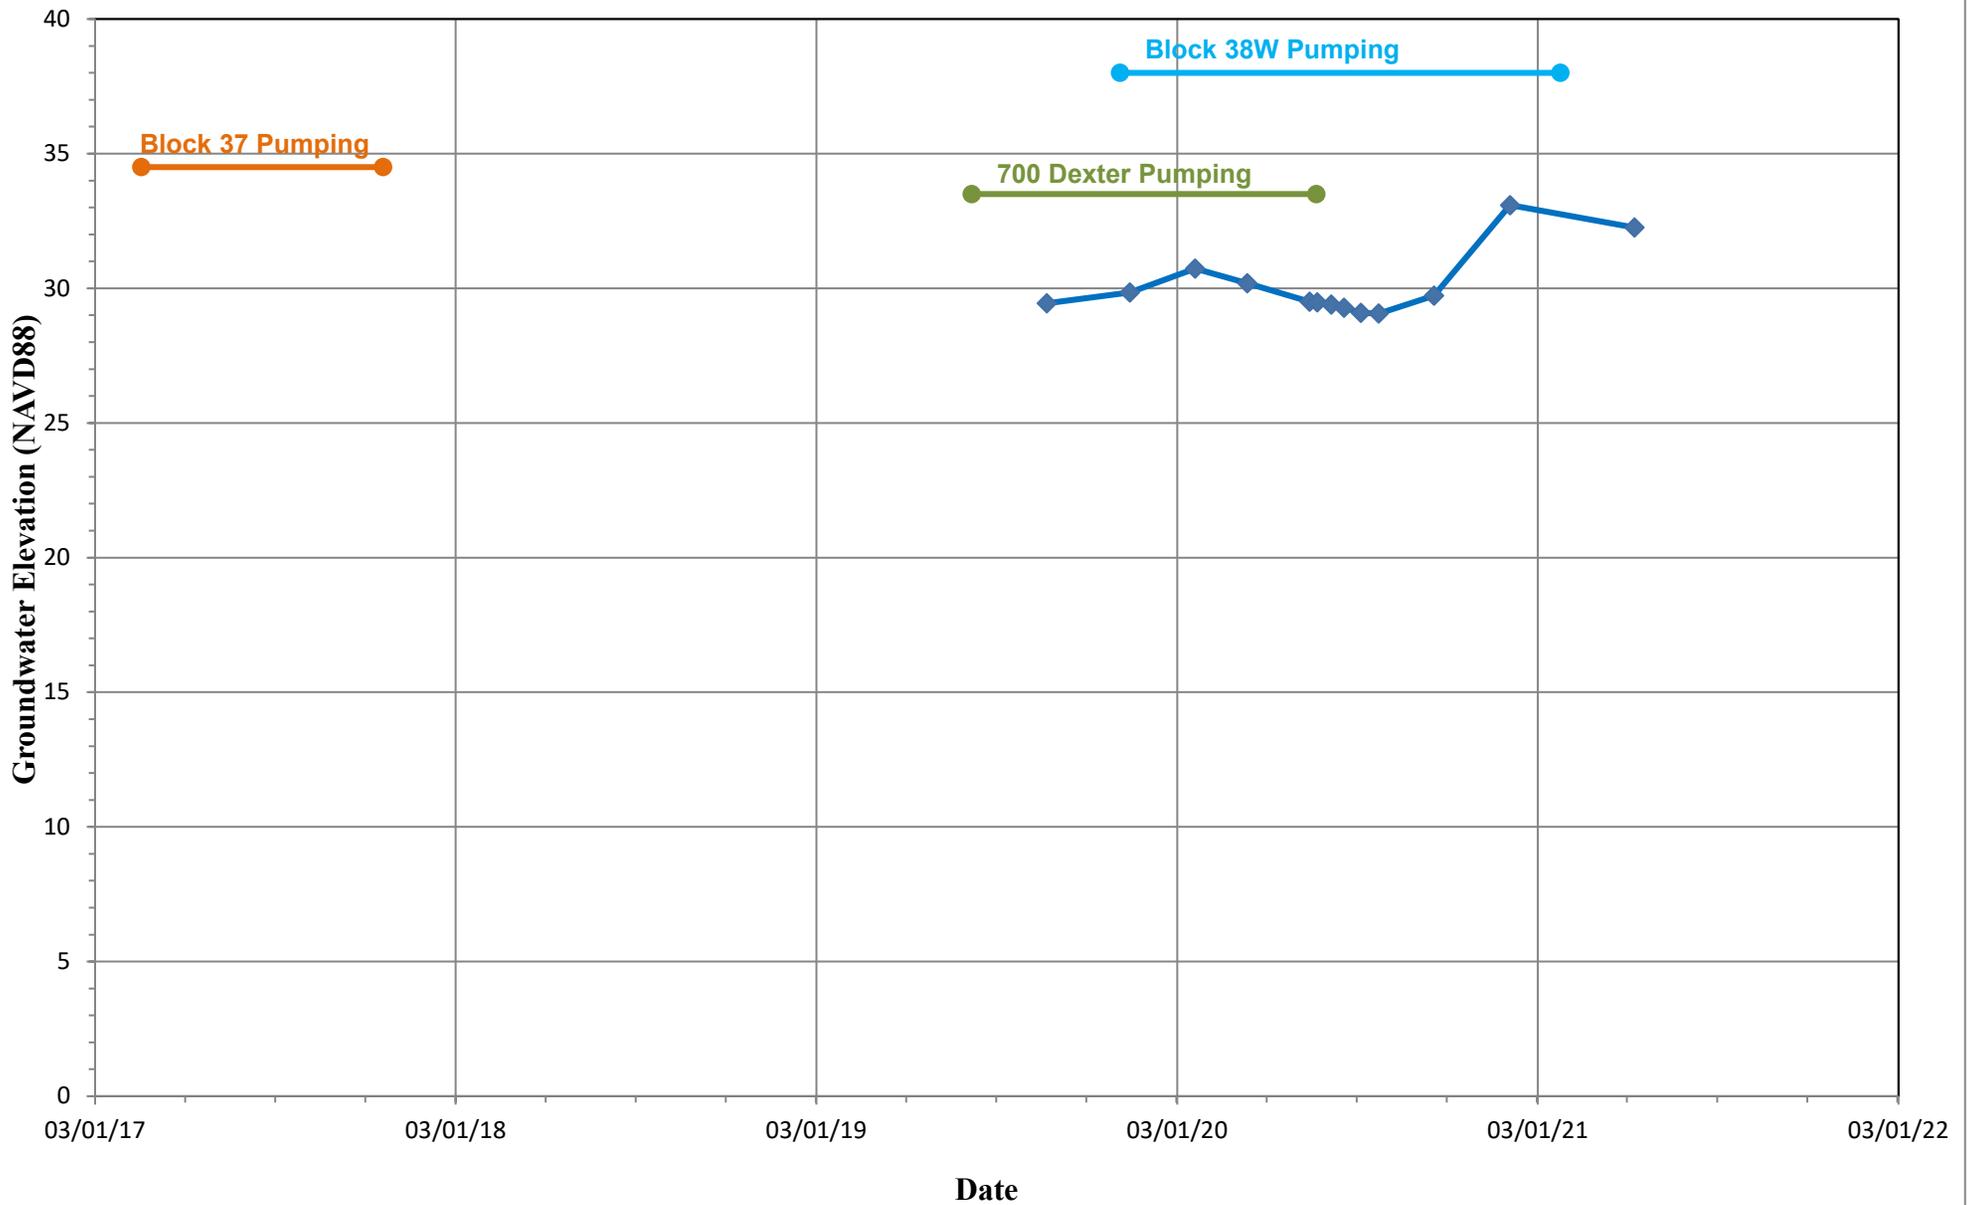


**Hydrograph**  
**MW-308, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

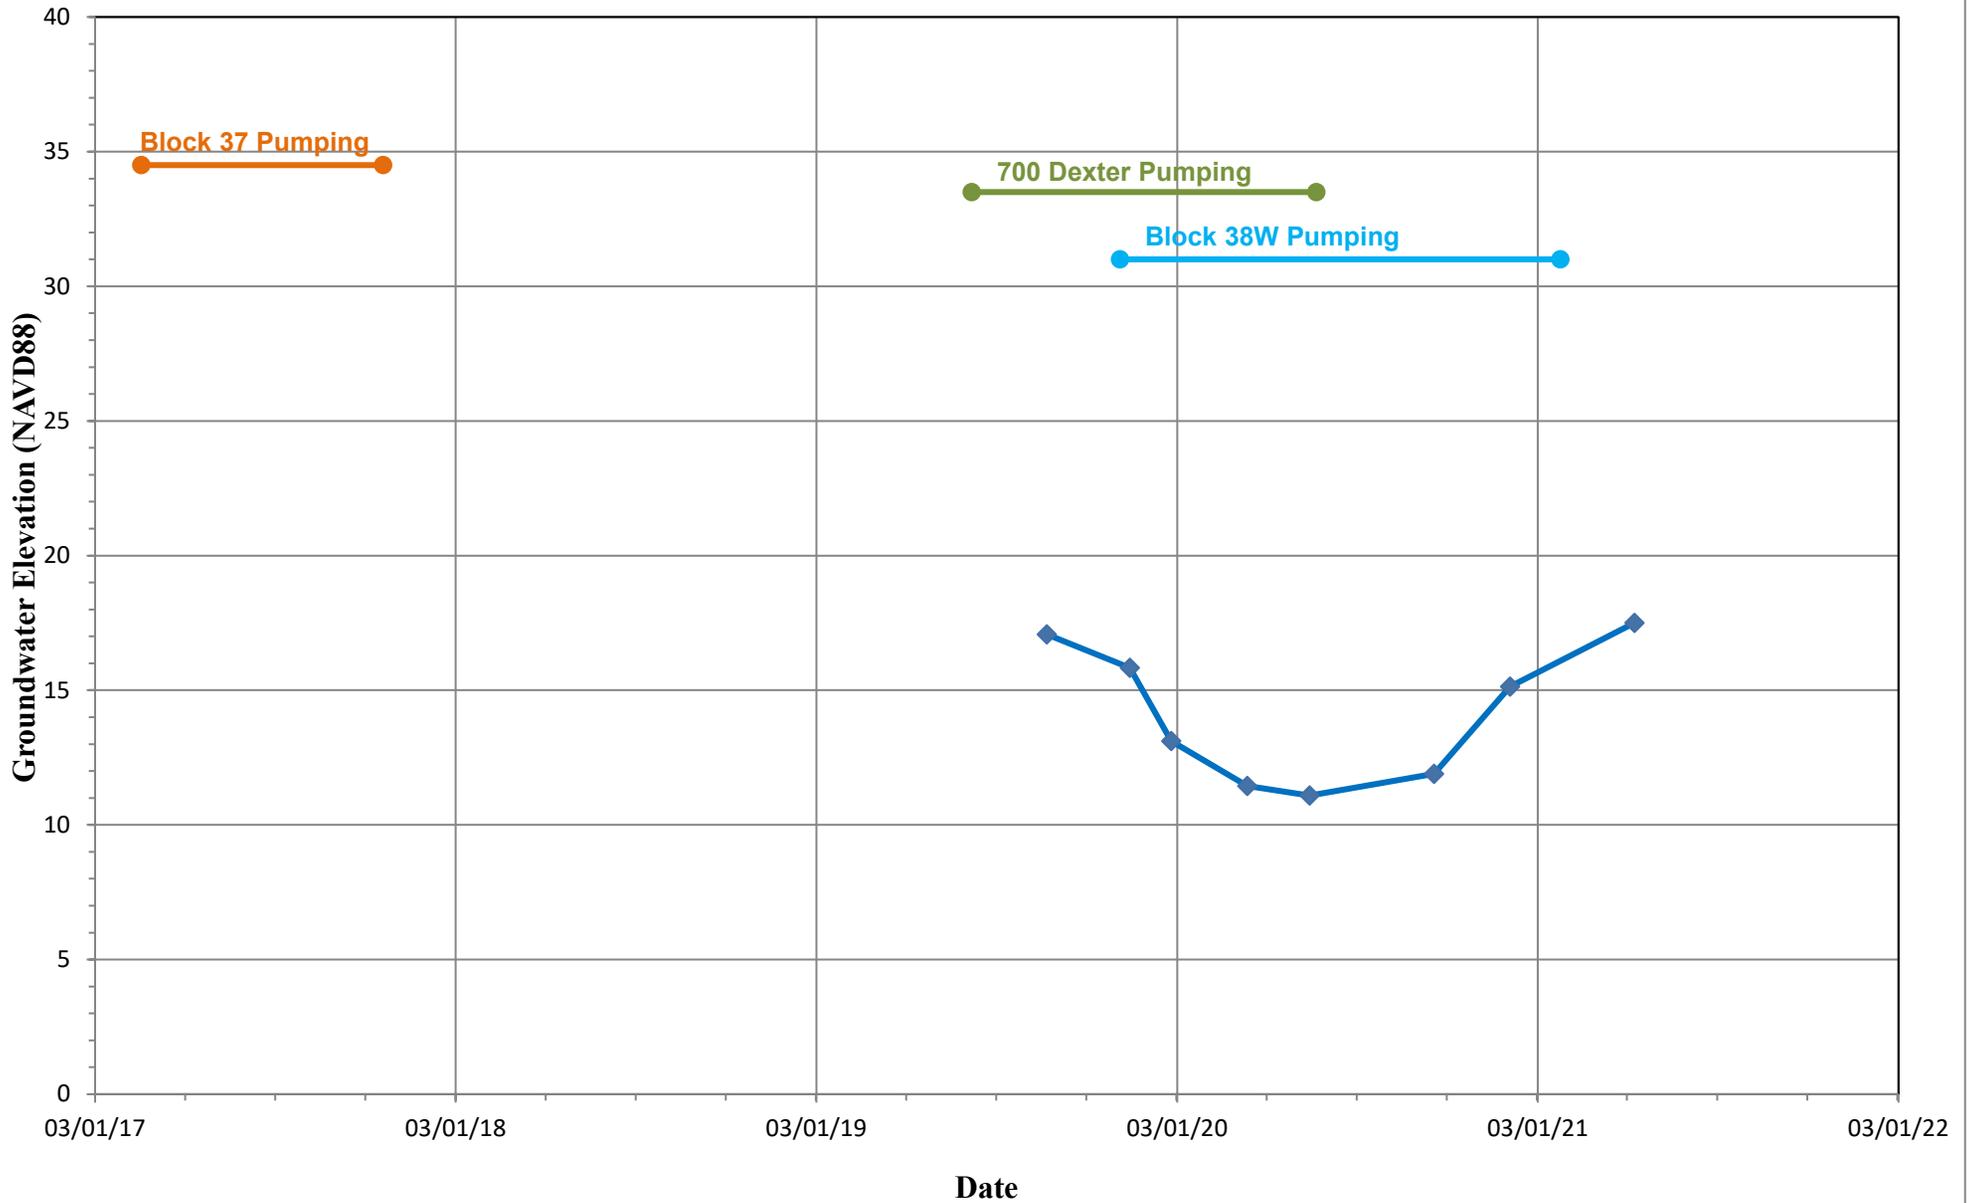


**Hydrograph**  
**MW-315, Mercer St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

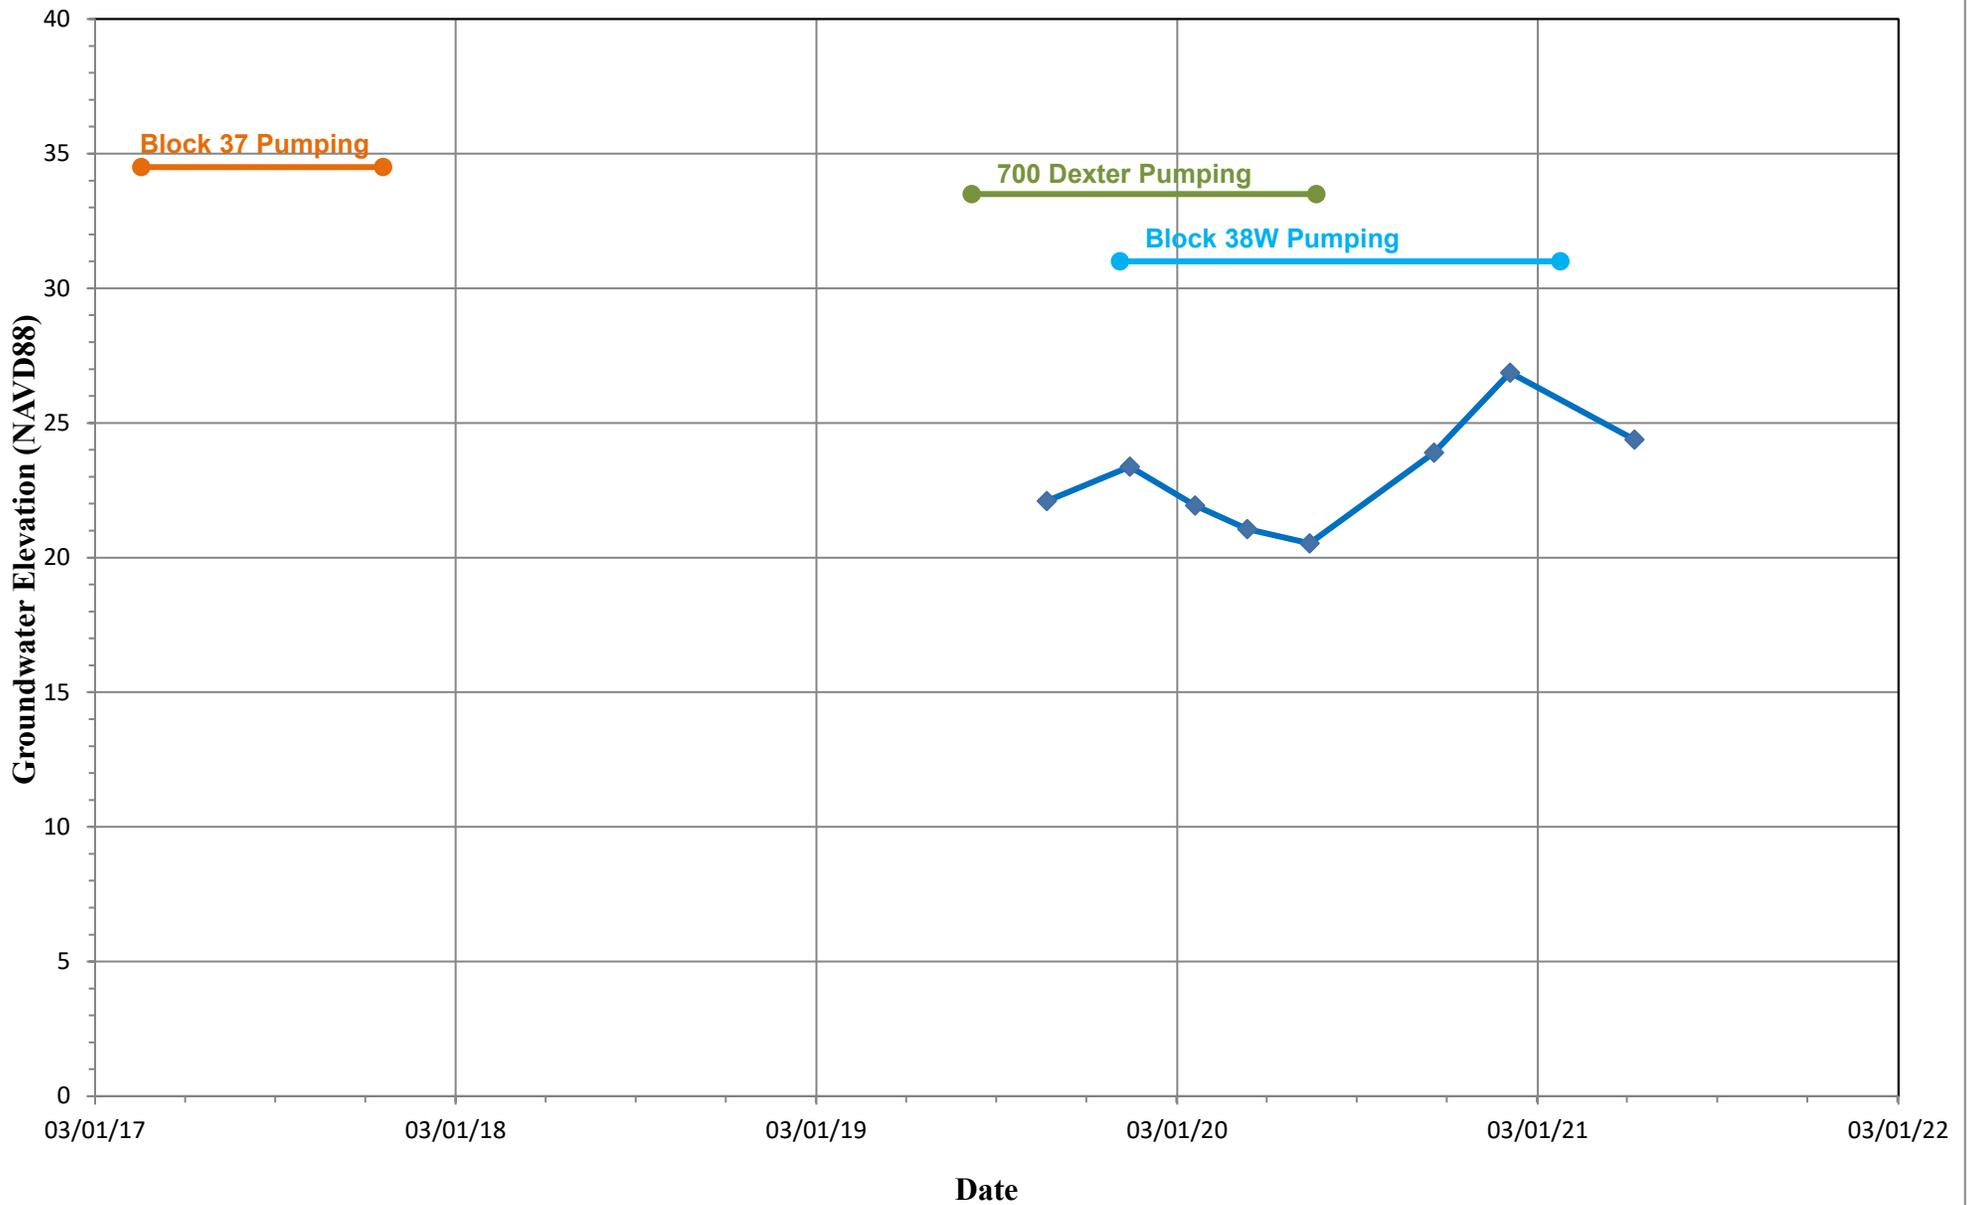


**Hydrograph**  
**MW-317, 9th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

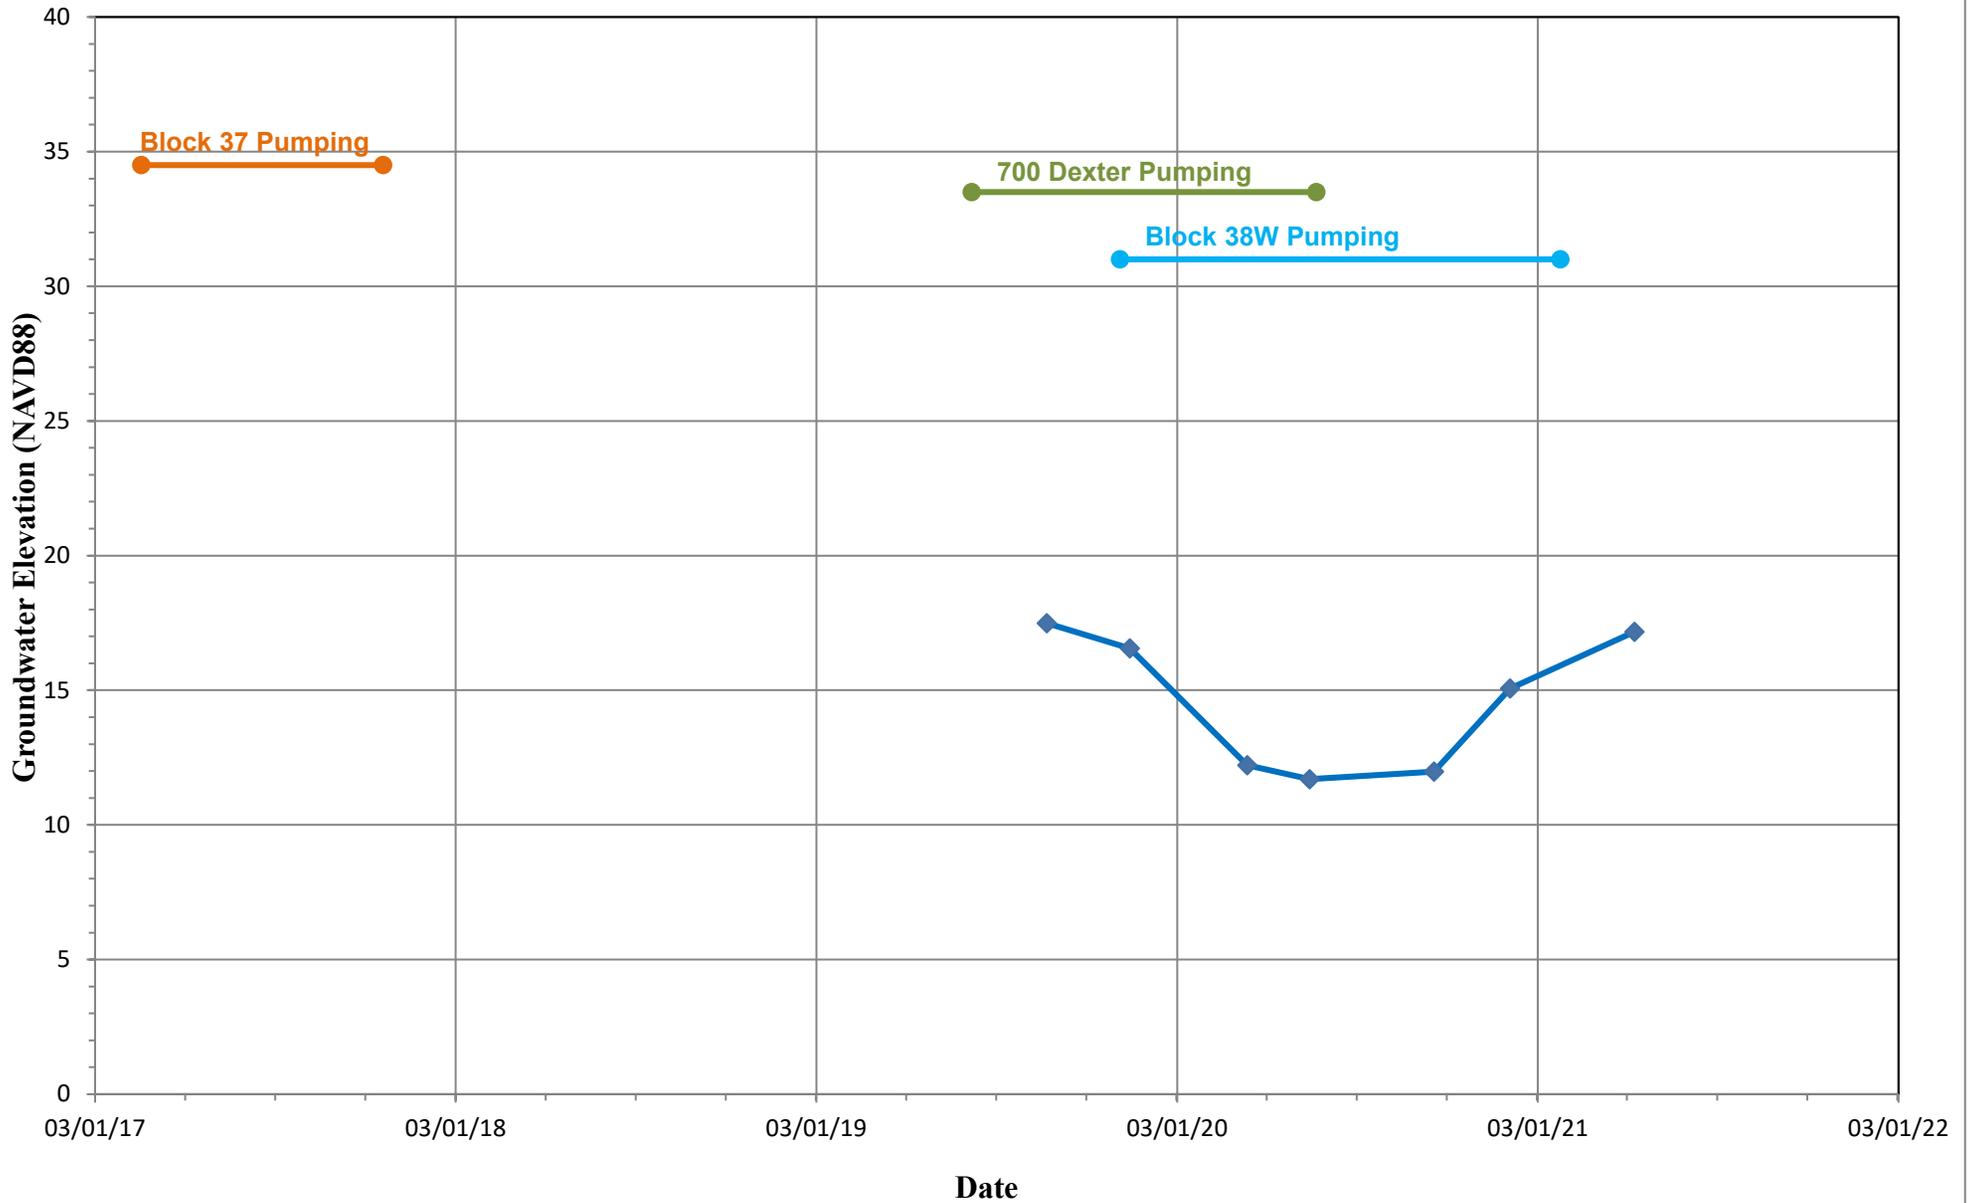


**Hydrograph**  
**MW-325, Mercer St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

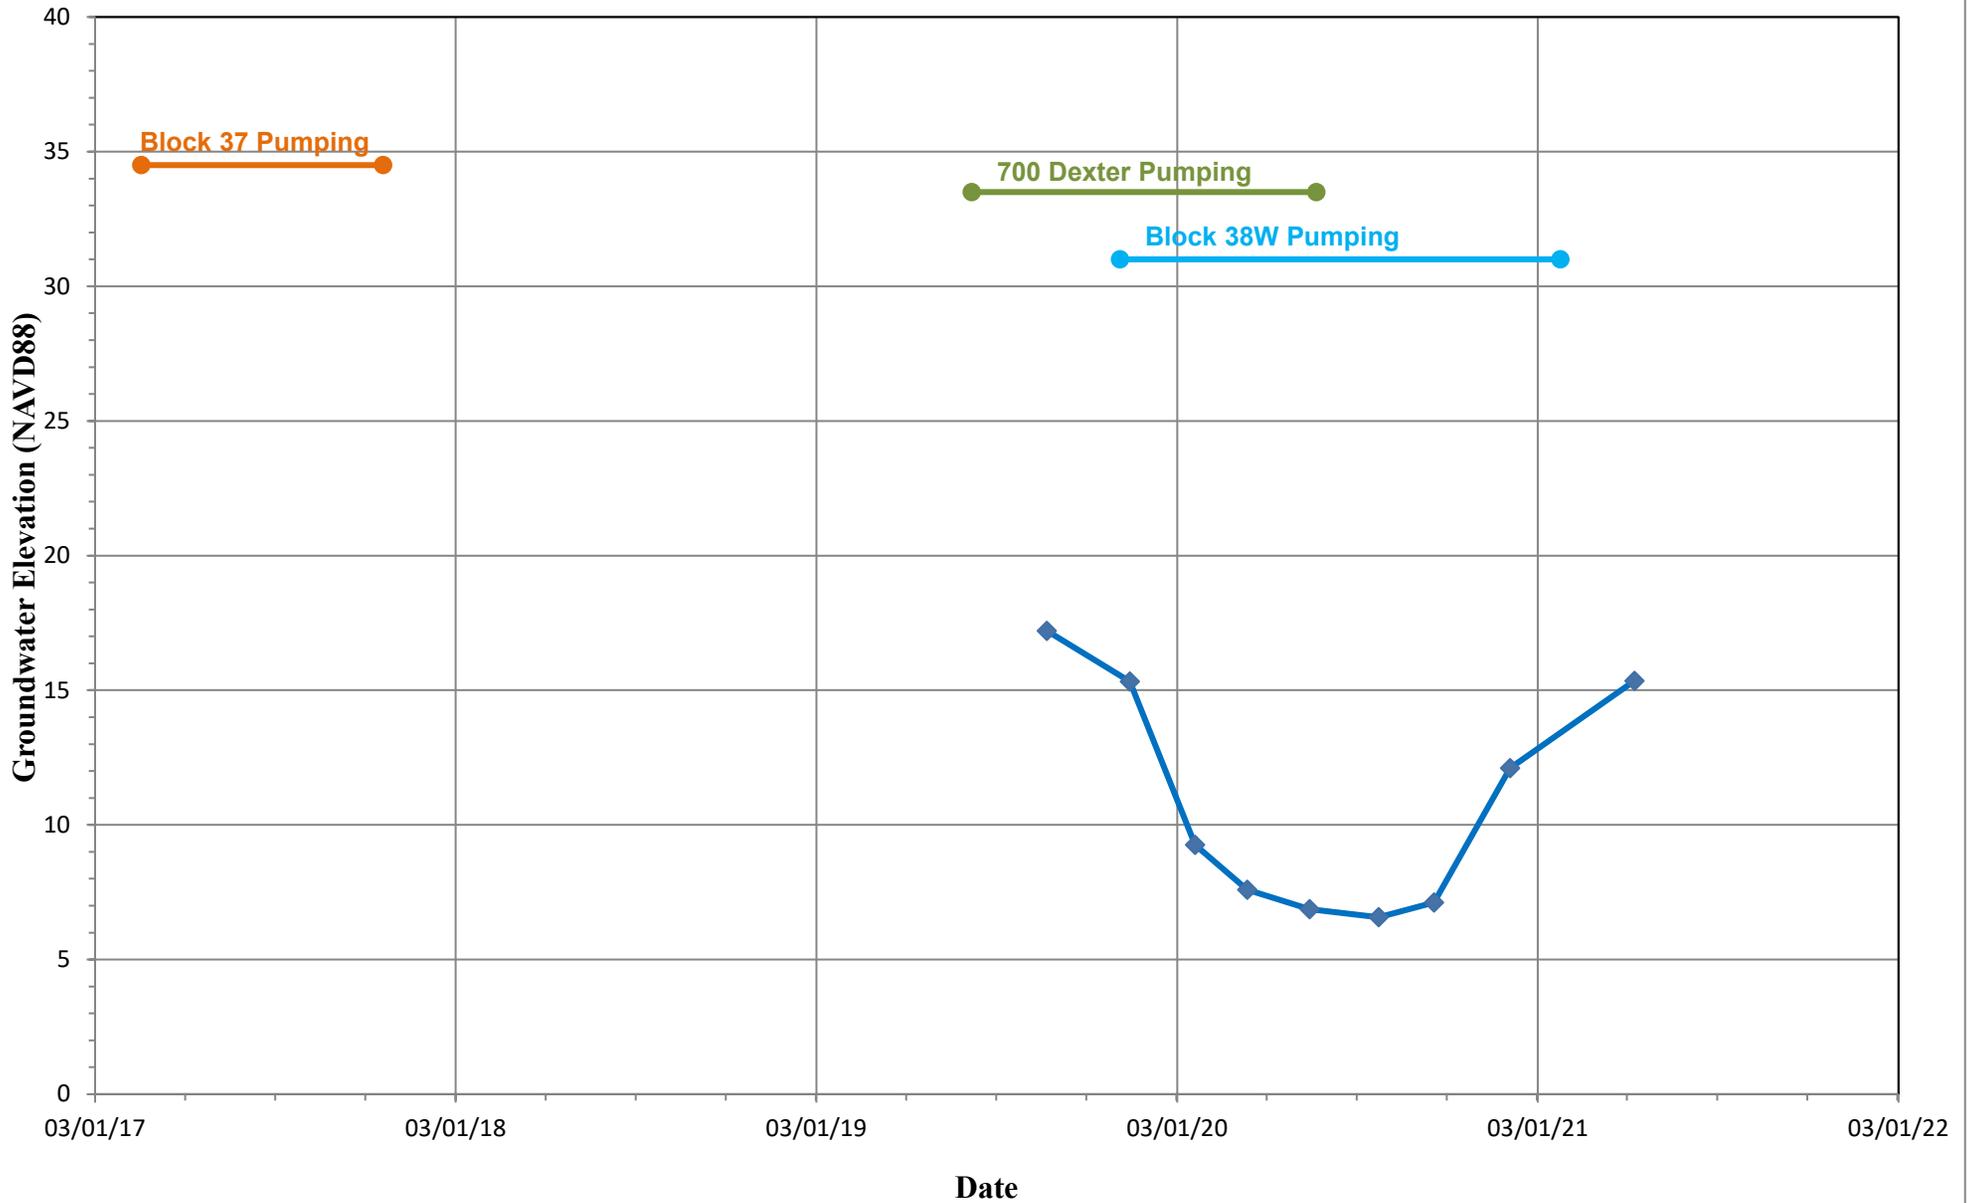


**Hydrograph**  
**MW-327, Lake Union Park, S end**  
**American Linen Supply Co Dexter Ave Site**

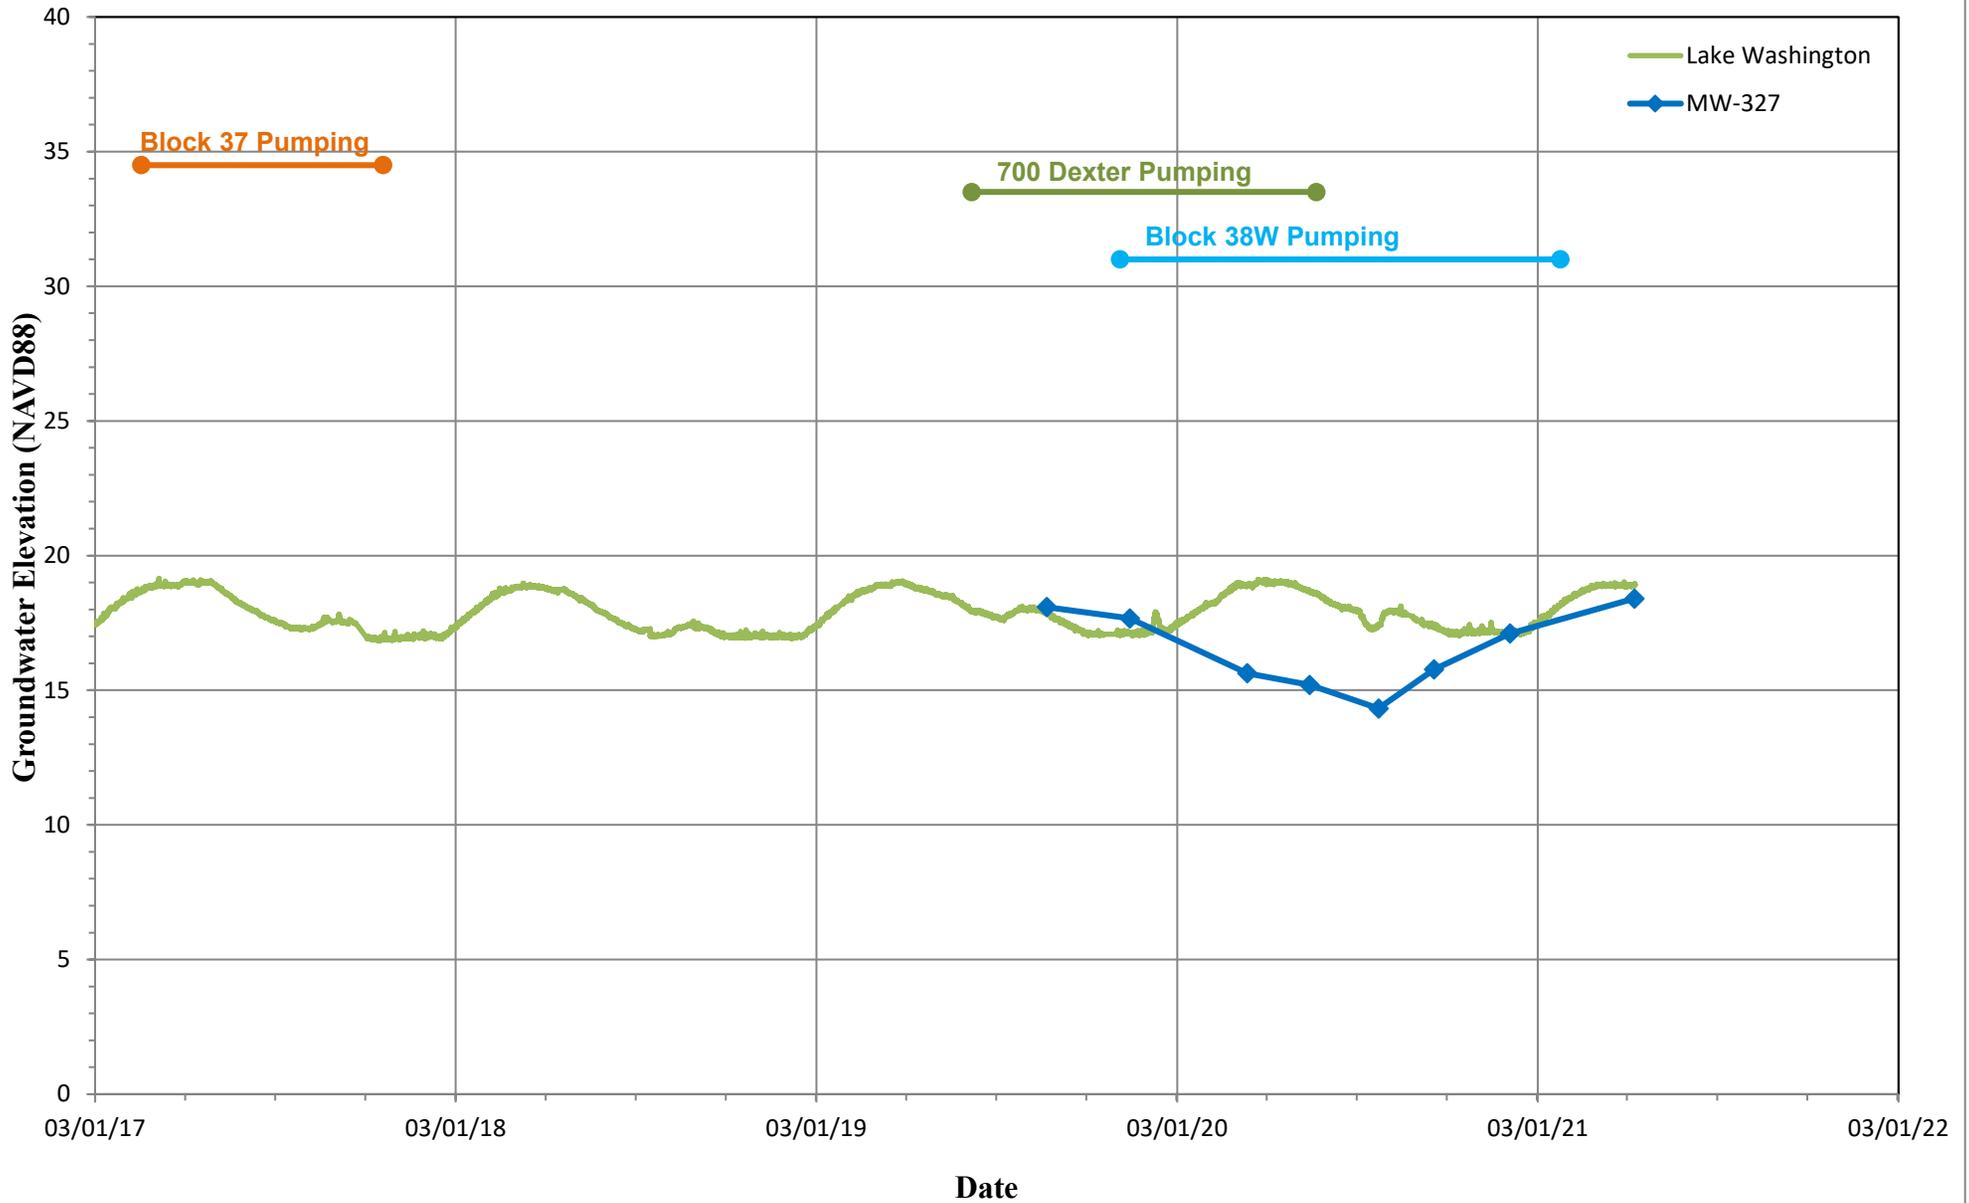


**Hydrograph**  
**MW-330, Valley St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

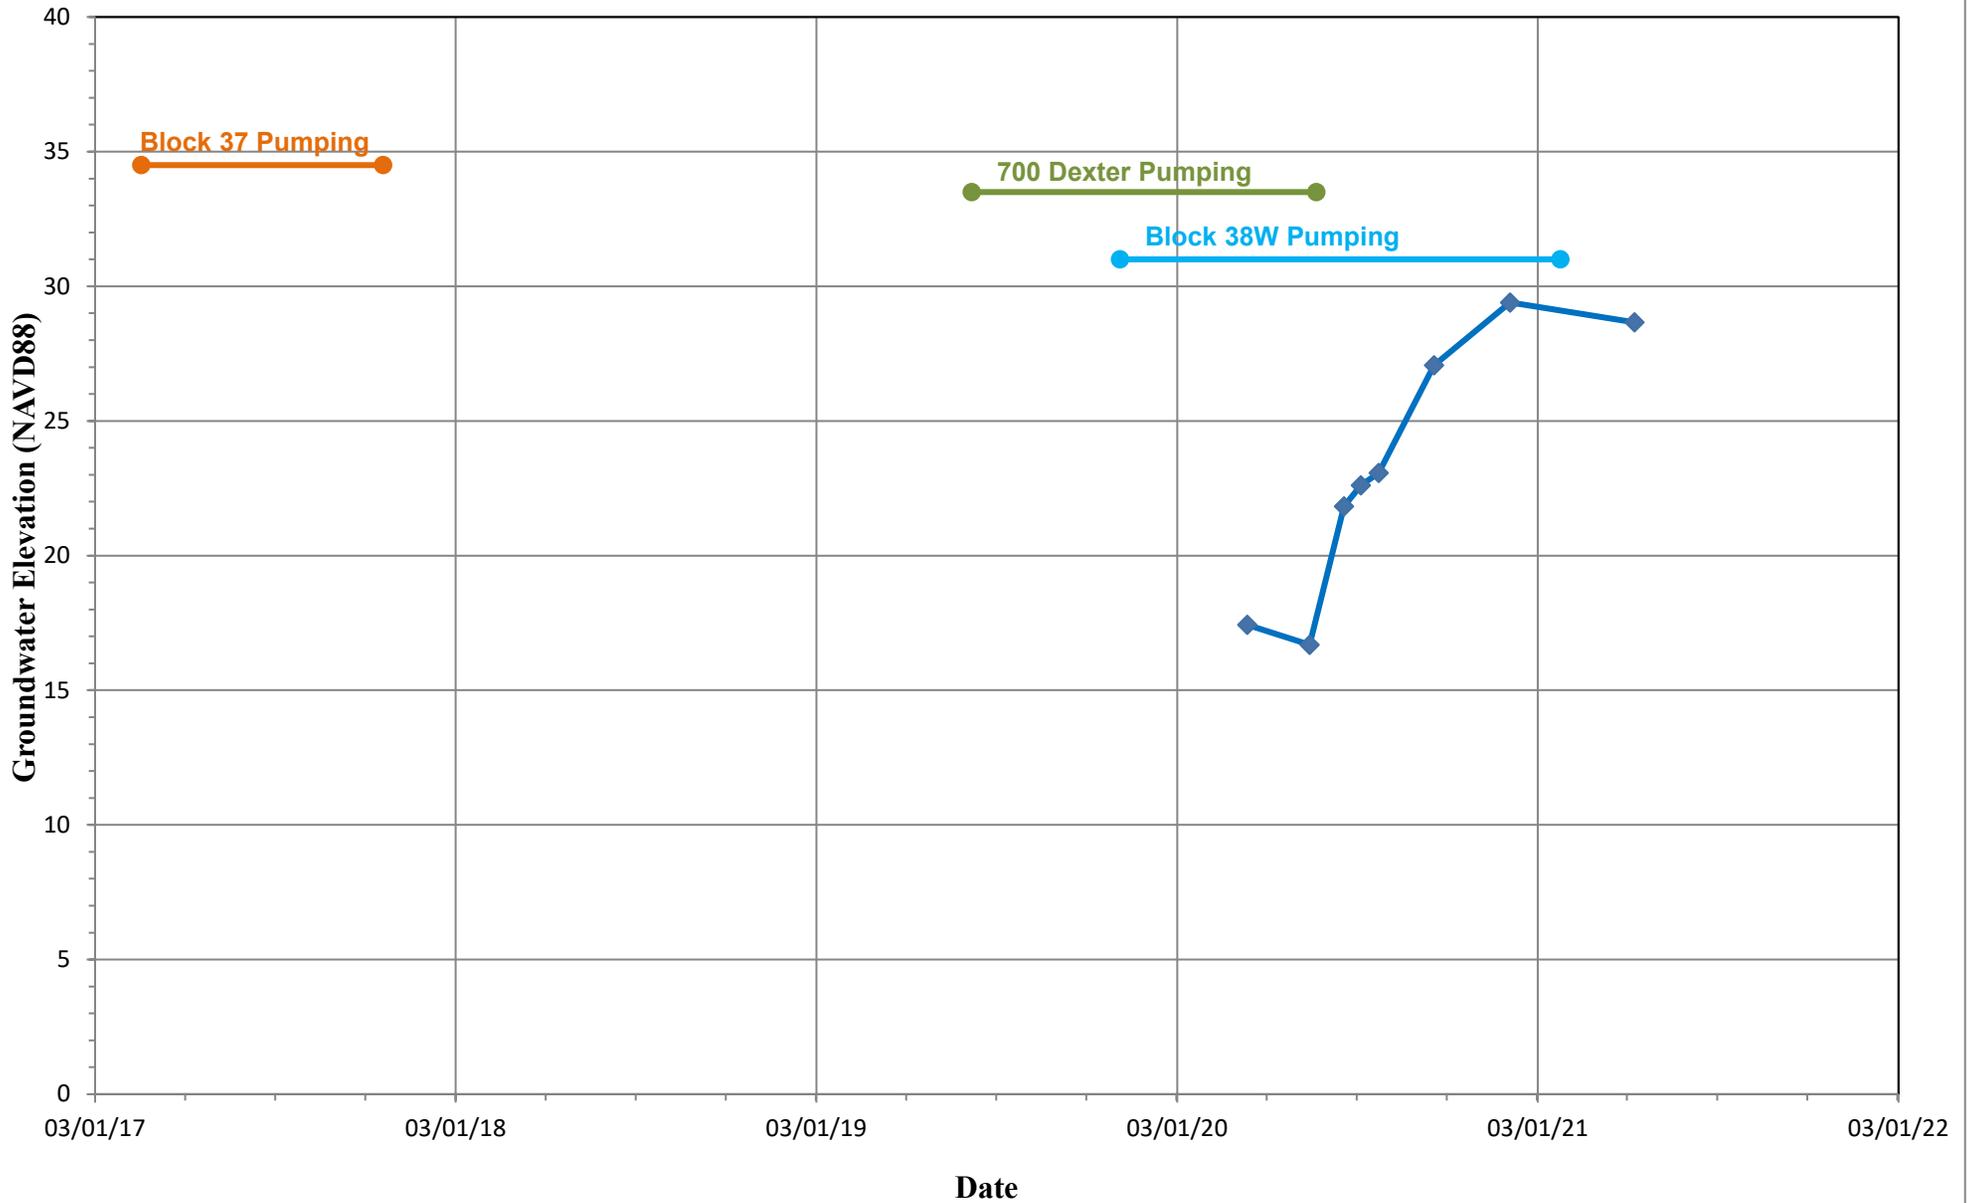

**Hydrograph**  
**MW-331, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

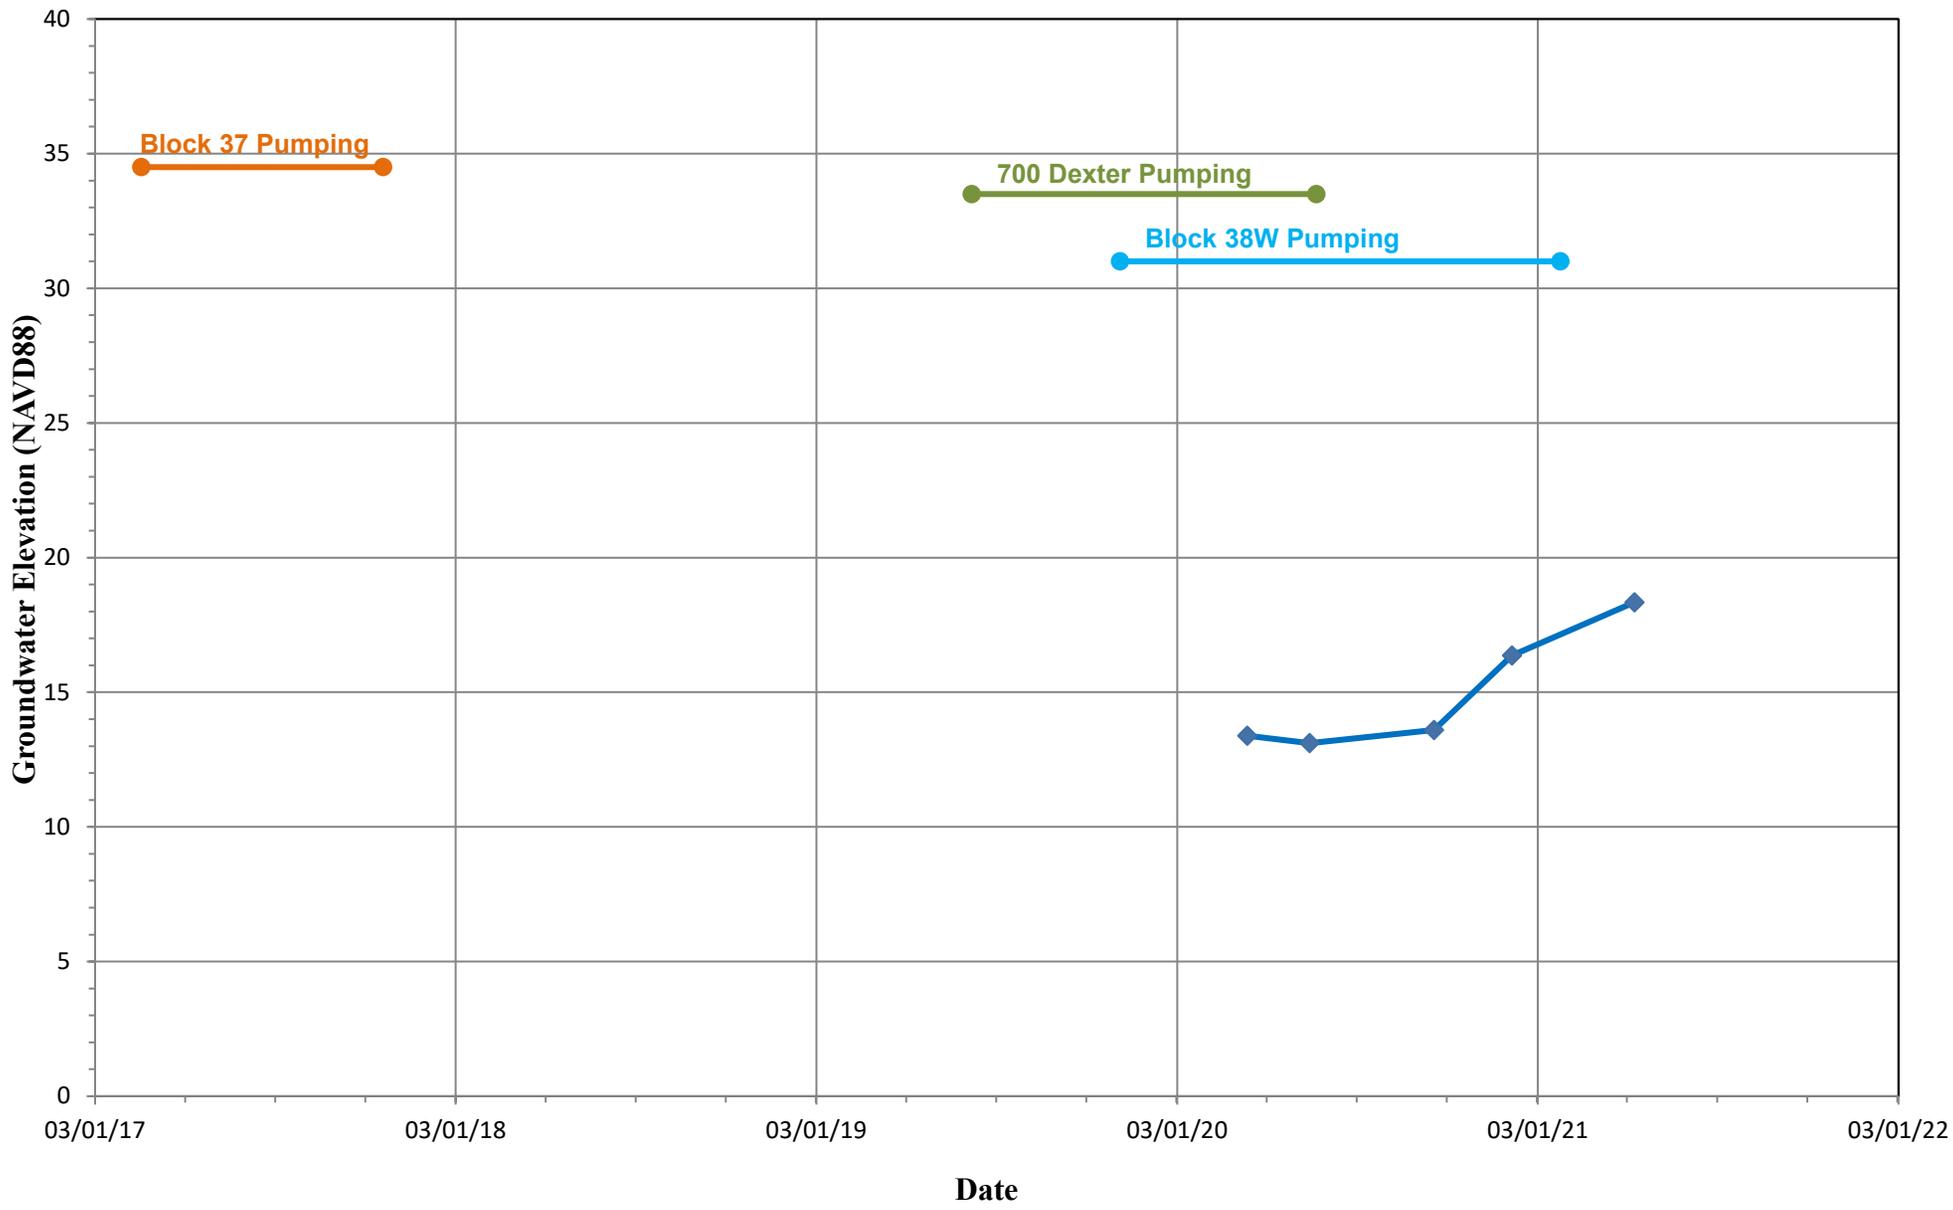


**Hydrograph**  
**MW-333, 900 Roy St, S end**  
**American Linen Supply Co Dexter Ave Site**

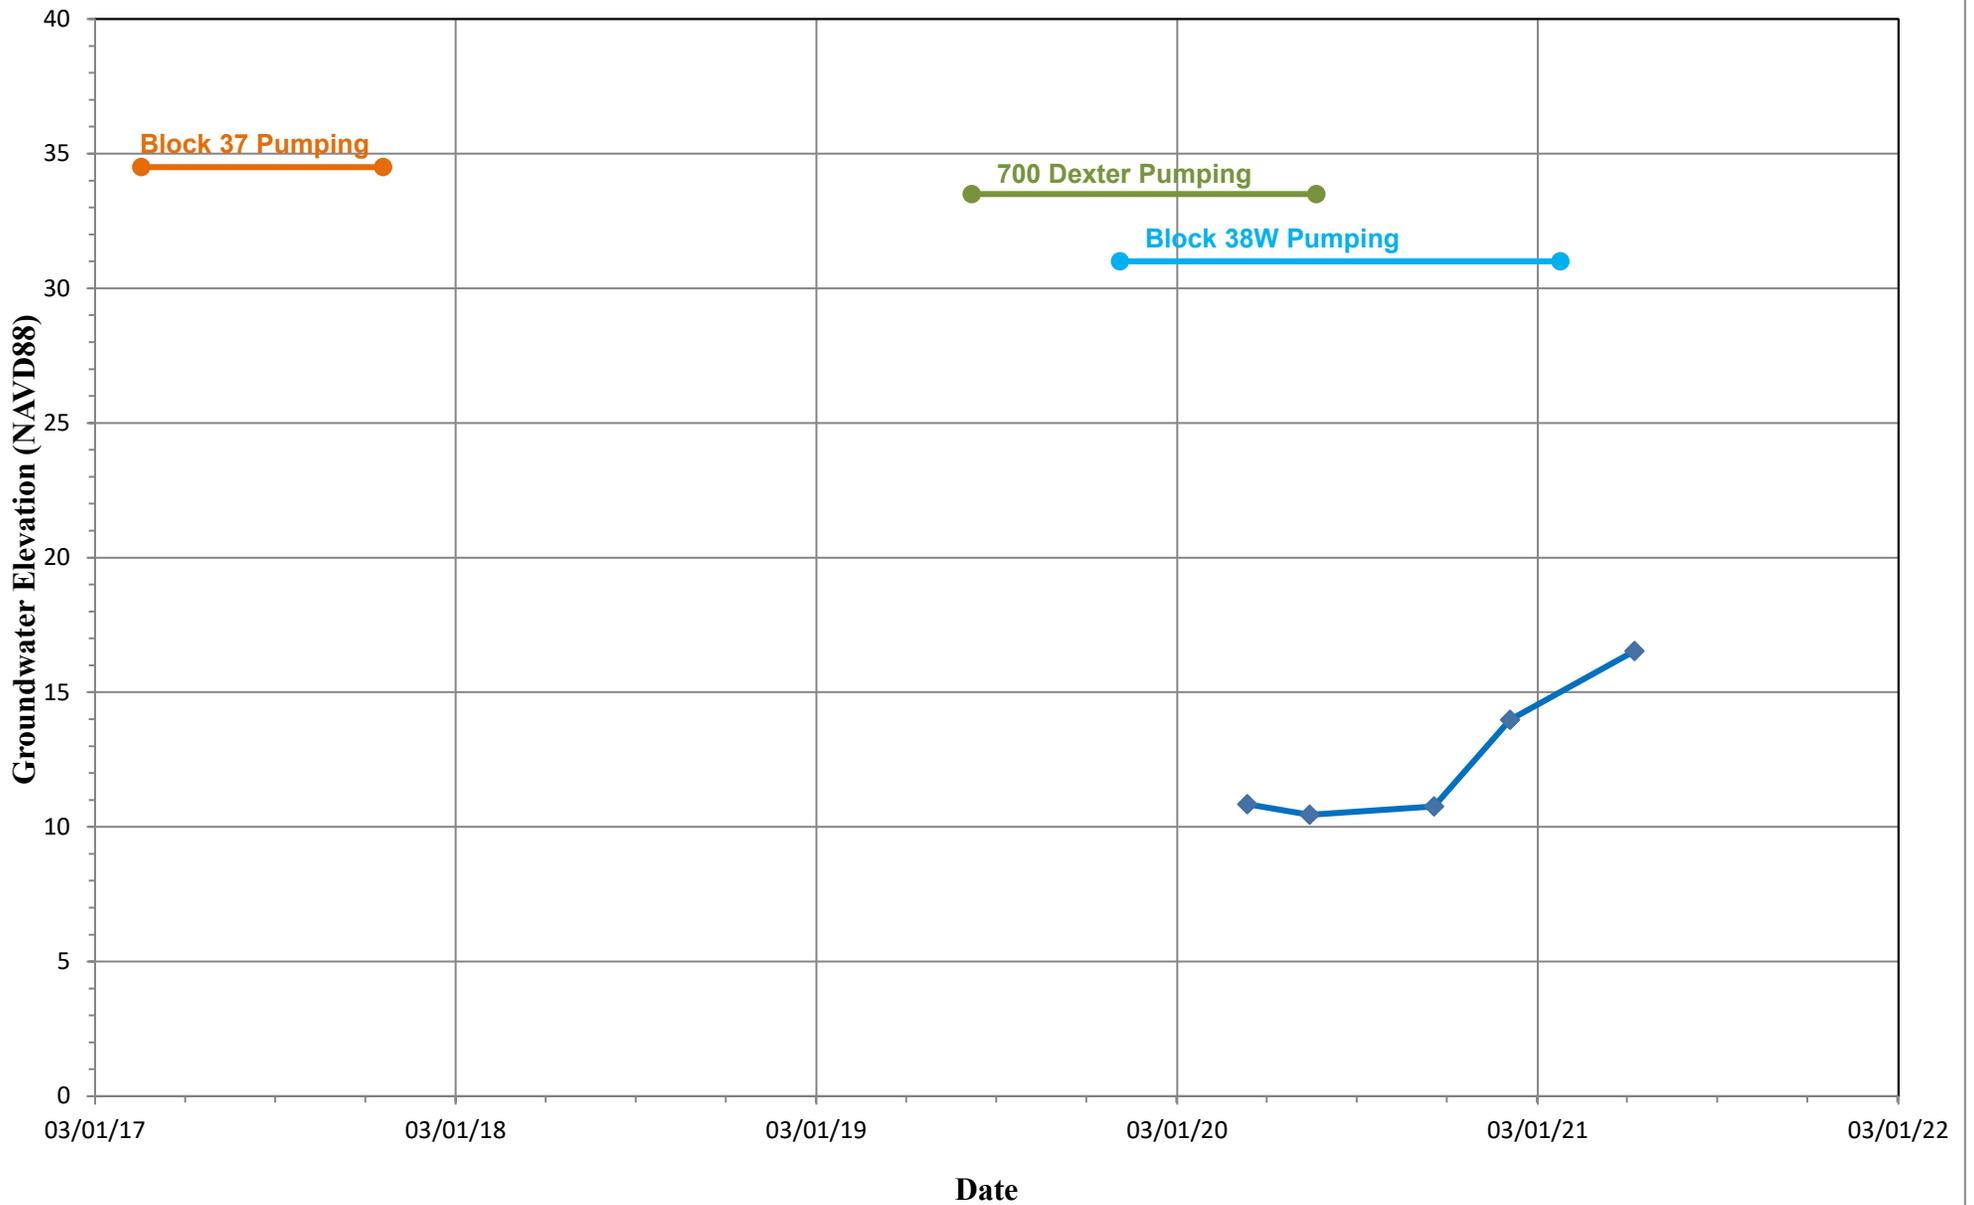





**Hydrograph**  
**MW112, Dexter Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

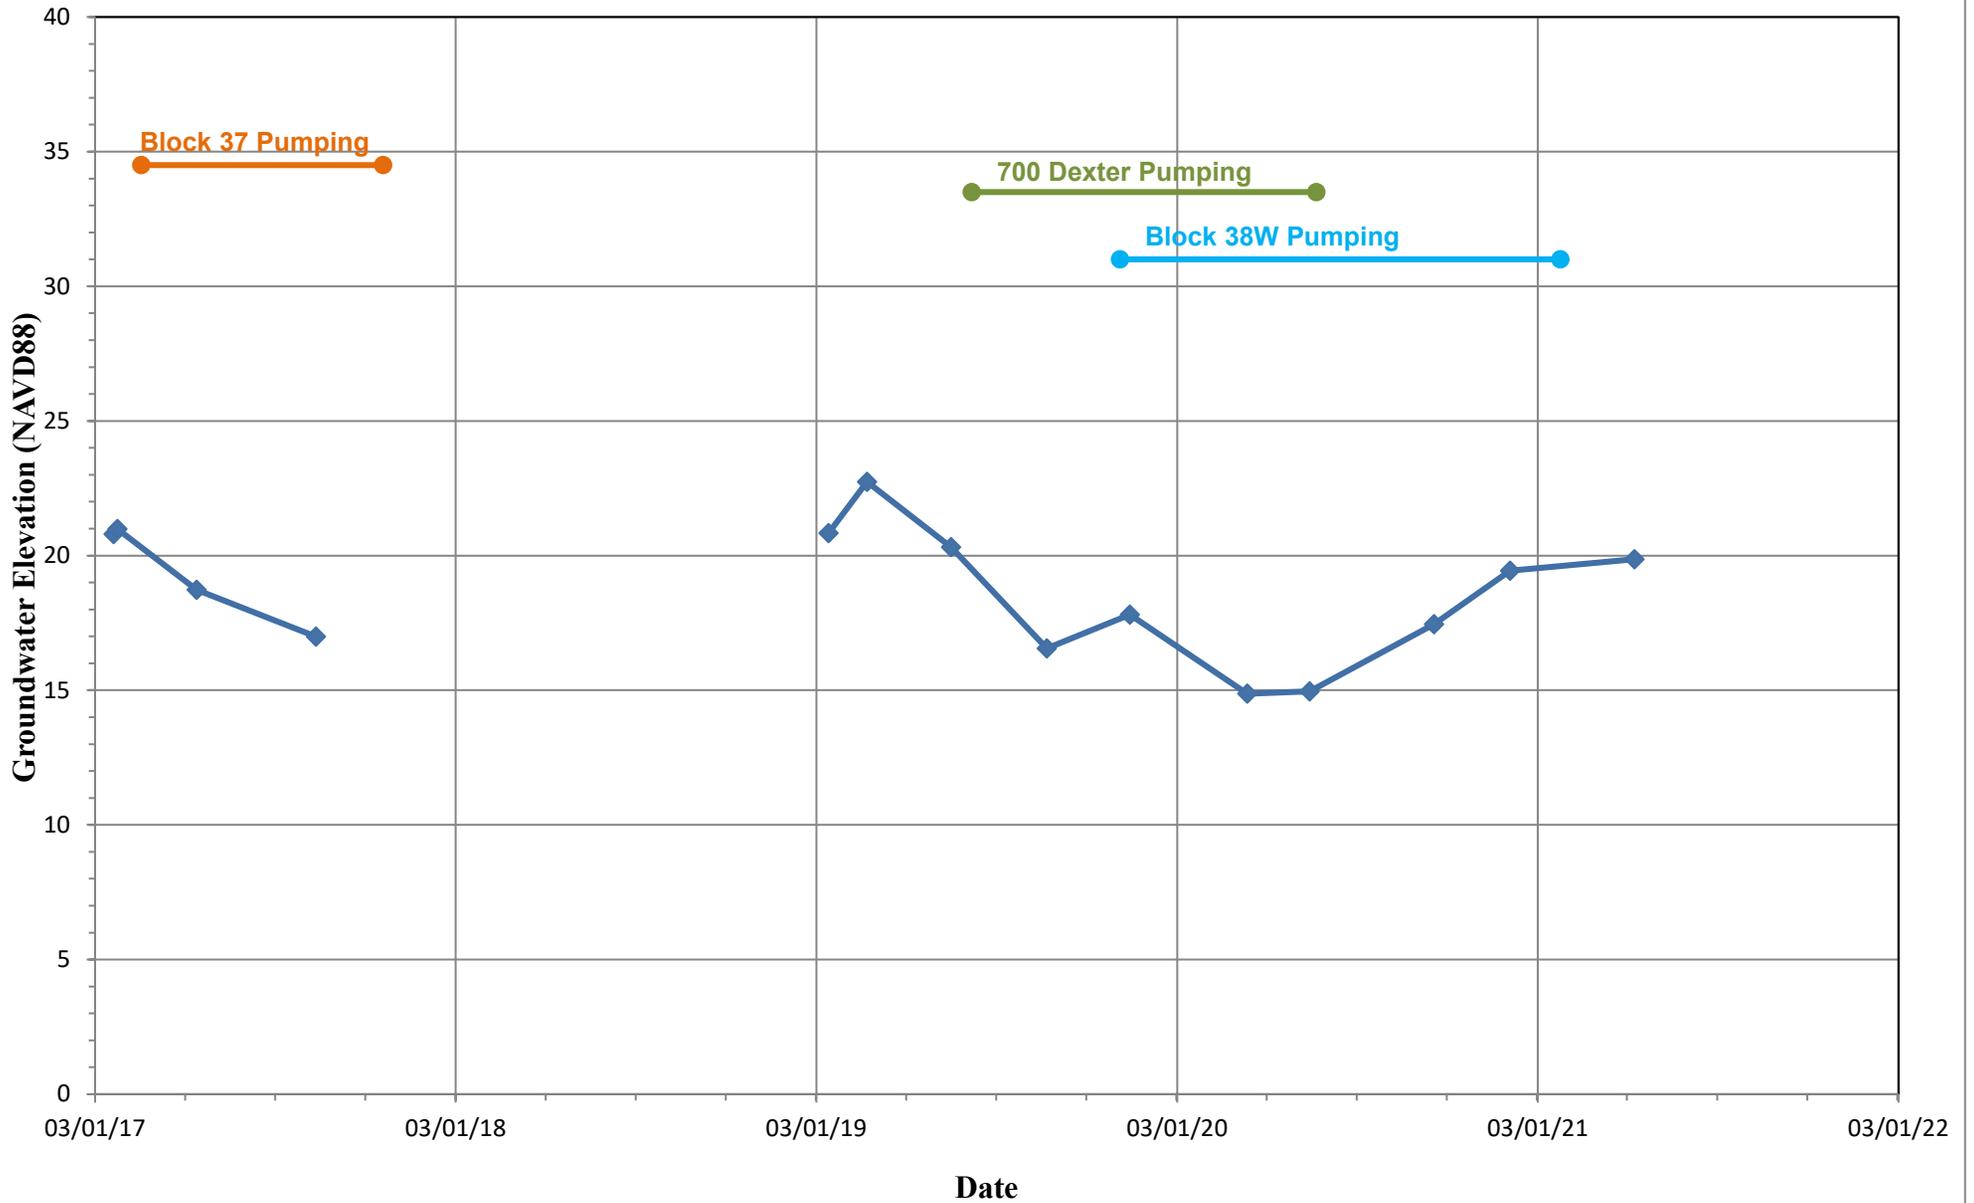

**Hydrograph**  
**MW-143, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

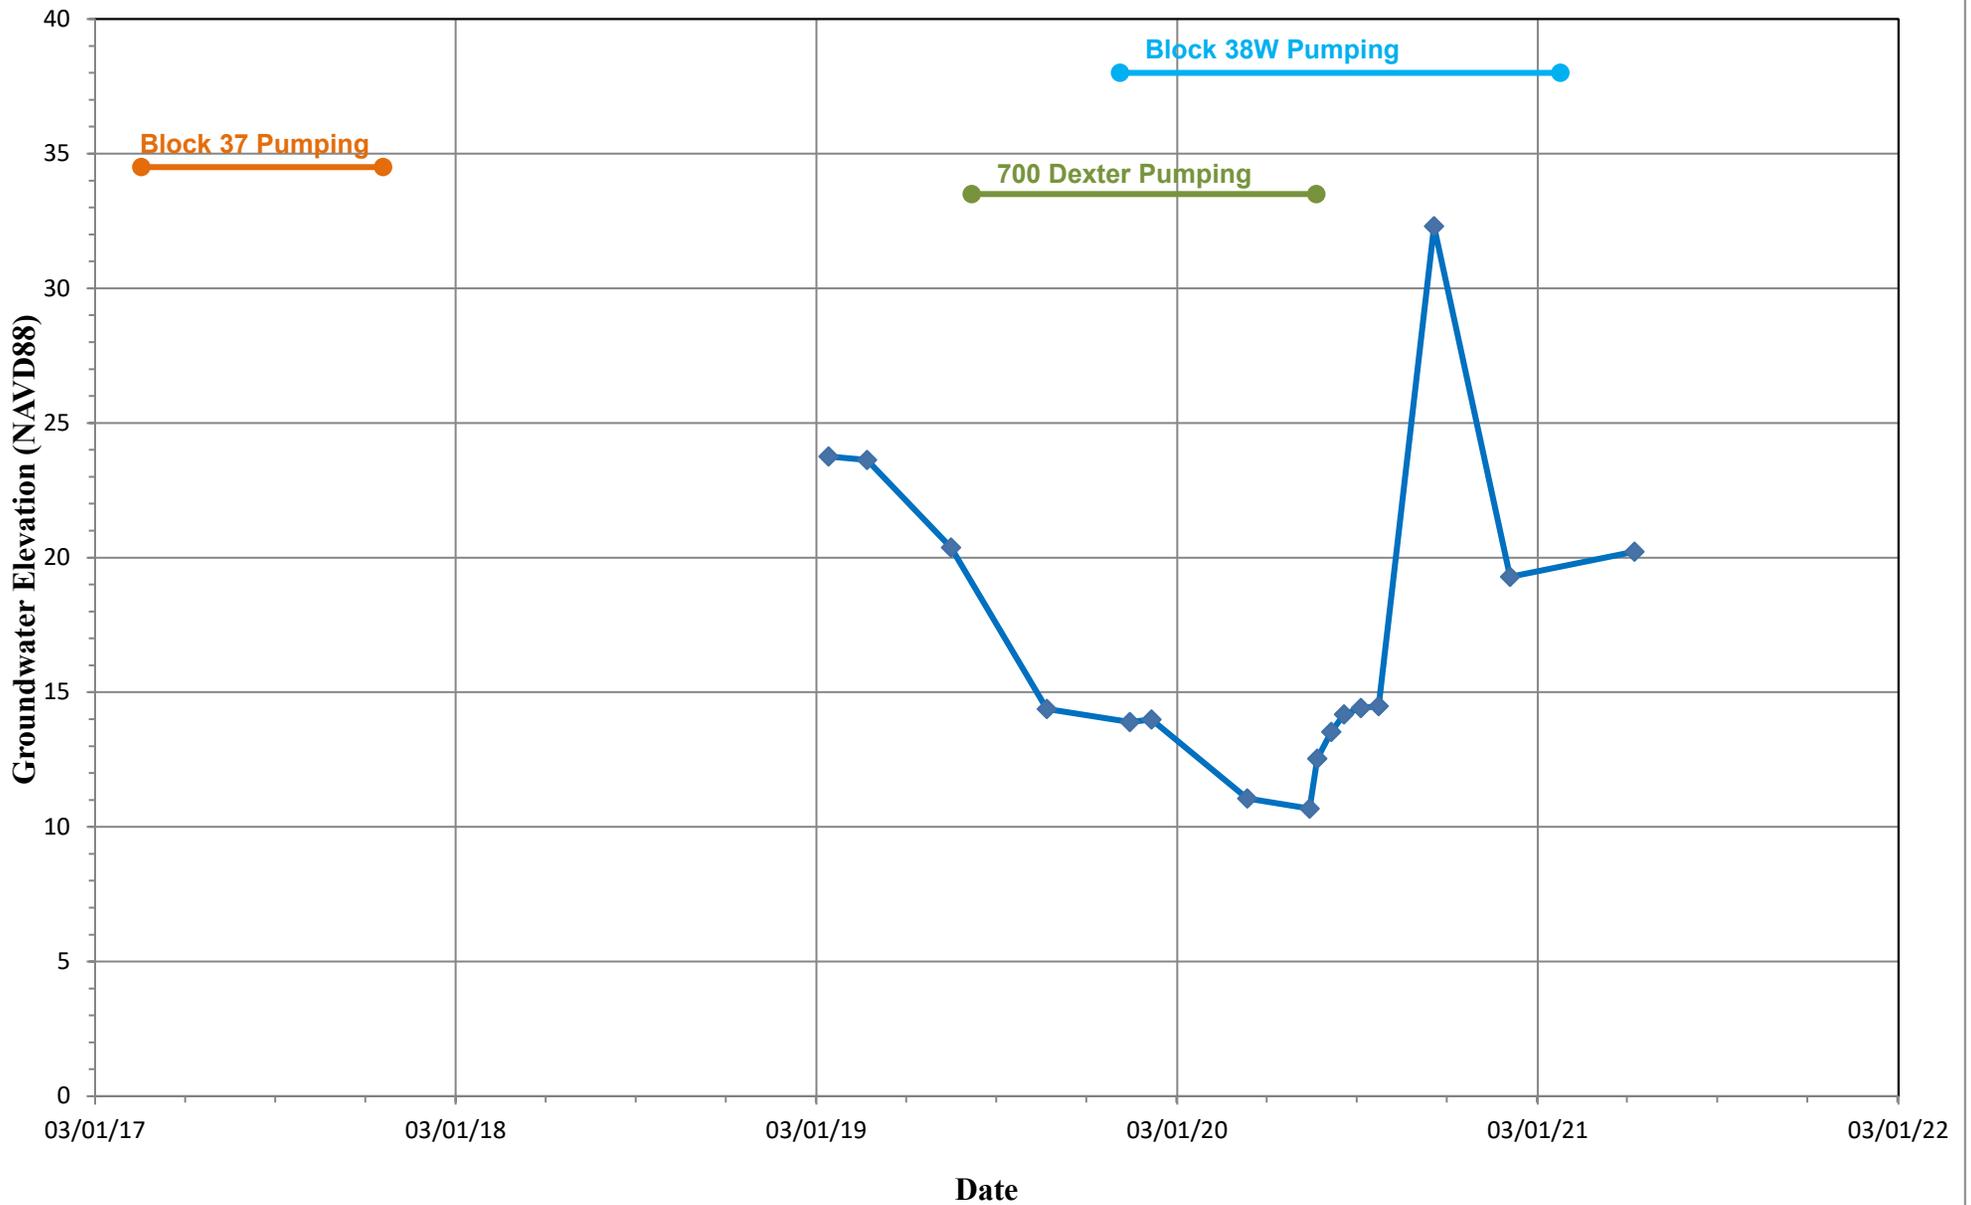


**Hydrograph**  
**MW-145R, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

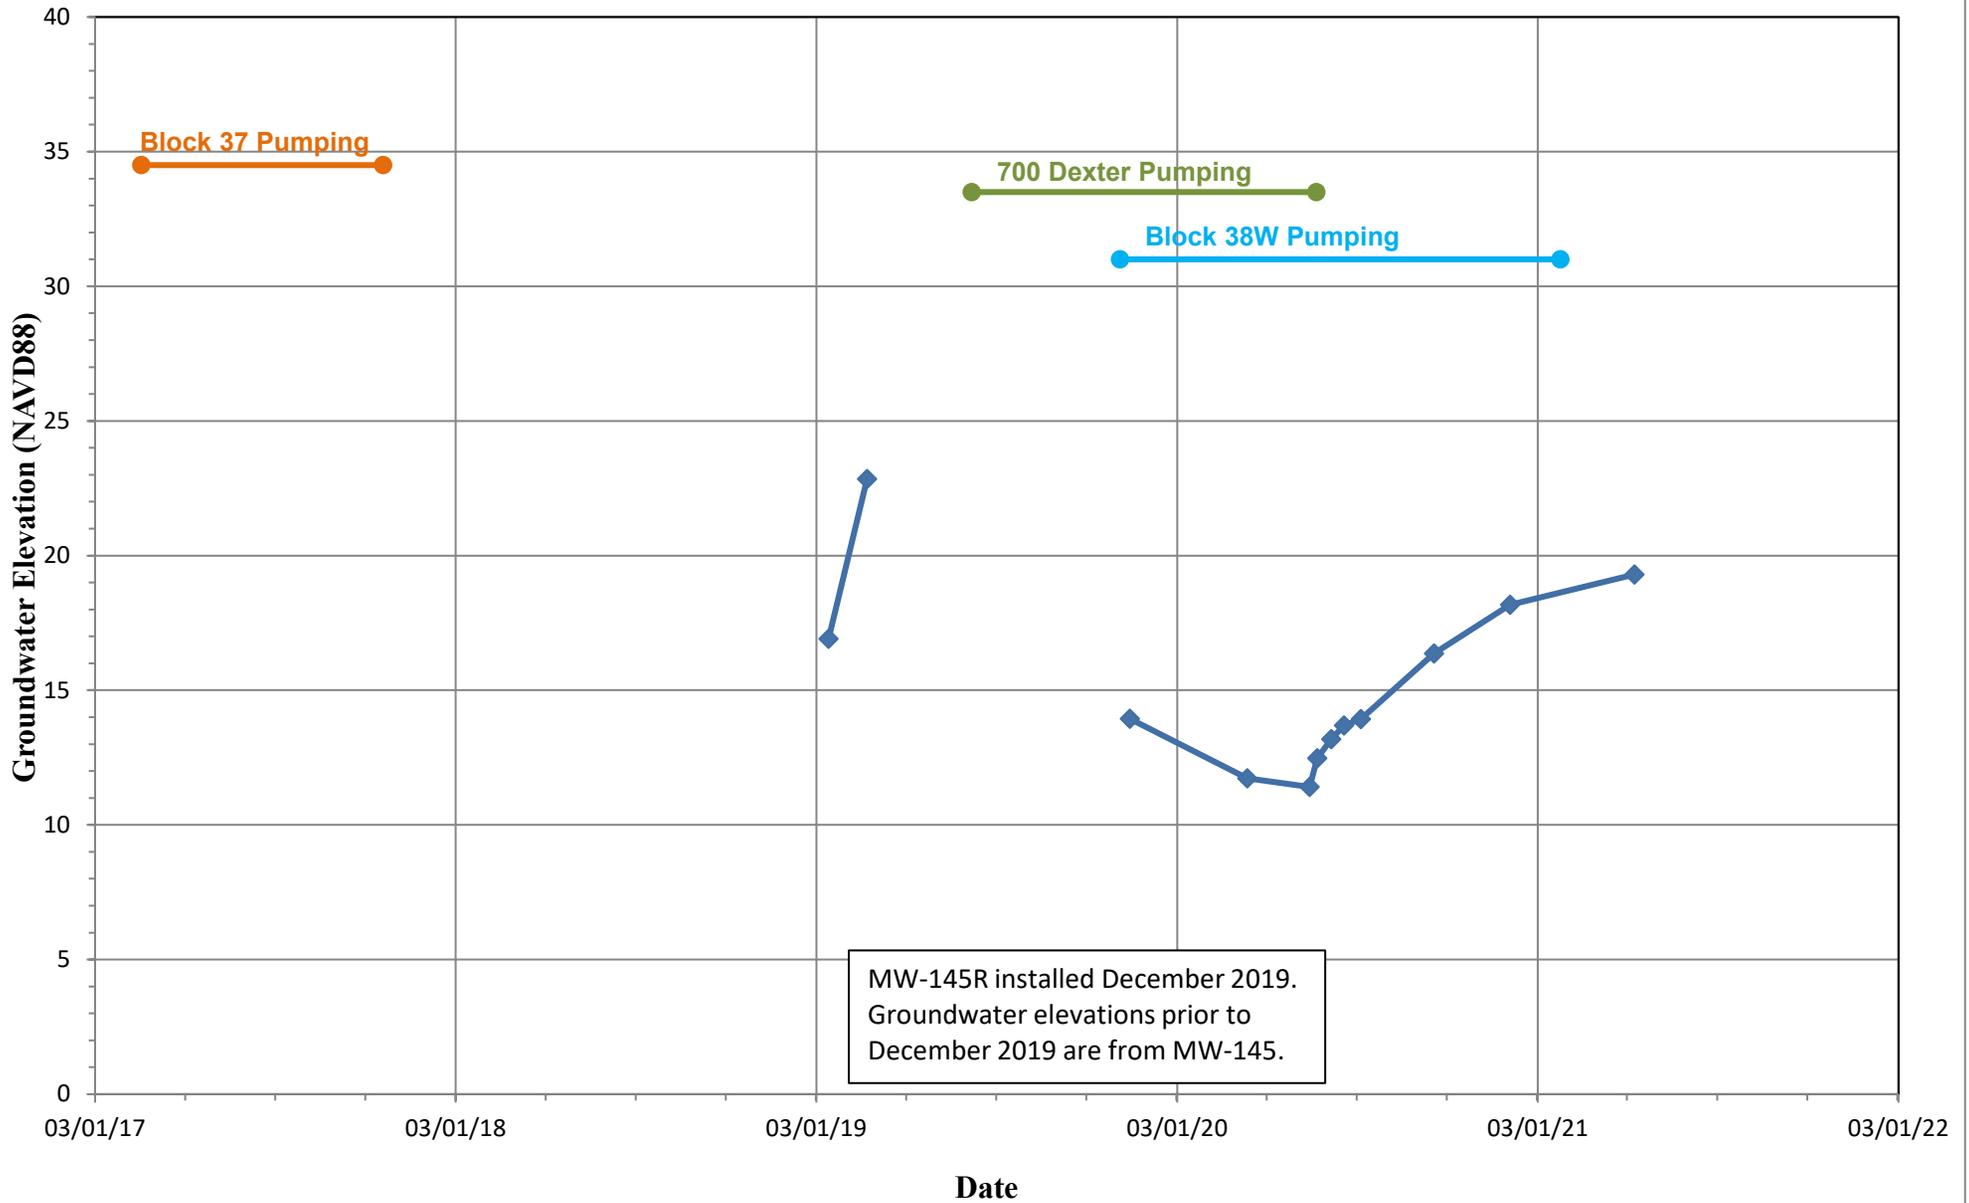


MW-145R installed December 2019.  
Groundwater elevations prior to  
December 2019 are from MW-145.

**Hydrograph**  
**MW-147, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

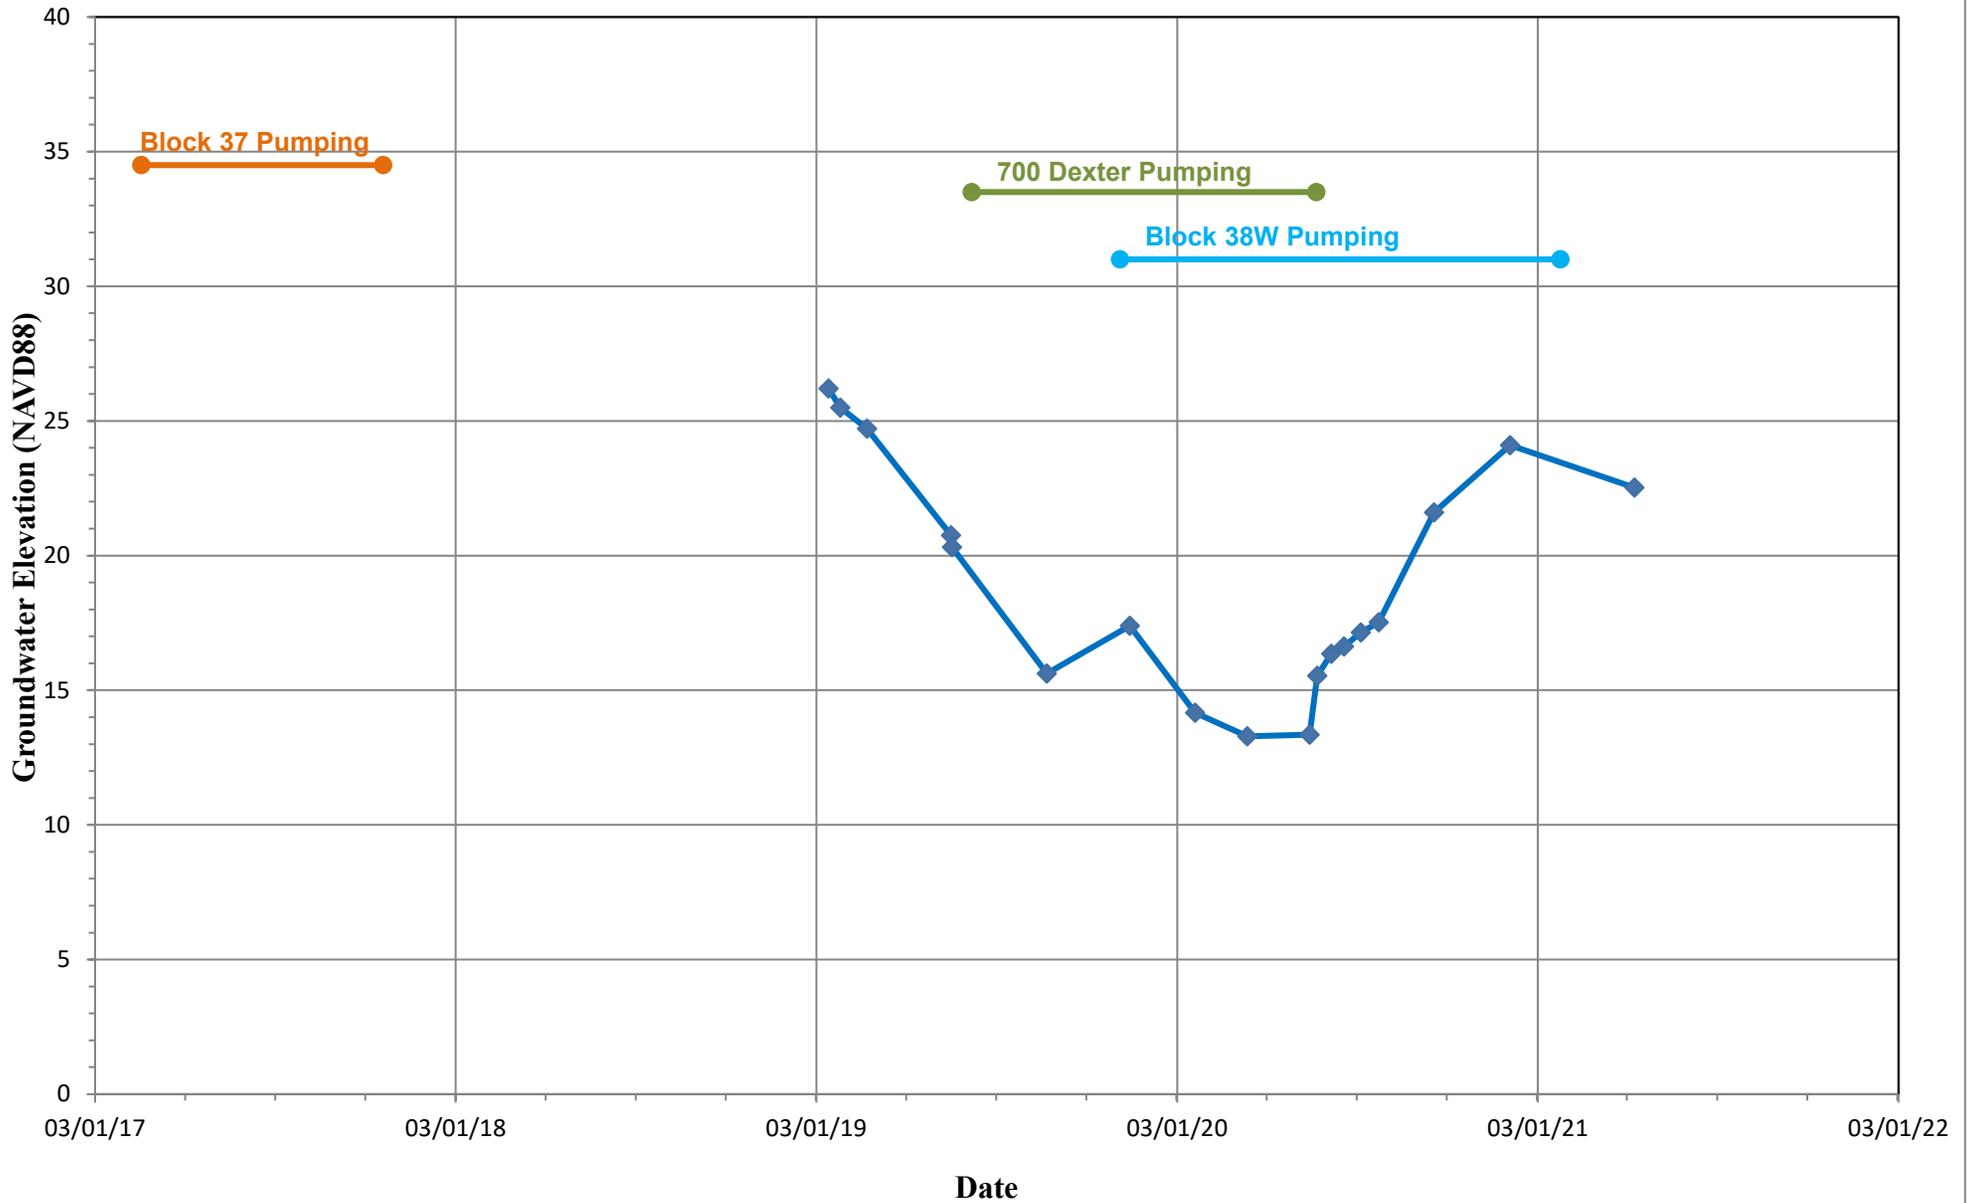





**Hydrograph**  
**MW-157, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

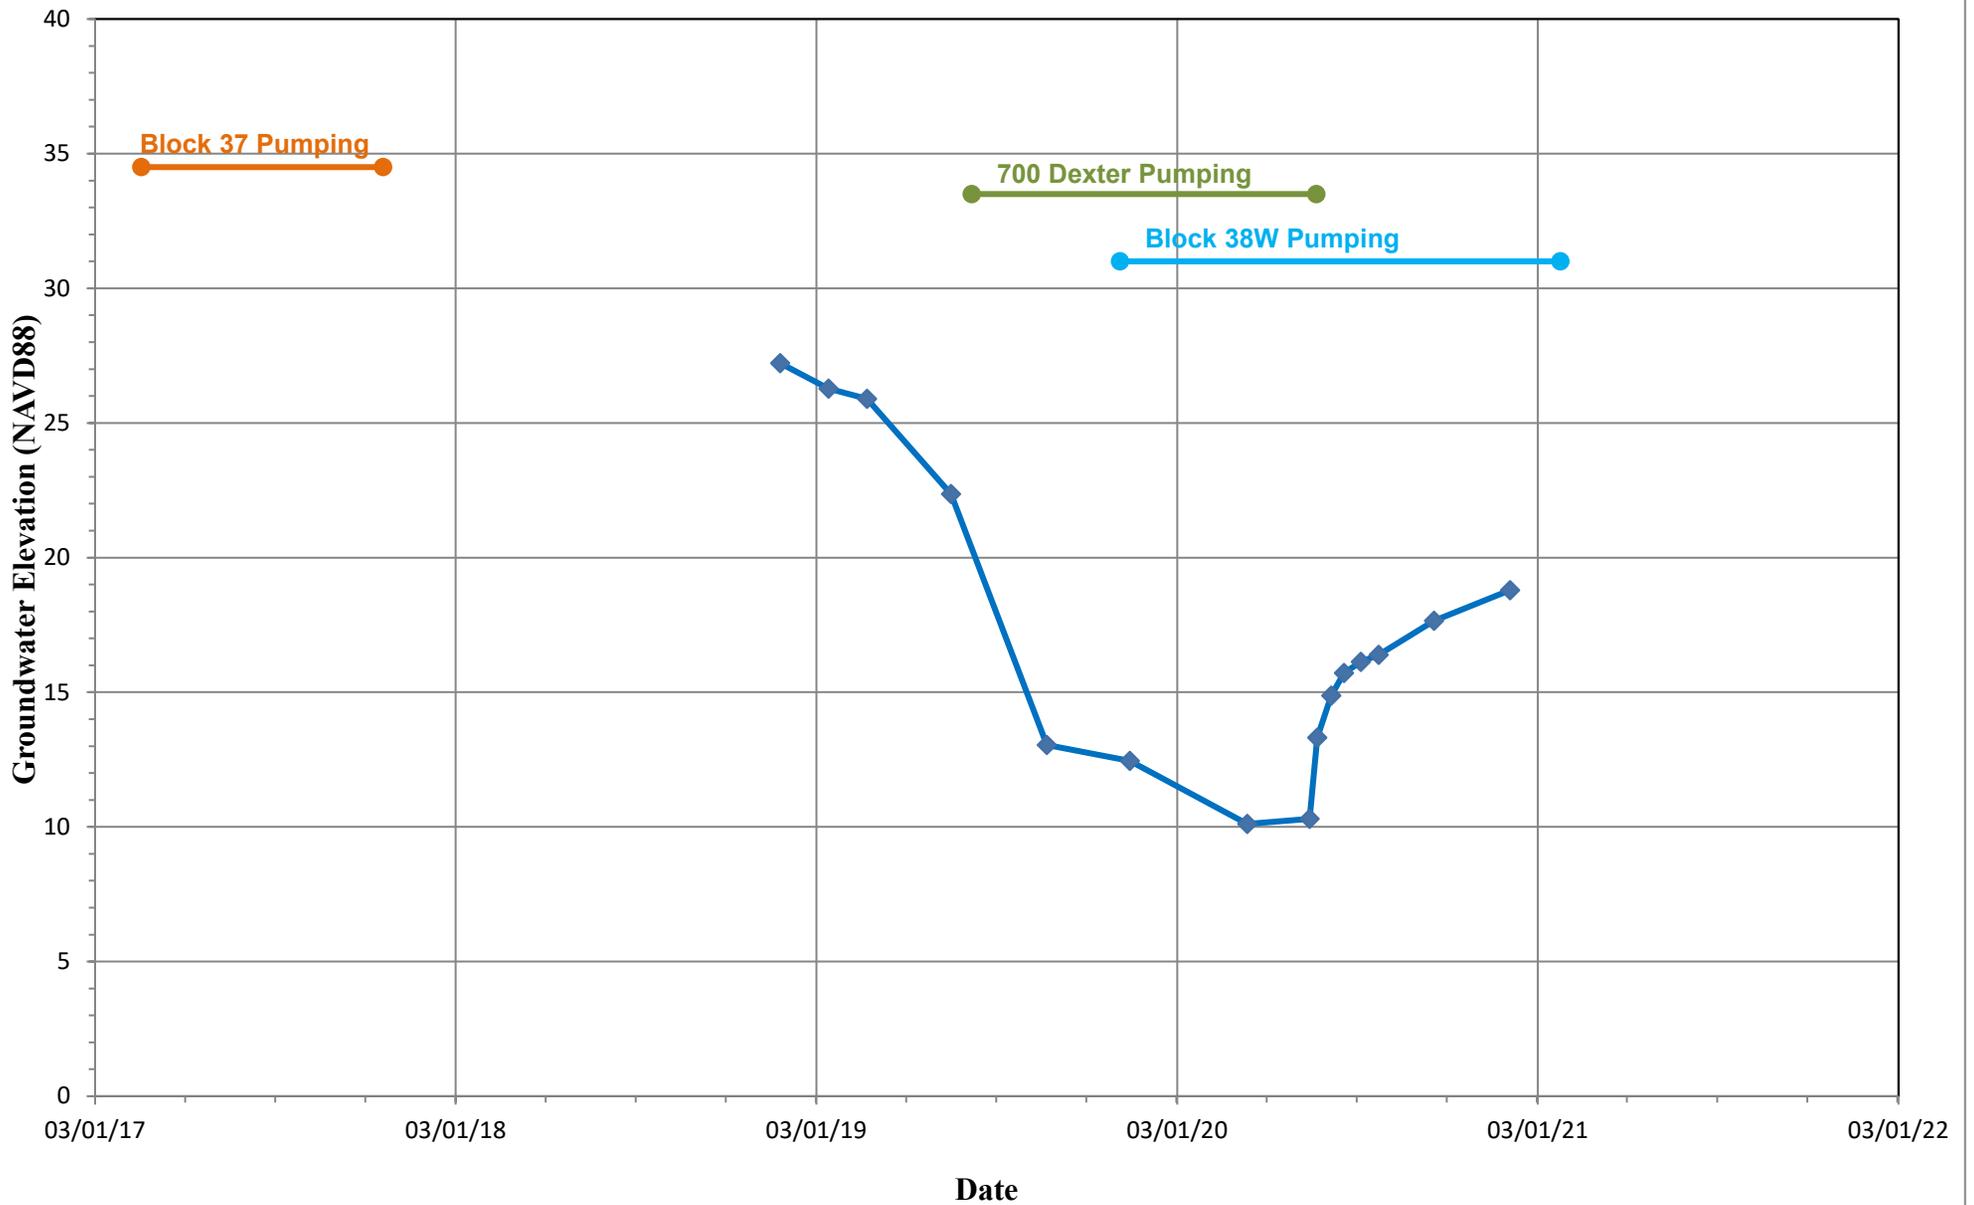


**Hydrograph**  
**MW-190, Valley St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

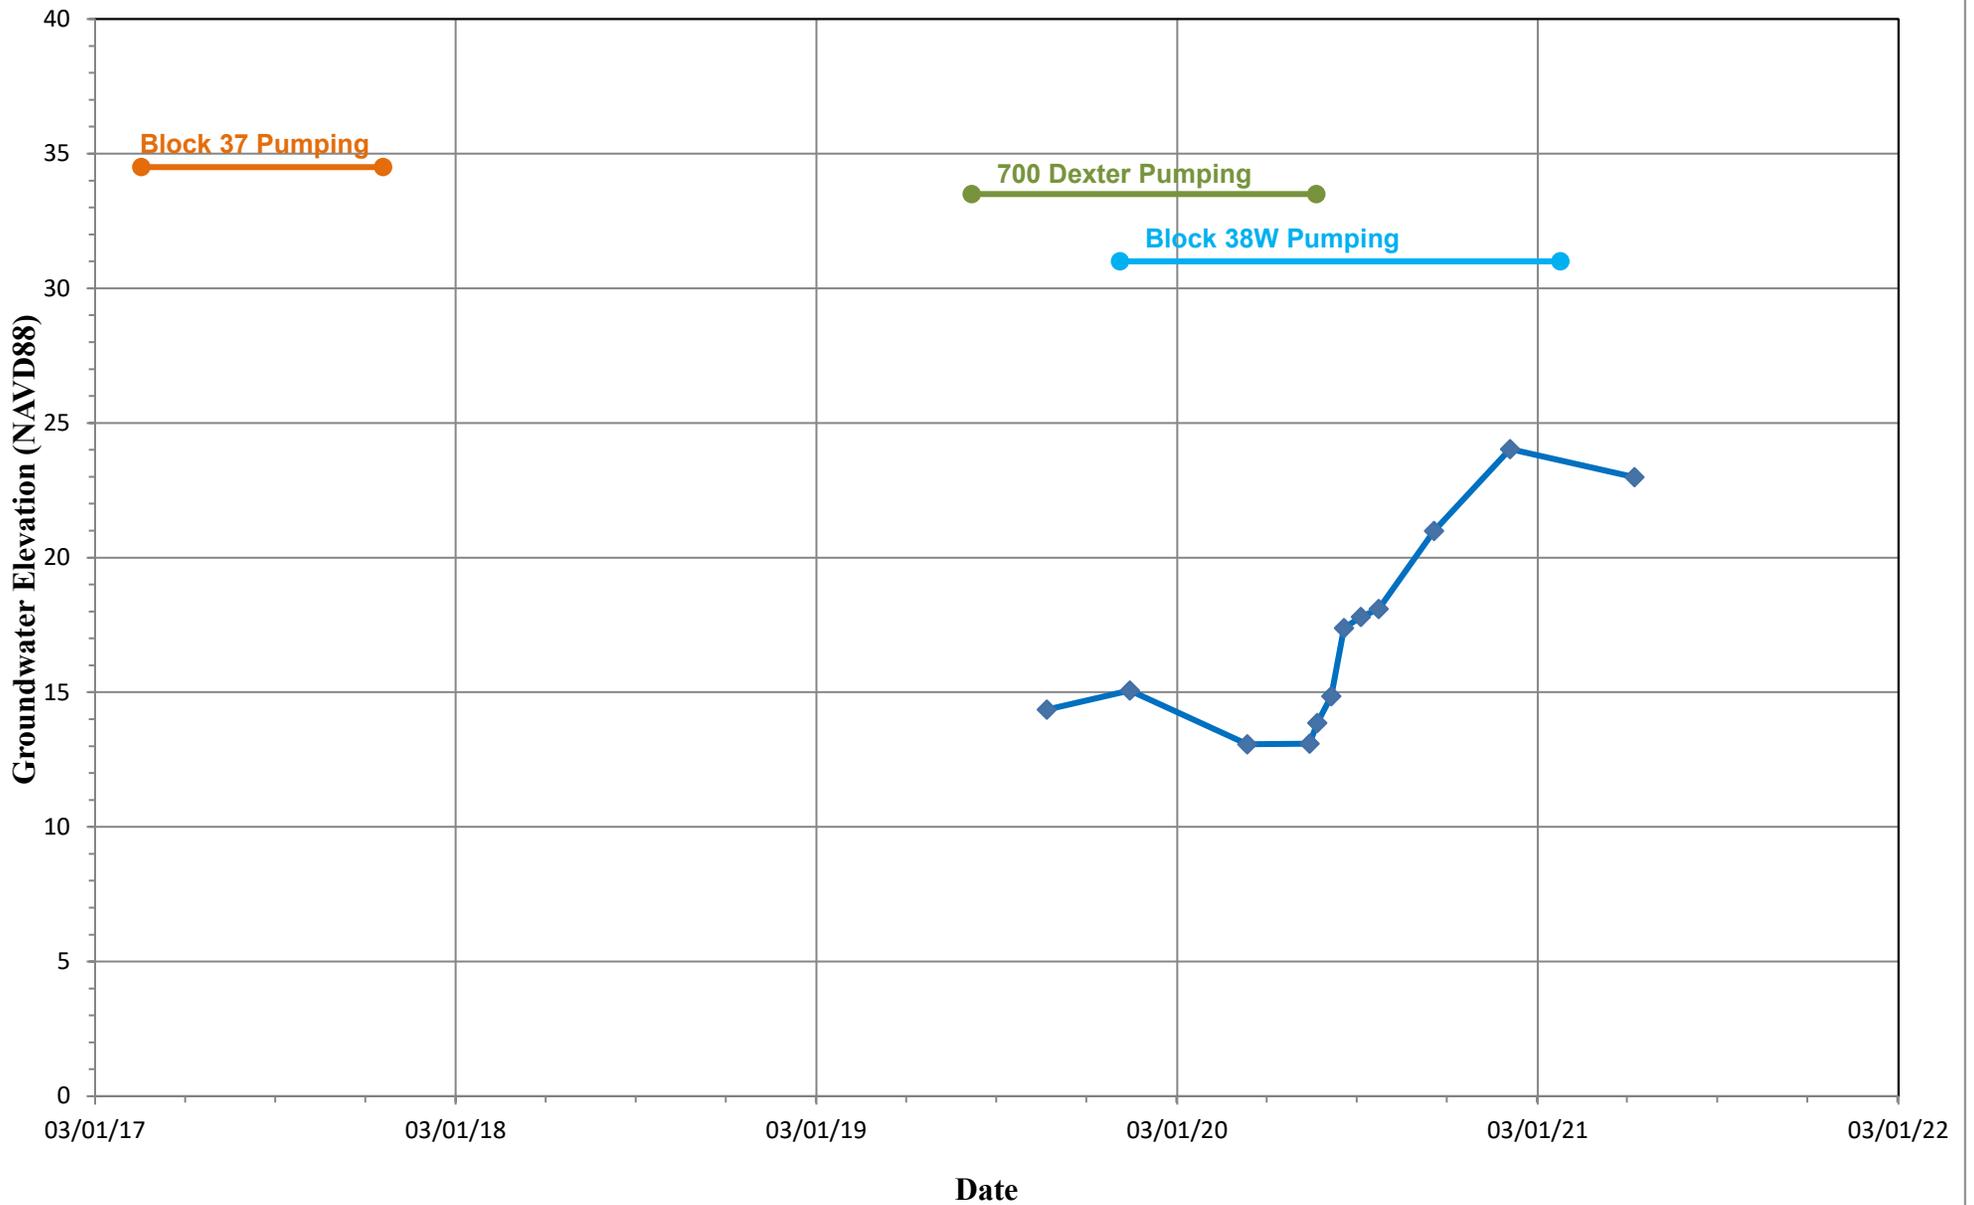


**Hydrograph**  
**MW-303, Dexter Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

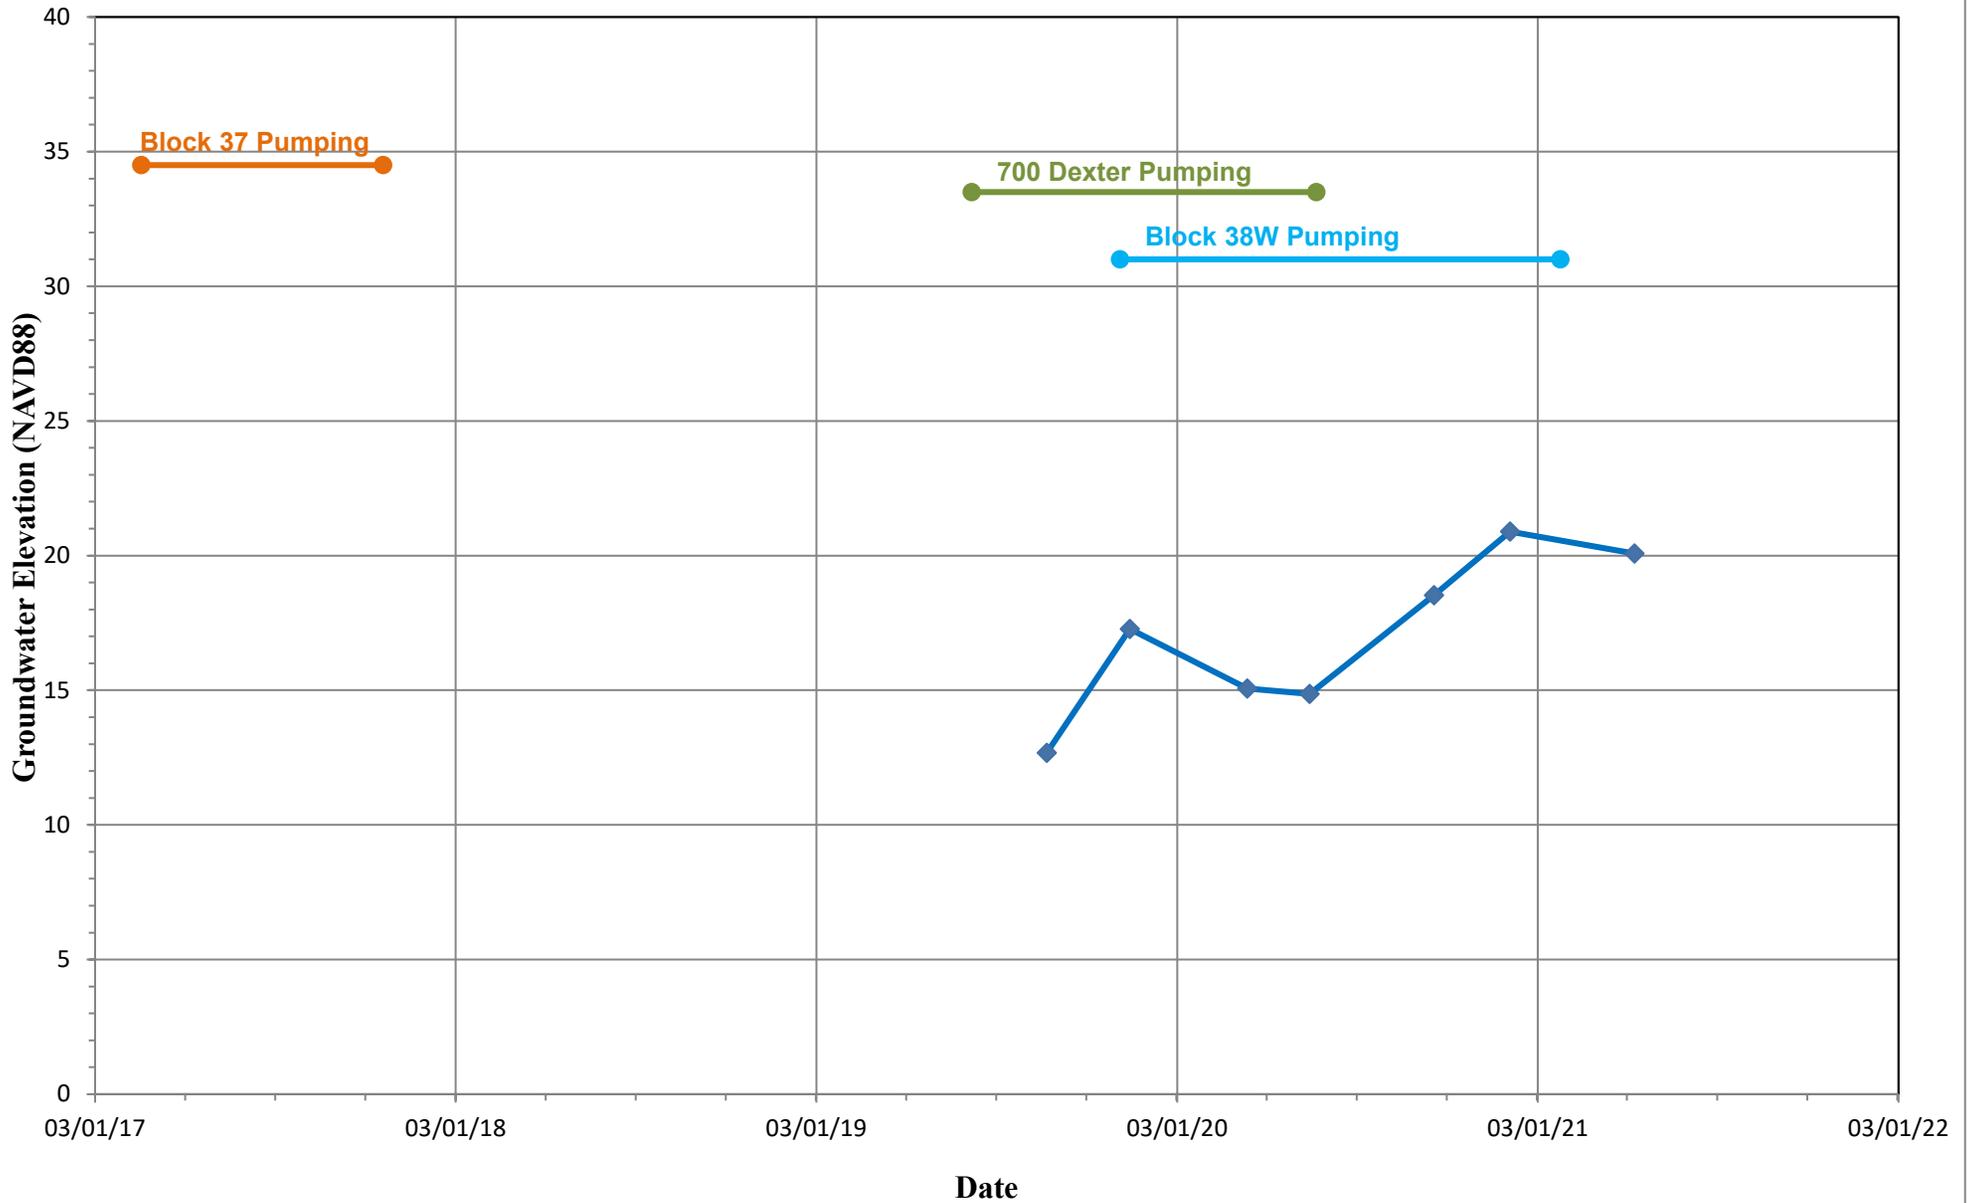


**Hydrograph**  
**MW-307, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

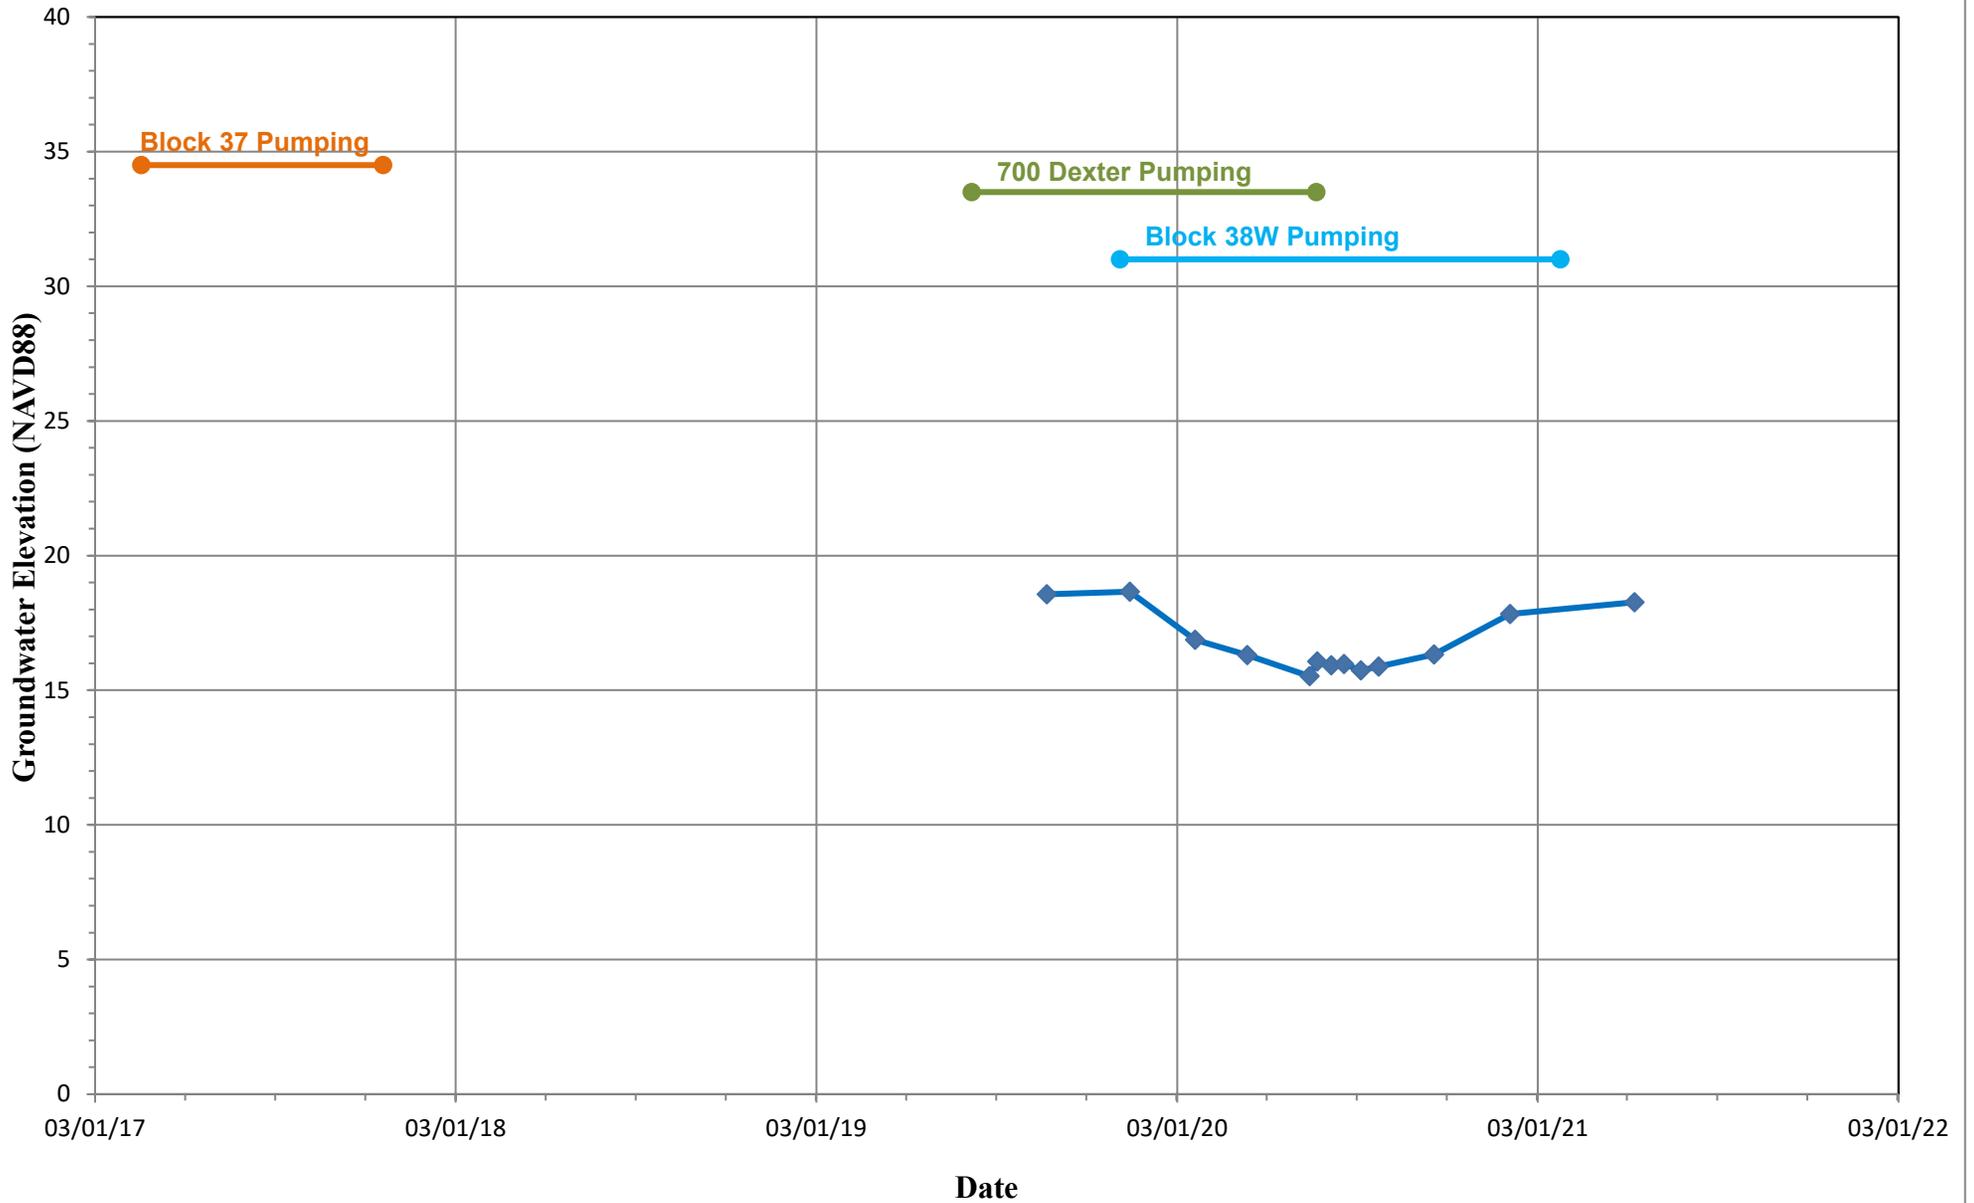


**Hydrograph**  
**MW-309, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

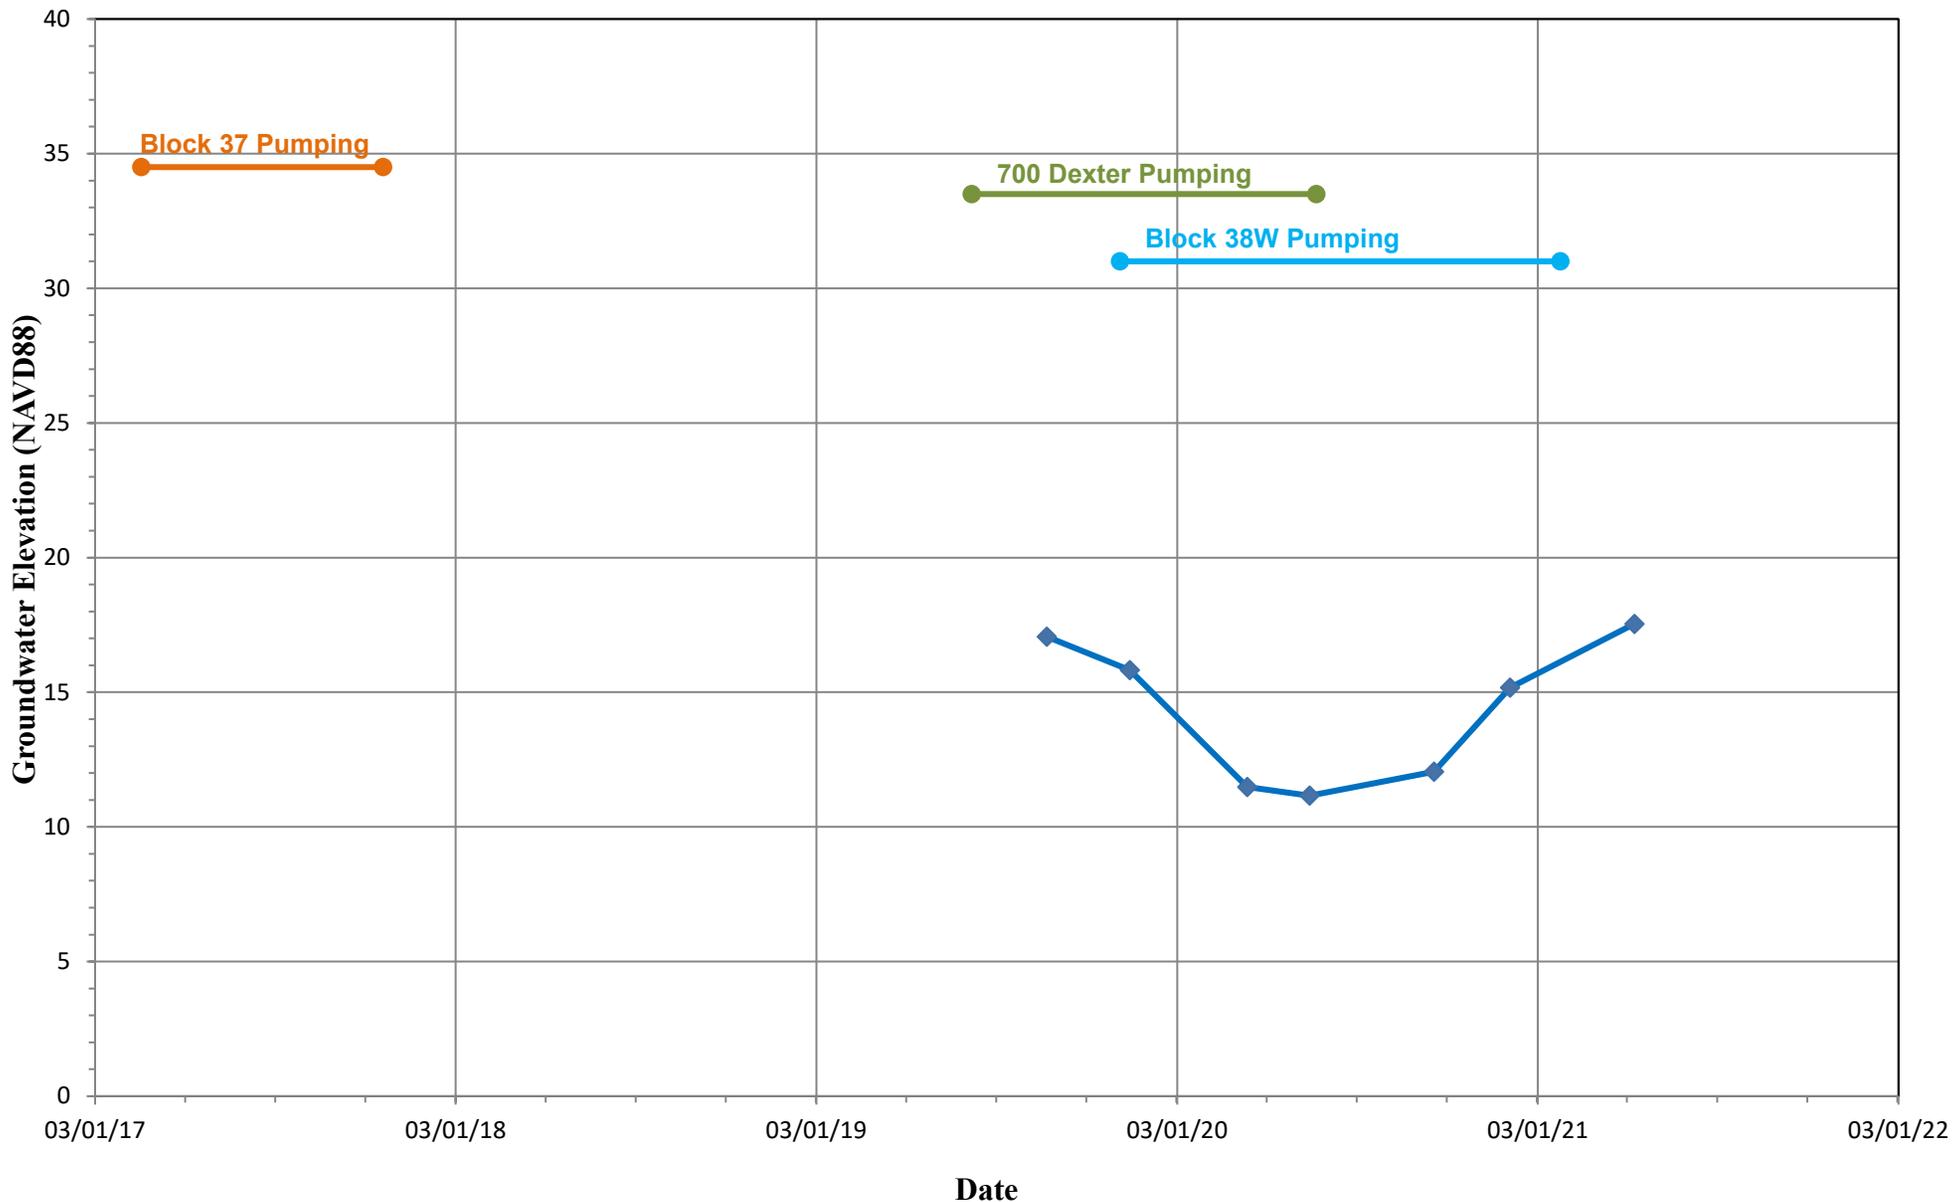


**Hydrograph**  
**MW-311, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

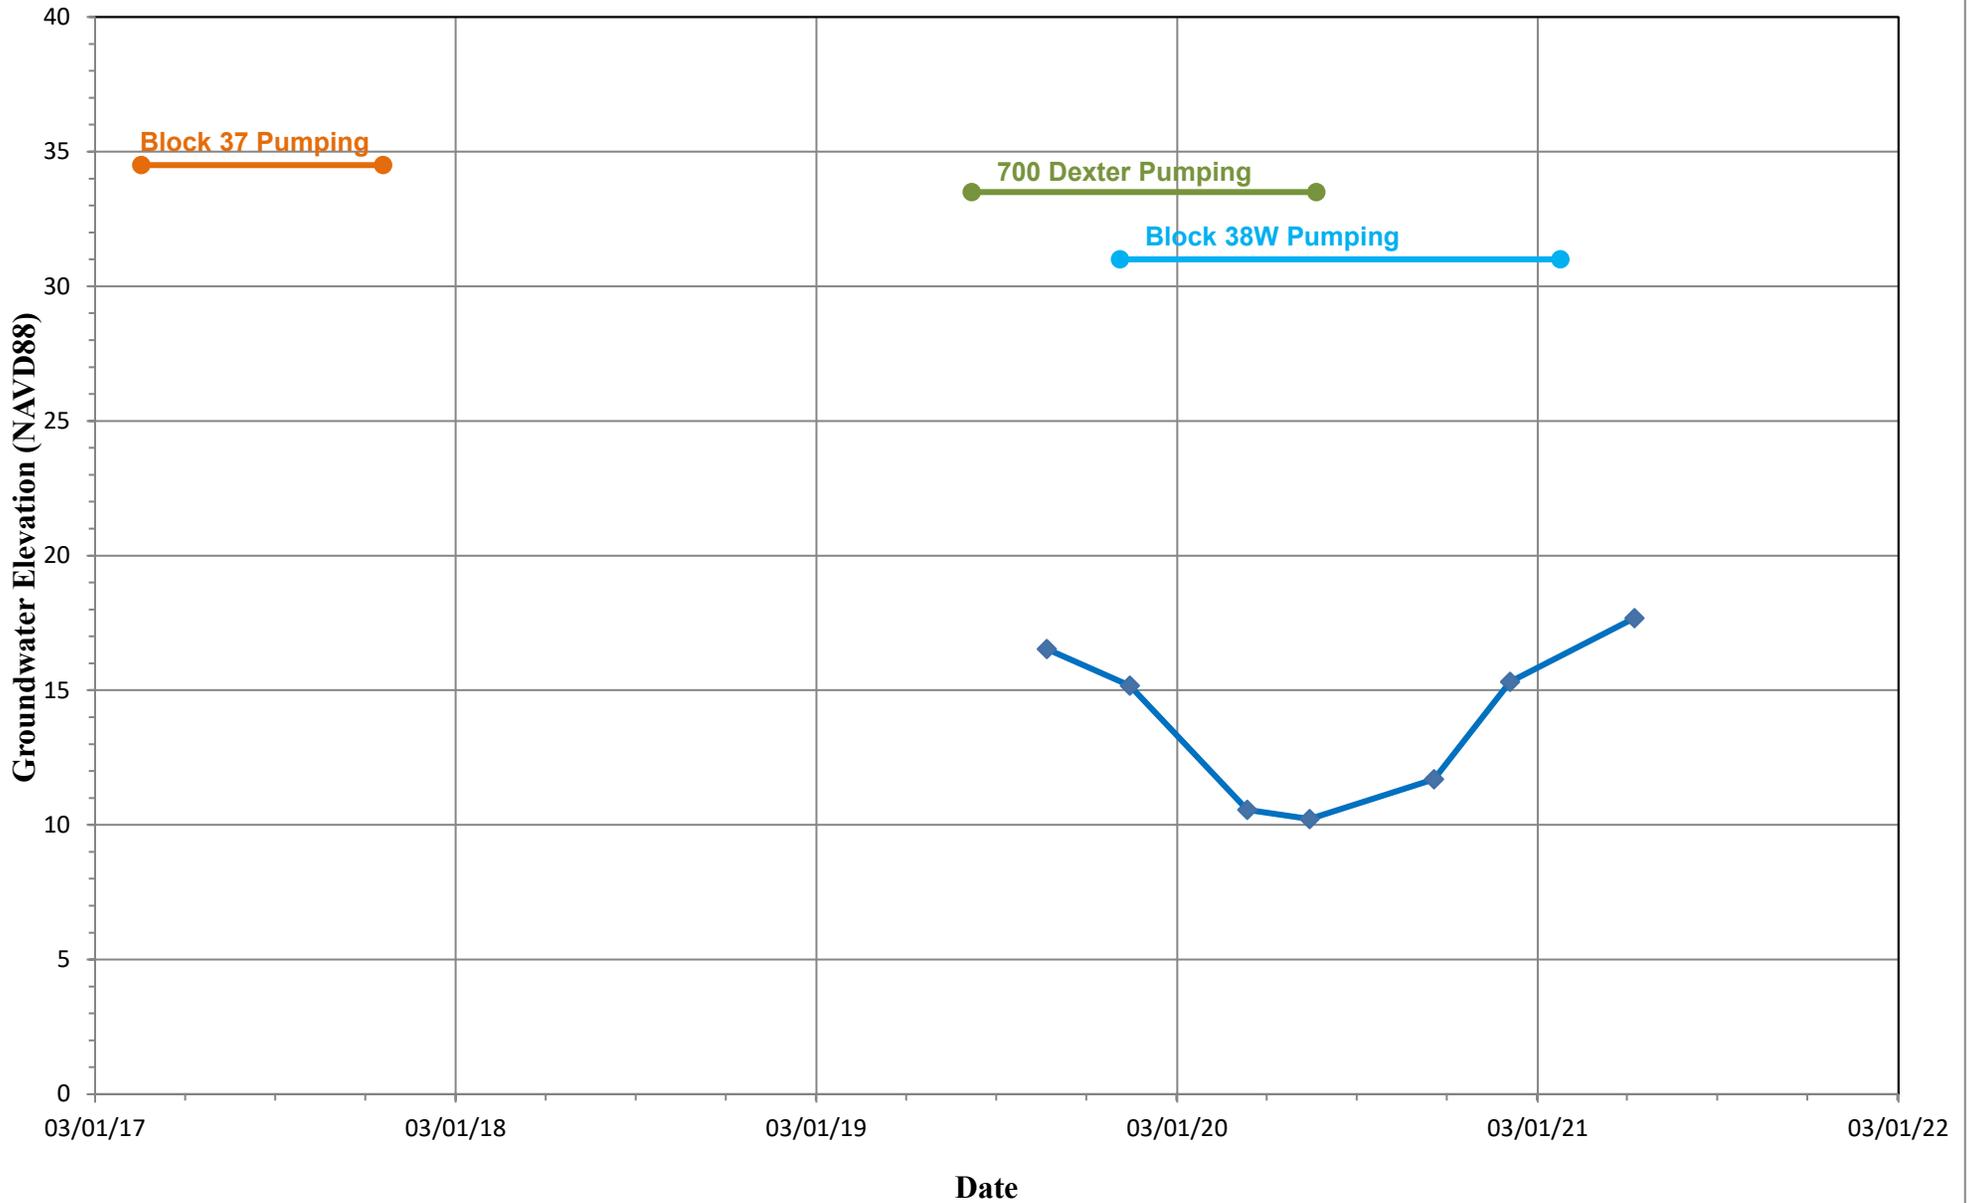

**Hydrograph**  
**MW-314, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

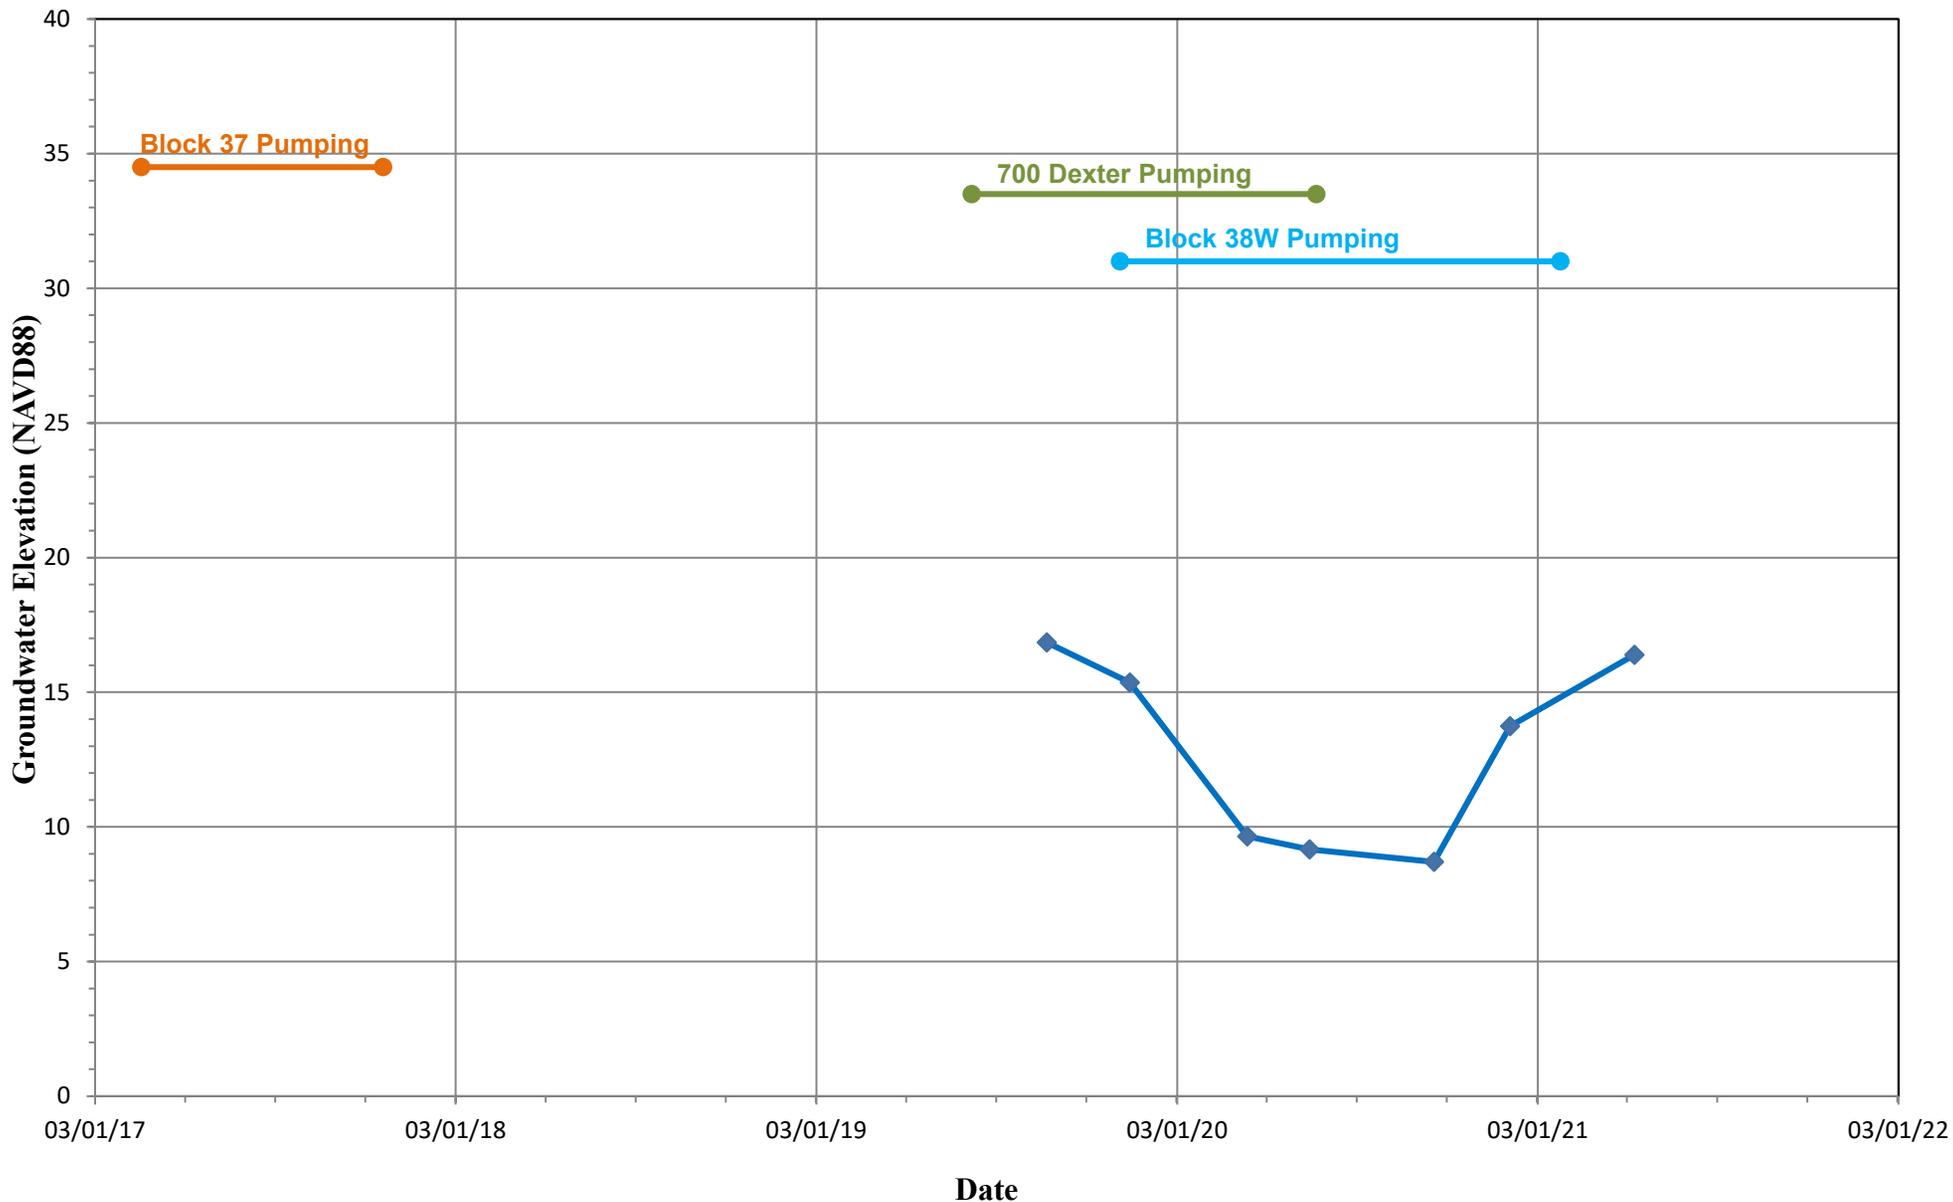


**Hydrograph**  
**MW-316, Merer St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

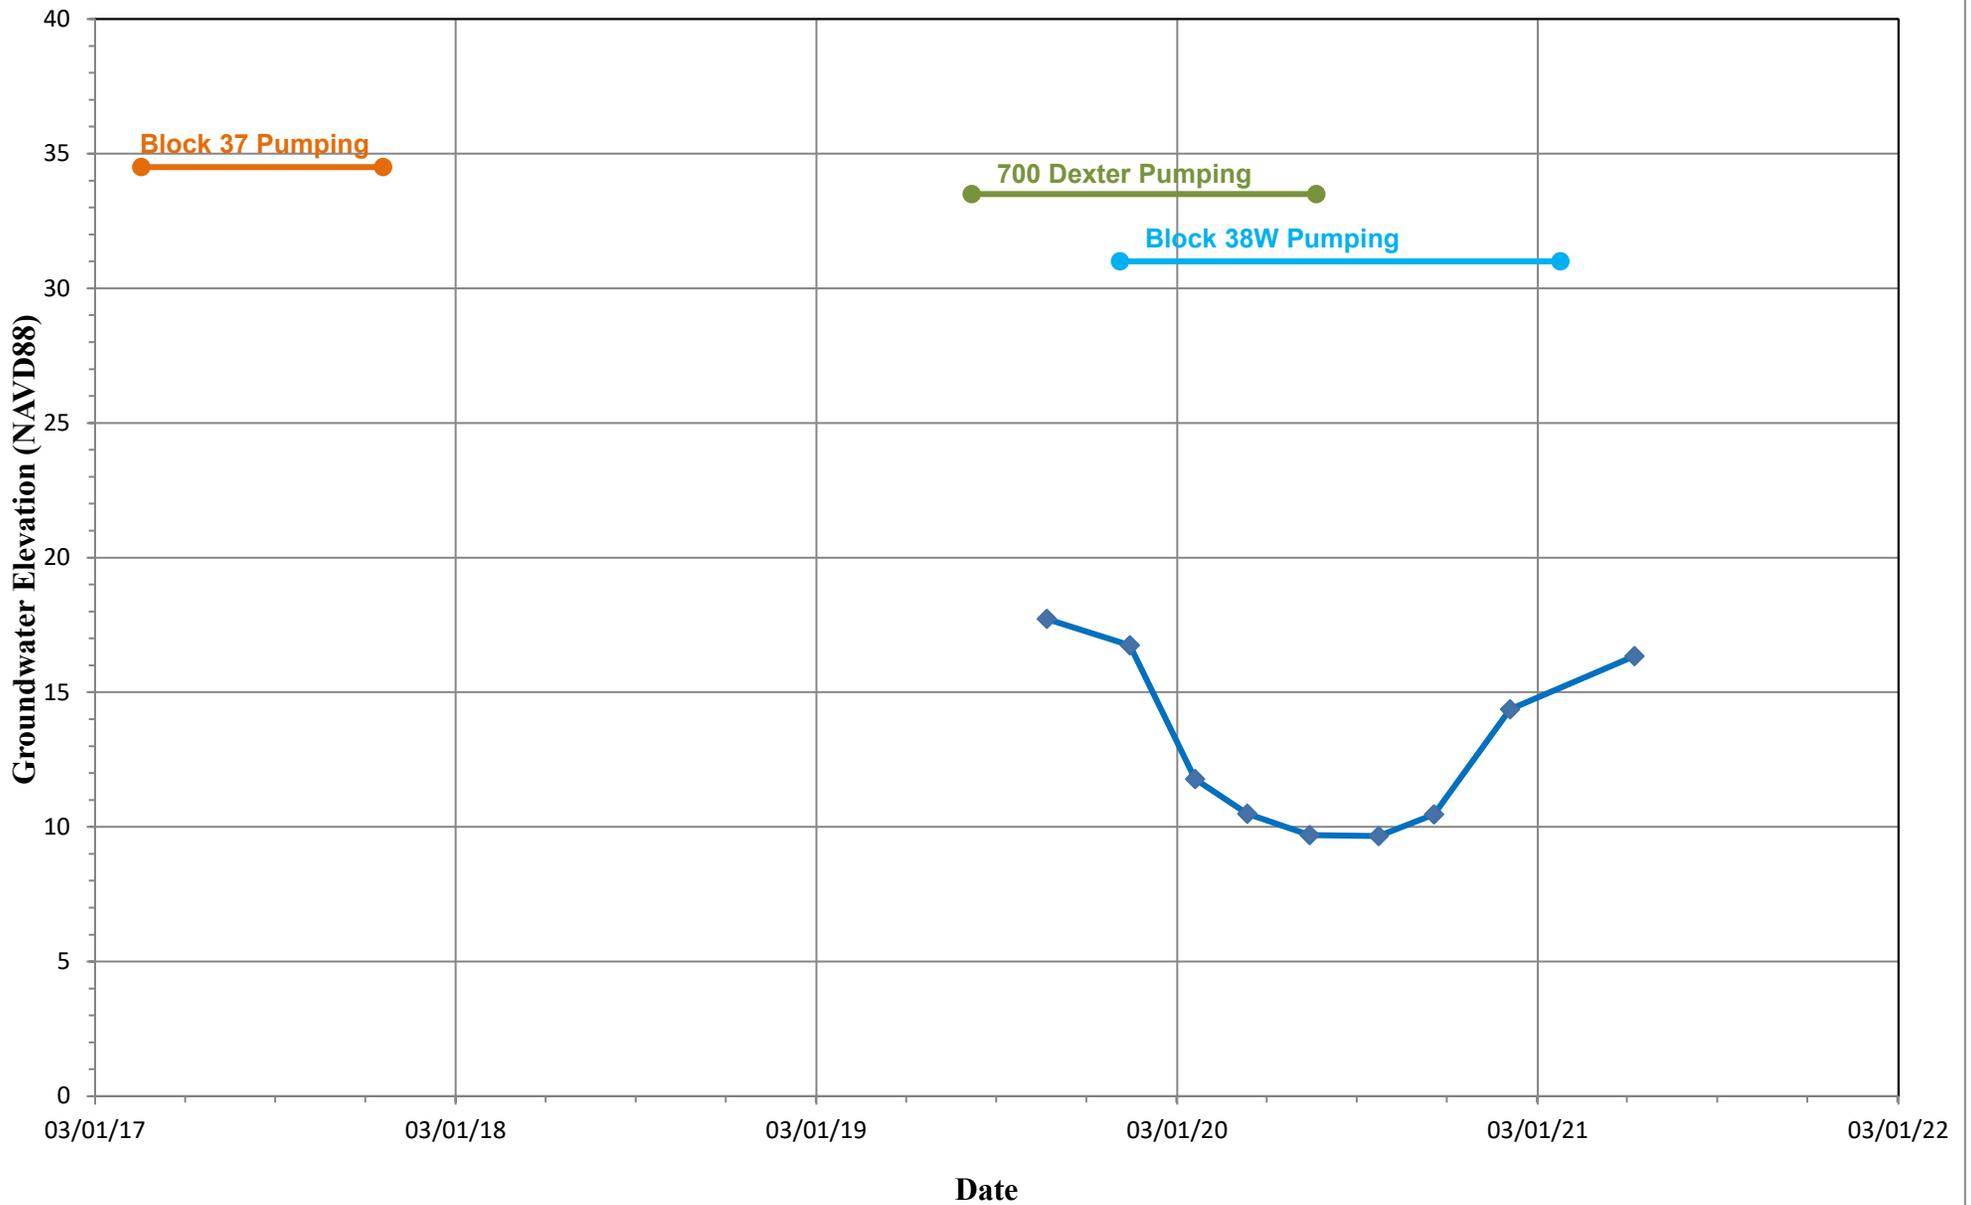





**Hydrograph**  
**MW-322, 9th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

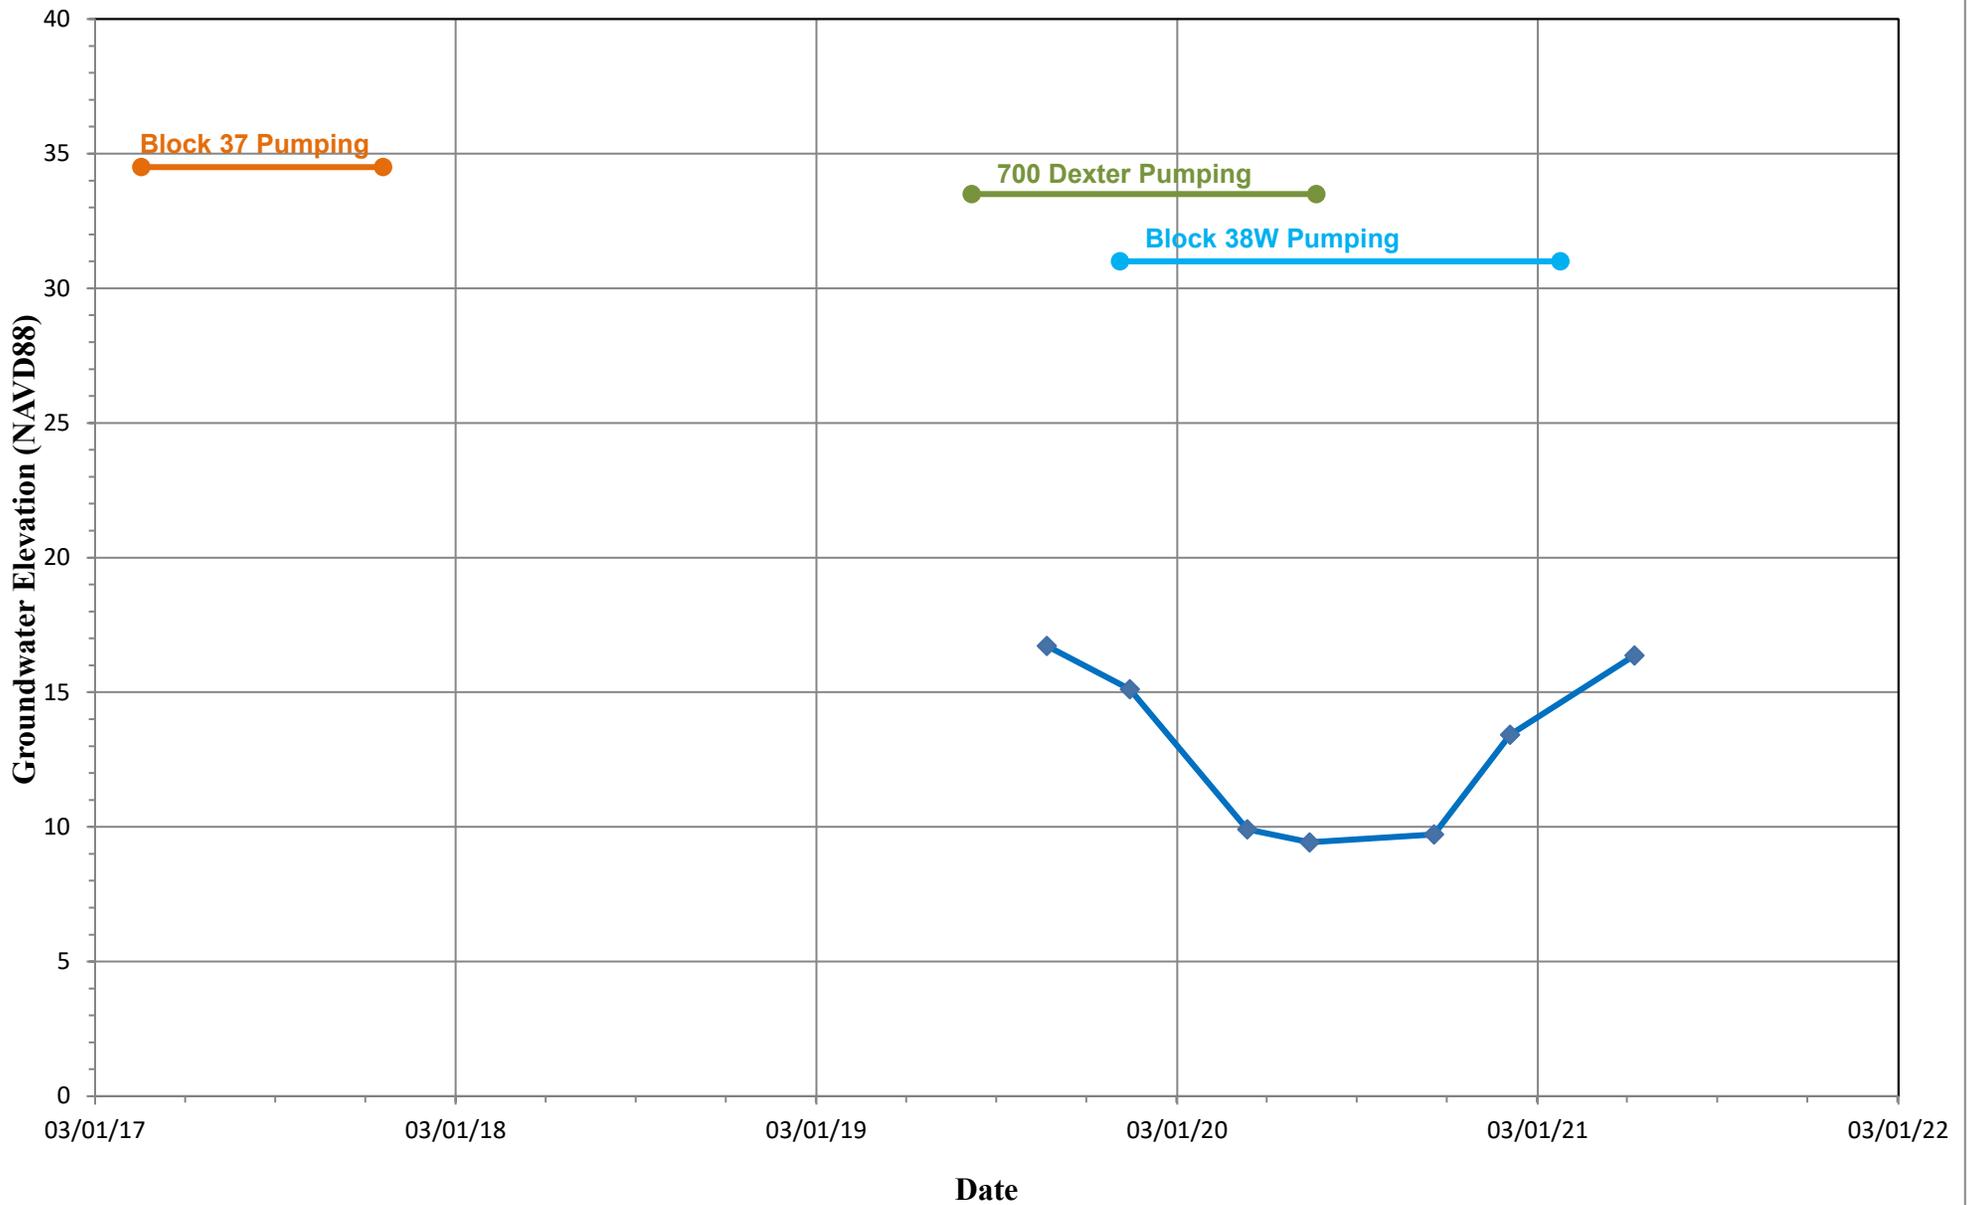

**Hydrograph**  
**MW-334, 900 Roy St, S end**  
**American Linen Supply Co Dexter Ave Site**

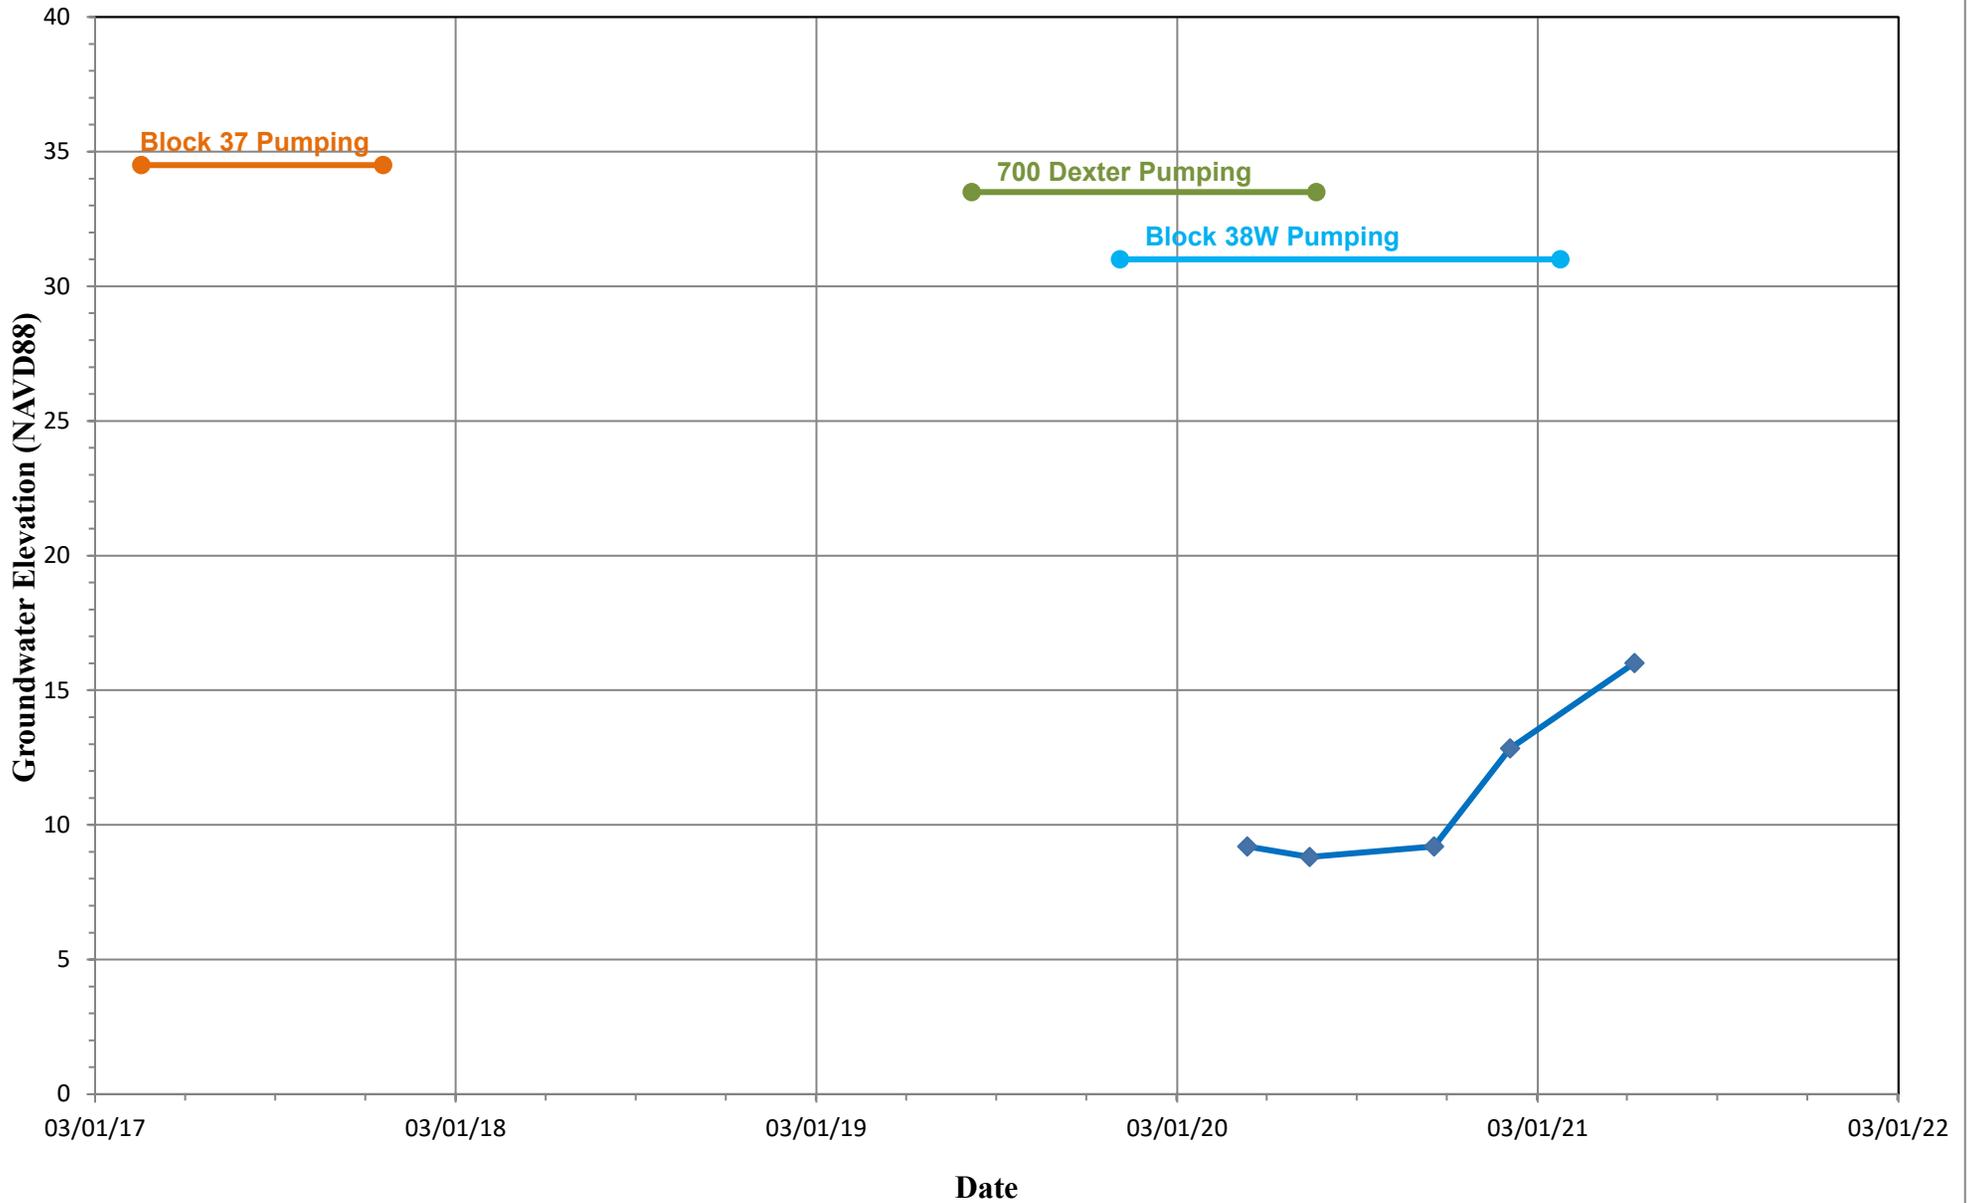


**Hydrograph**  
**MW-335, Mercer St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

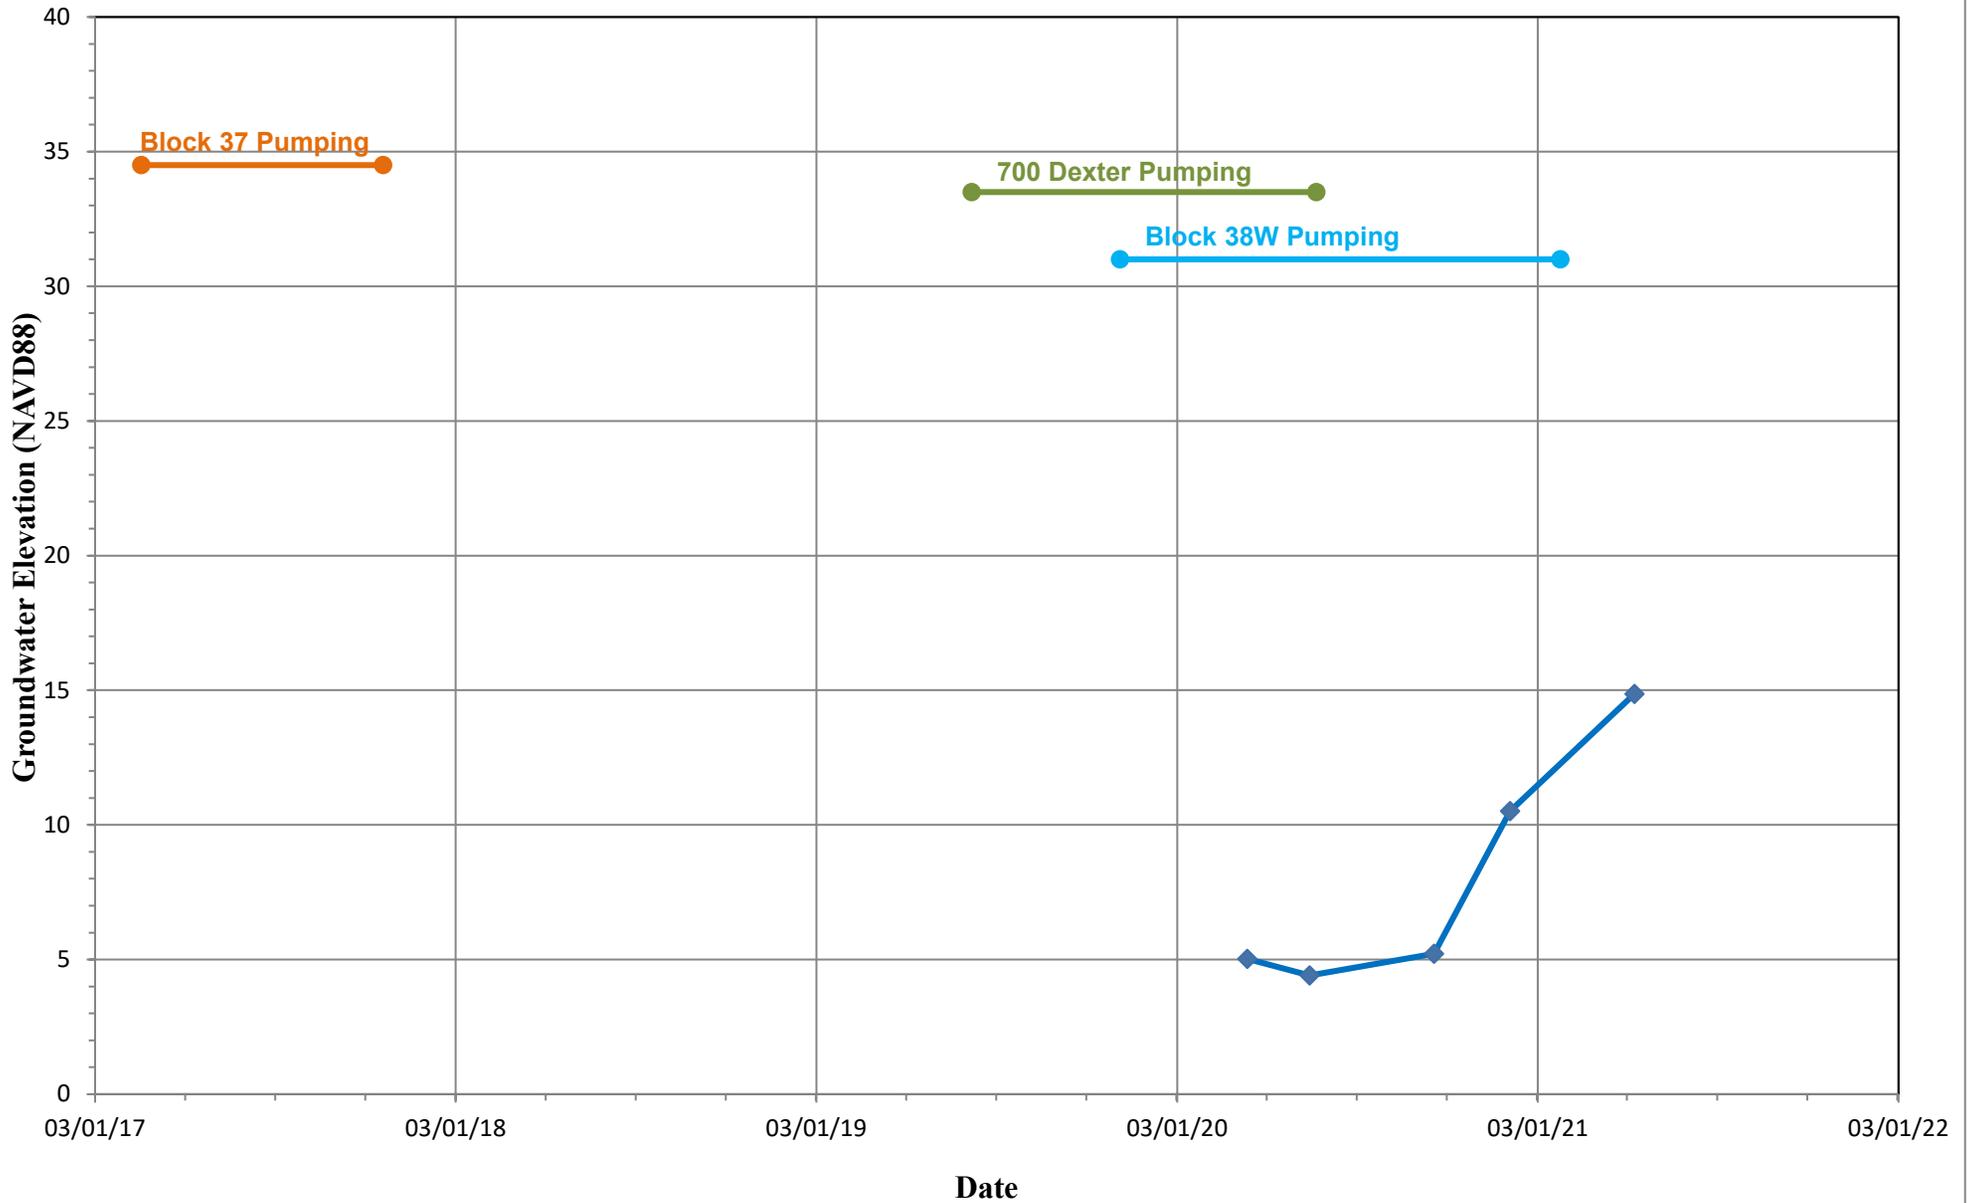


# Hydrograph

## MW-338, Lake Union Park, N end

### American Linen Supply Co Dexter Ave Site

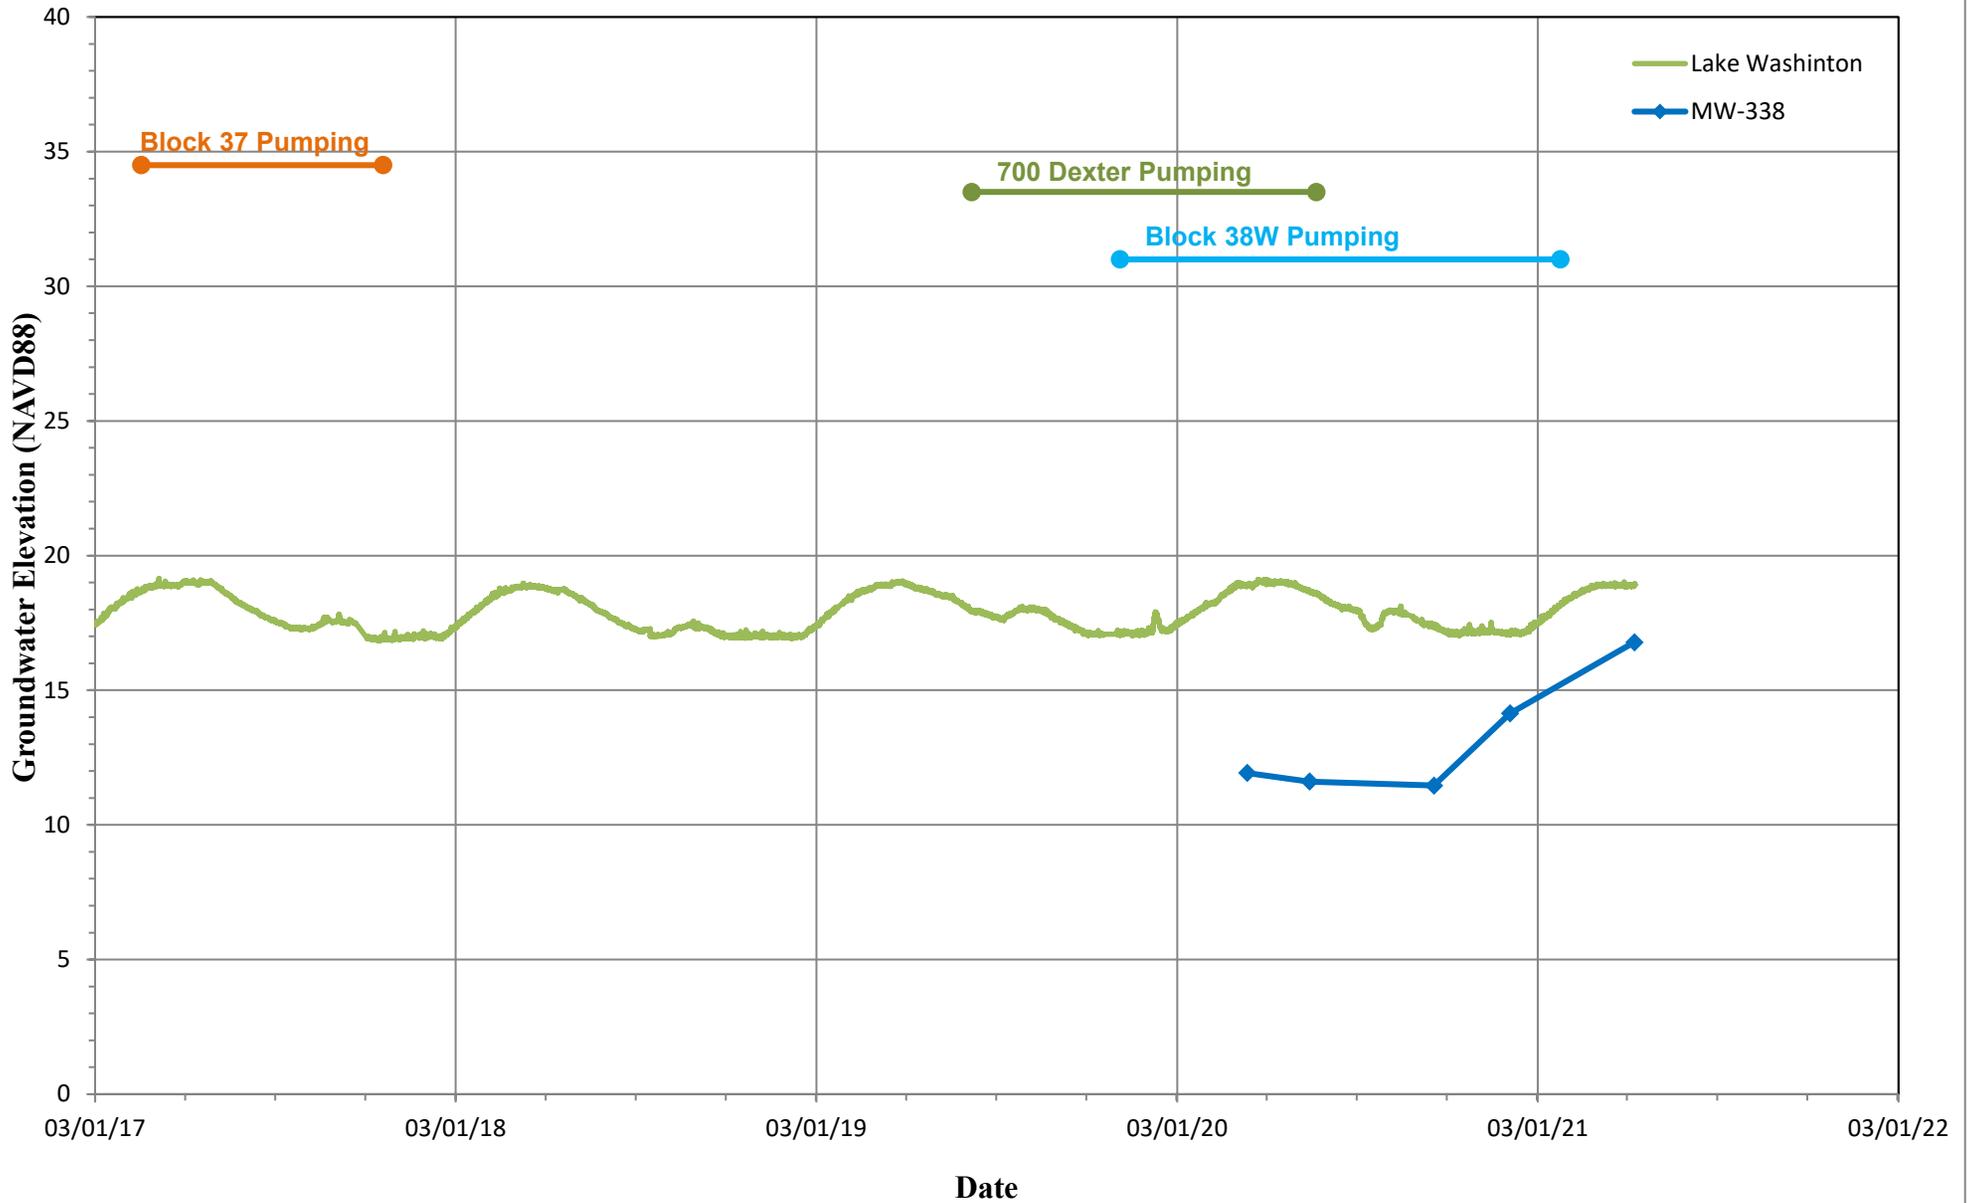


**Hydrograph**  
**MW-340, Lake Union Park, S end**  
**American Linen Supply Co Dexter Ave Site**

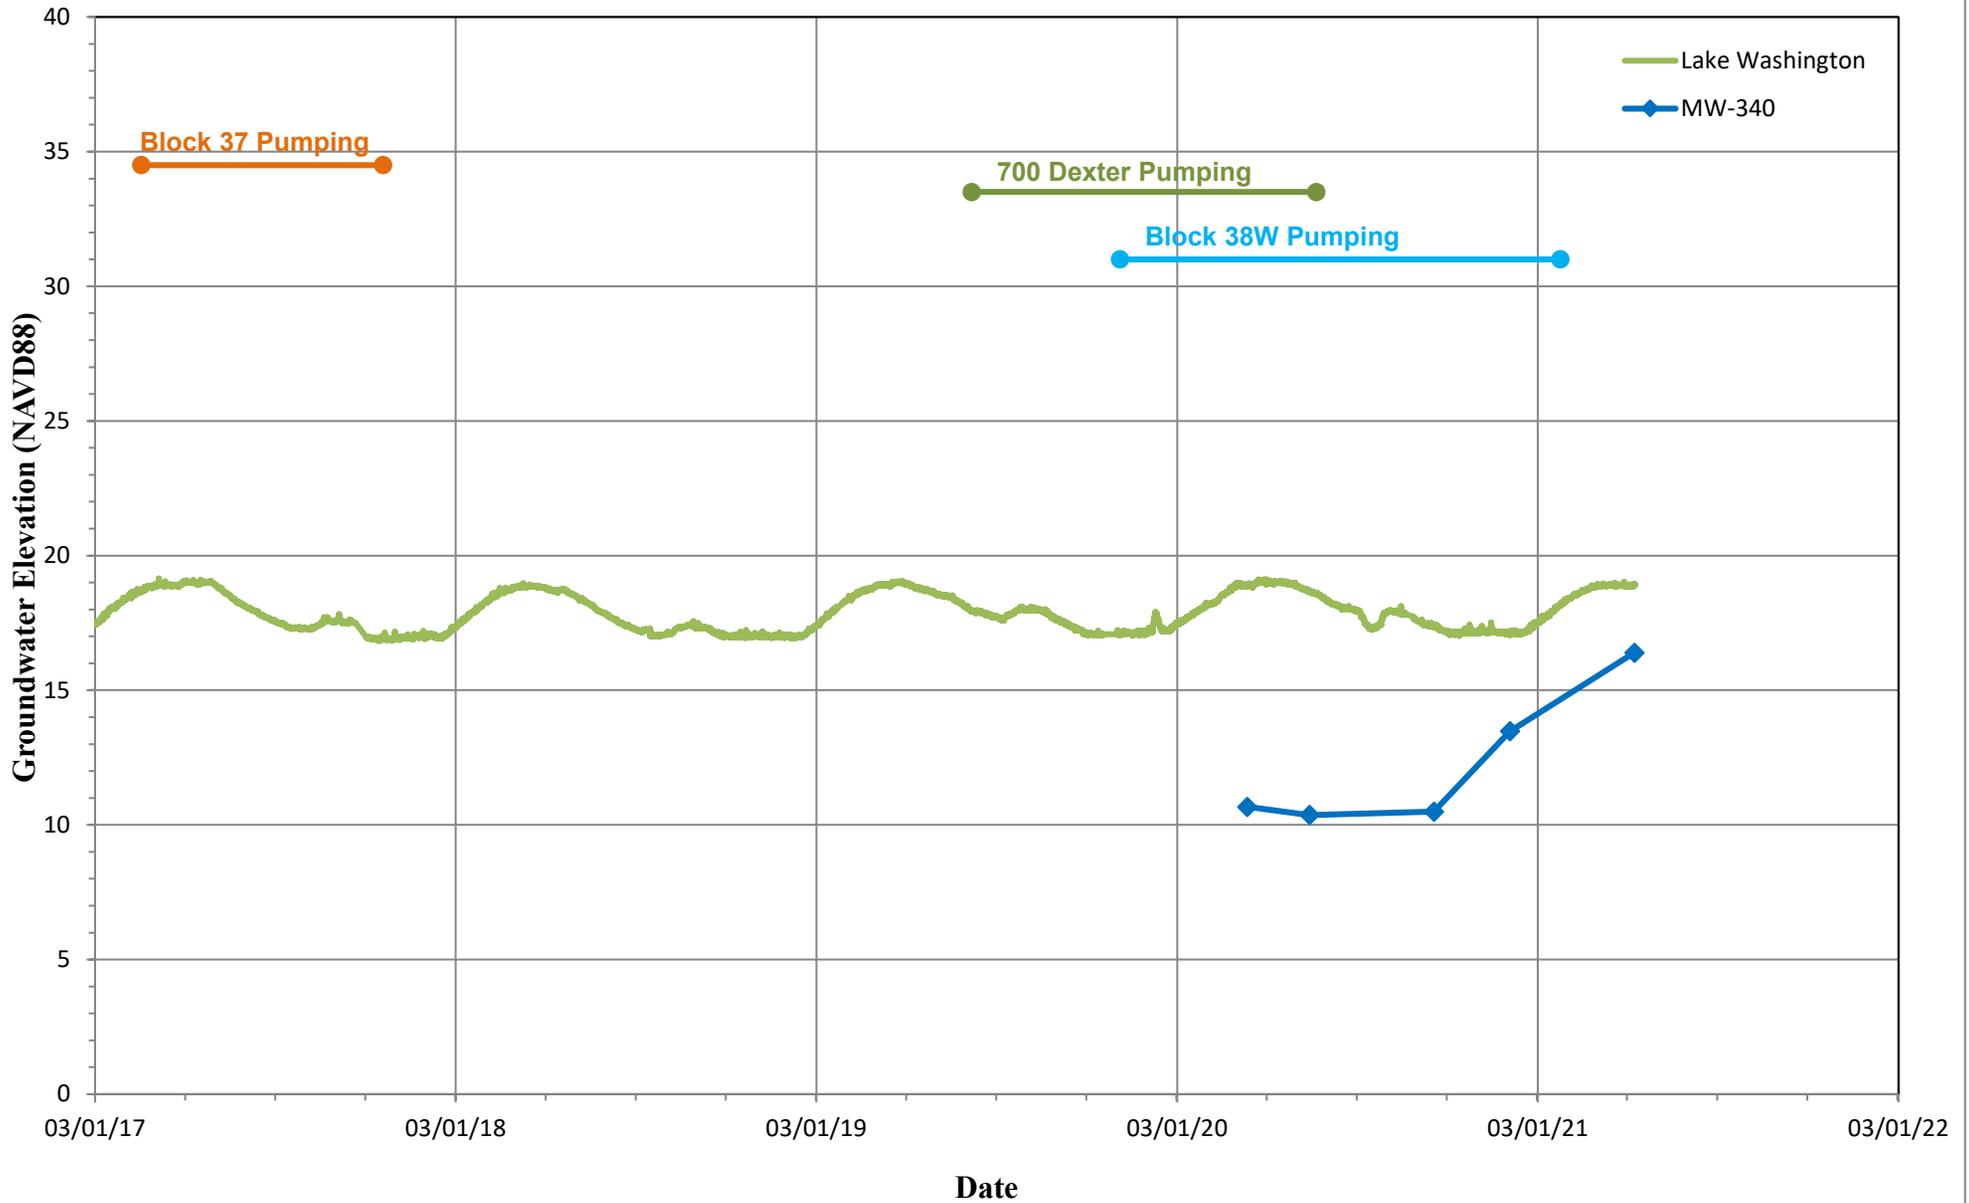




**Hydrograph**  
**W-MW-02, 8th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

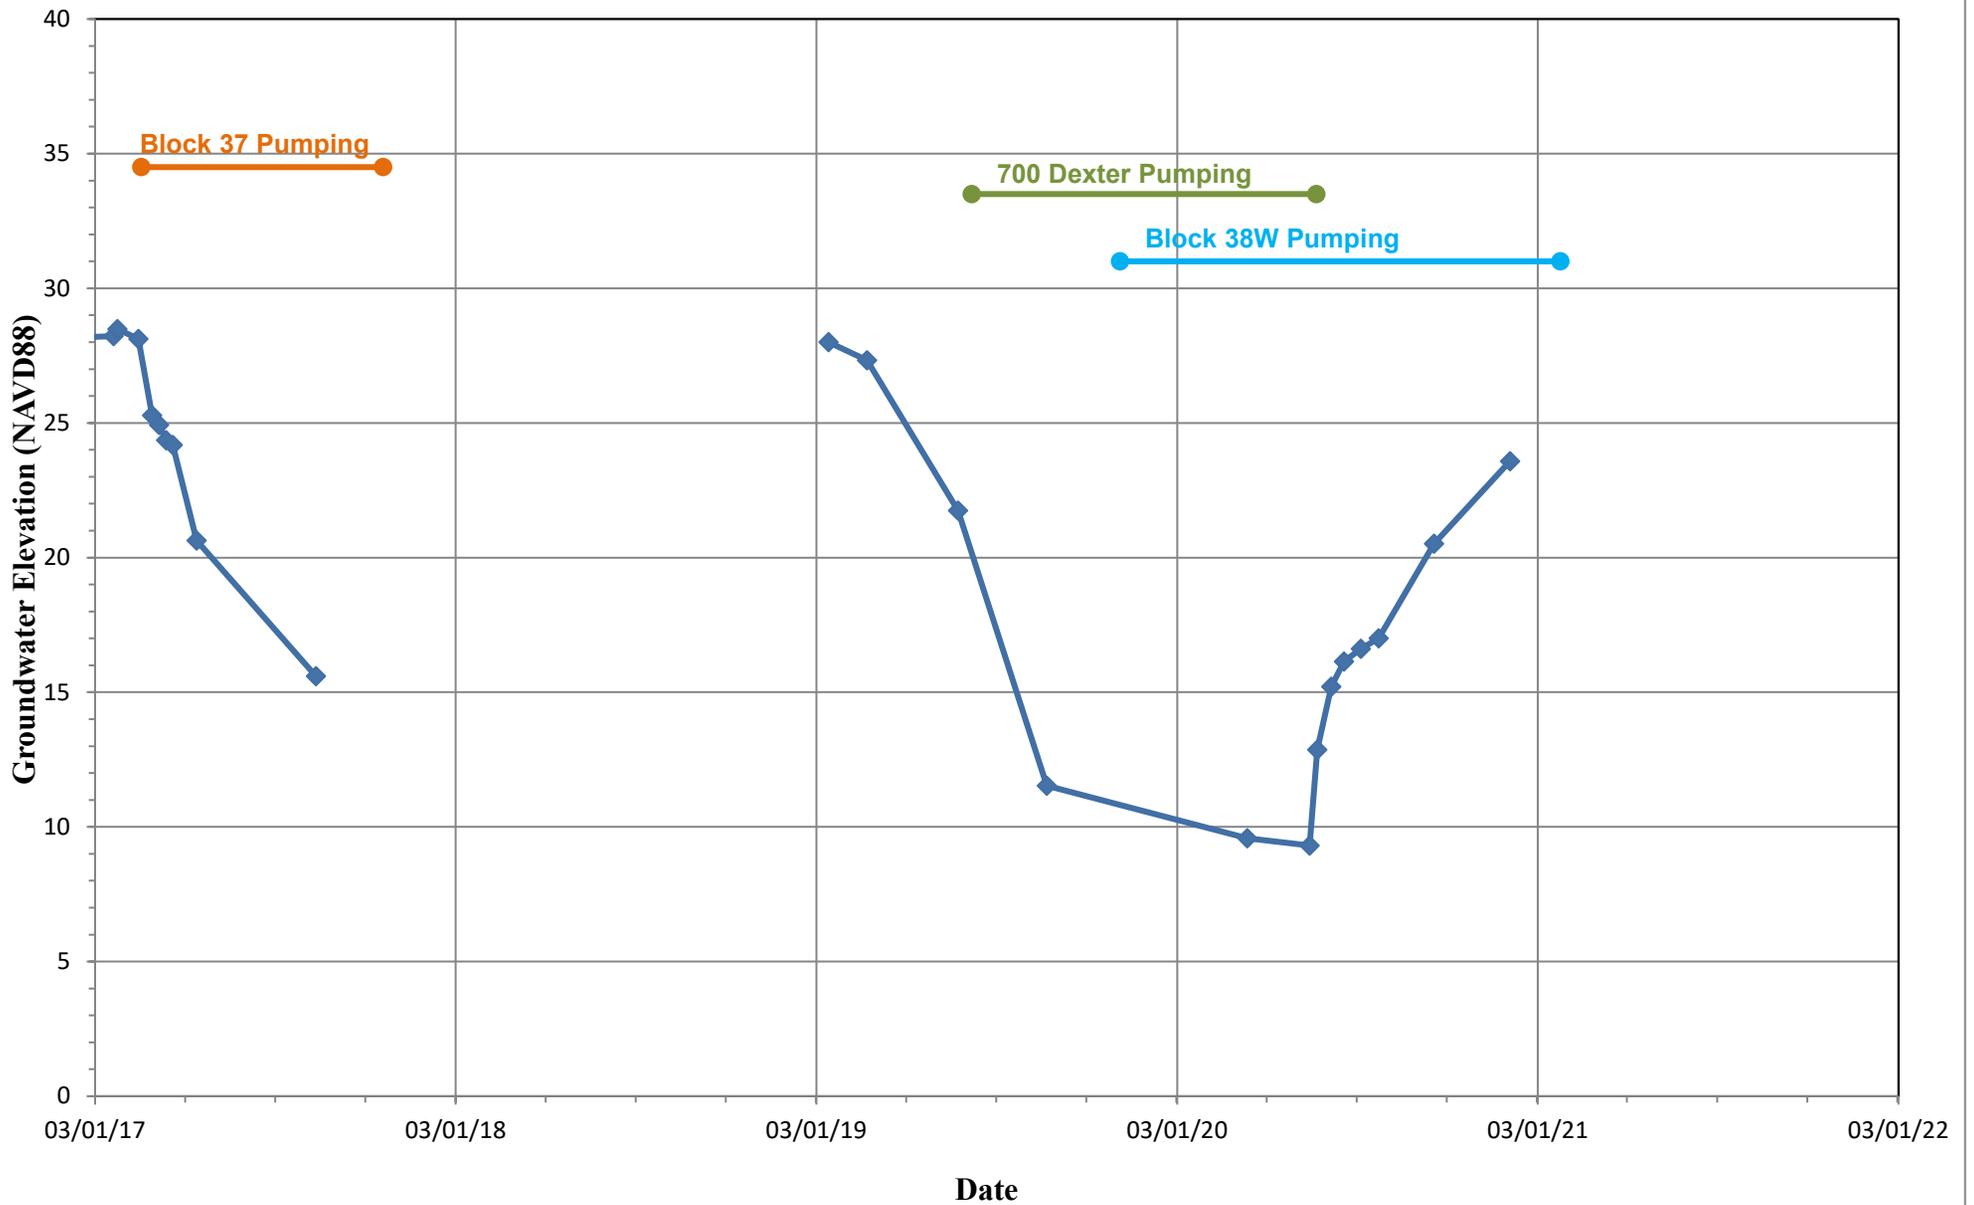





**Hydrograph**  
**MW103, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

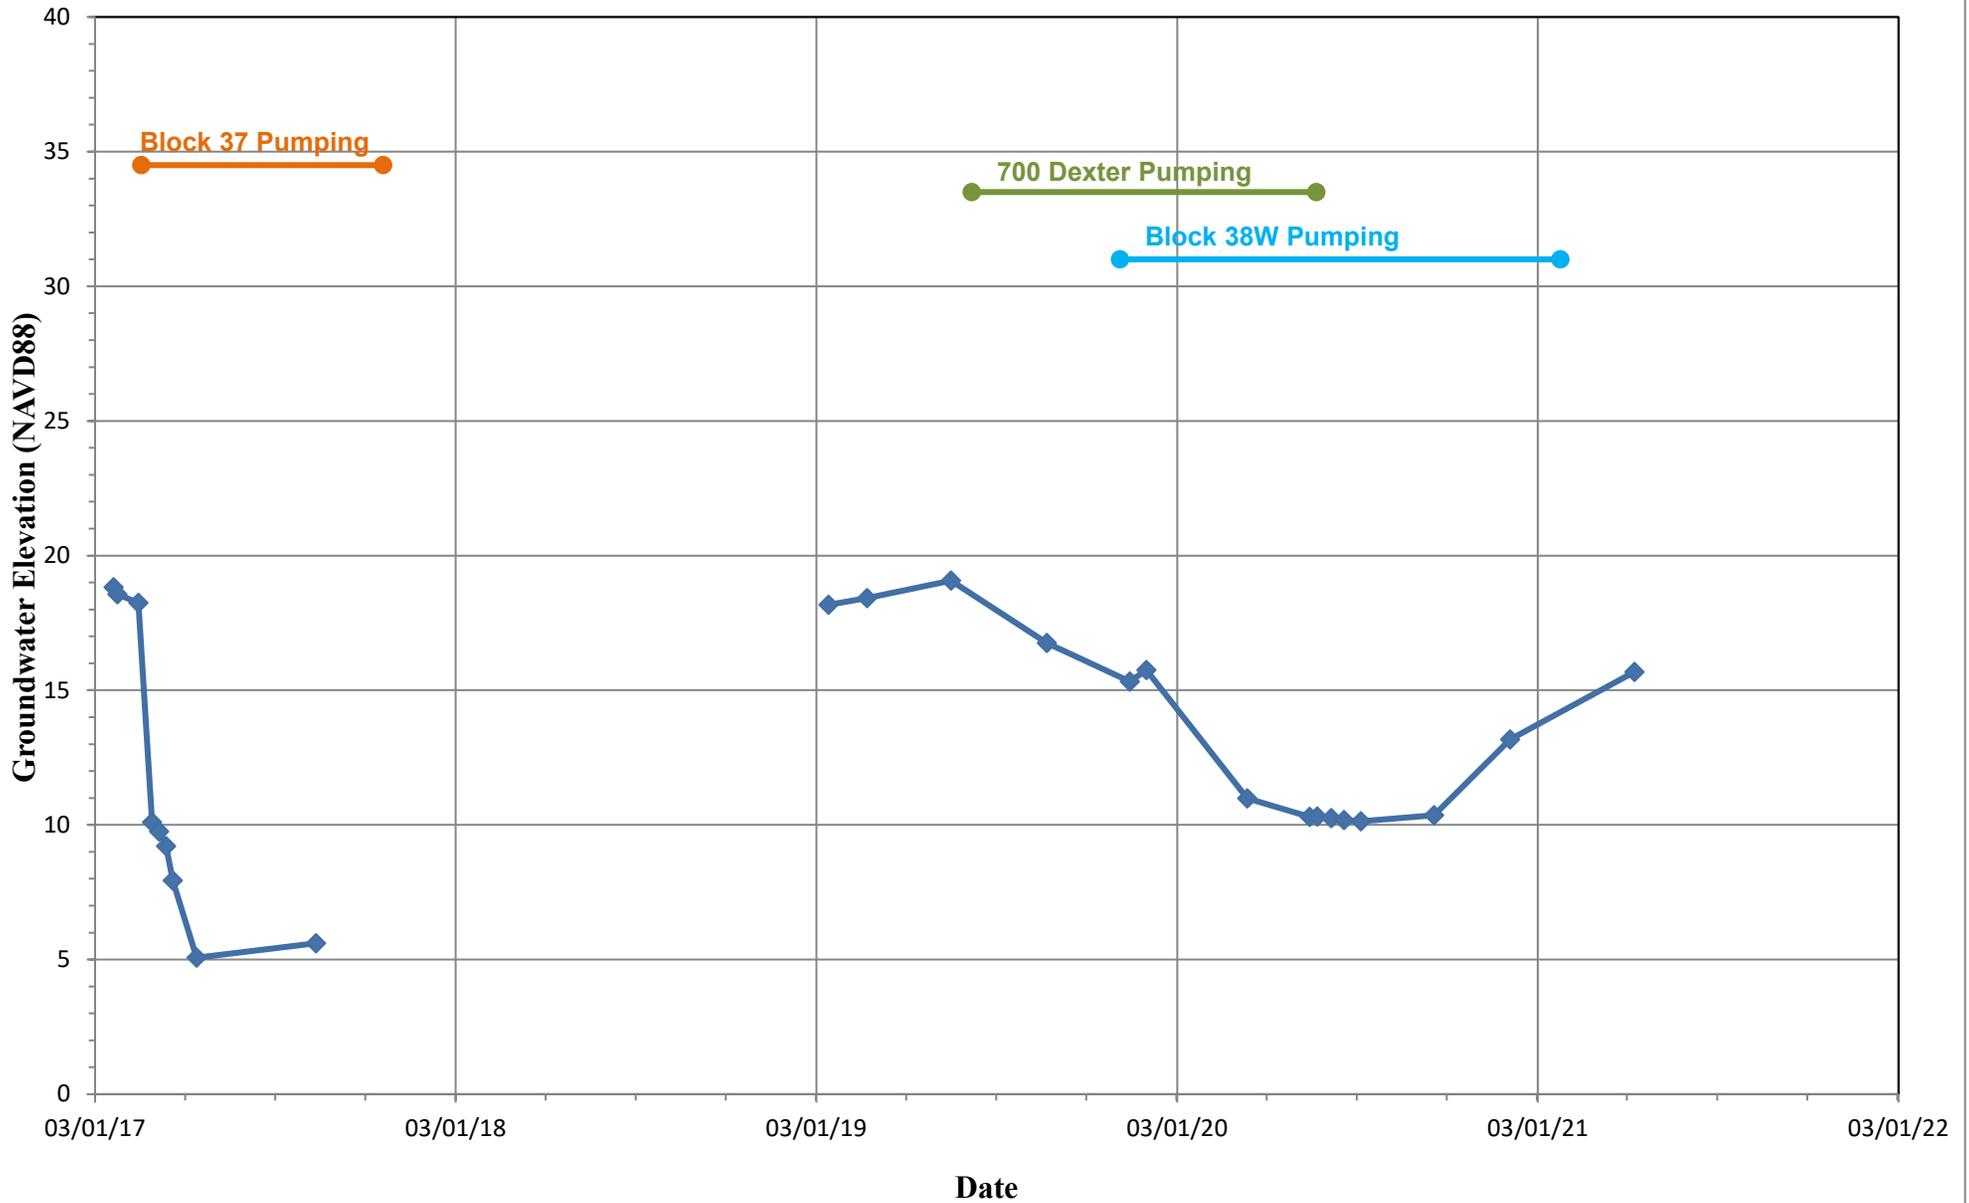

**Hydrograph**  
**MW104, 8th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

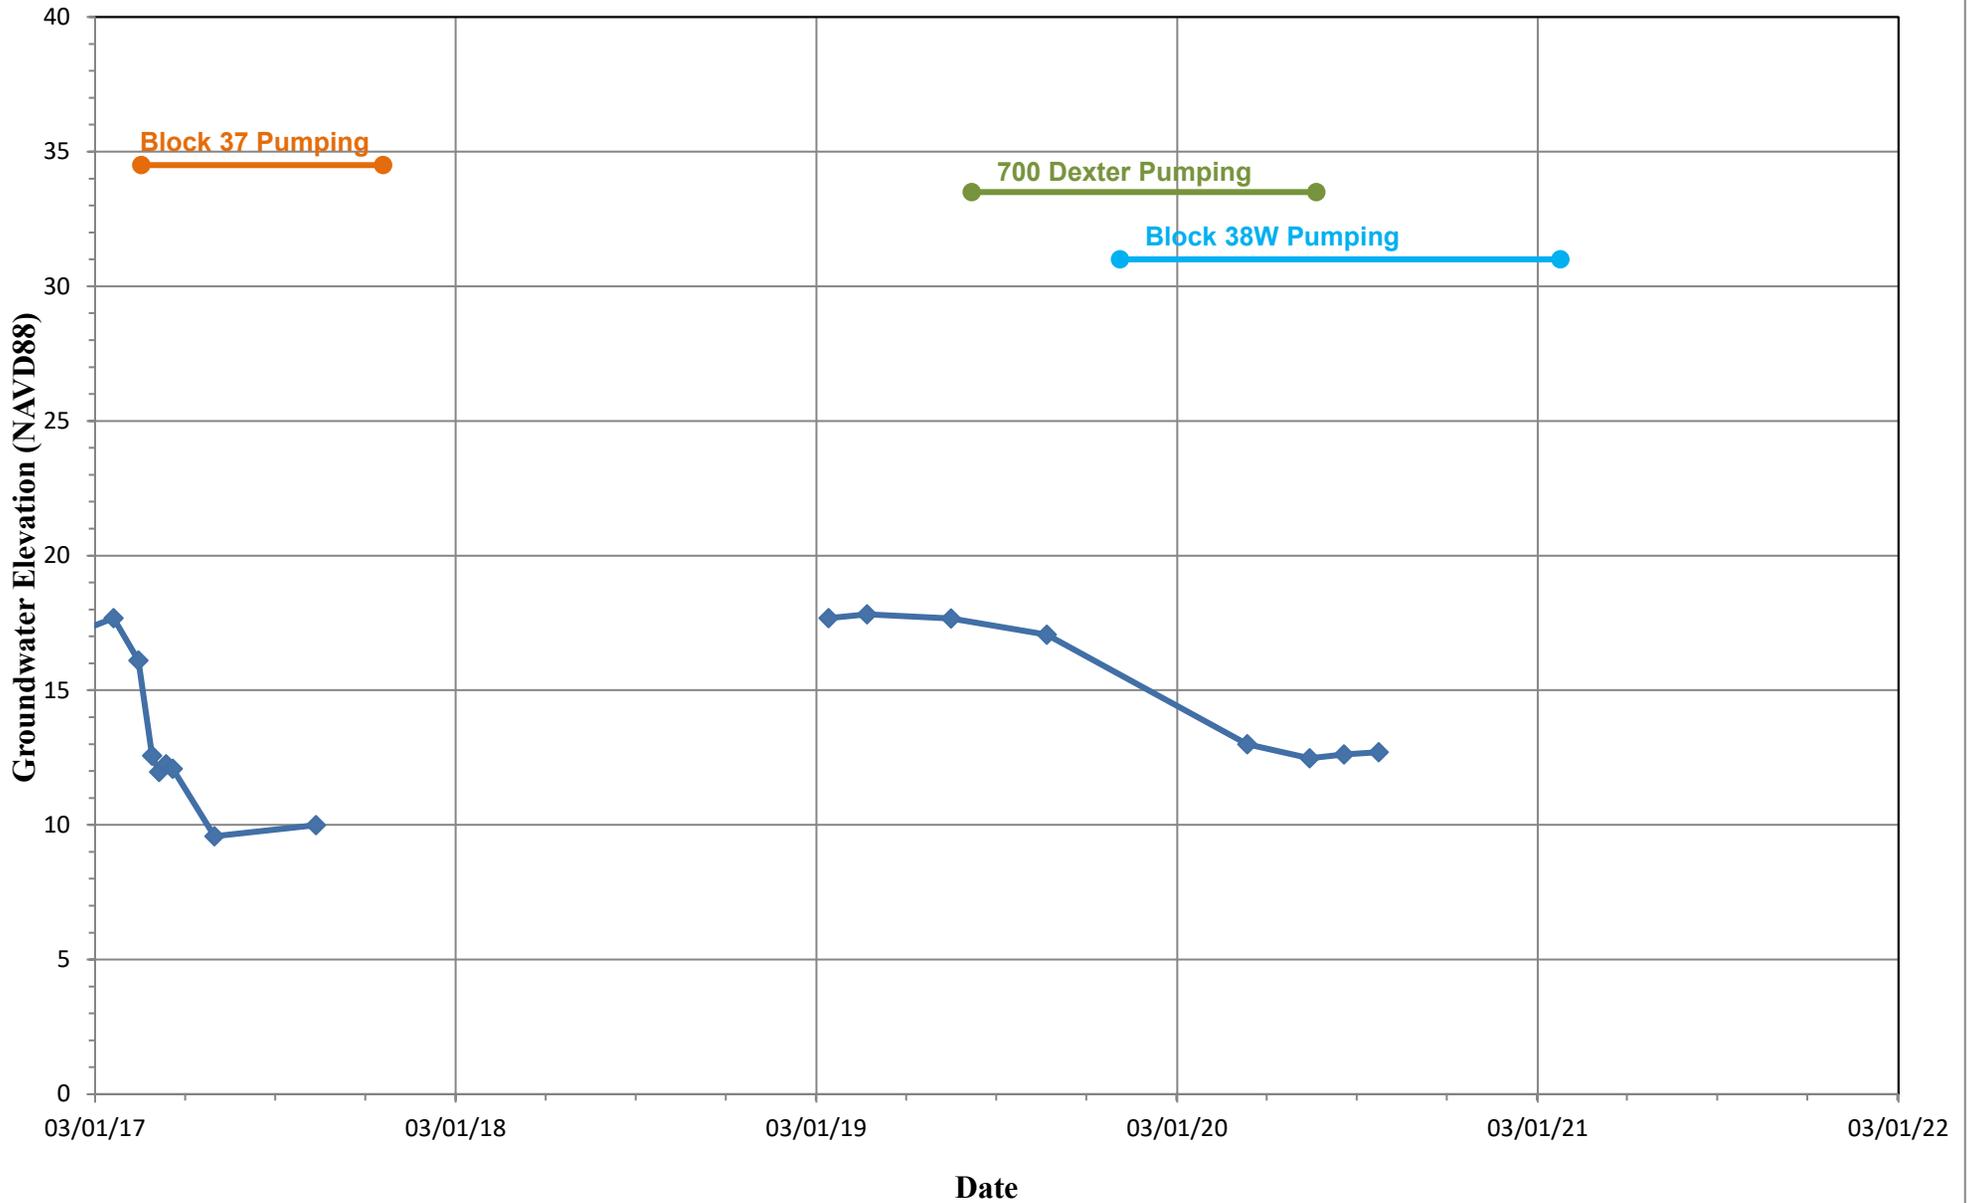


**Hydrograph**  
**MW105, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

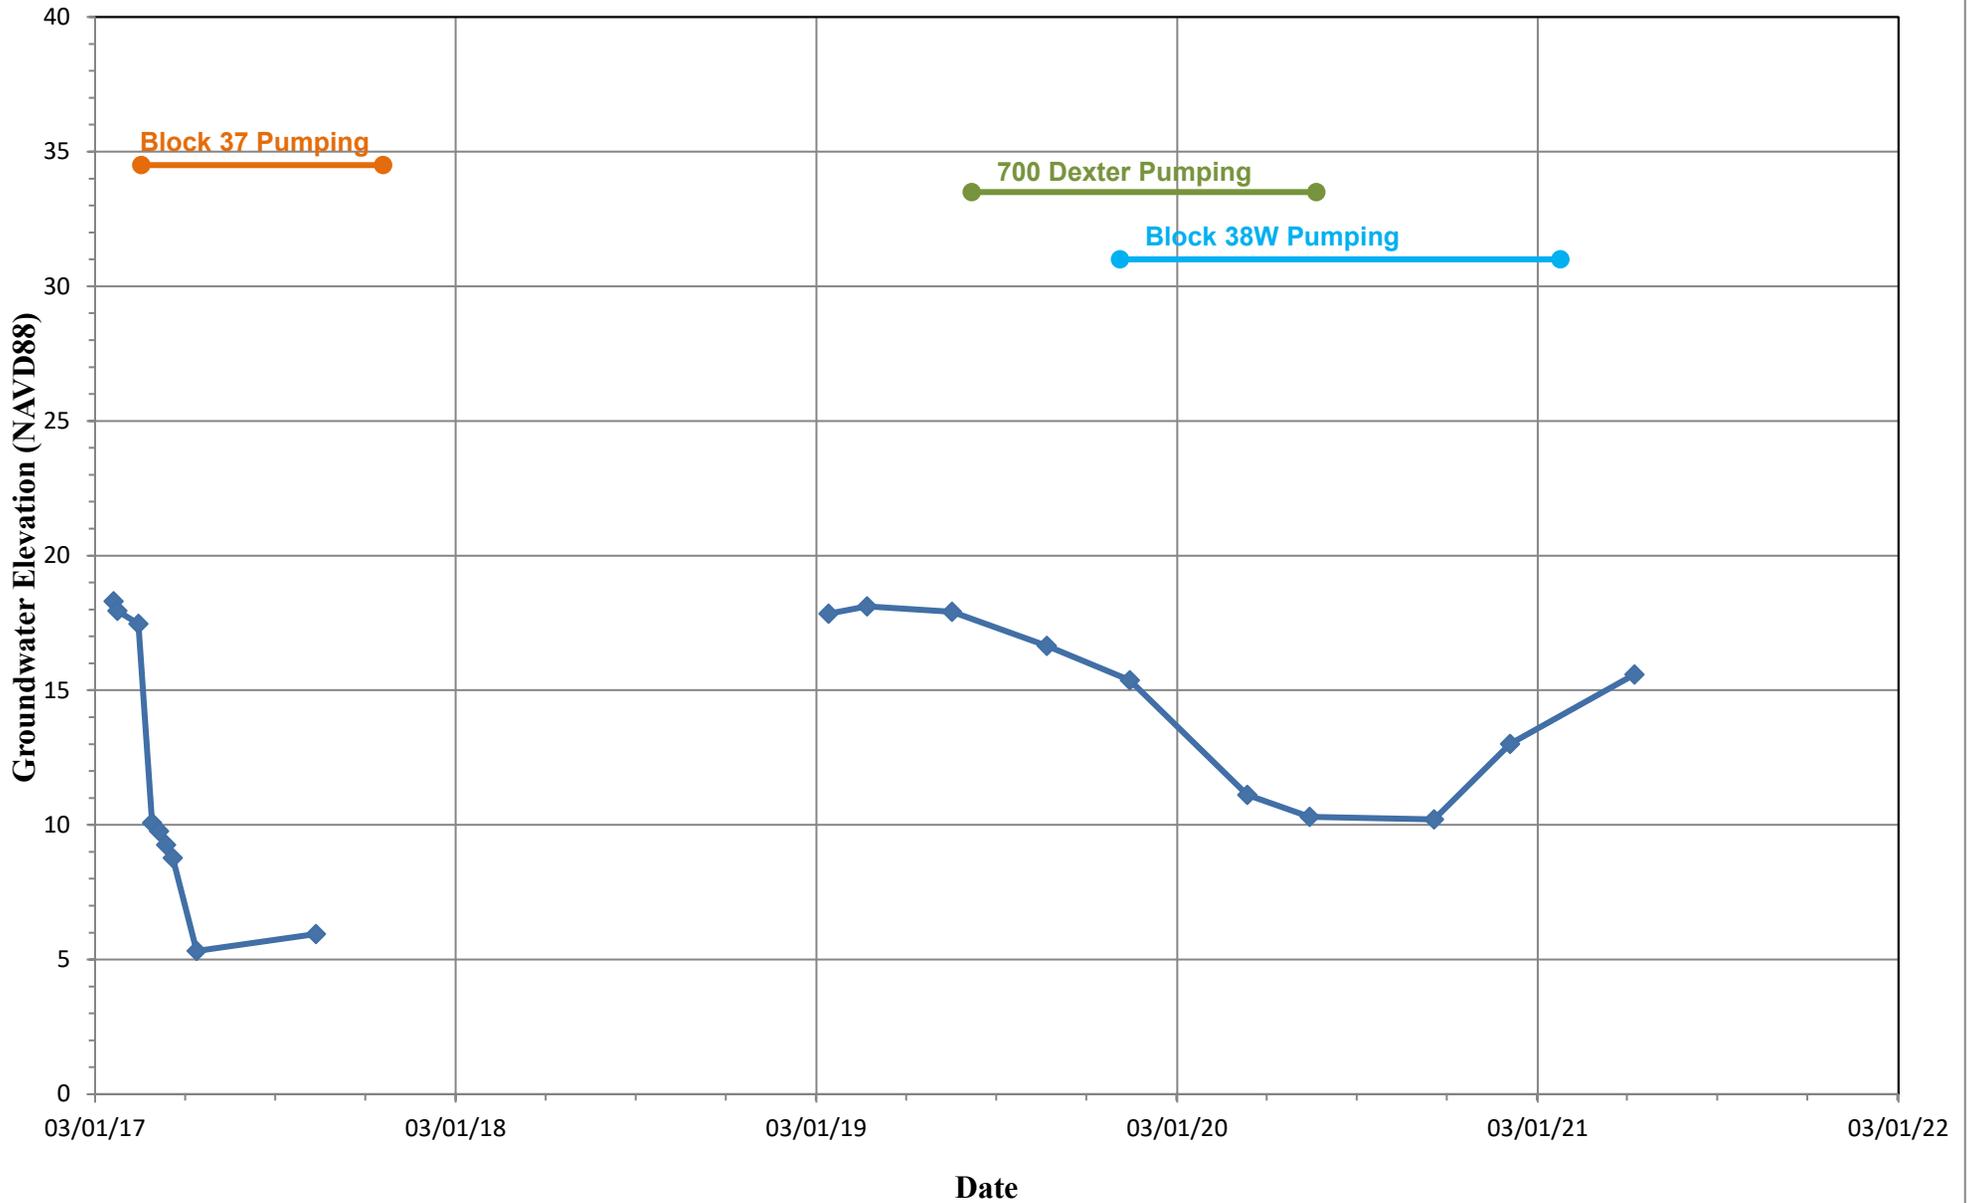


# Hydrograph

## MW106, SDOT Mercer Parcels, NW quadrant


### American Linen Supply Co Dexter Ave Site

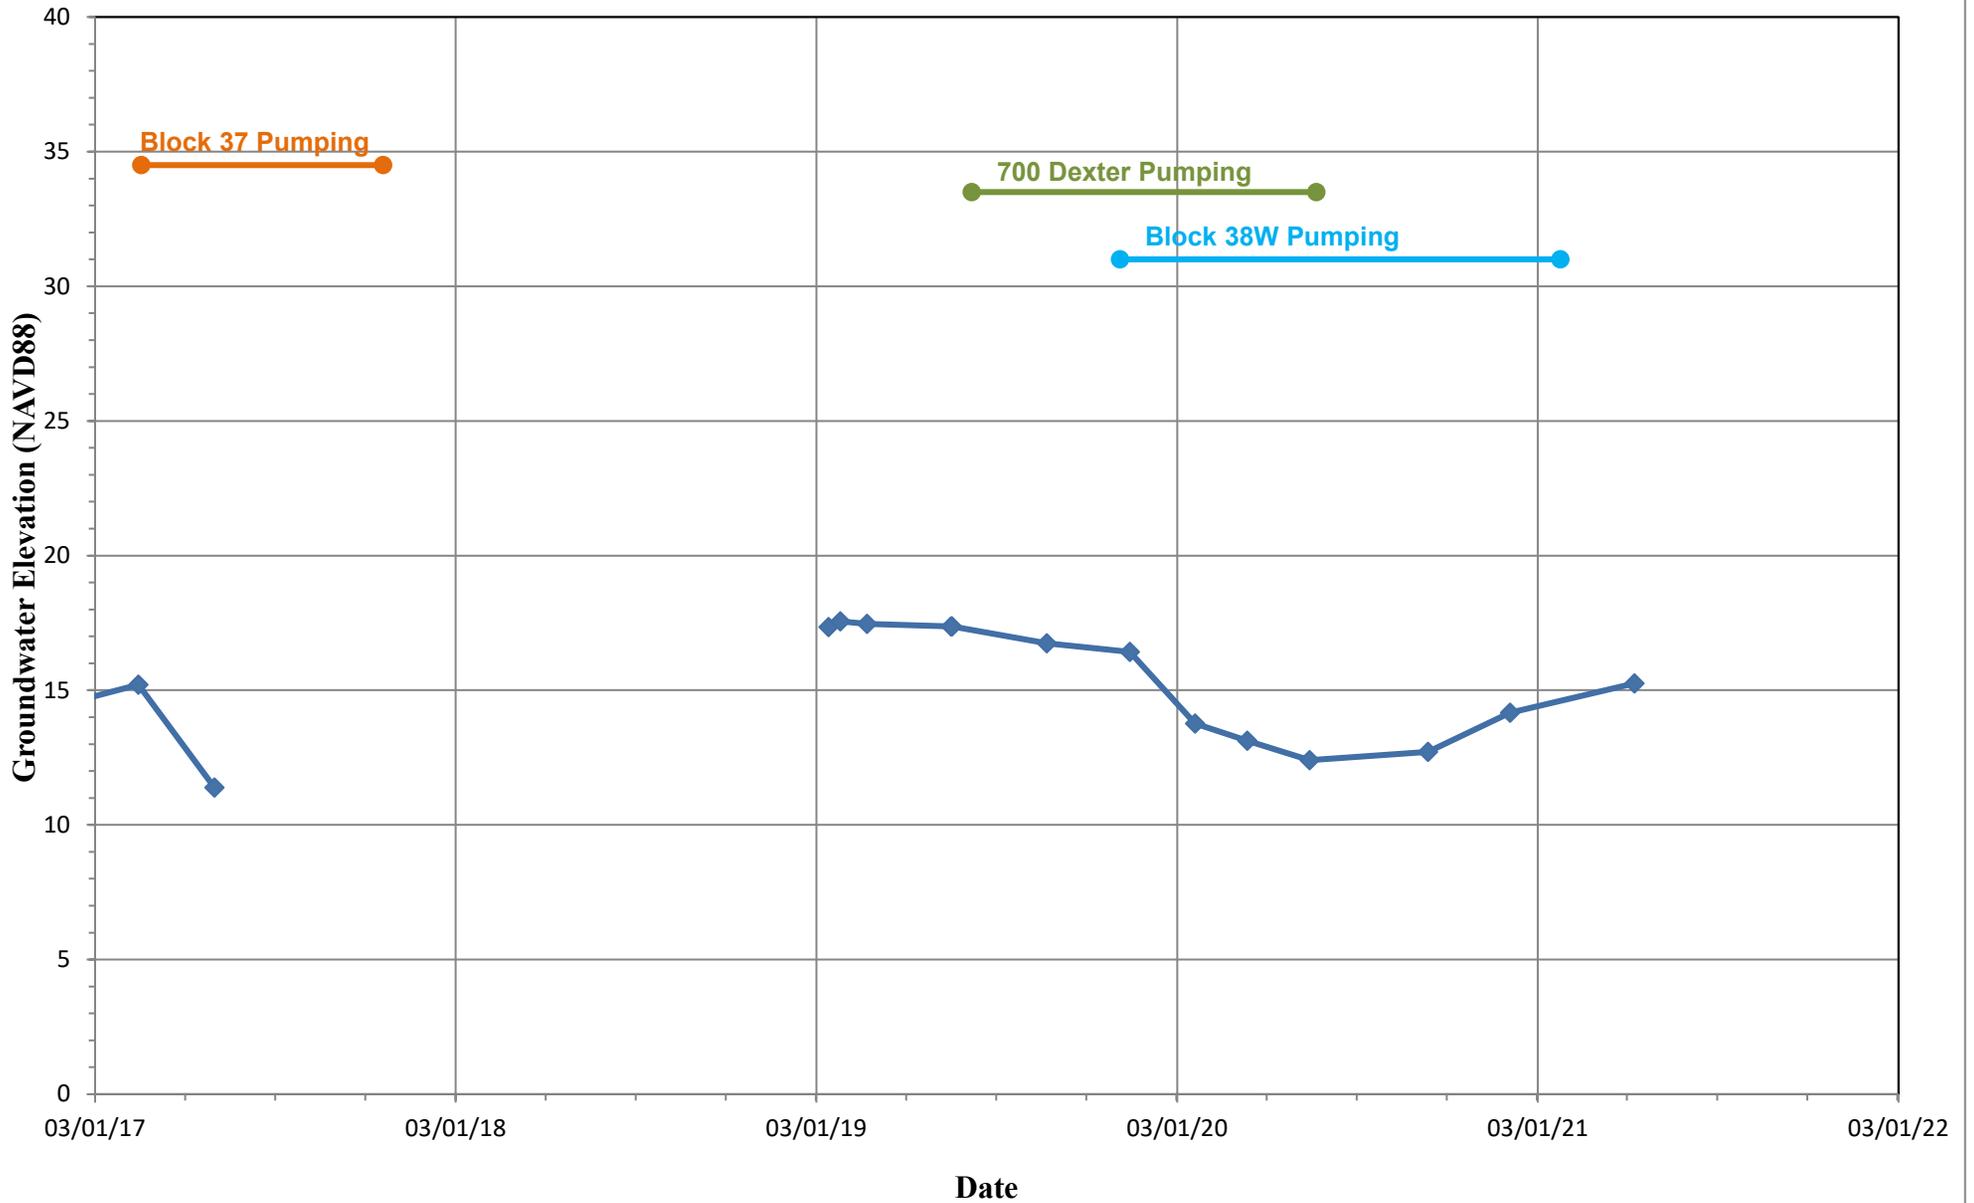


**Hydrograph**  
**MW113, 9th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

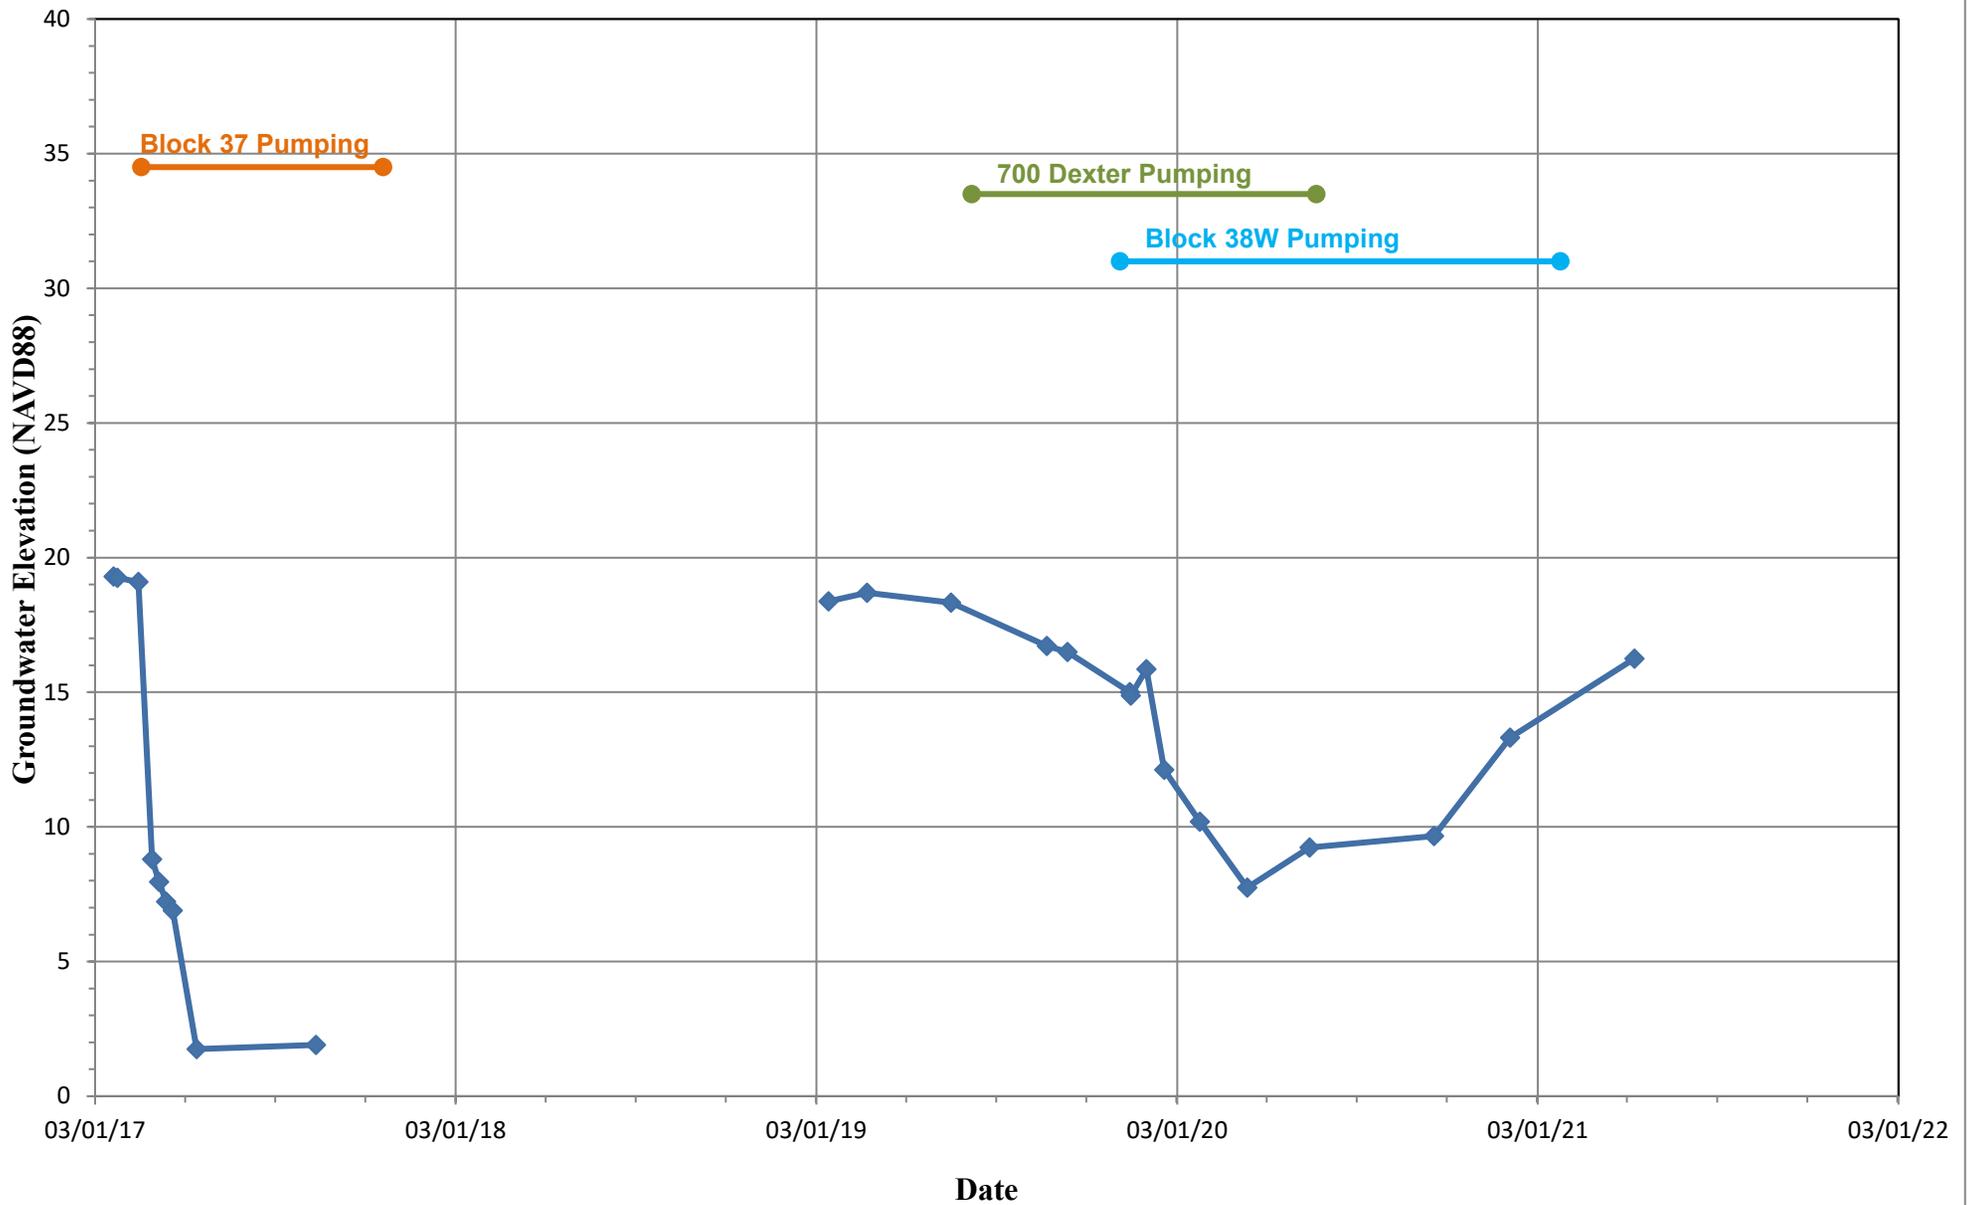


**Hydrograph**  
**MW122, Alley E of Seattle Roy Aloha Shops**  
**American Linen Supply Co Dexter Ave Site**

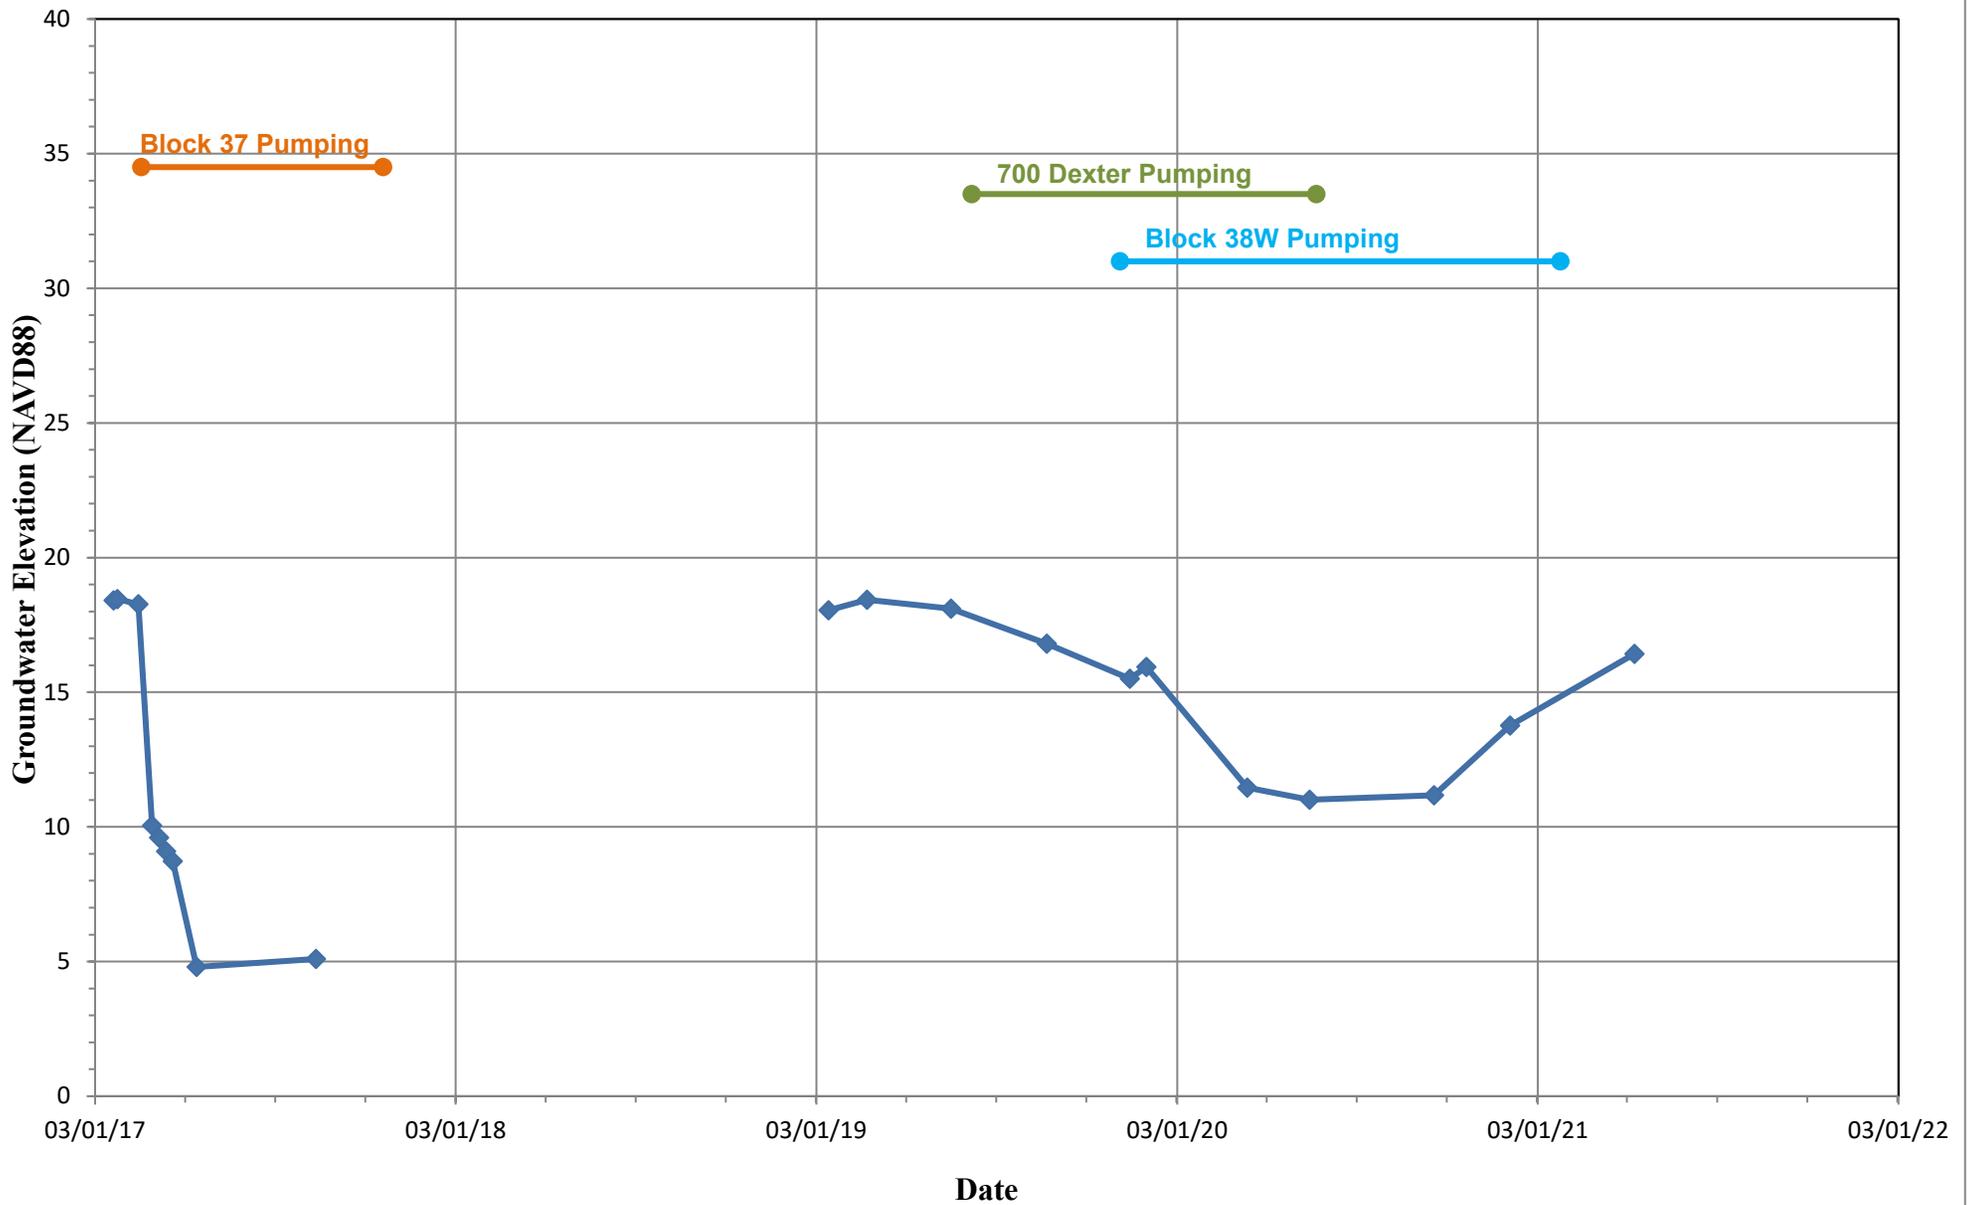


**Hydrograph**  
**MW123, Westlake Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

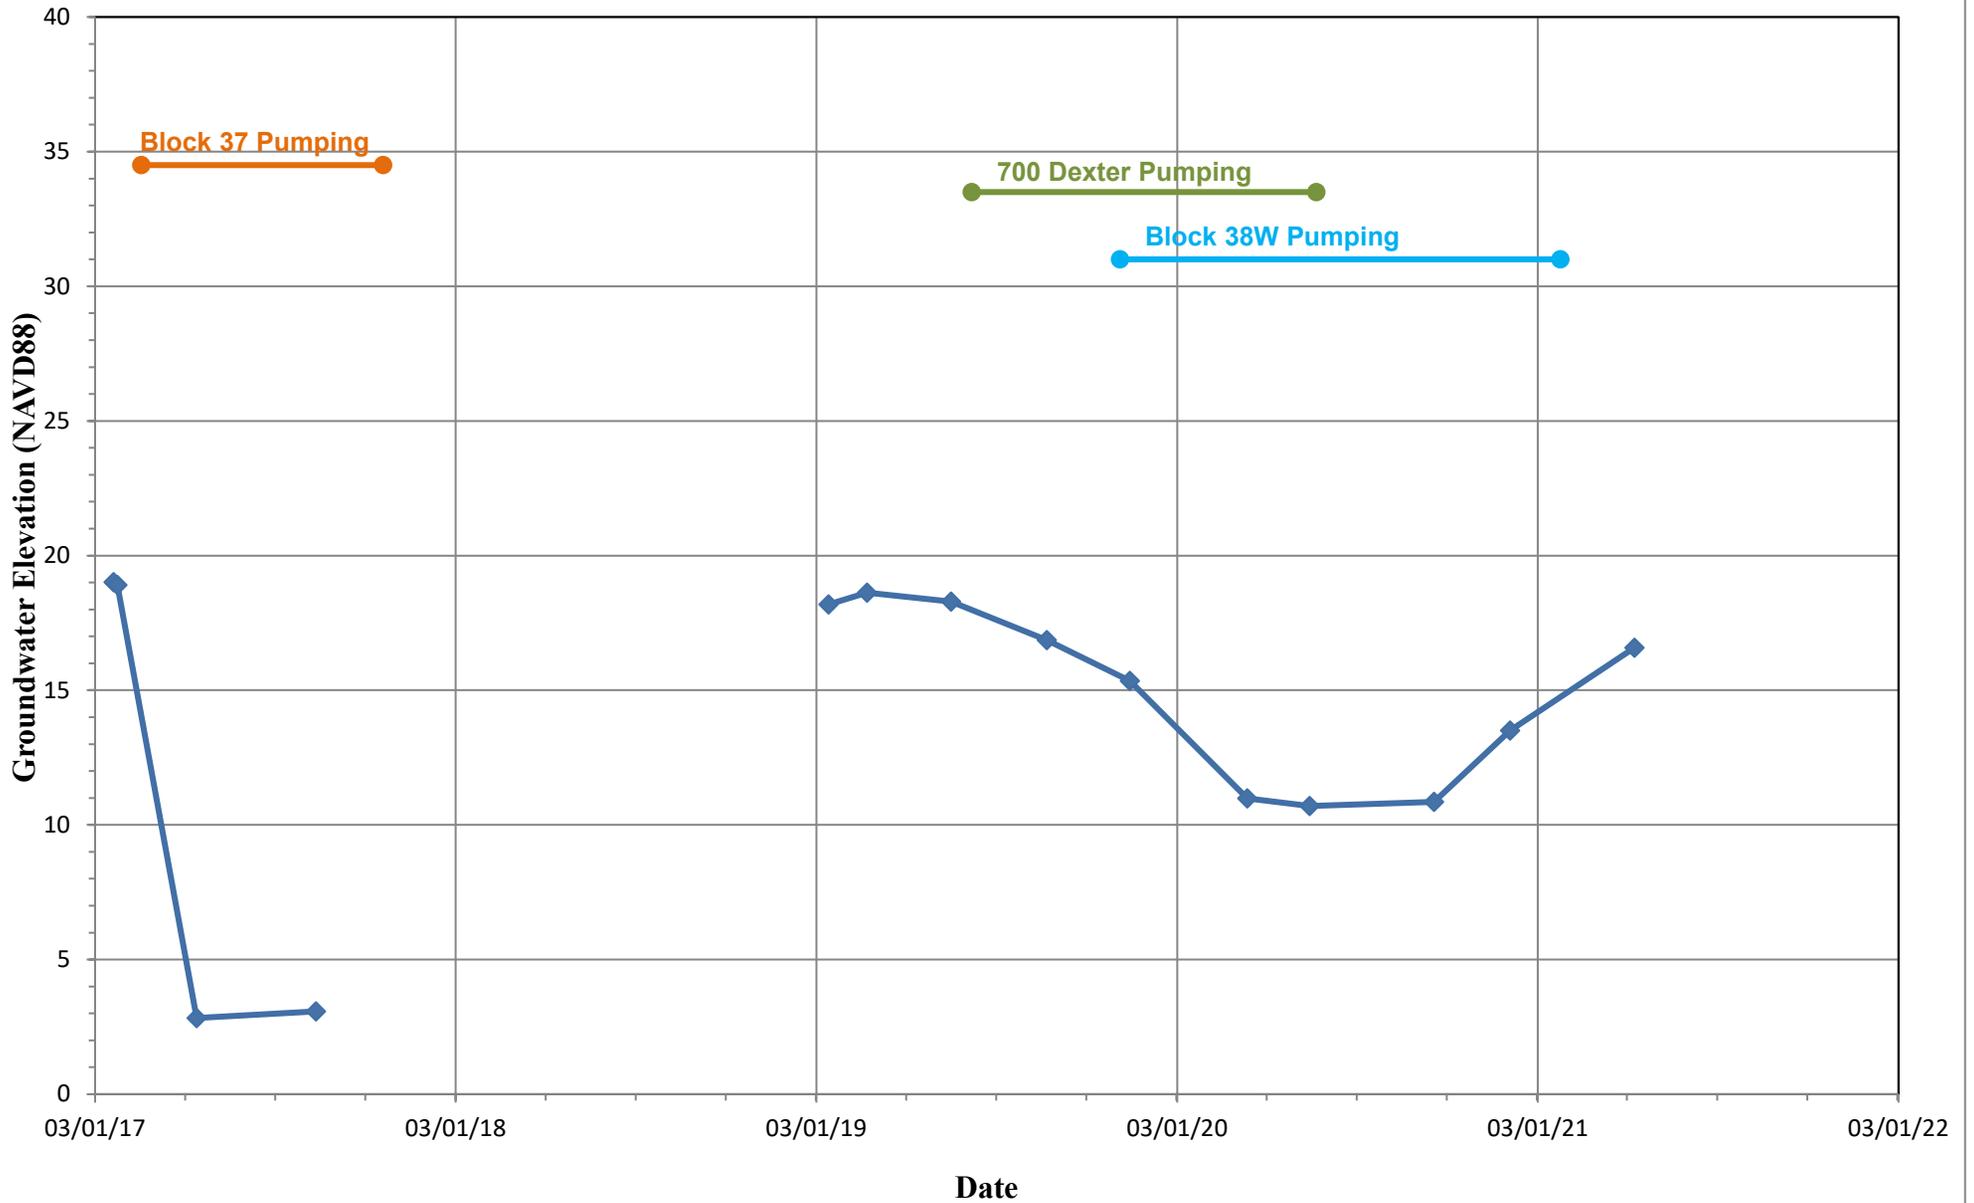


**Hydrograph**  
**MW124, Valley St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

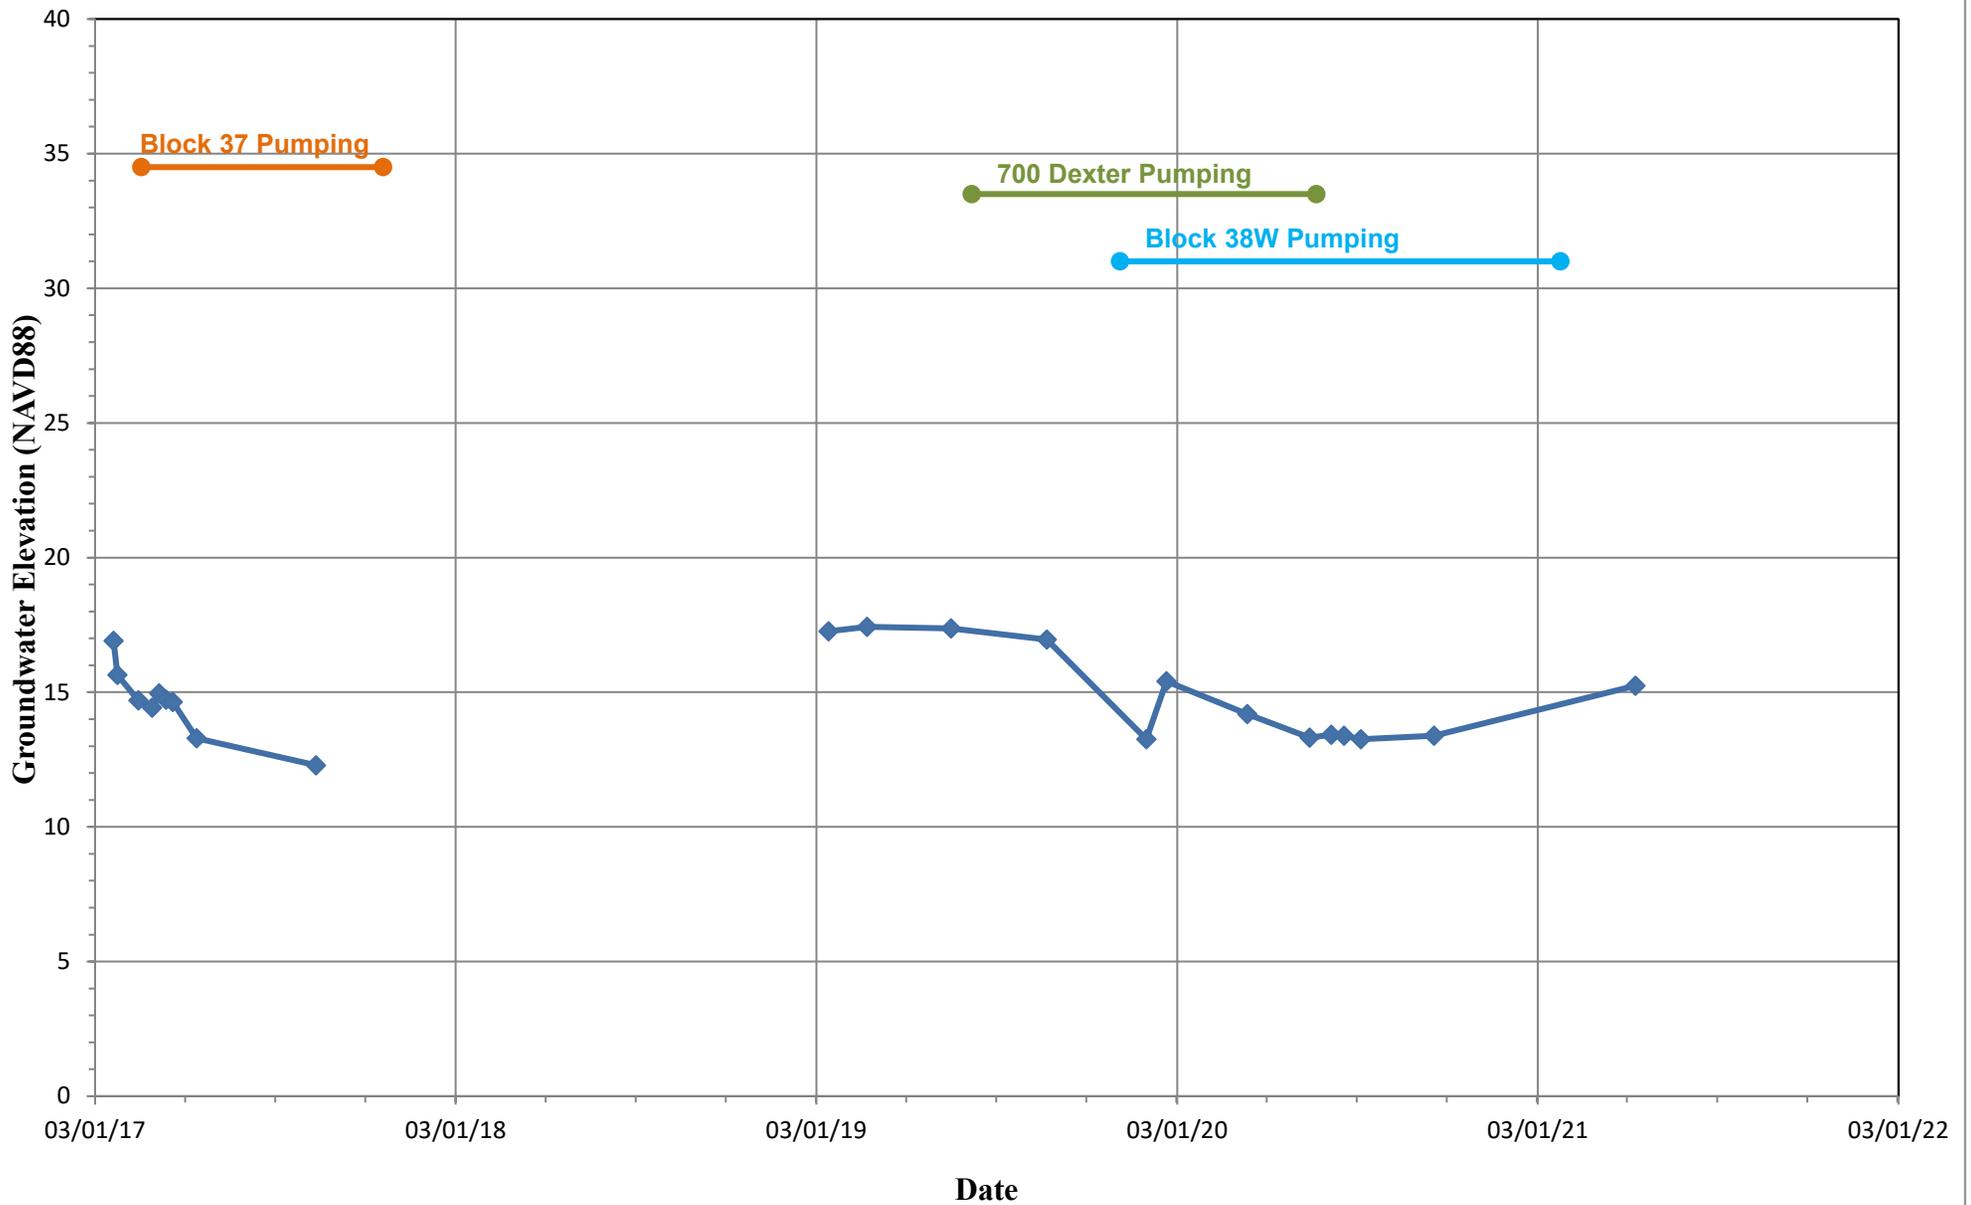


**Hydrograph**  
**MW128, Westlake Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

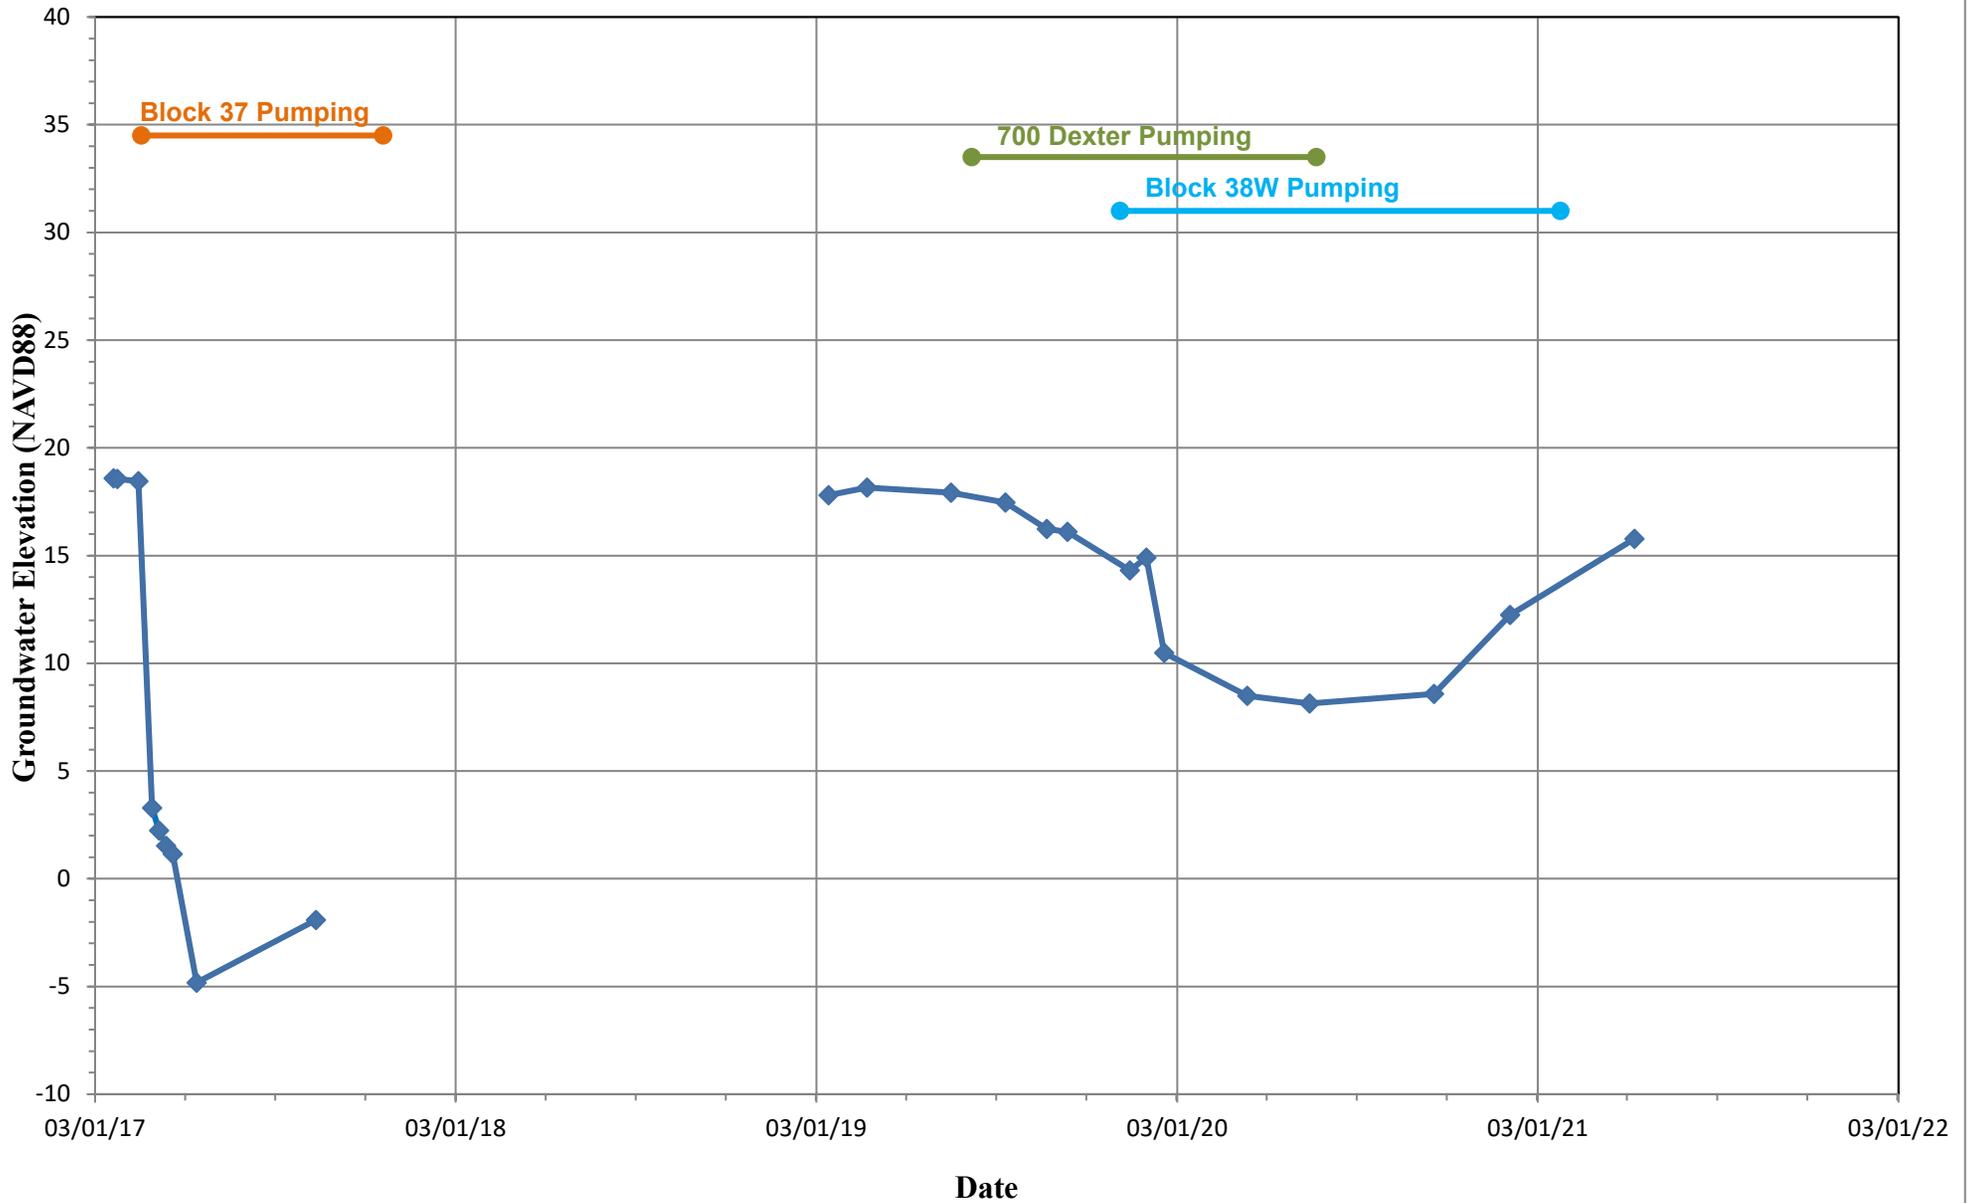


**Hydrograph**  
**MW-138, Dexter Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

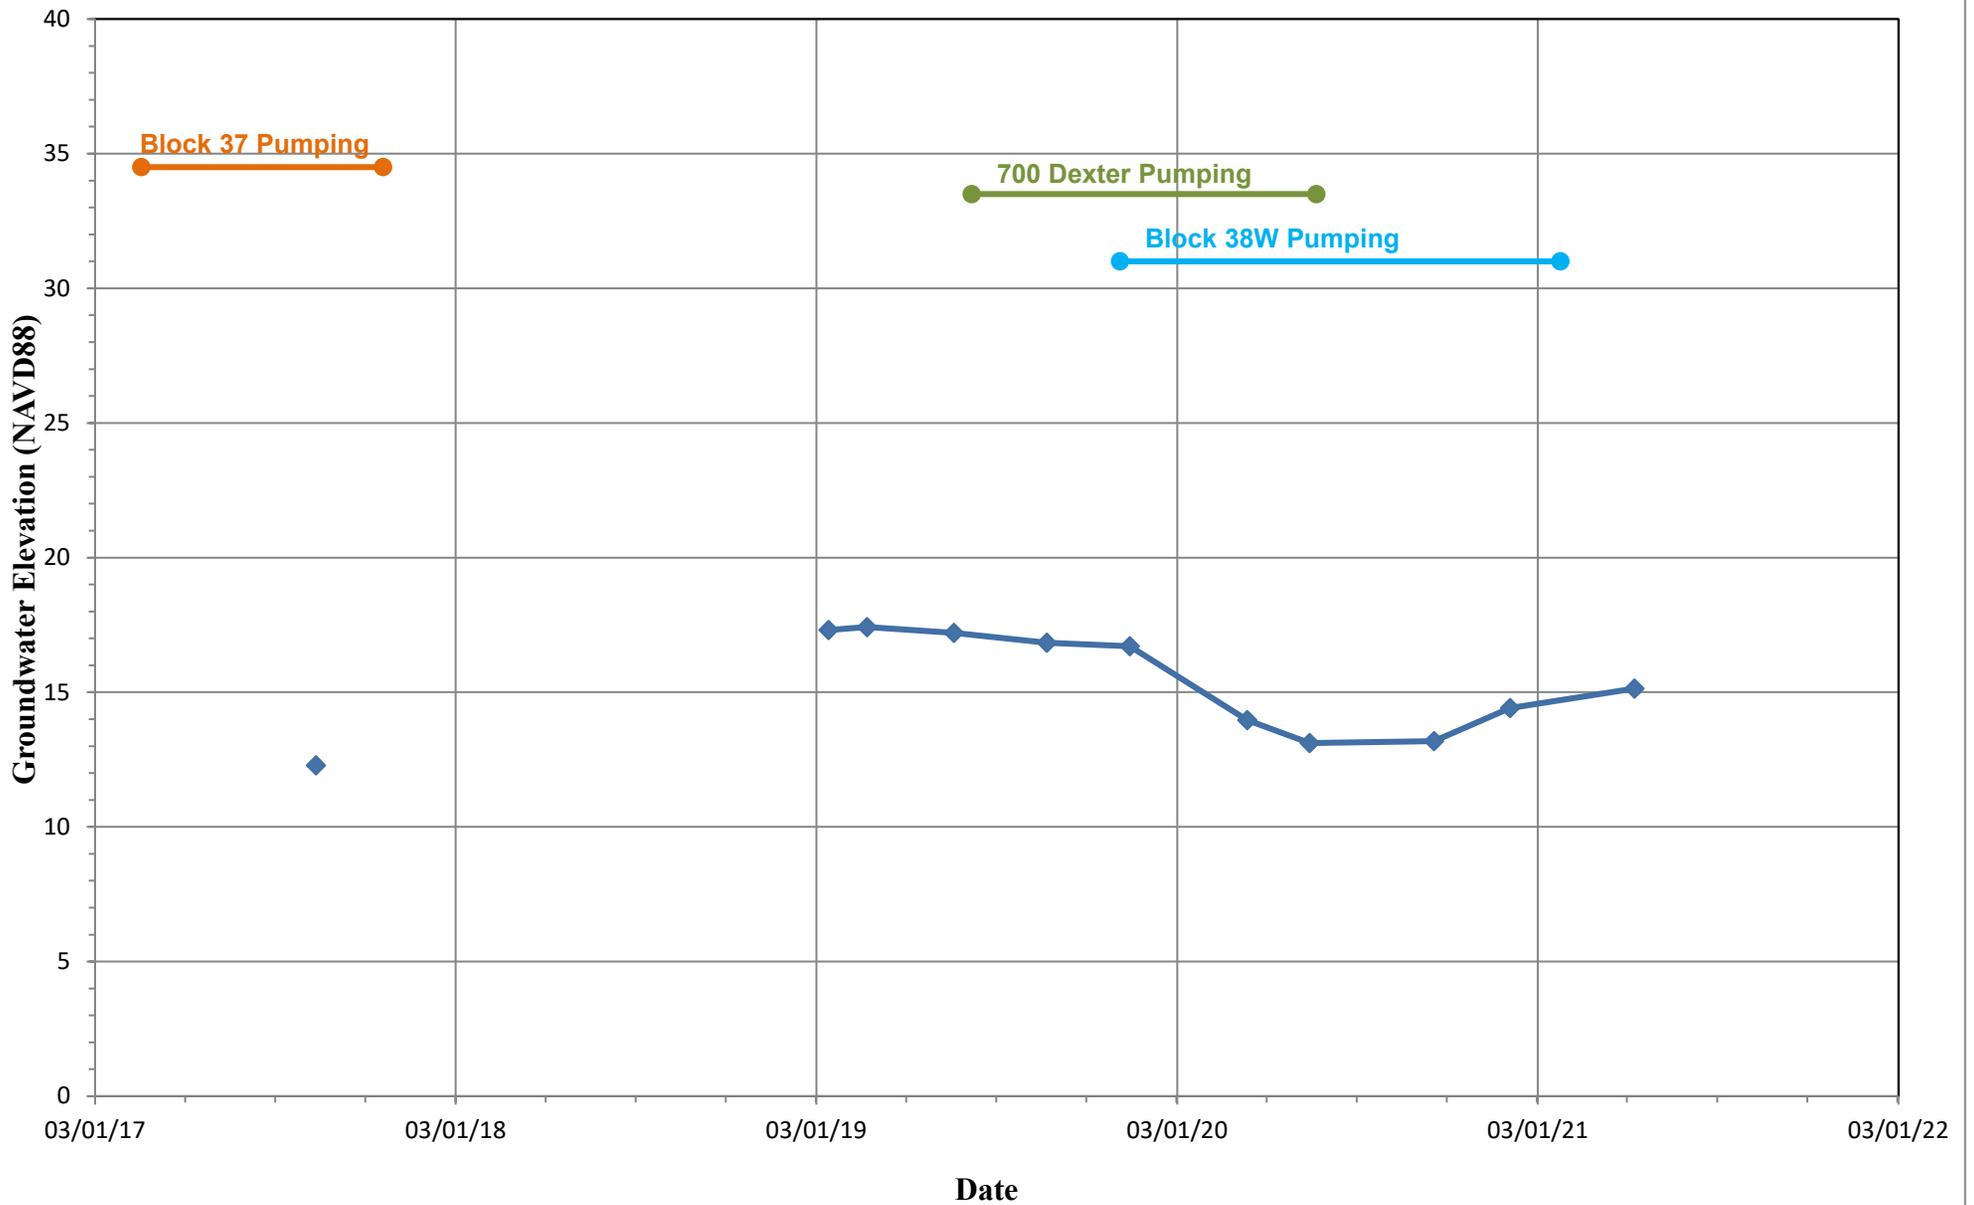


**Hydrograph**  
**MW-153, Roy St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

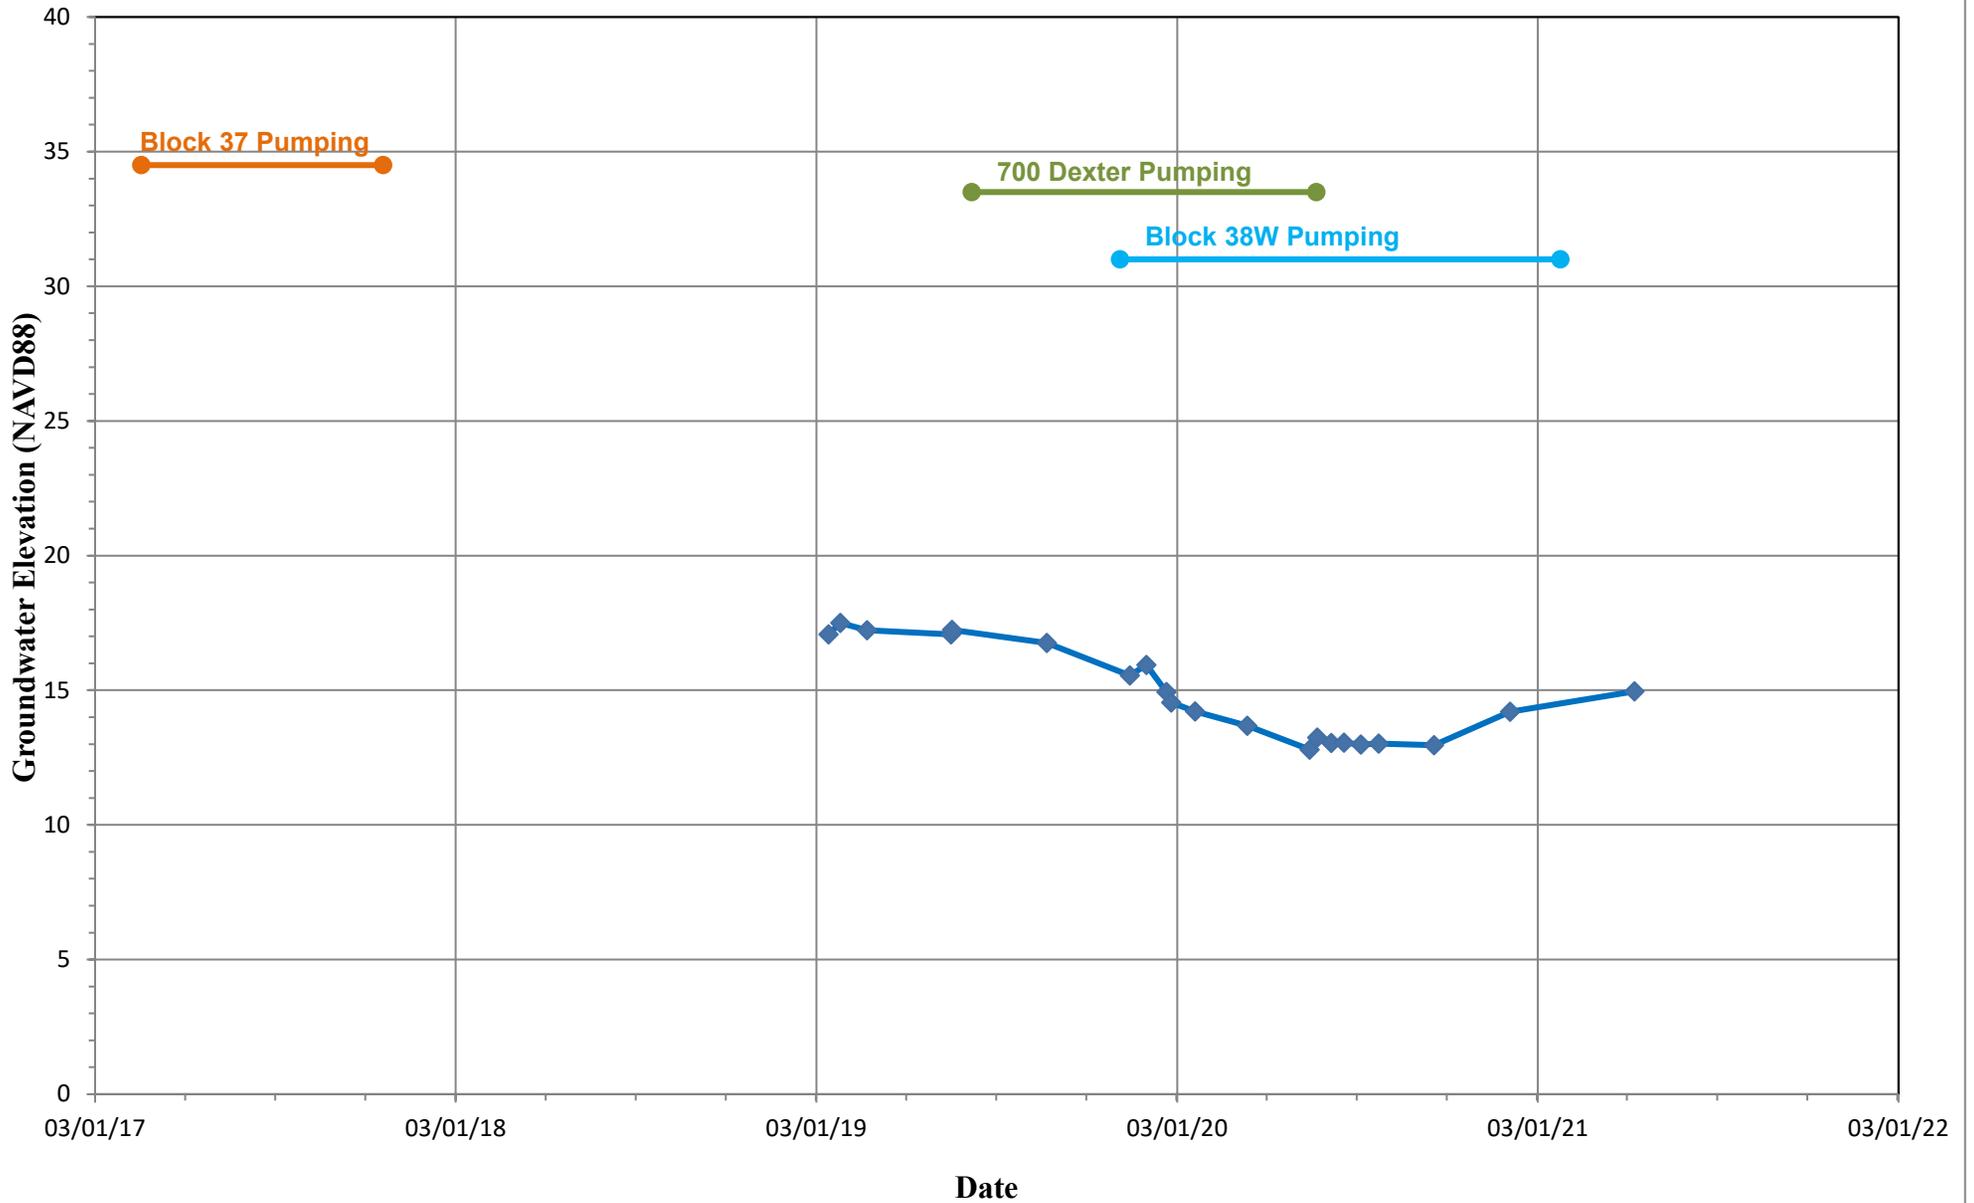


**Hydrograph**  
**MW-158A, 8th Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

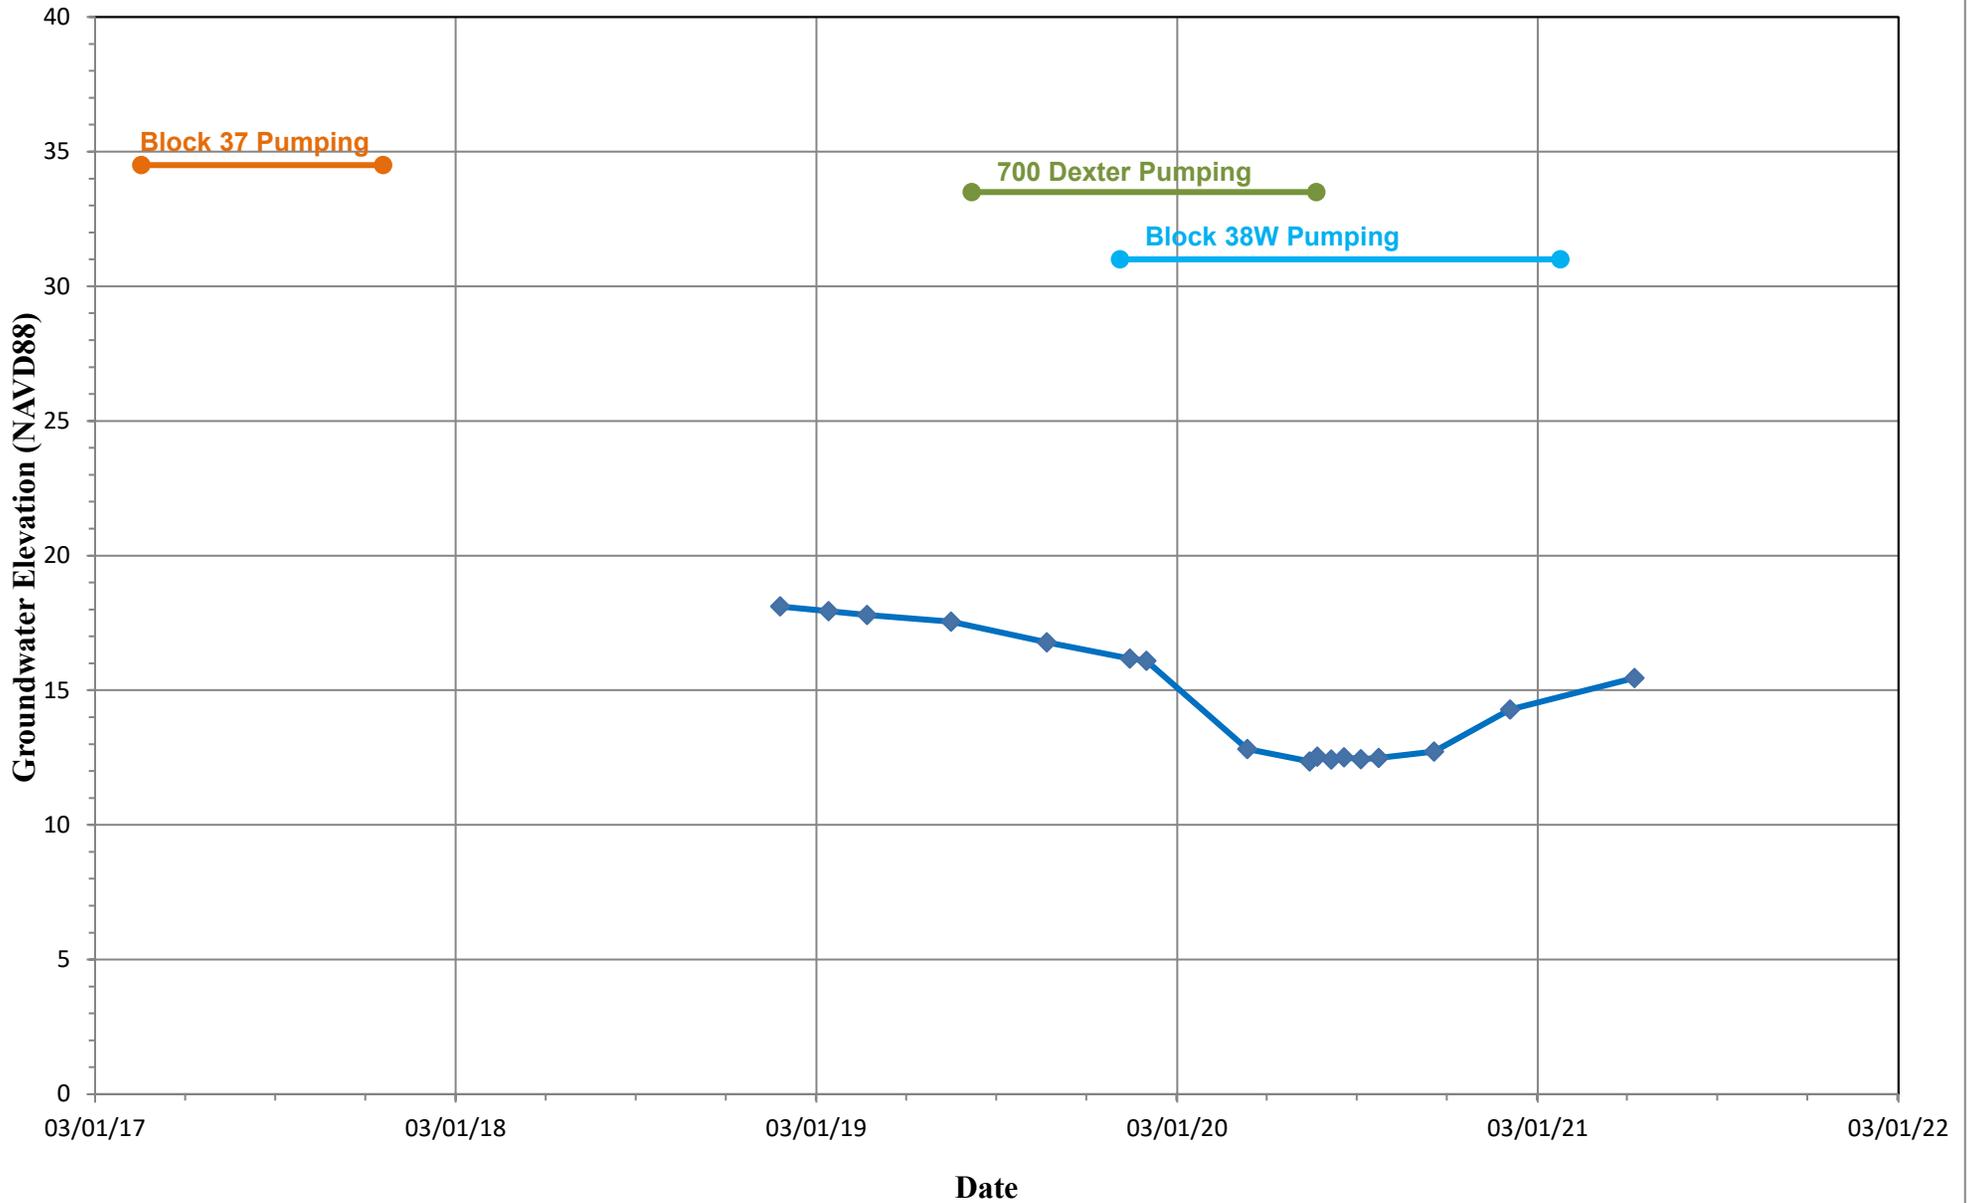


**Hydrograph**  
**MW-160, 8th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

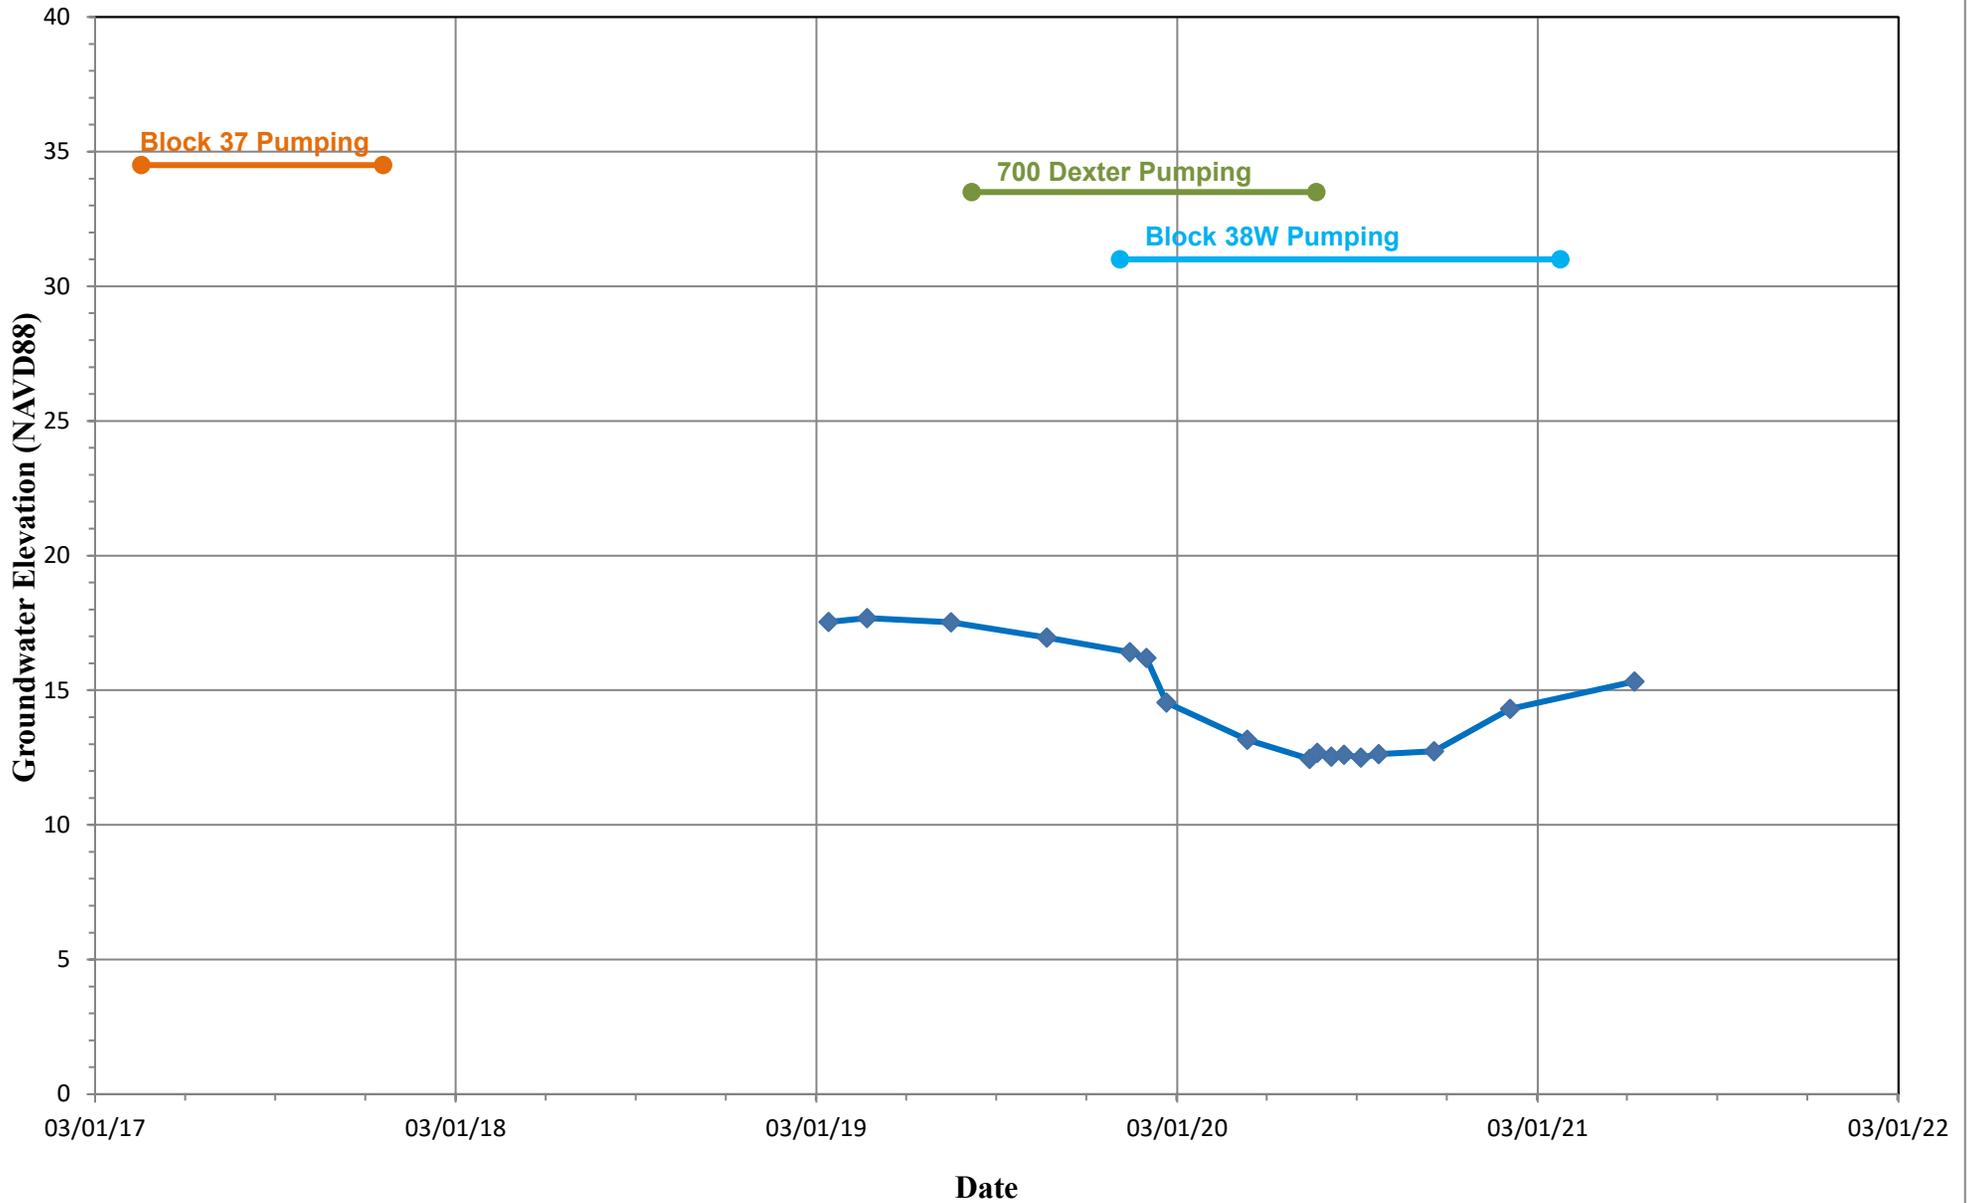


**Hydrograph**  
**MW-161, 8th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

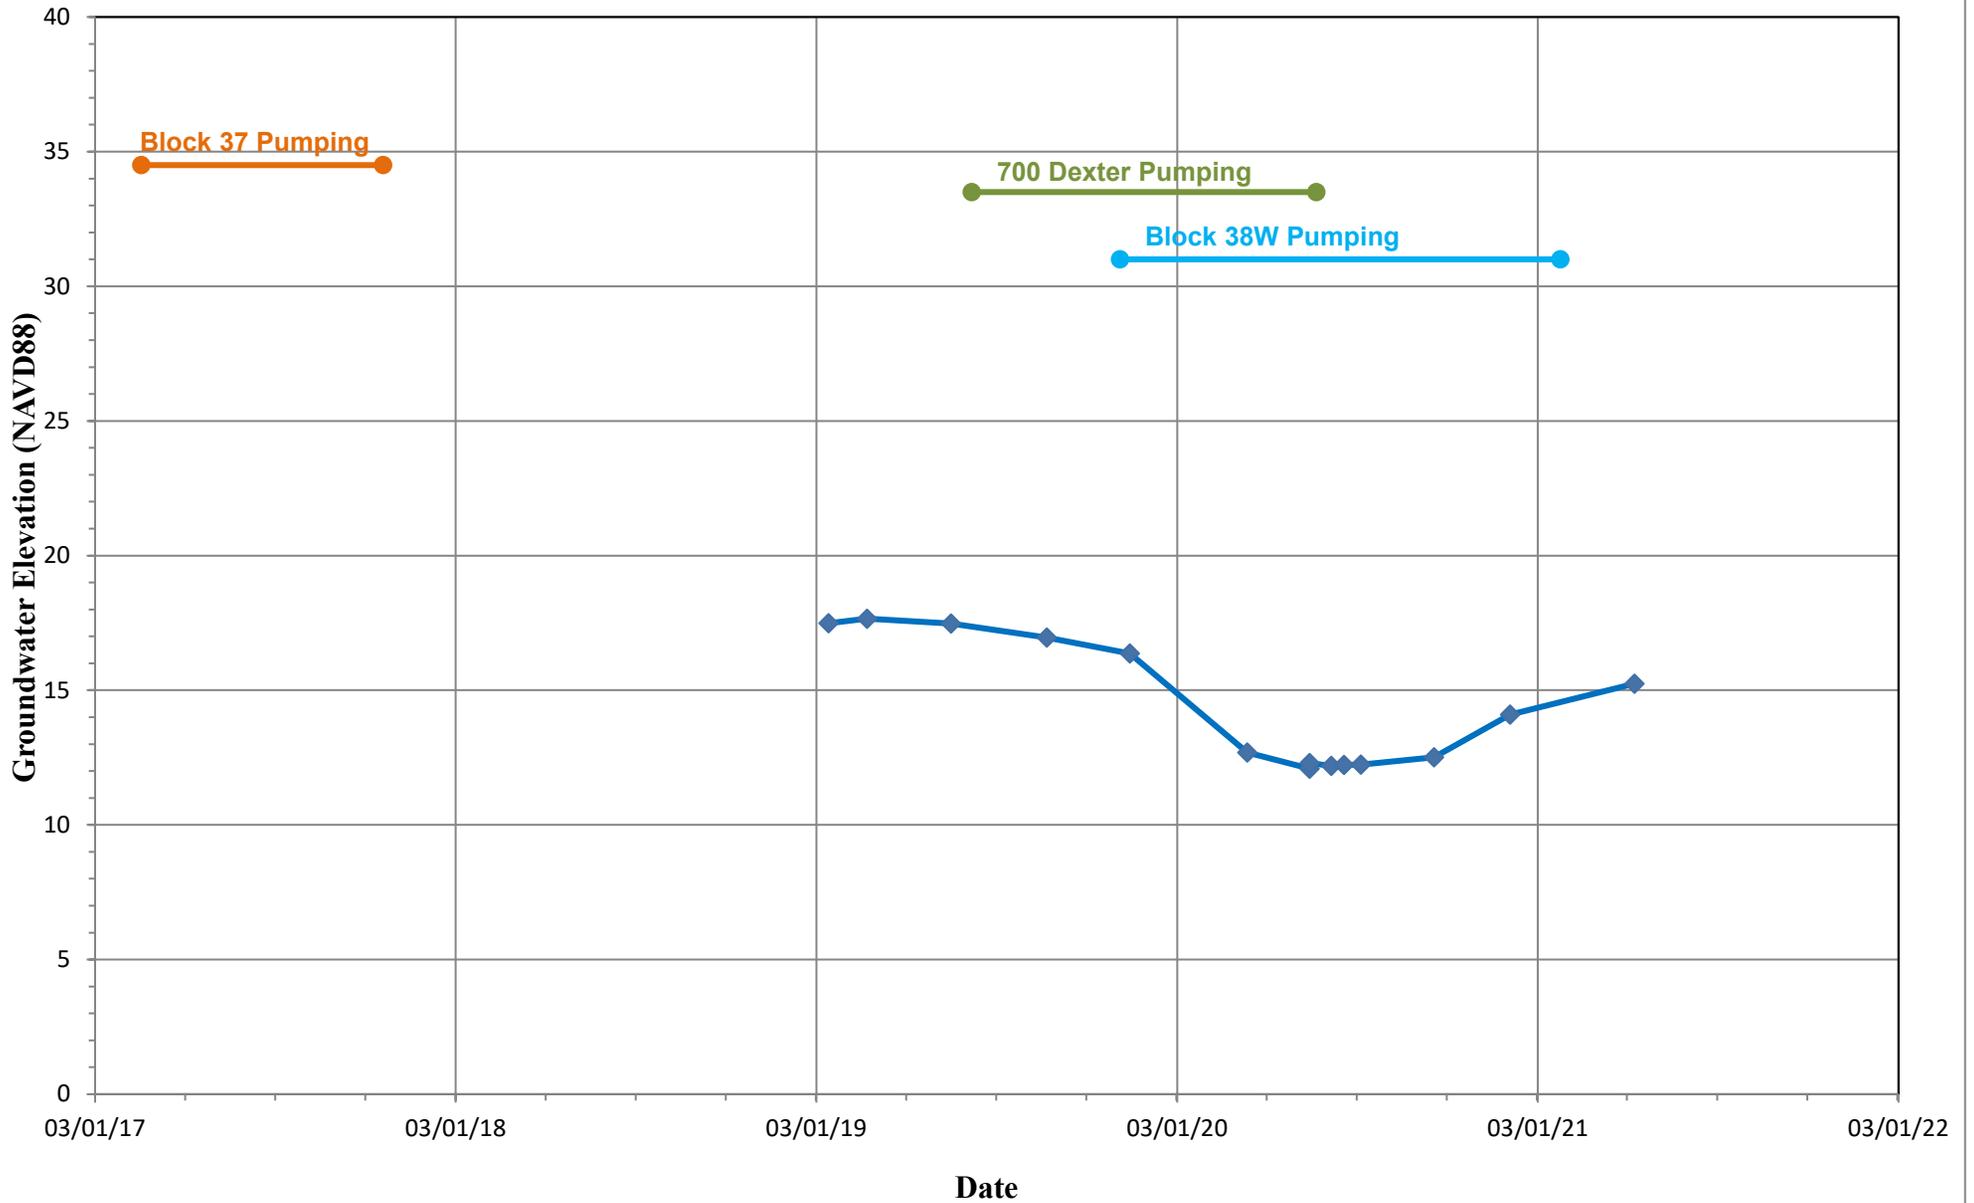


**Hydrograph**  
**MW-304, Dexter Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

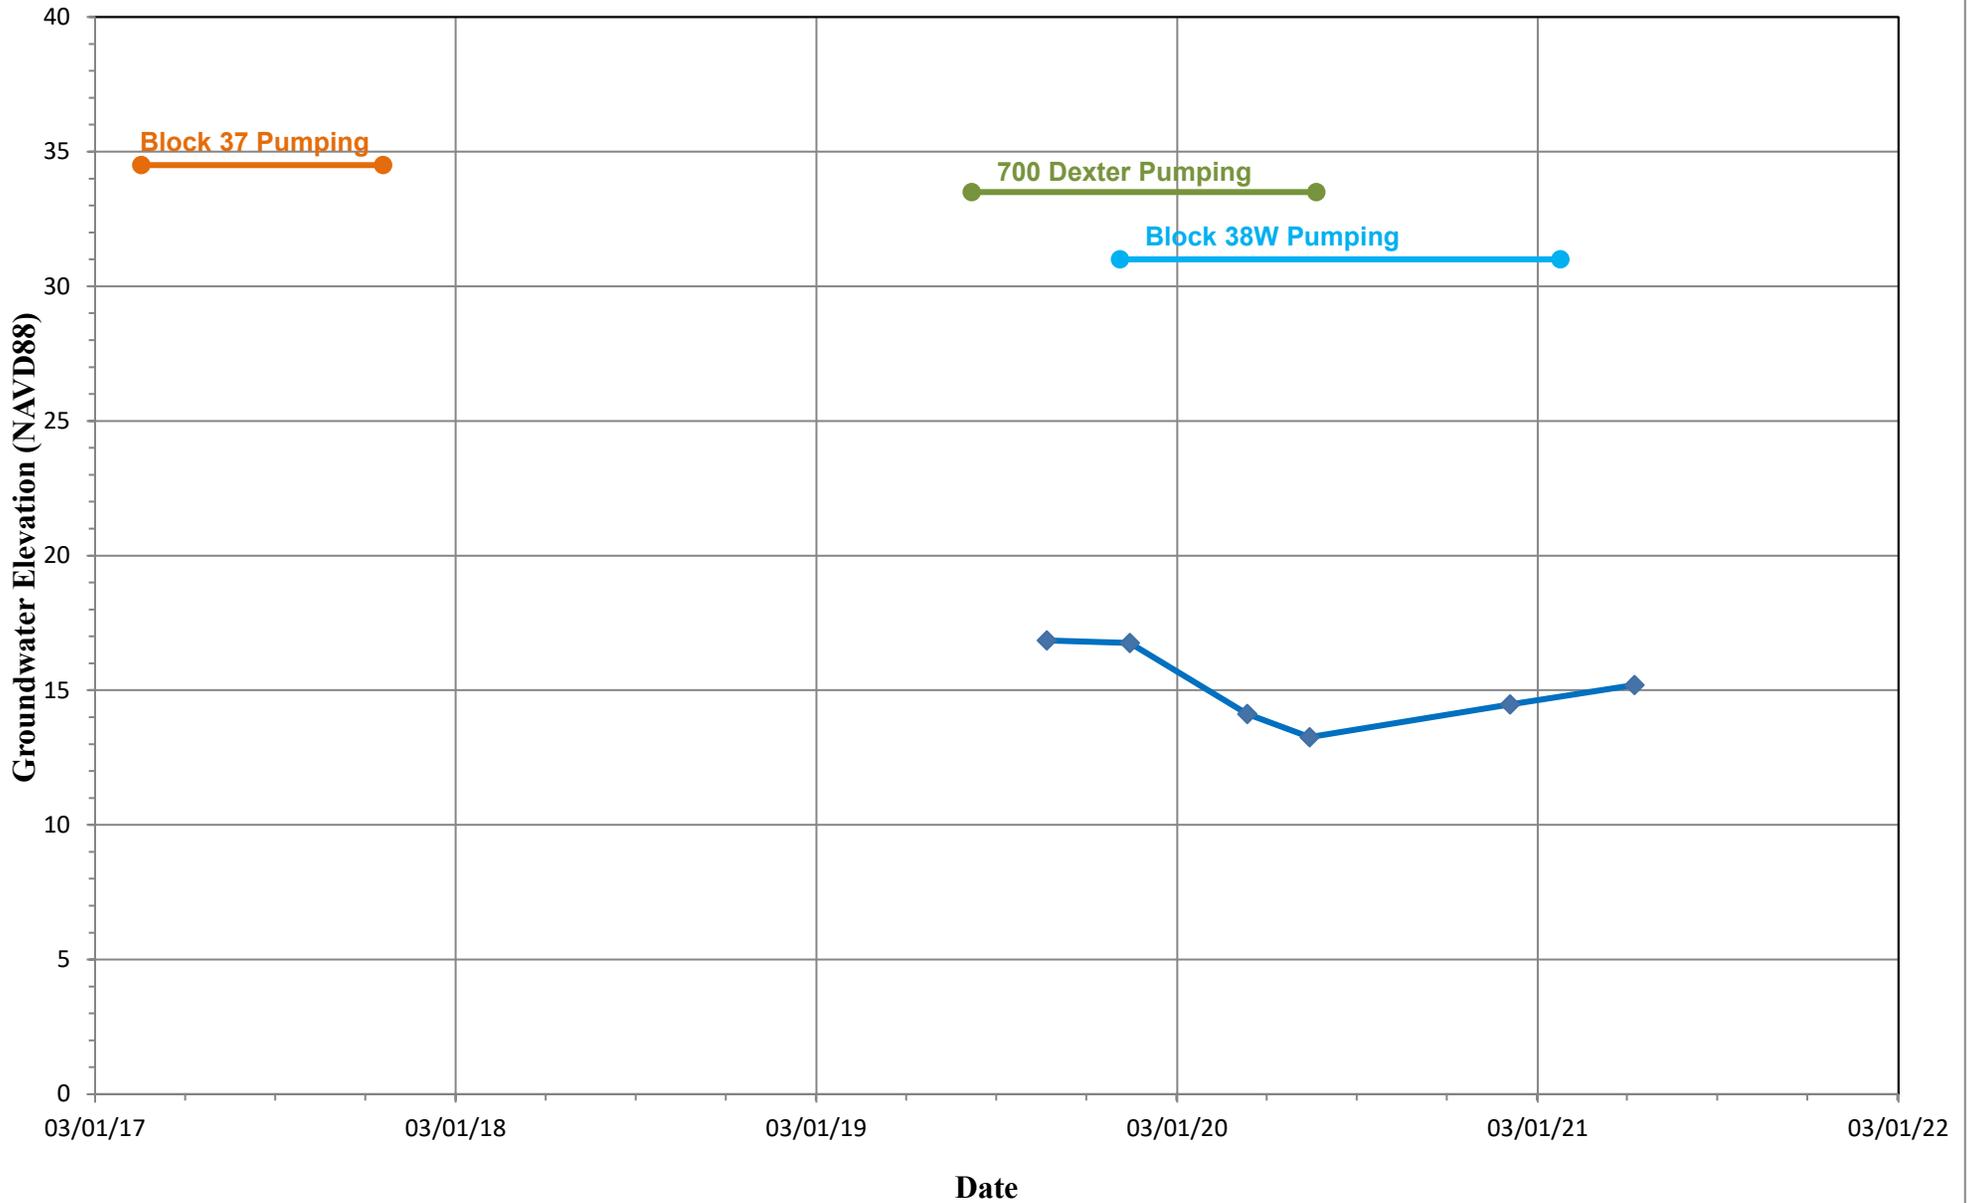


**Hydrograph**  
**MW-319, 9th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

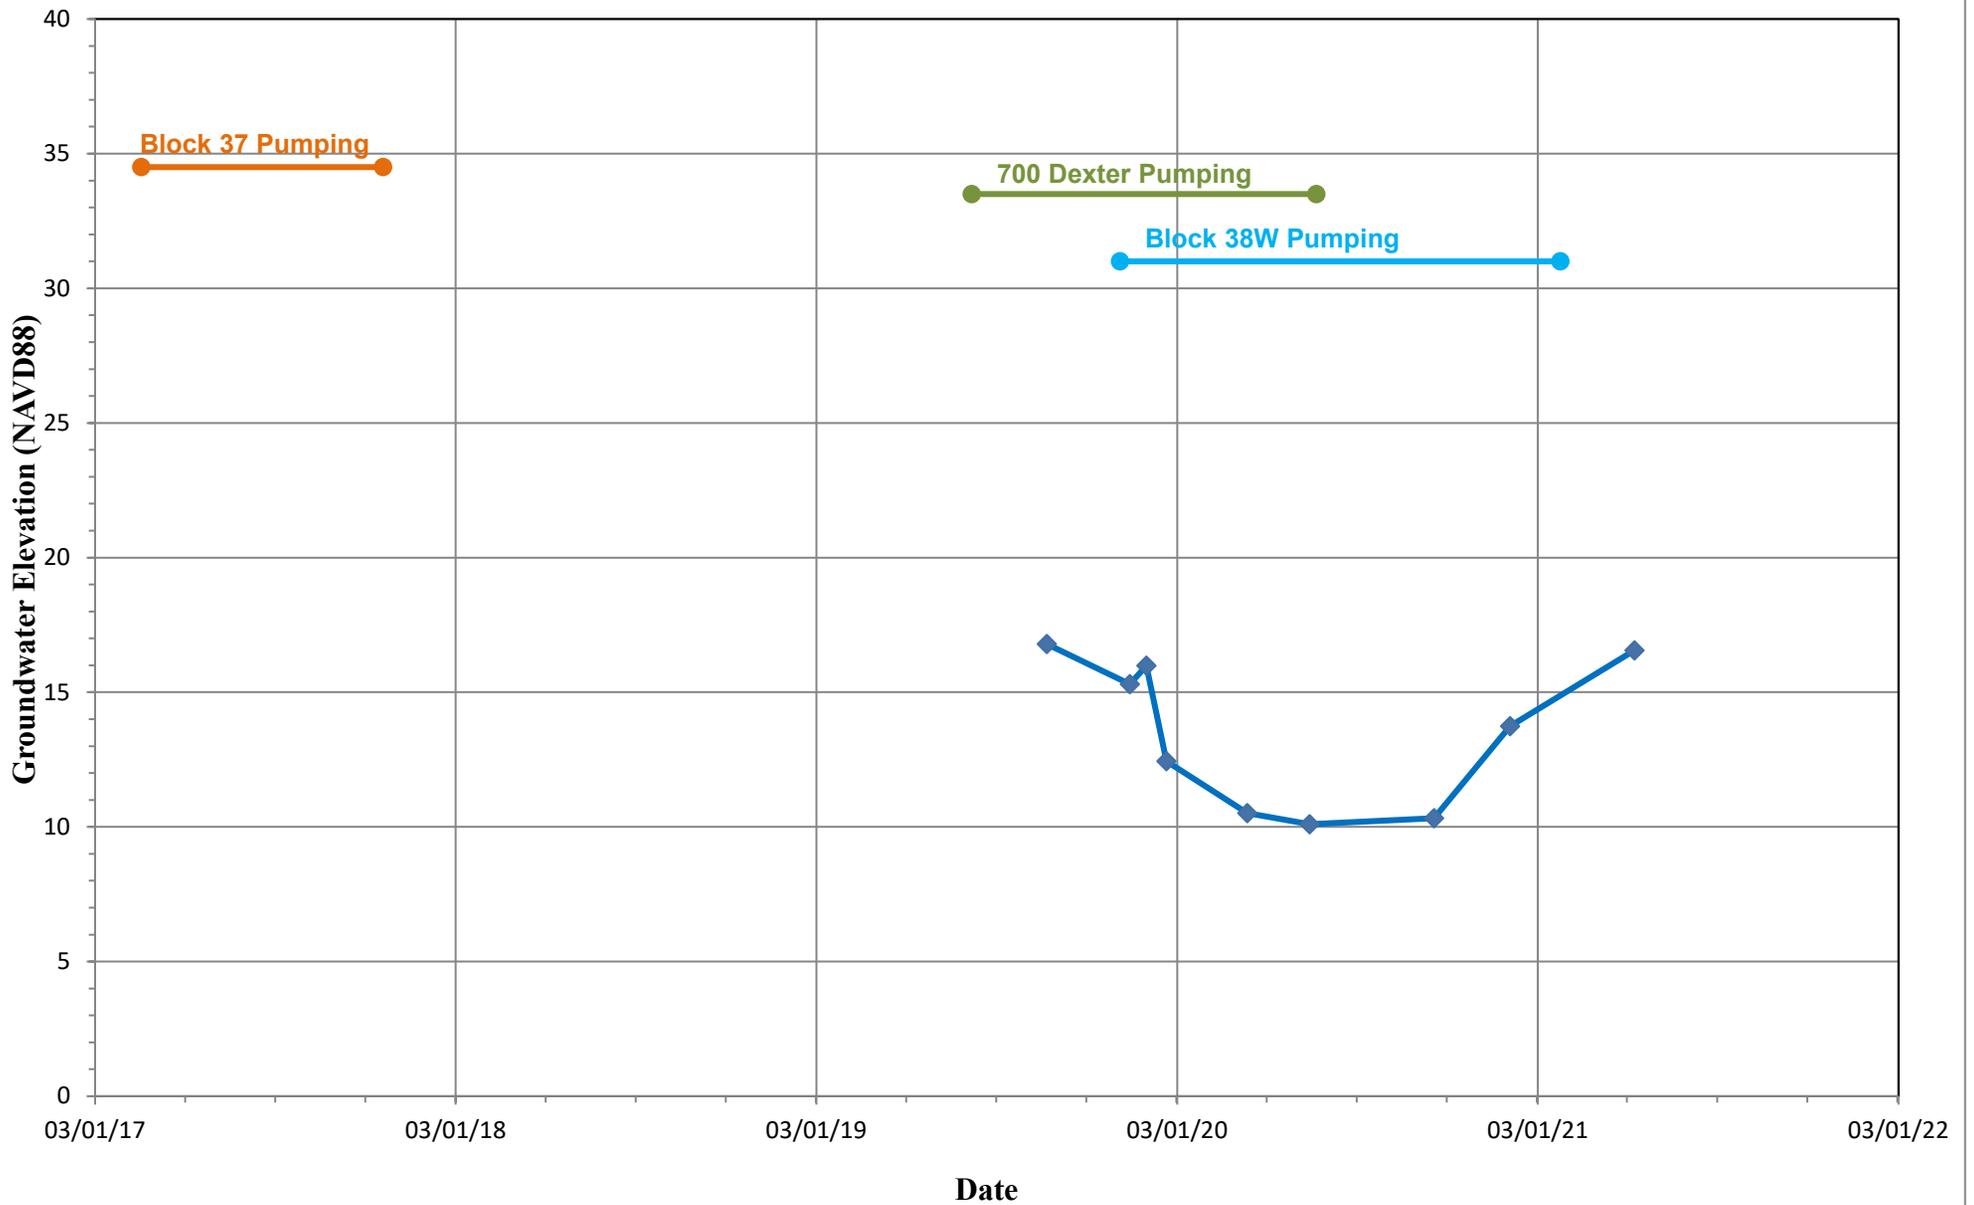


**Hydrograph**  
**MW-323, 9th Ave N ROW, W side**  
**American Linen Supply Co Dexter Ave Site**

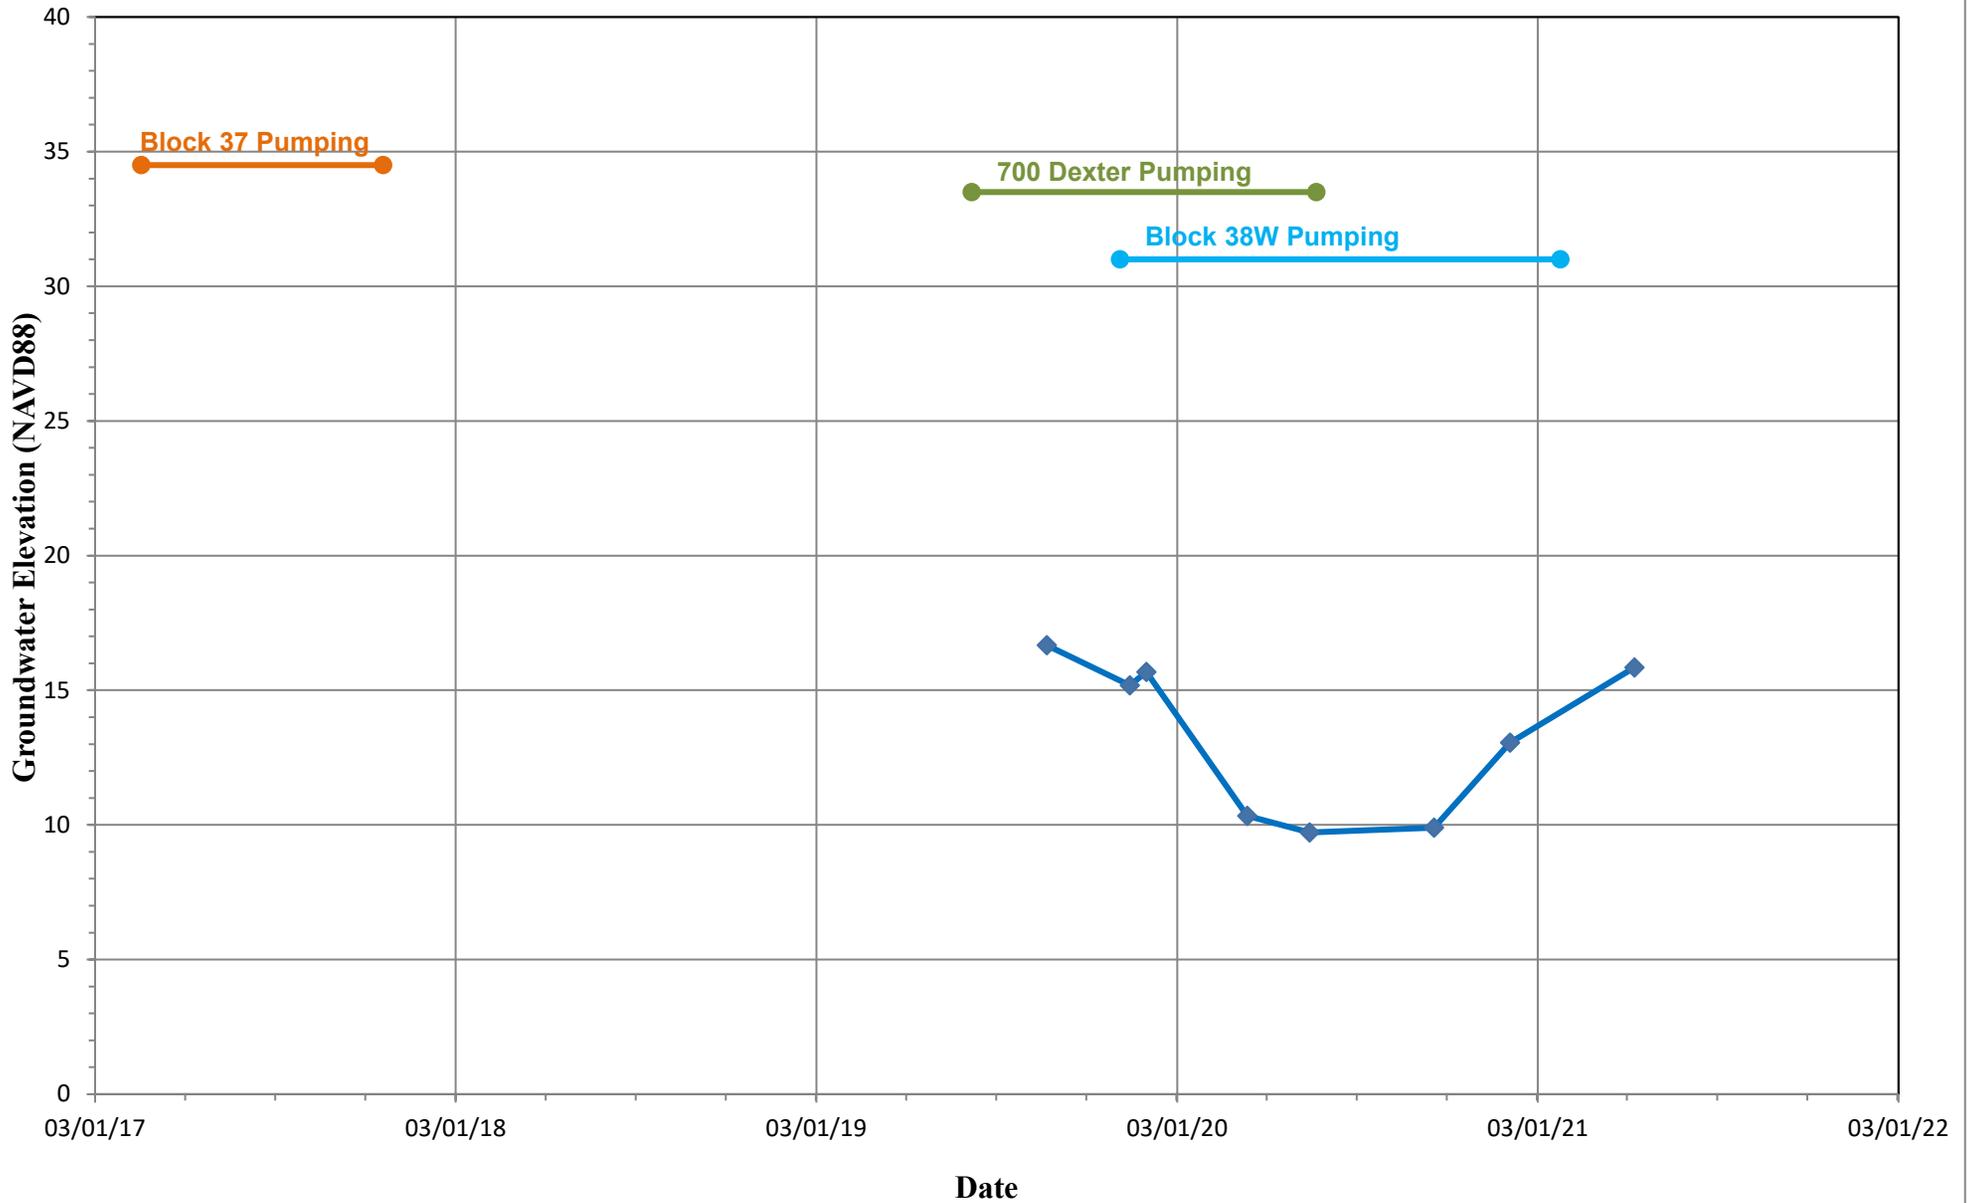


**Hydrograph**  
**MW-324, Roy St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

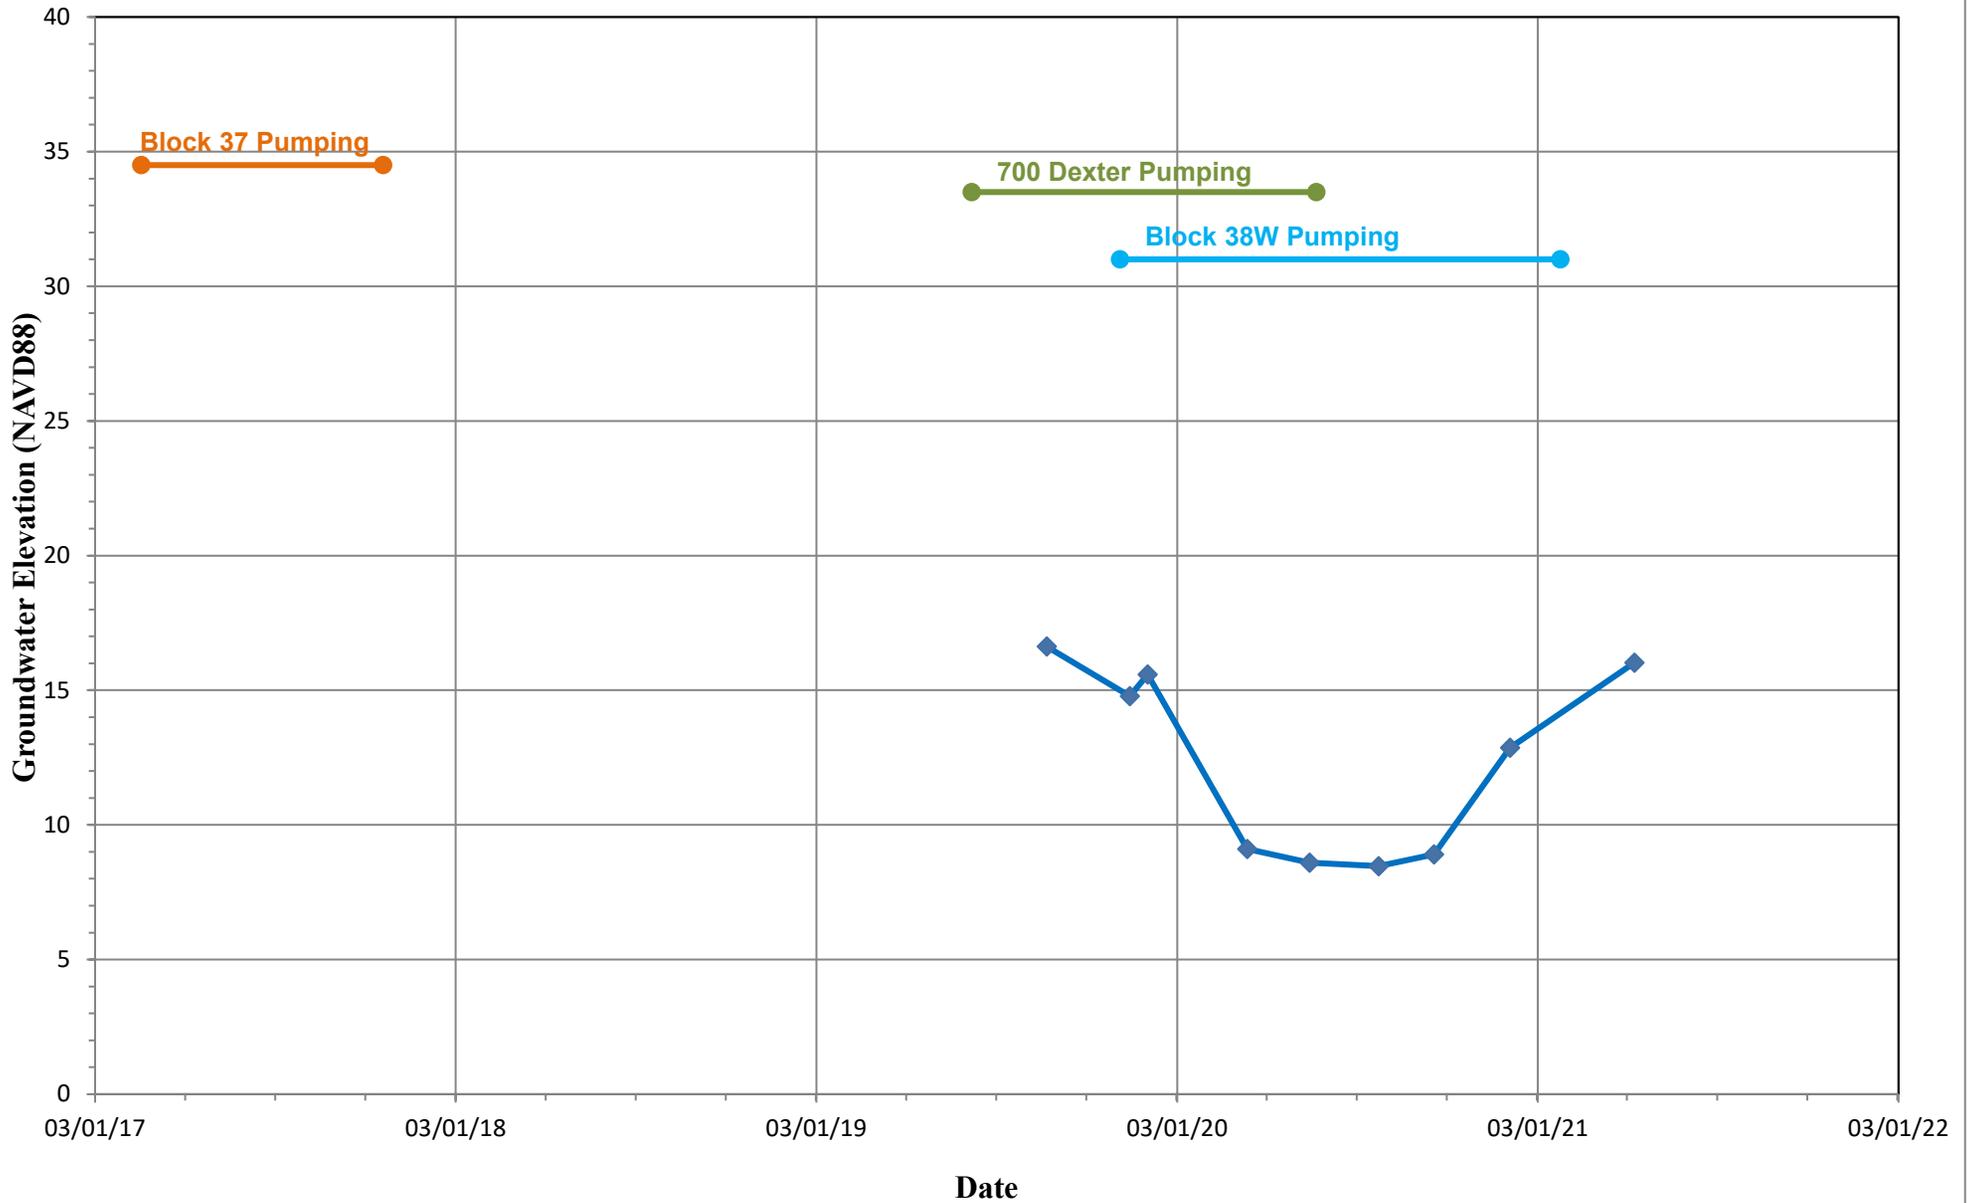


**Hydrograph**  
**MW-326, Mercer St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

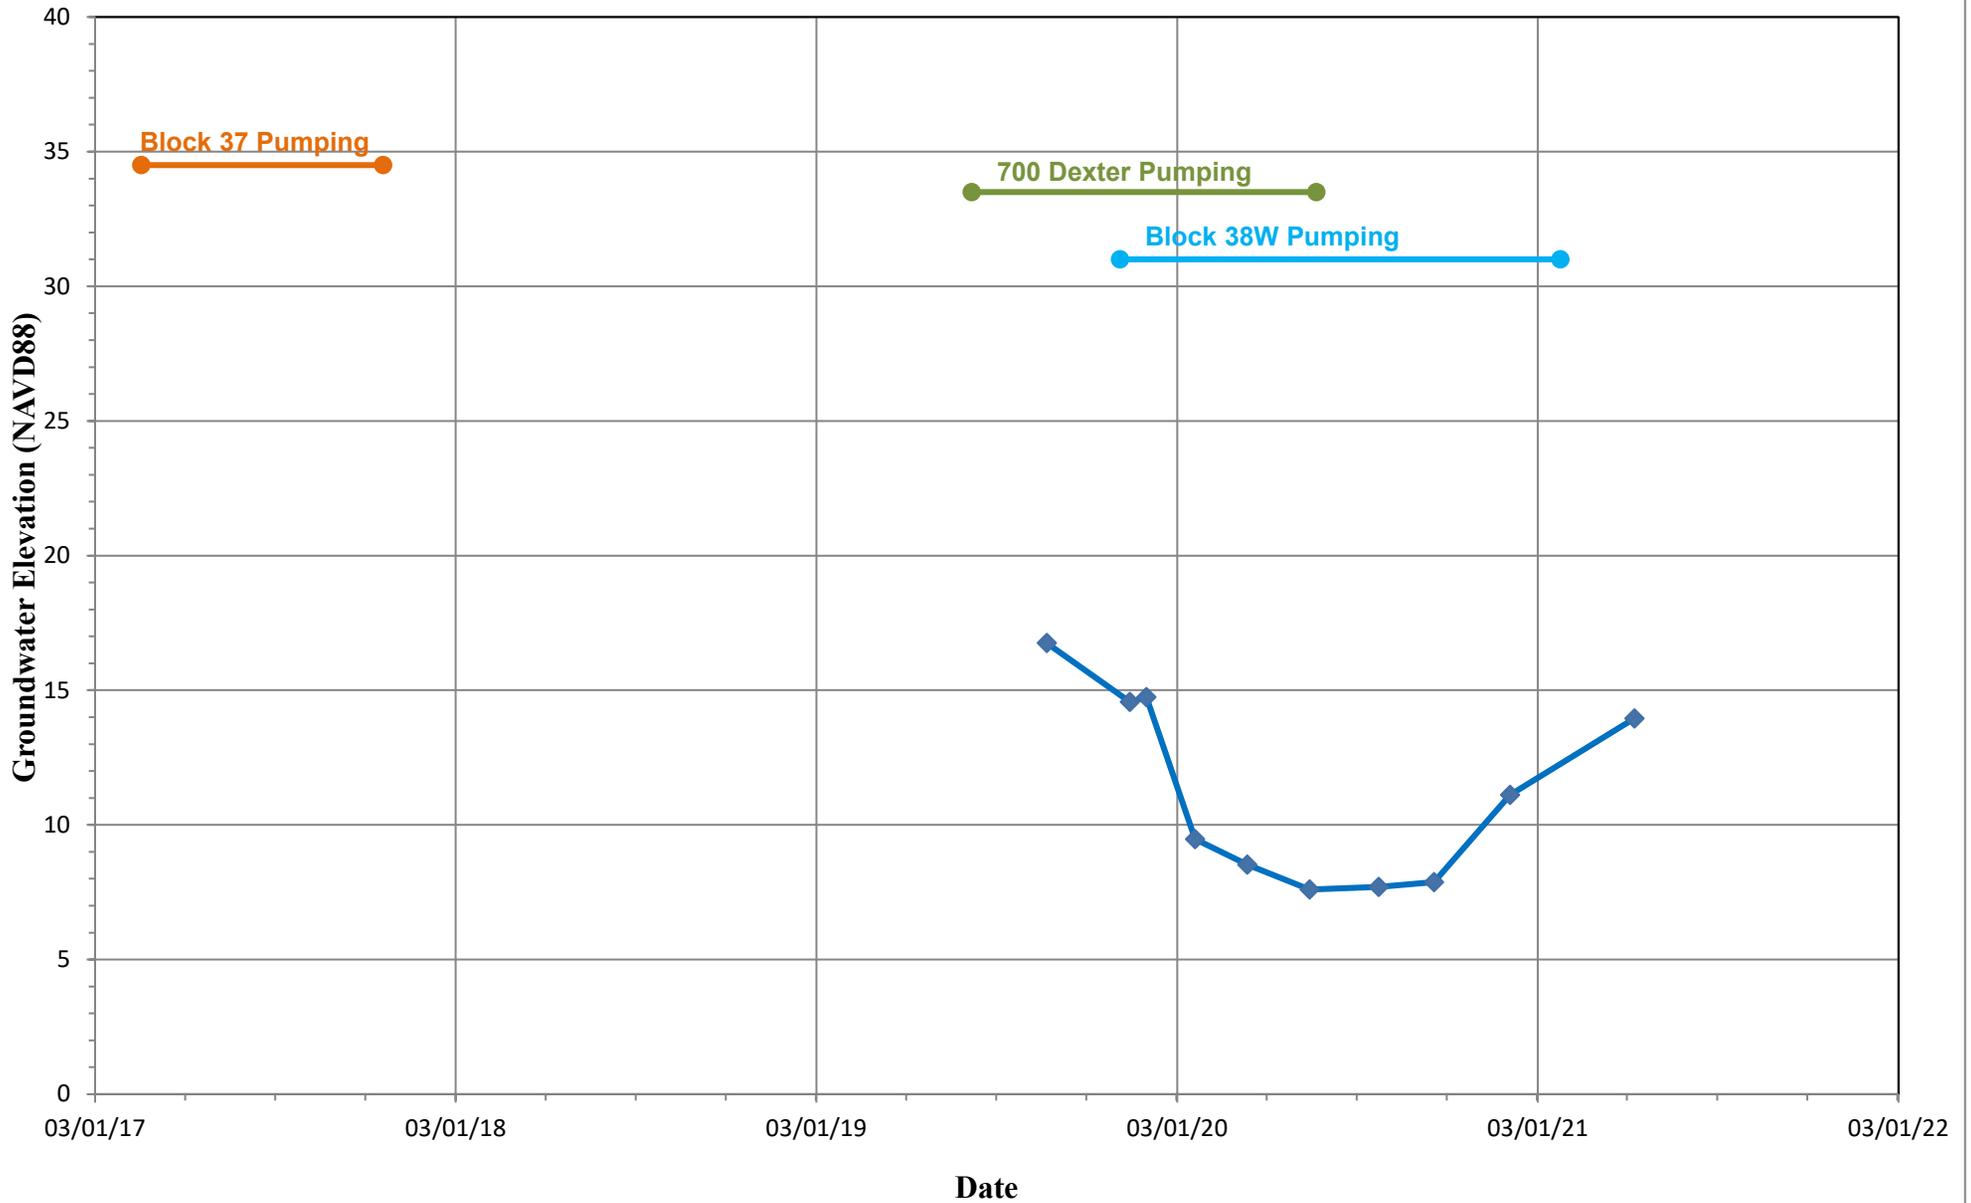


**Hydrograph**  
**MW-328, Lake Union Park, S end**  
**American Linen Supply Co Dexter Ave Site**

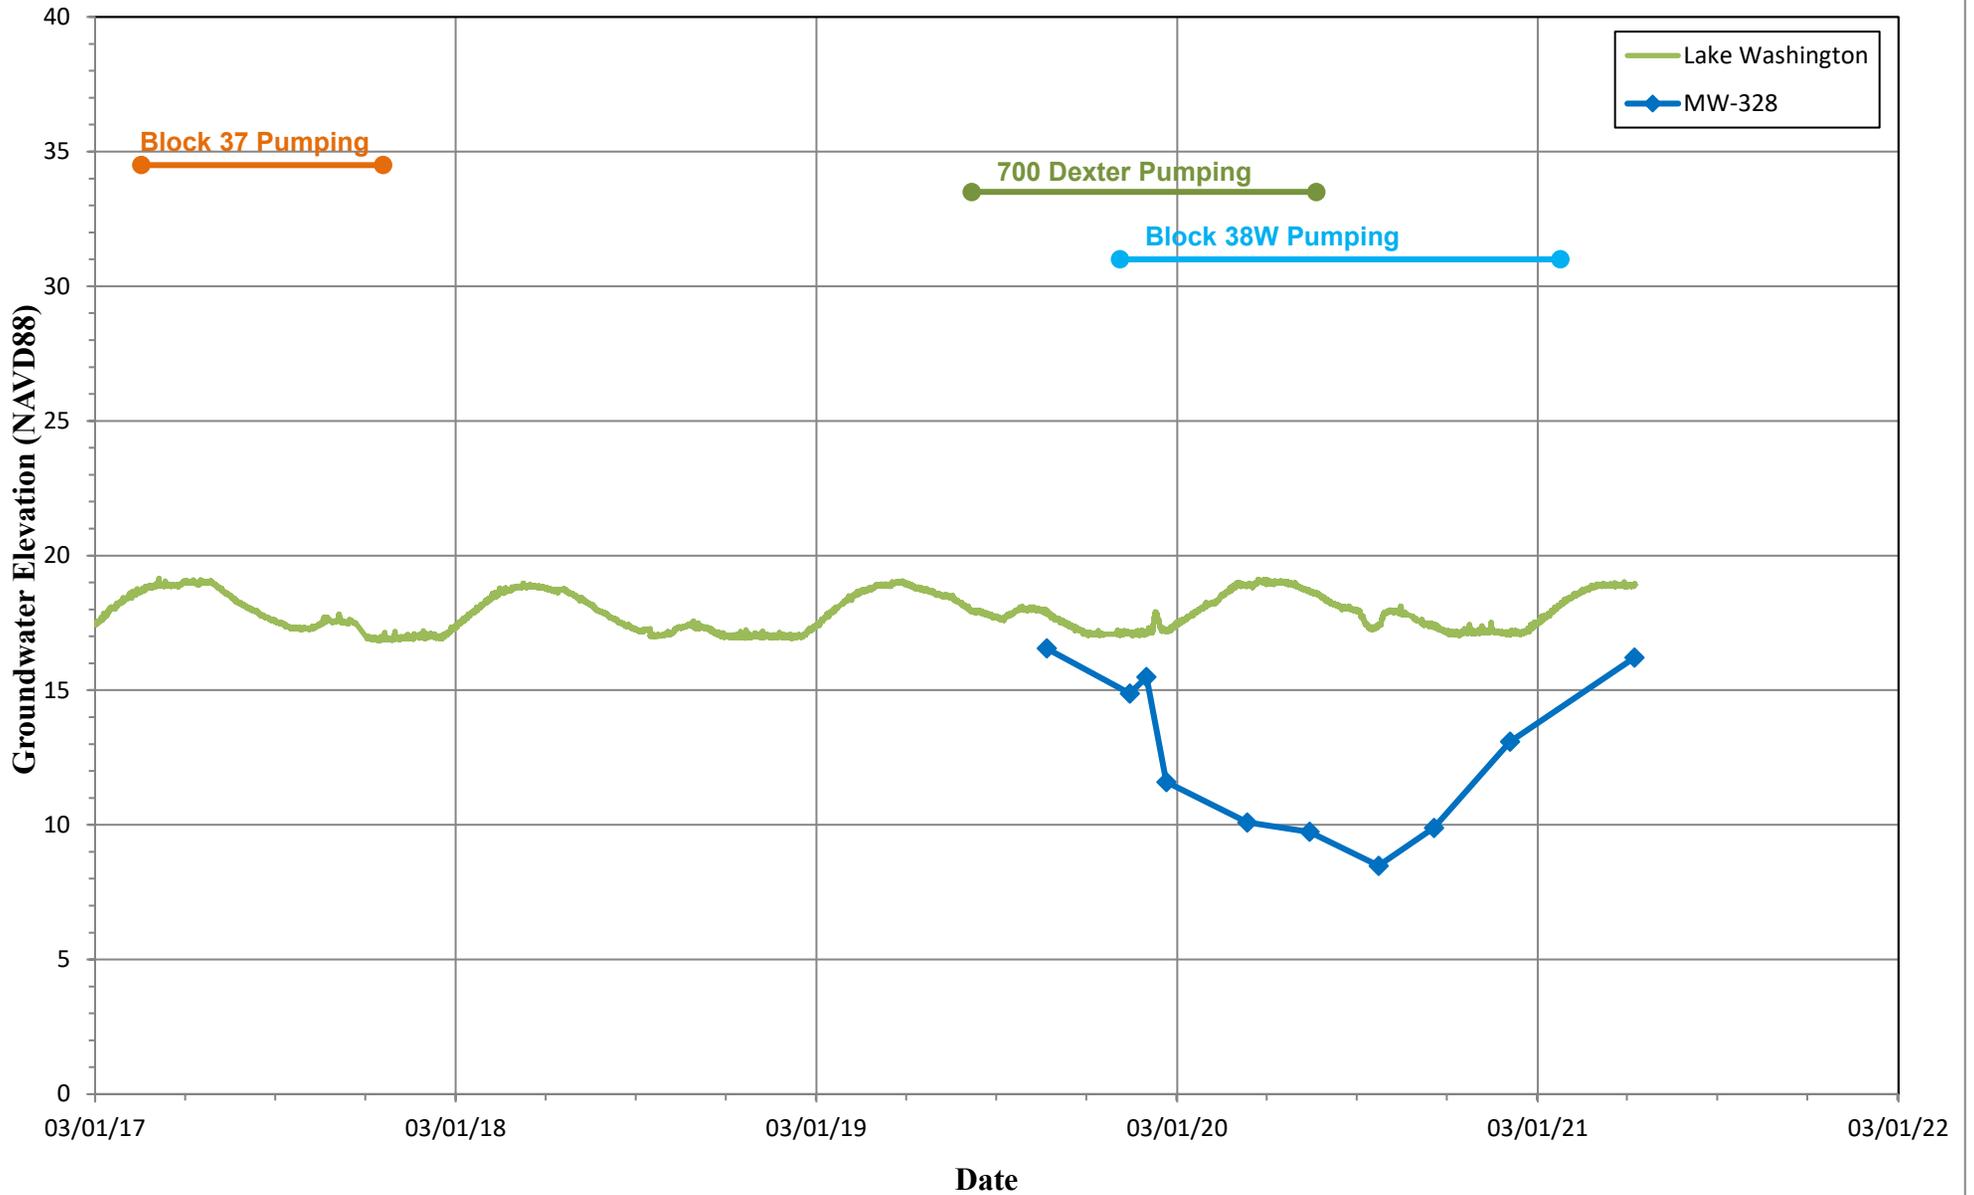


**Hydrograph**  
**MW-329, Westlake Ave N ROW, E side**  
**American Linen Supply Co Dexter Ave Site**

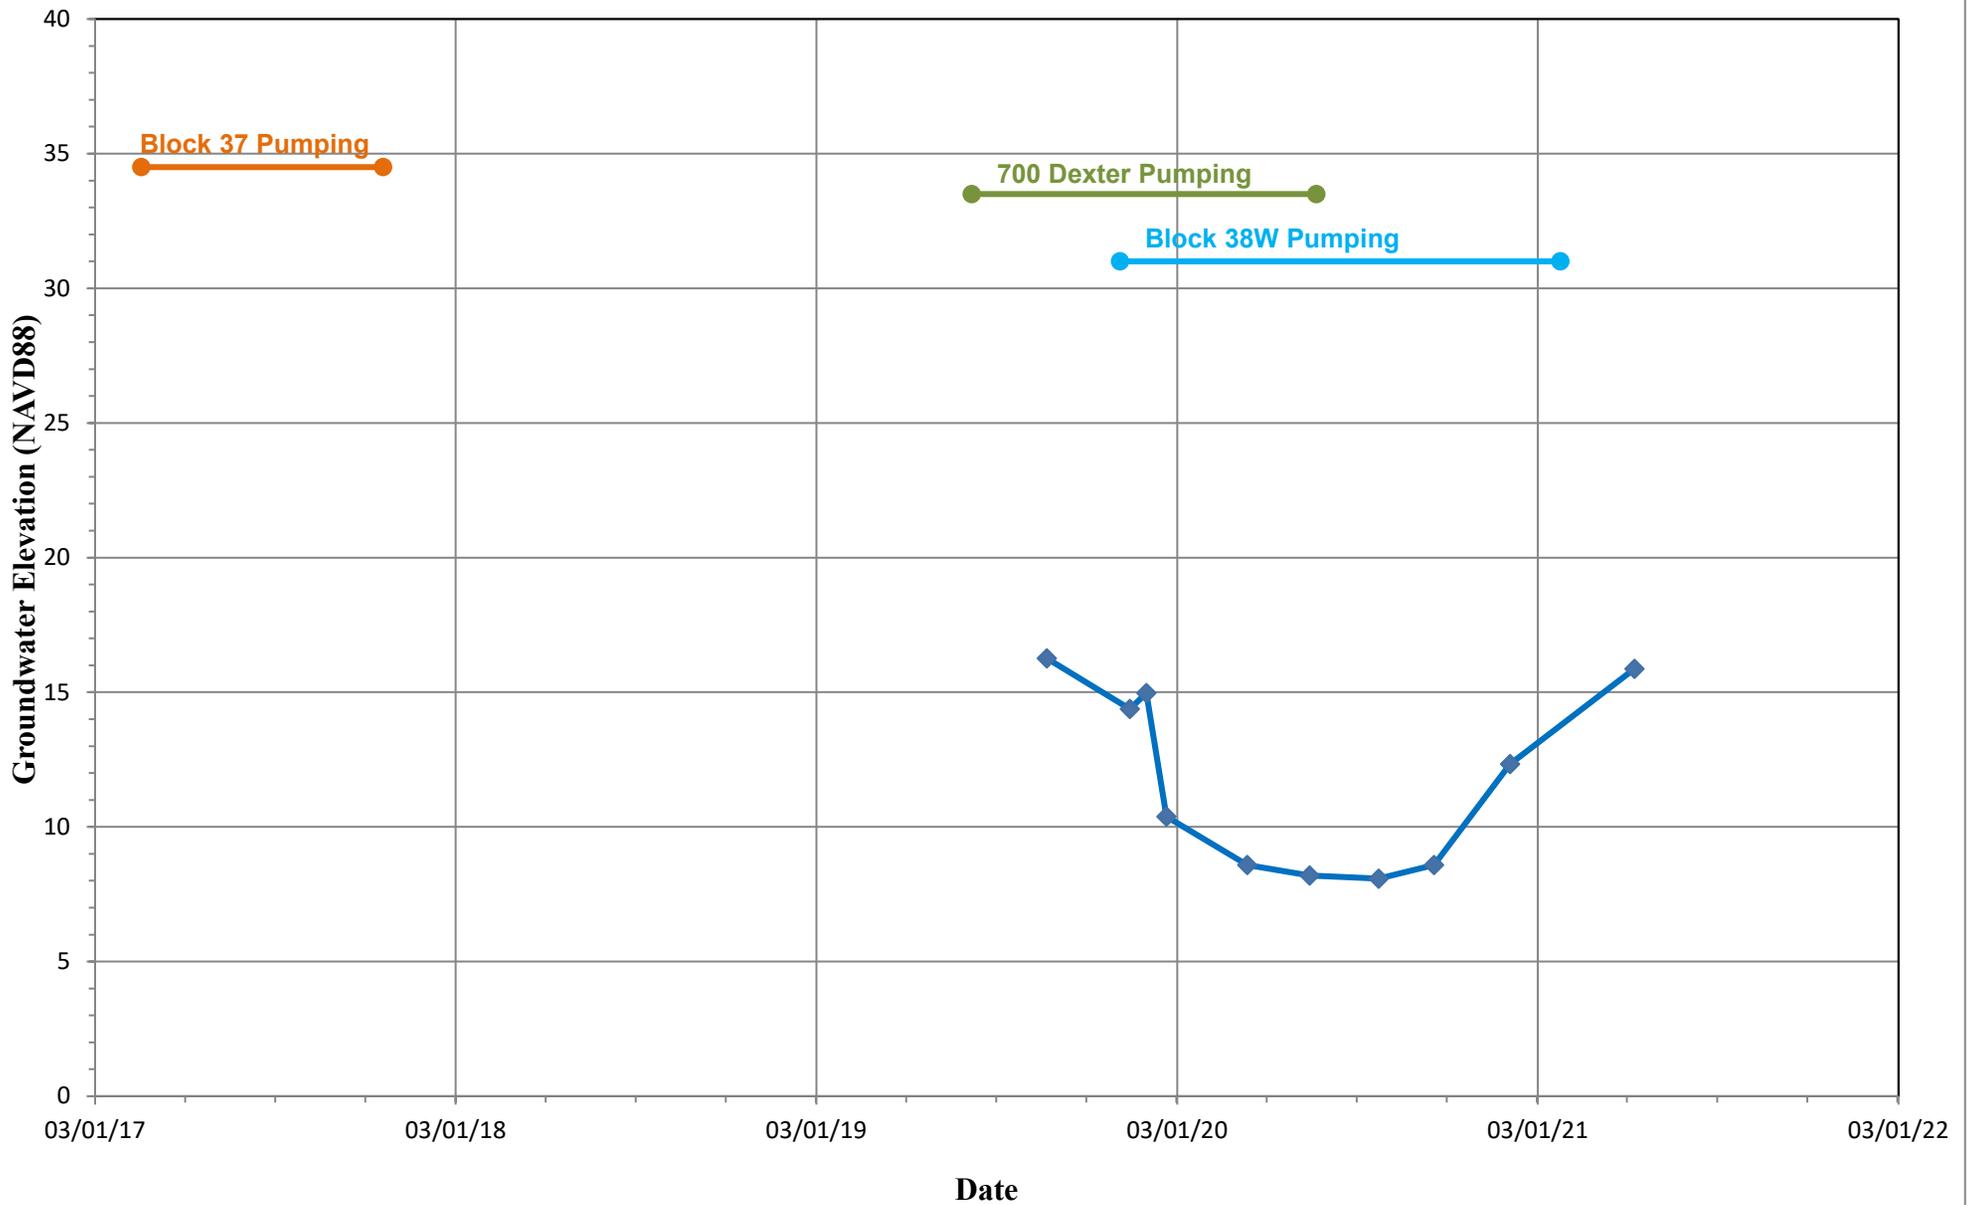


**Hydrograph**  
**MW-336, Mercer St ROW, N side**  
**American Linen Supply Co Dexter Ave Site**

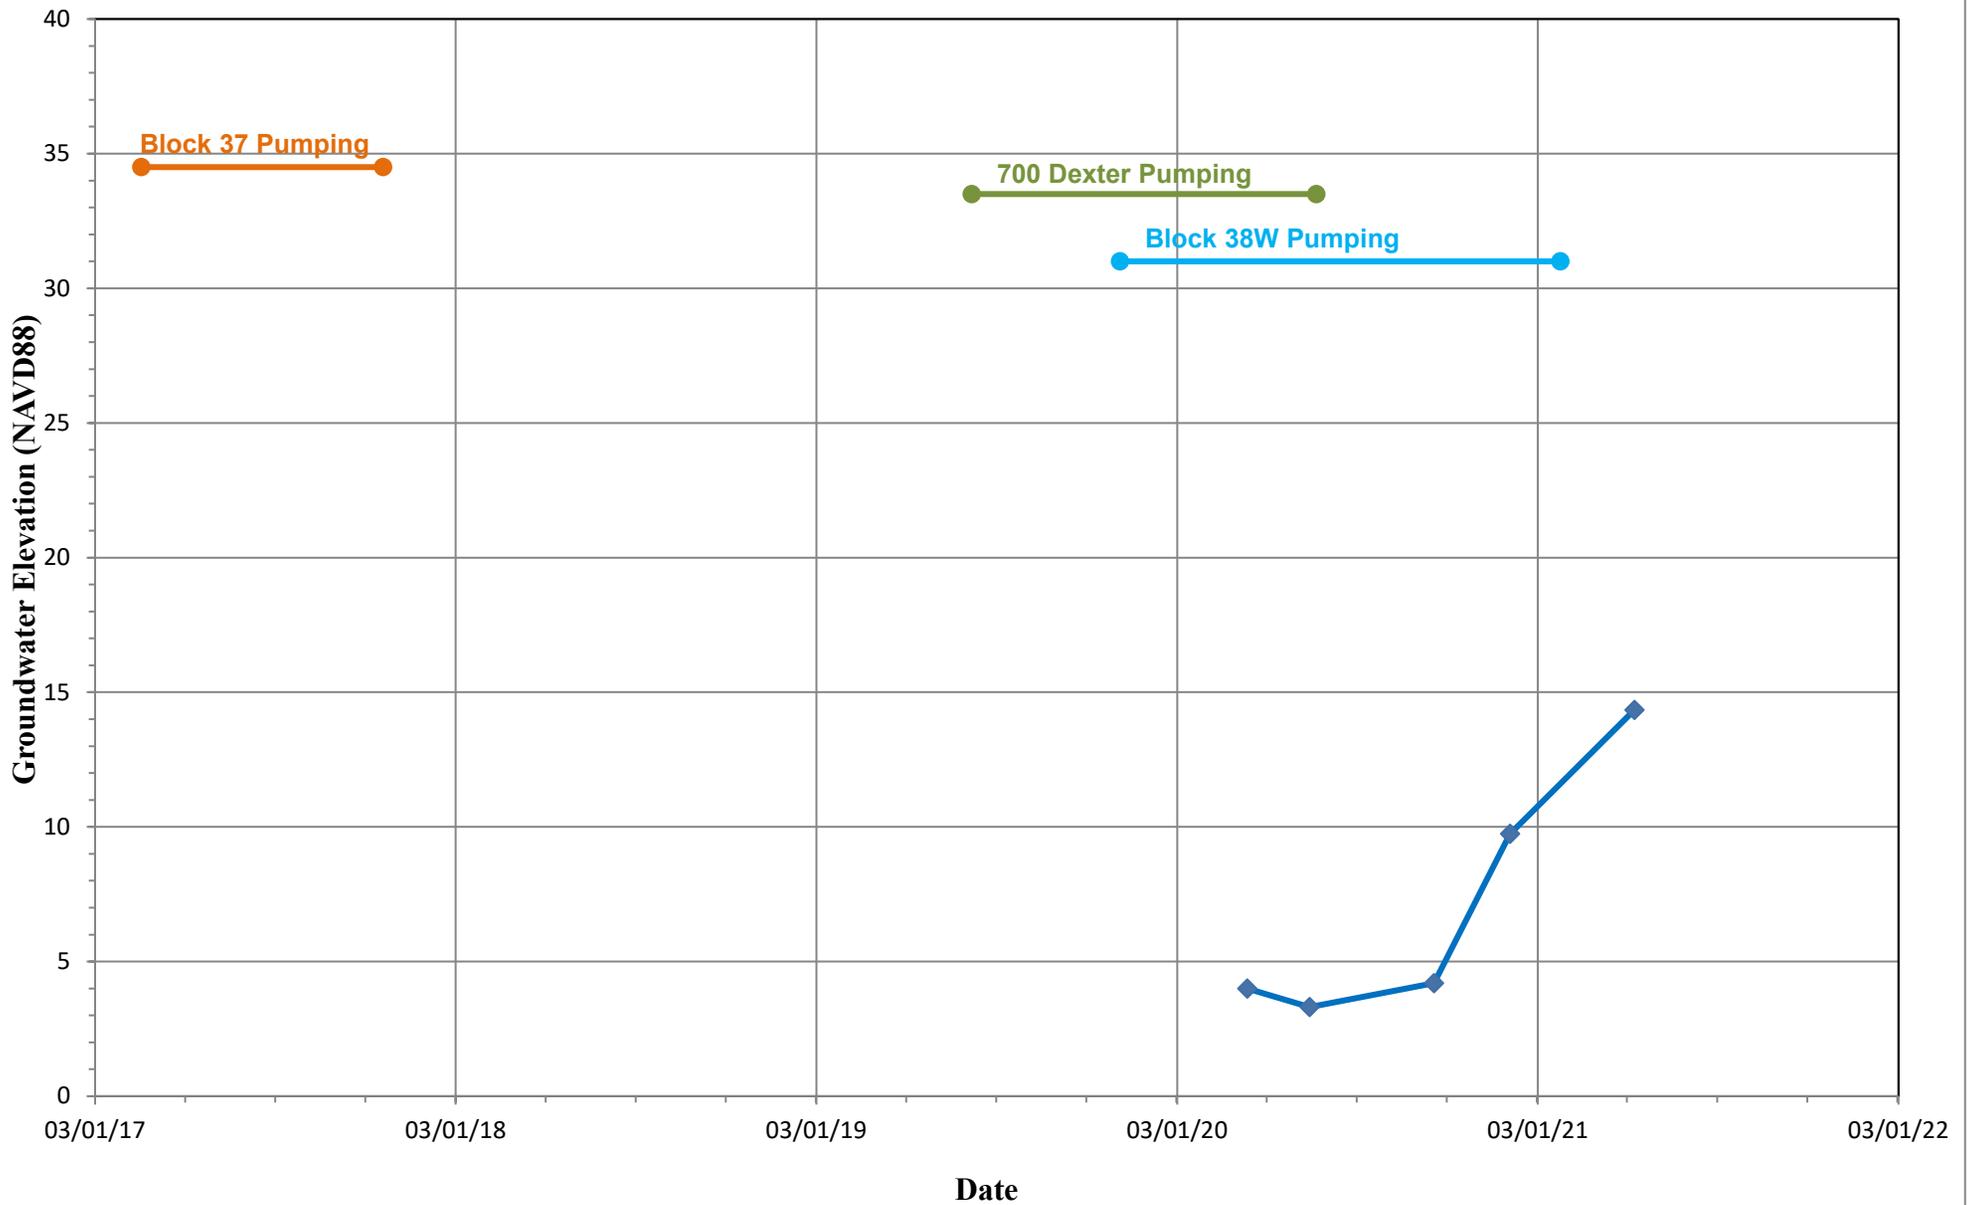

**Hydrograph**  
**MW-341, Lake Union Park, S end**  
**American Linen Supply Co Dexter Ave Site**

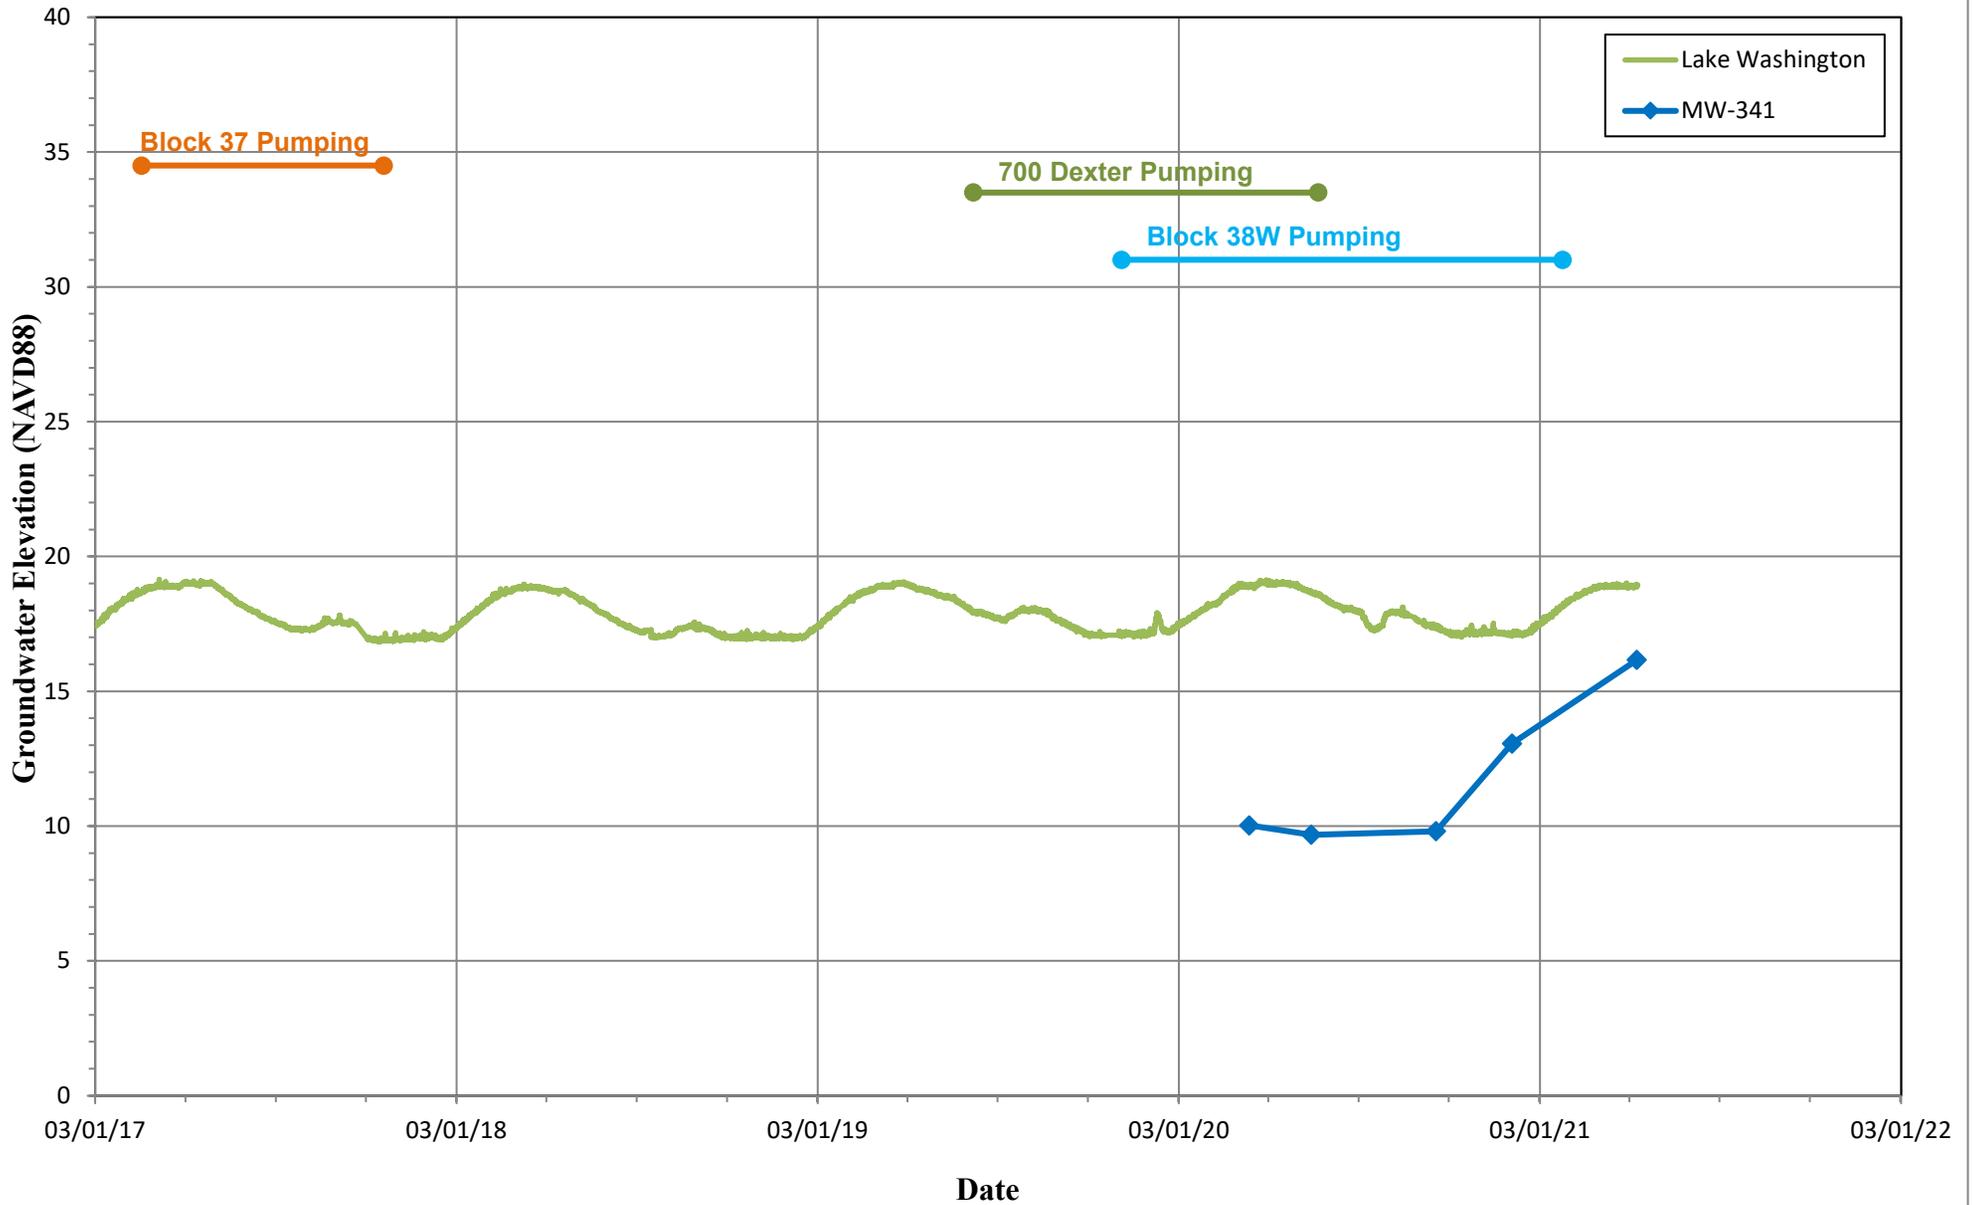

**Hydrograph**  
**MW-342, Valley St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

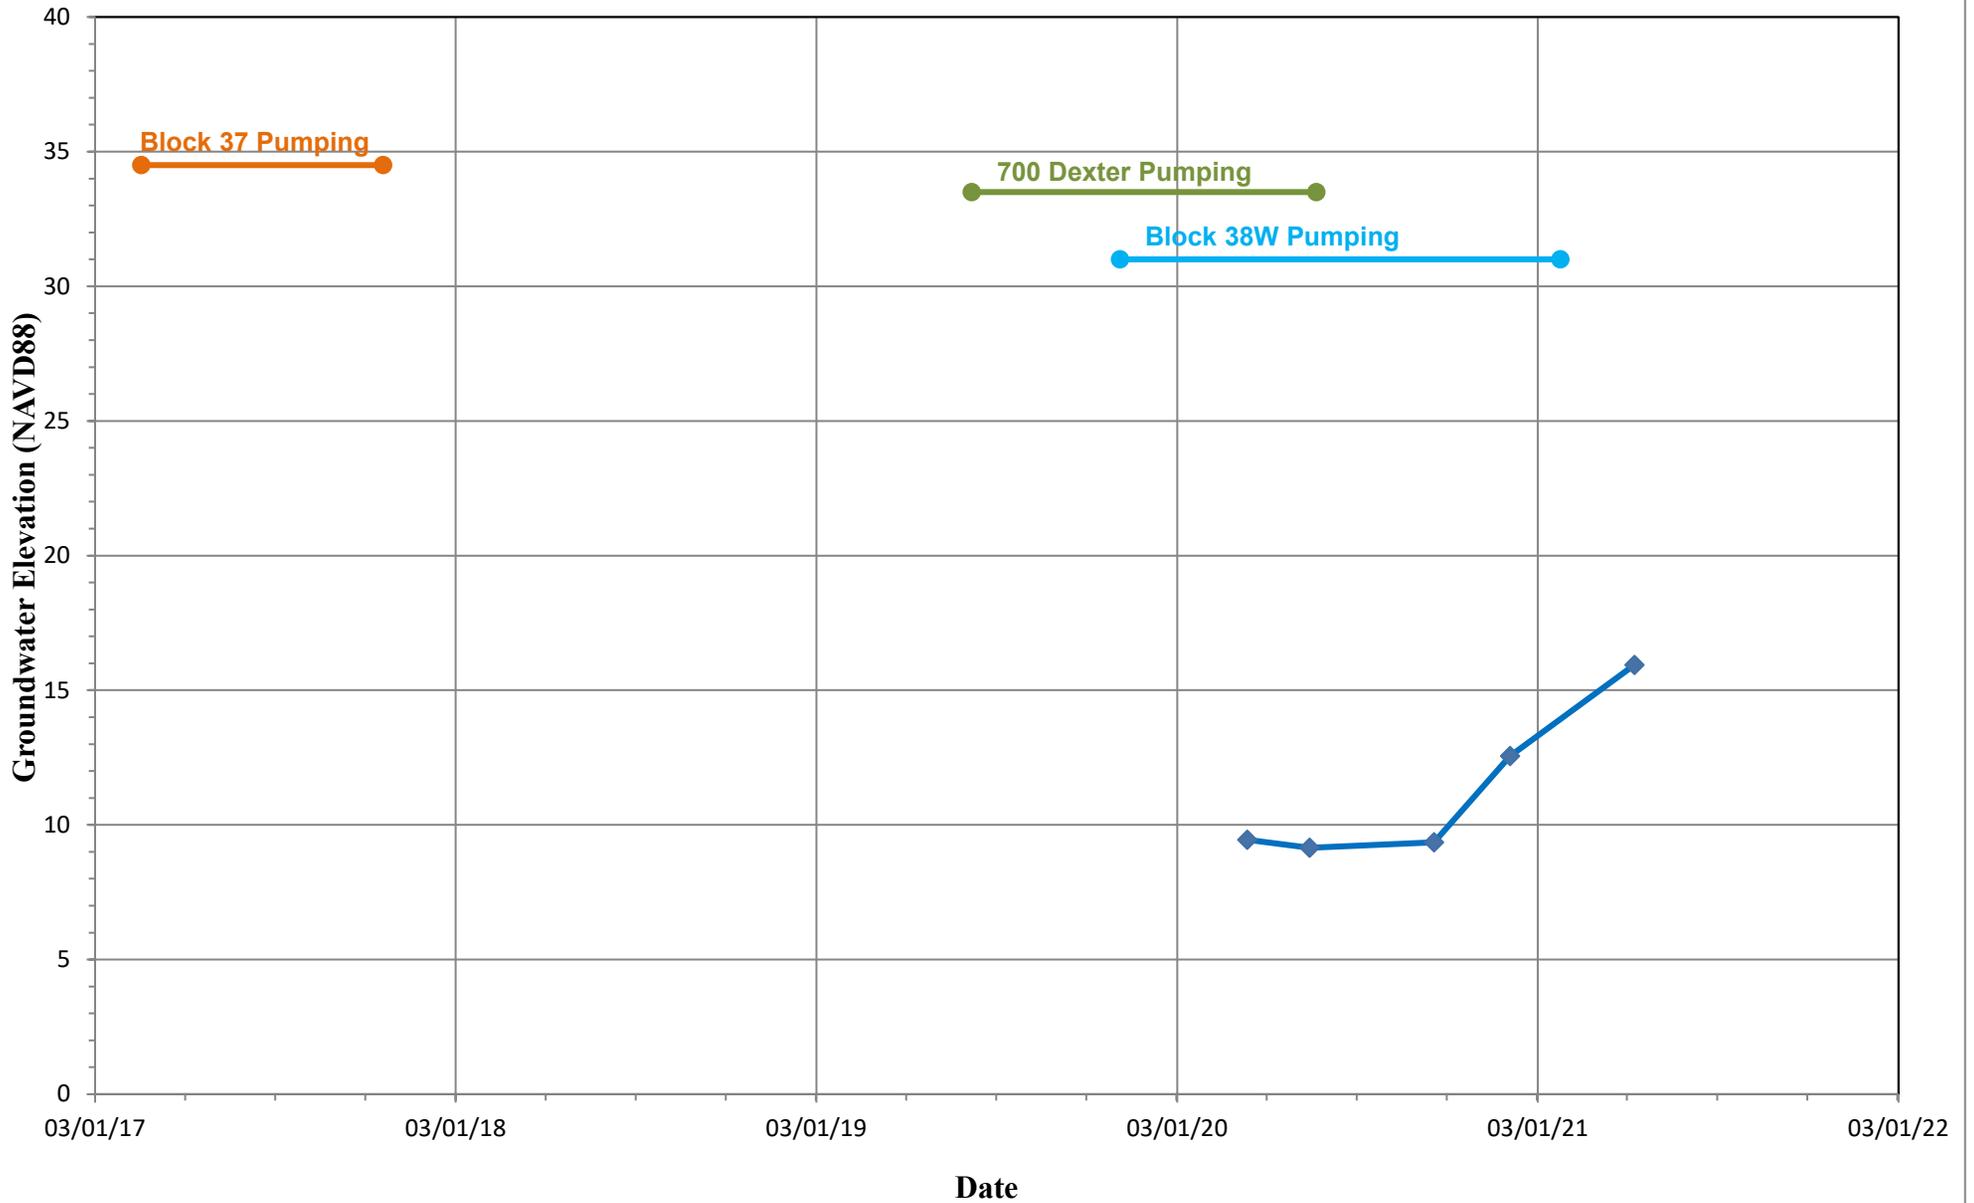

**Hydrograph**  
**MW-343, Valley St ROW, S side**  
**American Linen Supply Co Dexter Ave Site**

