

# SECOND PERIODIC REVIEW REPORT FINAL

Cascade Timber 3 POT Facility Site ID#: 1206 Cleanup Site ID#: 2693

Thorne Road and Maxwell Way Tacoma, Washington 98421

**Southwest Regional Office** 

TOXICS CLEANUP PROGRAM

January 2017

### **TABLE OF CONTENTS**

1.0 I	NTRODUCTION	1
2.0 \$	SUMMARY OF SITE CONDITIONS	3
2.1		
2.2		
2	2.2.1 Remedial Investigation	3
2	2.2.2 Feasibility Study	4
2.3	Remedial Activities	4
2.4	Cleanup Levels	5
2.5	Groundwater Monitoring	5
2.6	Restrictive Covenant	7
3.0 F	PERIODIC REVIEW	9
3.1	Effectiveness of completed cleanup actions	9
3.2	New scientific information for individual hazardous substances for mixtures present	at
	the Site	9
3.3	New applicable state and federal laws for hazardous substances present at the Site	9
3.4	Current and projected site use	10
3.5	Availability and practicability of higher preference technologies	10
3.6	Availability of improved analytical techniques to evaluate compliance with cleanup	
	levels	10
40 (	CONCLUSIONS	11
4.1	Next Review	
1.1		
5.0 F	REFERENCES	. 12
6.0	APPENDICES	. 13
6.1	Vicinity Map	14
6.2	Site Plan	15
6.3	Environmental Covenant	16
6.4	Memorandum of Agreement	. 23
6.5	Photo log	26

## **1.0 INTRODUCTION**

This document is a review by the Washington State Department of Ecology (Ecology) of postcleanup site conditions and monitoring data to ensure that human health and the environment are being protected at the former Cascade Timber 3 site (Site). Cleanup at this Site was implemented under the Model Toxics Control Act (MTCA) regulations, Chapter 173-340 Washington Administrative Code (WAC). The first periodic review was completed in November 2011. This periodic review evaluates the period from November 2011 through October 2016.

Cleanup activities at this Site were completed under Consent Decree No. 94-2-03590-3 entered into with Ecology on April 11, 1994. The cleanup actions resulted in concentrations of metals in soil and groundwater exceeding MTCA Method A cleanup levels remaining at the Site. The MTCA Method A cleanup levels for soil are established under WAC 173-340-745(2). The groundwater cleanup levels are established under United States Environmental Protection Agency (USEPA) Chronic Marine Water Quality Criteria (WAC 173-201A). WAC 173-340-420 (2) requires that Ecology conduct a periodic review of a site every five years under the following conditions:

- (a) Whenever the department conducts a cleanup action.
- (b) Whenever the department approves a cleanup action under an order, agreed order or consent decree.
- (c) Or, as resources permit, whenever the department issues a No Further Action (NFA) opinion
- (d) And one of the following conditions exists:
  - 1. Institutional controls or financial assurance are required as part of the cleanup.
  - 2. Where the cleanup level is based on a practical quantitation limit.
  - 3. Where, in the department's judgment, modifications to the default equations or assumptions using site-specific information would significantly increase the concentration of hazardous substances remaining at the site after cleanup or the uncertainty in the ecological evaluation or the reliability of the cleanup action is such that additional review is necessary to assure long-term protection of human health and the environment.

When evaluating whether human health and the environment are being protected, the factors the department shall consider include [WAC 173-340-420(4)]:

- (a) The effectiveness of ongoing or completed cleanup actions.
- (b) New scientific information for individual hazardous substances of mixtures present at the Site.
- (c) New applicable state and federal laws for hazardous substances present at the Site.
- (d) Current and projected Site use.
- (e) Availability and practicability of higher preference technologies.
- (f) The availability of improved analytical techniques to evaluate compliance with cleanup levels.

The department shall publish a notice of all periodic reviews in the Site Register and provide an opportunity for public comment.

## 2.0 SUMMARY OF SITE CONDITIONS

### 2.1 Site History

The former Cascade Timber 3 property is located along Maxwell Way between Port of Tacoma Road and Thorne Road in the City of Tacoma in Pierce County, Washington (Vicinity Map - Appendix 6.1). The Port of Tacoma (Port) entered into a Consent Decree (CD) Number 94-2-03590-3 with Ecology on April 11, 1994. On August 2, 1994, a Restrictive Covenant was recorded for the property.

From 1967 through June 1978, Nichiman America, Inc. leased the southern 10.73 acres of the property for use as a log sort yard. From 1978 through 1984, Cascade Timber Company leased the southern 10.73 acres of the property for use as a log sort yard. Between January and March of 1982, approximately 500 tons of slag generated by ASARCO was placed on the southern 10.73 acres of the property by Cascade Timber Company for use as ballast material. In 1984, the northern 7.84 acres of the property was developed. From 1984 through 1987, Cascade Timber Company leased the property for use as a log sort yard. The property was not used after 1987, prior to the remedial activity at the Site. Currently the Port of Tacoma is leasing the Site to Washington United Terminal for storing empty containers, chassis, and queuing trucks for entry onto the main terminal on the north side of Port of Tacoma Road.

### 2.2 Site Investigations

In 1983, USEPA identified Commencement Bay, where the Site is located, as a federal Superfund site. In February 1985, Ecology issued a report assessing storm-water runoff from numerous log-sort yards, including the Cascade Timber No.3 Site. The report concluded that heavy metals in excess of state and federal water quality standards were leaving log-sort yards via stormwater runoff. In the 1989 Record of Decision for the Commencement Bay Nearshore/Tideflats Superfund Site, the Cascade Log Yard No.3 Site was identified as a source of metals (arsenic, copper, zinc, and lead) discharging to Sitcum Waterway. In 1991, Ecology and the Port entered into an Agreed Order to complete a Remedial Investigation/Feasibility Study to investigate the extent of metals on the site and to evaluate possible remedies.

### 2.2.1 Remedial Investigation

Harding Lawson Associates (HLA) conducted the Remedial Investigation (RI) between February 1992 and March 1993. The purpose of the investigation was to evaluate metals associated with ASARCO slag at the Site and their extent in the soils, groundwater and surface water (stormwater runoff) on and adjacent to the Site. Soil in the southeast parcel of the log yard was found to contain metals of concern with the highest detected concentrations found in surface soil (arsenic: 2,650 mg/kg, copper: 2,760 mg/kg, lead: 1,180 mg/kg and zinc: 3,870 mg/kg). Subsurface soil 3 feet below ground surface had concentrations of metals of concern 1 to 2 orders of magnitude less than those detected at the surface.

There are two water bearing zones beneath the Site that are hydraulically separated by an approximately nine-foot thick clay layer. The shallow groundwater is present at about four feet below ground level and flows in northerly direction.

Groundwater at the Site is not a current or potential source of drinking water since both waterbearing zones would be expected to produce small quantities of poor-quality water. Results of groundwater sampling from both zones indicate that groundwater is not currently a pathway for the migration of the metals of concern into the Sitcom Waterway.

Analytical results of storm-water sampling conducted during several different sampling events indicated that runoff is the primary pathway by which metals are transported from the log yard via storm drains to the Sitcum Waterway. The maximum detected concentrations of arsenic (1,750  $\mu$ g/L), copper (160  $\mu$ g/L), lead (320  $\mu$ g/L), and zinc (868  $\mu$ g/L) exceeded the federal Marine Water Quality Standards for both acute and chronic conditions.

### 2.2.2 Feasibility Study

The feasibility study (FS) was completed by HLA following the remedial investigation. The FS considered several alternatives which would immobilize metals of concern in the slag and surface soils, and keep them from migrating into the surface waters with storm-water runoff. The remedial action selected for implementation was the construction of a low-permeable asphalt cap for covering the Site with the slag and contaminated soils remaining in place. The feasibility study recommended that, after grading the Site, the entire southwest parcel be covered with a layer of aggregate base and topped with a layer of dense grade asphalt concrete (DGAC) pavement. Additionally, groundwater would be monitored, and a Restrictive Covenant requiring post closure site limitations and restrictions on uses would be placed on the property.

### 2.3 Remedial Activities

Following the preparation of the soil/bark, subgrade, an aggregate base material was spread over the site in 4- to 6-inch lifts. The aggregate base was placed to provide a more structural foundation layer over the soft subgrade material, upon which to place the low permeable cap and pavement section. The resulting average aggregate base thickness is approximately 24 inches.

During construction, the low permeable cap and pavement section were modified to consist of the following section: a 3-inch lift of a DGAC, a geotextile fabric, and 13-1/2 inches of additional DGAC. The DGAC material was placed with paving equipment in 2 to 3 inch lifts. The total asphalt section thickness is approximately 16-1/2 inches.

Following cap construction, four new groundwater monitoring wells (MW-l, MW-2, MW-3-shallow and MW-3-deep) were installed in accordance with WAC 173-160, Minimum Standards

for Construction and Maintenance of Wells. Ecology approved the removal of MW-3-shallow and MW-3-deep from monitoring well network on October 8, 1999.

### 2.4 Cleanup Levels

Cleanup levels for the Site were established in the Final Cleanup Action Plan, which was submitted to Ecology in 1993. These cleanup levels (CULs) are available in the table below:

Contaminant	Groundwater	Soil	
	(µg/l)	(mg/kg)	
Arsenic	36	200	
Copper	2.9	N/A	
Lead	8.5	1000	
Zinc	86	N/A	

Note: µg/l micrograms per liter mg/kg milligrams per kilogram

Cleanup standards were developed for this Site based on Chapter 173-340 WAC. The use of Method A industrial soil cleanup standards per WAC 173-340-745 was justified for the following reasons: the Site cleanup may be defined as a routine cleanup per WAC 173-340-130; the Site is located in a heavy industrial area adjacent to other industrial properties; the Site is zoned for industrial use; and deed restrictions will limit the use of the Site to industrial activities in the future. Since the groundwater is not a current and potential source of drinking water, groundwater cleanup levels were established based USEPA Water Quality Marine Chronic Criteria.

### 2.5 Groundwater Monitoring

As required by the Final Cleanup Action Plan, annual groundwater monitoring is being conducted at the Site from 1994 until February of 2011. The Port of Tacoma (Port) is conducting the groundwater monitoring and cap maintenance as required by an Agreed Order or a Consent Decree with similar contaminants at five of Port's sites. To standardize the groundwater monitoring frequency and cap inspection amongst all these sites, the Department of Ecology (Ecology) and the Port of Tacoma entered into a Memorandum of Agreement (MOU) on September 1, 2011. As per this MOU, the Port is required to conduct the groundwater monitoring on an 18-months frequency and cap inspection on a 30-months frequency at this Site. A copy of the MOU is included as Appendix 6.4.

Based on the requirements of the above MOU, the groundwater sampling was conducted in February 2012, August 2013, and February 2015. During these three rounds of monitoring, only dissolved arsenic concentration exceeded the cleanup level of  $36 \mu g/l$  during February 2015 (47.7  $\mu g/l$  at MW-1) sampling event; whereas dissolved copper and lead concentrations were either below cleanup levels or below the laboratory detection limits.

However, arsenic concentrations exceeded the cleanup level consistently in the upgradient monitoring well MW-1. In addition, the arsenic concentrations in the upgradient well MW-1 has consistently been higher than the downgradient well MW-2 during all the three sampling events. Between 2012 and 2015, no other contaminants were detected above the Site CUL in MW-1. Between 1994 and 2015, arsenic showed a general decreasing trend in MW-1, but other contaminants of concern were detected inconsistently.

All the groundwater monitoring results are presented in Table 3 below and the groundwater monitoring well locations are included as Appendix 6.2.

Well Number	Date Sampled	Arsenic (µg/l)	Copper (µg/l)	Lead (µg/l)	Zinc (µg/l)
MW-1	11/28/1994	940	8	<3	<20
	12/9/1994	220	4	<3	<20
	12/1/1995	132	4	<1	53
	12/13/1996	93	6	<1	9
	12/9/1997	60	2.1	2.4	12
	12/7/1998	9.7	11	3.6	510
	12/22/1999	21	2.5	<1	99
	10/11/2000	73	<1.0	<0.5	4.7
	11/3/2000	14	NA	NA	NA
	11/16/2001	7.02	8.73	<0.5	<4
	11/26/2002	13.4	<2.5	<0.5	<2.5
	11/14/2003	18.4	<1.0	<0.5	5.2
	10/29/2004	32.4	<2.5	<2.5	12.2
	10/26/2005	46	<2.5	<2.5	<2.5
	1/29/2007	93	<2.0	<2.0	<5.0
	2/8/2008	140	< 0.55	< 0.22	5.2J
	2/27/2009	57.2	< 0.5	<1.0	6
	2/4/2010	50.3	0.6	<1.0	<4.0
	2/22/2011	158	<0.5	<0.5	0.8
	2/12/2012	53	< 0.5	<0.5	
	8/23/2013	28.6	<0.5	<0.5	
	2/12/2015	57.7	0.7	<0.1	
MW-2	11/28/1994	10	3	<3	<20
	12/1/1995	NA	NA	NA	NA
	12/13/1996	3	5	<1.0	<83
	12/16/1997	5	<2.0	<1.0	6
	12/7/1998	2.3	1.8	5.1	360
	12/22/1999	4.4	<2	23	6.9
	10/11/2000	<1	<1	<1	99

#### Table 3: Groundwater Monitoring Results

	11/3/2000	2	<1	600	8.3
	11/3/2000	NA	NA	600	NA
	11/19/2001	1.19	<1	3.74	38.6
	11/26/2002	<2.5	<2.5	<u> </u>	3.36
	11/20/2002	8.91	<1	<0.5	4.64
	10/29/2004	25.4	<2.5	<0.3	<5
	10/26/2004	<u> </u>	<2.5	<2.5	<2.5
		<u> </u>		<2.5	<2.5
	1/29/2007		<2		
	2/8/2008	24	0.78 <b>J</b>	<0.22	5.1 <b>J</b>
	2/27/2009	32.6	1.6	<1	6
	2/4/2010	8.1	4.1	<1	<4
	2/22/2011	27.2	<0.5	<0.5	0.8
	2/13/2012	16	0.5	<0.5	
	8/23/2013	4.1	<0.5	<0.5	•••
	2/12/2015	41.6	2.0	0.1	
	2/12/2015 (Duplicate)	40.7	1.8	0.1	
MW-3S	11/28/1994	25	28	<3	<20
	12/1/1995	54	3	2	65
	12/13/1996	190	<2	3	9
	12/9/1997	63	2	4.2	330
	12/7/1998	50	2.9	2.2	<5
MW-3D	11/28/1994	20	7	<3	<20
	12/1/1995	3	4	<1	35
	12/9/1996	4	14	<5	18
	12/9/1997	27	2.2	2	17
	12/7/1998	3	<2	<1	7.8
CLEANUP LEVELS		36	2.9	8.5	86

Note: 940 above cleanup level

J estimate

µg/l micrograms per liter

... not analyzed (Zinc analysis of discontinued in 2011 with Ecology approval dated June 28, 2011)

Currently the Port of Tacoma (Port) is conducting the groundwater monitoring and cap maintenance as required by the MOU. Based on the MOU requirement, the cap inspection was conducted on February 2012 and August 2014. All the cap repairs were conducted as per the recommendations of August 2014 cap inspection report recommendations. Currently the cap is in excellent condition.

### 2.6 Restrictive Covenant

Following remediation, a Restrictive Covenant was recorded for the Site on August 2, 1994. The Restrictive Covenant imposes the following limitations:

<u>Section 1:</u> The Site may be used only for Industrial uses as defined in and allowed under the City of Tacoma's Zoning Requirements codified in the Tacoma City code as of the date of this Restrictive Covenant.

<u>Section 2:</u> Any activity on the Site that may interfere with or reduce the effectiveness of the Cleanup Action or operation, maintenance, monitoring, or other activity required by the Order (or any Ecology-approved modification or amendment to the Order) is prohibited. Any activity

that would threaten the structural integrity of the cap is prohibited. Any activity on the Site that would result in the release of a hazardous substance that was contained as a part of the Cleanup Action is prohibited. It is understood that disturbance of the cap may be required in the future for installation of utilities or other activities associated with future industrial use of the Site. The Port shall obtain approval from Ecology prior to initializing any disturbance of the cap stormwater drainage and/or monitoring system. Ecology shall not deny approval if the Port can show (1) that no releases of hazardous materials will occur; (2) integrity of the cap and stormwater drainage and monitoring systems will be restored to their original condition in a timely manner; and (3) that material will be handled and disposed of in accordance with state law.

<u>Section 3:</u> The owner of the Site must give written notice to the Department of Ecology, or to a successor agency, of the Owner's intent to convey any interest in the Site. No conveyance of title, easement, lease or other interest in the Site shall be consummated by the Owner without adequate and complete provision for the continued operation, maintenance and monitoring of the Cleanup Action.

<u>Section 4:</u> The Owner shall allow authorized representatives of the Department of Ecology, or of a successor agency, the right to enter the Site at reasonable times for the purpose of evaluating compliance with the Cleanup Action Plan and the Order, to take samples, to inspect Cleanup Actions conducted at the Site, and to inspect records that are related to the Cleanup Action.

<u>Section 5:</u> The Owner of the Site and Owner's assigns and successors in interest reserve the right under WAC 273-340-440 to record an instrument which provides that this Restrictive Covenant shall no longer limit the use of the Site or be of any further force or effect. However, such an instrument may be recorded only with the consent of the Department of Ecology or of a successor agency. The Department of Ecology or a successor agency may consent to the recording of such an instrument only after public notice and comment.

The Restrictive Covenant is available as Appendix 6.3.

### 3.0 PERIODIC REVIEW

### 3.1 Effectiveness of completed cleanup actions

Based upon the site visit conducted on September 29, 2016, the DGAC cover at the Site is in excellent condition. The Site is currently used to store empty freight containers, chassis and queueing trucks for entry onto the main terminal on the north side of Port of Tacoma Road. The DGAC cap at the Site continues to eliminate direct exposure pathways (ingestion, contact) to contaminated soils. It also appears to be effective in eliminating storm water percolation into contaminated soils below the cap. A photo log is available as Appendix 6.5.

The Restrictive Covenant for the Site was recorded and is in place. This Restrictive Covenant prohibits activities that will result in the release of contaminants contained as part of the cleanup without Ecology's approval, and prohibits any use of the property that is inconsistent with the Covenant.

Since 1994, groundwater sampling was being conducted on an annual basis. However, as per the requirements of the 2011 MOU, future groundwater sampling will be conducted at the Site on a 18-month schedule. Due to the sporadic detection of contaminants of concern in groundwater at the Site, continued groundwater monitoring is recommended.

# 3.2 New scientific information for individual hazardous substances for mixtures present at the Site

Cleanup levels at the site were based on regulatory standards rather than calculated risk for chemicals and/or media. These standards continue to be protective of site-specific conditions.

# 3.3 New applicable state and federal laws for hazardous substances present at the Site

The cleanup at the site was governed by Chapter 173-340 WAC (1996 ed.). WAC 173-340-702(12) (c) [2001 ed.] provides that,

"A release cleaned up under the cleanup levels determined in (a) or (b) of this subsection shall not be subject to further cleanup action due solely to subsequent amendments to the provision in this chapter on cleanup levels, unless the department determines, on a case-by-case basis, that the previous cleanup action is no longer sufficiently protective of human health and the environment." The current MTCA Method A Industrial soil cleanup standard for arsenic has been reduced from 200 mg/kg to 20 mg/kg since the final Consent Decree was issued. Because contaminated soils at the Site have been capped, the modification to the MTCA cleanup standard does not represent an increase in risk to human health or the environment. Several of the state marine chronic surface water quality criteria have also `changed since the Consent Decree was issued. Values for copper, lead, and zinc have been reduced to  $3.1 \,\mu$ g/l,  $8.1 \,\mu$ g/l and  $81 \,\mu$ g/l, respectively. Overall, the changes to the original standards have not resulted in the need for additional remedial actions at the site.

### 3.4 Current and projected site use

The Site is currently used for industrial purposes. The Site continues to be used by Washington United Terminals for the storage of empty freight containers, chassis, and queueing trucks for entry onto the main terminal on the north side of Port of Tacoma Road. Future uses are likely to remain related to shipping and receiving from the Port of Tacoma. These uses are not likely to have a negative impact on the integrity of the Site cap.

### 3.5 Availability and practicability of higher preference technologies

The remedy implemented included containment of hazardous substances, and it continues to be protective of human health and the environment. While higher preference cleanup technologies may be available, they are still not practicable at this Site.

# 3.6 Availability of improved analytical techniques to evaluate compliance with cleanup levels

The analytical methods used at the time of the remedial action were capable of detection below MTCA Method A cleanup levels. The presence of improved analytical techniques would not affect decisions or recommendations made for the Site.

## 4.0 CONCLUSIONS

- The cleanup actions completed at the Site appear to be protective of human health and the environment.
- Soils cleanup levels have not been met at the Site; however, under WAC 173-340-740(6)(f), the cleanup action is determined to comply with cleanup standards since the long-term integrity of the containment system is ensured, and the requirements for containment technologies have been met.
- The Restrictive Covenant for the property is in place and will be effective in protecting public health and the environment from exposure to hazardous substances and protecting the integrity of the cleanup action.
- Ground water monitoring was being conducted on an annual basis at the Site since 2004. However, as per the MOU, currently the groundwater monitoring is being conducted on an 18-months frequency at the Site.
- Continued cap inspection every 30-months and maintenance are required. Cap maintenance appears to be adequate at this time.

Based on this periodic review, Ecology has determined that the remedial actions conducted at the Site are continue to be protective of human health and the environment. Requirements of the Restrictive Covenant are satisfactorily being met and no additional remedial actions are necessary at this time. The cap is currently in satisfactory condition, and the conditions set forth in the Restrictive Covenant are being followed. It is the property owner's responsibility to continue to inspect the site to ensure that the integrity of the cap is maintained and to continue groundwater monitoring.

### 4.1 Next Review

The next review for the site will be scheduled five years from the date of this periodic review. In the event that additional cleanup actions or institutional controls are required, the next periodic review will be scheduled five years from the completion of those activities.

## 5.0 **REFERENCES**

Ecology and Environment. 1987. Volume 1. Site Inspection Report for Commencement Bay Nearshore/Tideflats, Tacoma, Washington. Prepared for U.S. EPA.

Harding Lawson Associates. 1993. Remedial Investigation/Feasibility Study, Cascade Timber No. 3 Log Sort Yard, Tacoma, Washington.

Norton. D. and A. Johnson. 1985. Completion Report on WQIS Project 1 for the Commencement Bay Nearshore/Tideflats Remedial Investigation: Assessment of Log Sort Uards as Metal Sources to Commencement Bay Waterways, November 1983 to June 1984.

U.S. Environmental Protection Agency. 1998. Commencement Bay Nearshore/Tidefliats Record of Decision.

Ecology. Consent Decree No. 94TC-S167 and Cleanup Action Plan. December 27, 1993. Cascade Timber No. 3 Log Yard.

Harding Lawson Associates. April 29, 1994. Engineering Design Report Remedial Action–Cascade Timber Log Yard No. 3, Port of Tacoma, Tacoma, Washington.

Restrictive Covenant. August 2, 1994. Cascade Log Yard No. 3.

Kennedy/Jenks Consultants. May 4, 2010. Annual Groundwater Monitoring Summary Report for 4 February 2010, Former Cascade Timber #3 Log Yard.

Kennedy/Jenks Consultants. August 2, 2009. Annual Operations and Maintenance (O&M) for 27 February 2009, Cap Inspection Summary Report for Former Cascade Timber #3 Log Yard.

Kennedy/Jenks Consultants. August 7, 2009. Annual Operation and Maintenance (O&M) for 8 February 2008 Cap Inspection Summary Report for Former Cascade Timber Log Yard No.3, Port of Tacoma, Washington.

Kennedy/Jenks Consultants. 21 December 2001. Annual Groundwater Monitoring/ O&M Cap Inspection Summary Report, Former Cascade timber #3 Log Yard.


Kennedy/Jenks Consultants. 14 January 2003. 2002 Annual Ground Water Monitoring/O&M Inspection Summary Report, Former Cascade Timber #3 Log Yard.

Kennedy/Jenks Consultants. 8 February 2005. 2004 Annual Ground Water Monitoring/O&M Inspection Summary Report, Former Cascade Timber #3 Log Yard.


Ecology. September 29, 2016 Site Visit.

# 6.0 APPENDICES

### 6.1 Vicinity Map

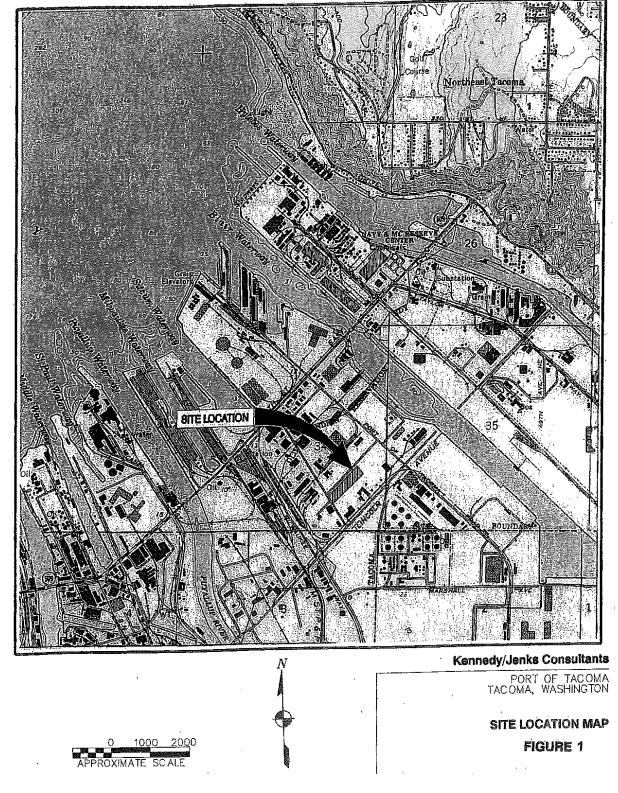

### 6.2 Site Plan

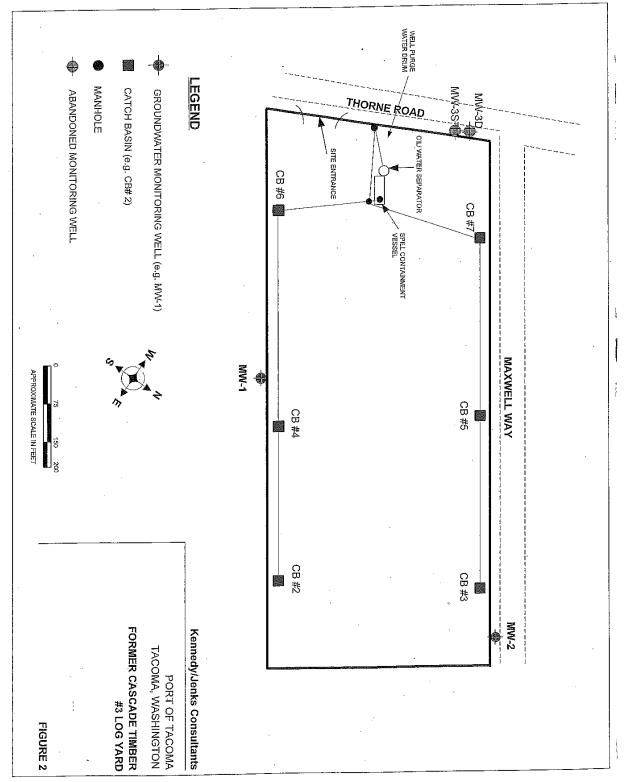

13

#### 6.3 Environmental Covenant

BK | 048PG | 97 |

#### 9408020435

94 AUG -2 PM 3: 05 RECORDED

DECLARATION OF RESTRICTIVE COVENANT PEARSALL-STIPER AUDITOR PERCE CO. WASH The property that is the subject of this Restrictive Covenant is the subject of remedial action under Chapter 70.105D RCW. The work done to clean up the property (hereafter the "Cleanup Action") is described in Washington State Department of Ecology Consent Decree No. 94TC-S167, and in attachments to the Decree. This Restrictive Covenant is required by WAC 173-340-440 because the Cleanup Action at the Site will result in residual concentrations of arsenic and lead which exceed Ecology's Methoc A cleanup levels for Industrial soil established under WAC 173-340-745.

The Port of Tacoma is the fee owner of real property known as the Cascade Timber No. 3 log sort yard in the County of Pierce, State of Washington of which 10.7 acres are referred to as the "Site" (legal description attached in Exhibit B of Consent Decree No. 94TC-S167).

As a result of the Cleanup Action, the Site will include a woodwaste, soil, and slag mixture which will be covered with a cap system equipped with a surface water collection system. The Site will also include monitoring wells.

The Port of Tacoma makes the following declaration as to limitations, restrictions, and uses to which the Site may be put, and specifies that such declarations shall constitute covenants to run with the land, as provided by law, and shall be binding on all parties and all persons claiming under them,

08020435

January 2017 Page 17

#### BK1048PG1972

including all current and future owners of any portion of or interest in the Site.

<u>Section 1</u> The Site may be used only for Industrial uses as defined in and allowed under the City of Tacoma's Zoning Regulations codified in the Tacoma City Code as of the date of this Restrictive Covenant.

Section 2 Any activity on the Site that interferes with or reduces the effectiveness of the Cleanup Action or any operation, maintenance, monitoring, or other activity required by the Order (or any Ecology-approved modification or amendment to the Order) is prohibited. Any activity that would threaten the structural integrity of the cap is prohibited. Any activity on the Site that would result in the release of a hazardous substance that was contained as a part of the Cleanup Action is prohibited. It is understood that disturbance of the cap may be required in the future for installation of utilities or other activities associated with future industrial use of the site. The Port shall obtain approval from Ecology prior to initiating any disturbance of the cap stormwater drainage and/or monitoring system. Ecology shall not deny approval if the Port can show (1) that no releases of hazardous materials will occur; (2) integrity of the cap and stormwater drainage and monitoring systems will be restored to their original condition in a timely manner; and (3) that material will be handled and disposed of in accordance with State law. 9408020435

January 2017 Page 18

### -BK1048PG1973

Section 3 The owner of the Site must give written notice to the Department of Ecology, or to a successor agency, of the owner's intent to convey any interest in the Site. No conveyance of title, easement, lease or other interest in the Site shall be consummated by the owner without adequate and complete provision for the continued operation, maintenance and monitoring of the Cleanup Action.

Section 4 The owner shall allow authorized representatives of the Department of Ecology, or of a successor agency, the right to enter the Site at reasonable times for the purpose of evaluating compliance with the Cleanup Action Plan and the Order, to take samples, to inspect Cleanup Actions conducted at the Site, and to inspect records that are related to the Cleanup Action.

Section 5 The owner of the Site and owner's assigns and successors in interest reserve the right under WAC 173-340-730 and WAC 173-340-440 to record an instrument which provides that this Restrictive Covenant shall no longer limit the use of the Site or be of any further force or effect. However, such an instrument may be recorded only with the consent of the Department of Ecology or of a successor agency. The Department of Ecology or a successor agency may consent to the recording of such an instrument only after public notice and comment. The Port of Tacoma agrees to file this Restrictive Covenant in

9408020435

January 2017 Page 19

### BK 1048PG 1974


Date

the Site property deed with the Pierce County Auditor and provide the Department of Ecology with a filed copy.

1 of Tacoma\

w2400 Jeffrey A. Lincoln Sr. Dir. Facility Development

### 9408020435

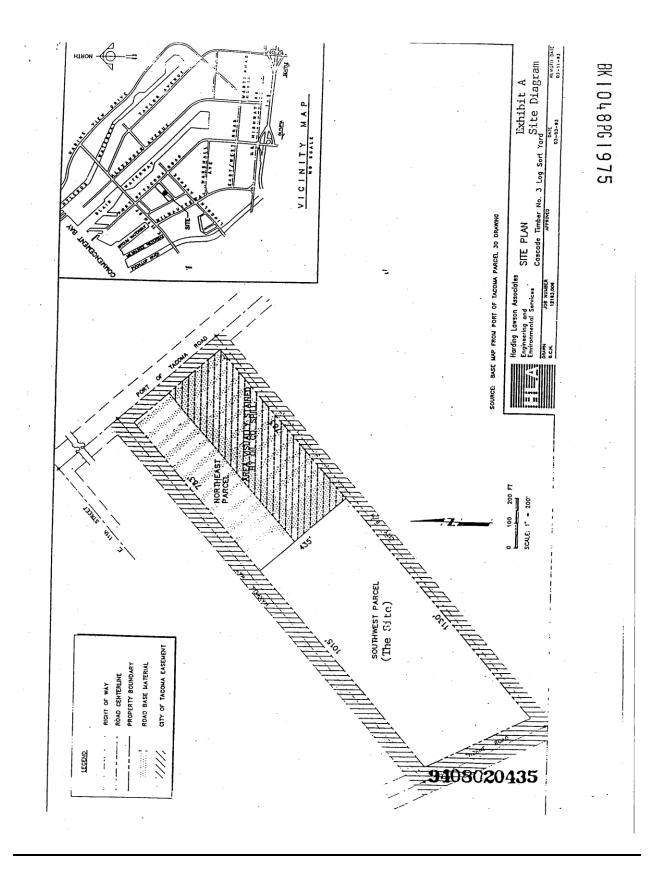

#### BK1U48PG1976

#### EXHIBIT B

#### Description - Consent Decree Cascade Timber No. 3 Log Yard

A parcel of land situate in the Southeast Quarter of Section 34, Township 21 North, Range 3 East of the Willamette Meridian, County of Pierce, State of Washington and being more particularly described as follows:

Lots 8 through 18 inclusive of Block 12 of the Port of Tacoma Industrial District First Addition as recorded in Volume 18 of Plats at Page 18.

Containing 10.73 acres, more or less.

va


Robert N. Erb, P.L.S. Washington State Registration No. 18082

Sitts & Hill Engineers, Inc. 2901 South 40th Street Tacoma, Washington 98409 (206) 474-9449 December 27, 1993 Project No. 7763



### 9408020435

EXHIBIT B - PAGE 1 of 2

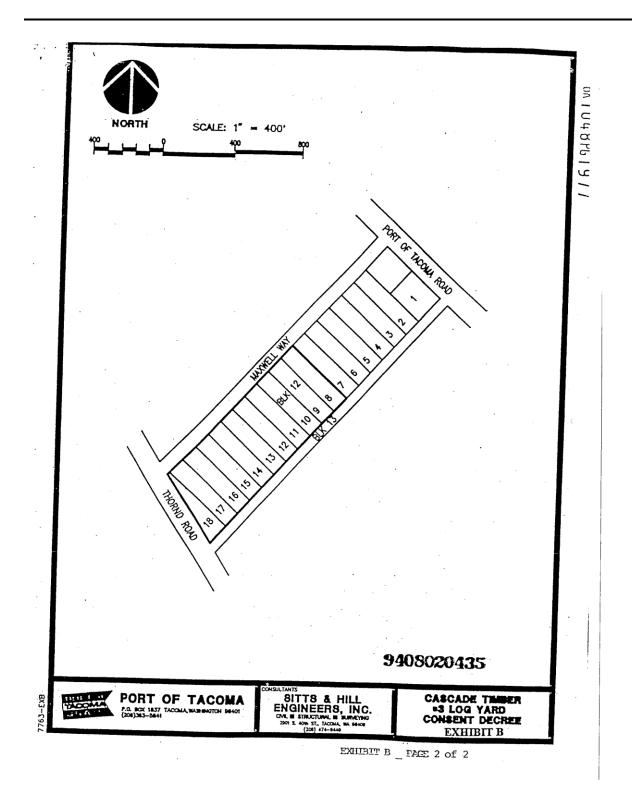

### 6.4 Memorandum of Understanding

#### MEMORANDUM OF UNDERSTANDING

Former Log Yard Groundwater Monitoring and Cap Inspection

This Memorandum of Understanding (MOU) is entered into this  $\underline{\mathbb{A}}$  day of September 2011 between the Washington State Department of Ecology ("Ecology") and the Port of Tacoma ("Port") (collectively the "Parties") to memorialize the Parties' agreement to modify the requirements for future groundwater monitoring and cap inspection frequencies for five Port sites, as set forth below.

These sites affected by this agreement are Cascade Timber No. 3, Murray Pacific No. 2, Wasser Winters, Portac, and Louisiana-Pacific (aka Pony Lumber) ("Monitored Sites").

Each Monitored Site was cleaned up under an administrative agreement between Ecology and the Port, either as an original party or successor interest, as follows: Cascade Timber No. 3, Murray Pacific No. 2, and Wasser Winters were cleaned up under Consent Decrees, Louisiana-Pacific under an Enforcement Order, and Portac under a pre-Model Toxics Control Act (MTCA) Order On Consent (cumulatively referred to as: "Ecology Orders"). Portac, Inc. was also a respondent to the Portac Order on Consent along with the Port.

Each Monitored Site addressed similar contaminants of concern (COCs), which included arsenic, copper, lead, and zinc. However, each Ecology Order had site-specific requirements with respect to cleanup levels, and cap and groundwater monitoring frequencies.

In Spring 2010, the Port initiated a request to Ecology to standardize the monitoring requirements for the Monitored Sites in an effort to align the timing of the periodic monitoring/ inspections at the sites so that the Port may better align a contractor to do the work all at once, as required.

In August 2010, to supplement the information already provided to Ecology, the Port provided Ecology with a tour of the Monitored Sites. As part of the tour, Ecology inspected the type and condition of the caps; the current site uses, specifically on the capped areas, and the locations and conditions of existing monitoring wells and stormwater basins.

Ecology has reviewed the information provided by the Port, as well as observations made during the site tour, and has chosen to provide a response in the form of this MOU.

This MOU was created for the Parties to understand and agree upon the requirements associated with Ecology's response, and to memorialize the decisions made with respect to each of the Port's requests.

In preparing this MOU, Ecology took into account, for each site, the type and condition of the cap and stormwater collection system, the adequacy of the groundwater monitoring system, and the recent groundwater compliance history.

Based on the above, Ecology and the Port agree as follows:

#### A. CAP MONITORING FREQUENCY

- 1. The Port may standardize the cap monitoring (inspection and reporting) frequency for the Monitored Sites to 30 months as requested. However, the following shall also occur:
  - During the site tours, Ecology noted that some of the stormwater basins were in better condition than others. Stormwater basins at each of the Monitored Sites should be inspected quarterly and cleaned out as needed, such that they are continuously operational.
  - Any unanticipated breaches of the cap for any of the Monitored Sites shall be reported to Ecology and repaired as soon as practicable. As per the respective Ecology Orders, the Port shall provide Ecology with a plan for each of the sites that summarizes intended action and reporting by the Port for unanticipated cap breaches.
  - Advance notice shall be provided and prior approval shall be obtained from Ecology for any planned cap breaches and repairs that are not otherwise permitted under the respective Ecology Order for each Monitored Site.
  - Minor cracking and normal wear and tear shall be repaired and reported as anticipated by and according to each Monitored Site's Ecology Order.
  - The appropriate Ecology Site Manager shall be informed, in writing, of any changes in site use on capped areas.
- 2. The next cap monitoring for the Monitored Sites based on this new 30-month frequency shall be February 2012, which corresponds to the next 30-month groundwater monitoring event for Wasser Winters described below. Unless changed by Ecology, all future cap monitoring for the Monitored Sites shall occur every 30 months beginning February 2012 to coincide with the groundwater monitoring that is intended to target alternating wet and dry seasons.

#### B. GROUNDWATER MONITORING FREQUENCY

- 1. The Port may standardize the groundwater monitoring frequency for each of the Monitored Sites as requested, which included the following:
  - Cascade Timber No. 3 18 months (formerly 12 months).
  - Murray Pacific No. 2 18 months (formerly 6 months).
  - Wasser Winters No change (currently 30 months).
  - Portac No change (currently discontinued).
  - Louisiana-Pacific 30 months (formerly 24 months wet/dry).

2. The next groundwater monitoring for the Monitored Sites shall be conducted in February 2012. Unless changed by Ecology, all future groundwater monitoring for the Monitored Sites shall occur according to the frequency identified above beginning February 2012.

#### C. EFFECT OF MODIFICATION

- 1. Except as modified herein, all provisions of the Original Ecology Orders for each Monitored Site as existing and as may have been amended, including addressing any potential data compliance issues, remain in full force and effect.
- 2. A copy of this MOU shall be filed with the Ecology Project Manager for each of the Monitored Sites.

John Wolfe

Chief Executive Officer Port of Tacoma

9.1. Date

Rebecca S. Lawson, P.E., LHG Section Manager, Toxics Cleanup Program Southwest Regional Office Washington State Department of Ecology

2611 Date

cc:

Jason Jordan – Port of Tacoma Mark Rettmann – Port of Tacoma William Evans – Port of Tacoma Leslee Connor – Port of Tacoma Scott Hooton – Port of Tacoma Dom Reale – Ecology Marv Coleman – Ecology Guy Barrett – Ecology James DeMay – Ecology Scott Rose – Ecology Rebecca Lawson – Ecology

### 6.5 Photo log

Photo 1: Cap Area, Empty Freight Containers Storage - from the South (from eastern half of the Site)



Photo 2: Cap Area, Empty Freight Containers Storage – from the South (from the western half of the Site)



### Photo 3: Cap Area and Empty Freight Containers Storage – from the Southwest



Photo 4: Cap Area and Empty Freight Containers Storage – from the North







Photo 6: One of the Catch Basin at the Western Boundary of the Site



#### Photo 7: Downgradient Groundwater Monitoring Well, MW-2 at the Western Property Boundary of the Site



Photo 8: Downgradient Groundwater Monitoring Well, MW-2 at the Western Property Boundary of the Site

