

AUTO MERCURY SWITCH REMOVAL


Convenience Light Switches

| MAKE/MODEL | MODEL YEAR | LOCATION |
|--|---------------|---------------|
| AUDI | | |
| Audi 100 | 1977-1988 | Hood |
| Audi 200 | 1980-1988 | Hood |
| CHRYSLER | | |
| All Dodge, Chrysler, Jeep, Plymouth, Eagle | 1998 & Before | Hood & Trunk |
| FORD MOTOR COMPANY | | |
| Ford Mustang | 2000 & Before | Hood & Trunk |
| Ford Crown Victoria | 2000 & Before | Hood & Trunk |
| Mercury Grand Marquis | 2000 & Before | Hood & Trunk |
| Lincoln Town Car | 2000 & Before | Hood & Trunk |
| Ford, Lincoln, Mercury and Merkur cars | 1996 & Before | Hood & Trunk |
| Ford, Lincoln, Mercury trucks, SUVs and vans | 2001 & Before | Hood |
| <i>* EXCLUDES: 1999 and newer model year Ford Econoline, Windstar, Ranger and Mercury Villager</i> | | |
| Mazda Navajo | 1993-1997 | Hood |
| Mazda B-series Pick-up | 1995-1999 | Hood |
| <i>*Ranger/B-Series phased out of mercury switches with 1999 model year</i> | | |
| Volvo | 1991 & Before | Hood & Trunk |
| Volvo vanity mirror switches, Exclude Volvo 240 | 1986-1991 | Vanity Mirror |
| <i>*Volvo convenience switches may contain glass mercury capsules. Use care when removing from vehicles.</i> | | |
| GENERAL MOTORS | | |
| All Buick, GMC, Chevrolet, Cadillac, Oldsmobile, Pontiac, Saturn, Saab | 1999 & Before | Hood & Trunk |
| <i>Excludes: 1999 Chevrolet Astro, Silverado & GMC Safari, Sierra</i> | | |
| Cadillac Escalade | 2000 | Hood |
| Chevrolet Blazer | 2000-2002 | Hood |
| Chevrolet Cavalier | 2000, 2001 | Trunk |
| Chevrolet Corvette | 2000 | Hood |
| Chevrolet Express | 2000-2002 | Hood |
| Chevrolet S-10 Crew Cab | 2002 | Hood |
| GMC Denali | 2000 | Hood |
| GMC Envoy | 2000, 2001 | Hood |
| GMC Jimmy | 2000, 2001 | Hood |
| GMC Savana | 2000, 2001 | Hood |
| GMC Sonoma Crew Cab | 2002 | Hood |
| Luxury G-Van | 2001, 2002 | Hood |
| Oldsmobile Bravada | 2001, 2002 | Hood |
| Pontiac Sunfire | 2000, 2001 | Trunk |
| PORSCHE | | |
| 924 | 1976-1985 | Hood |
| 924 S | 1986-1988 | Hood |
| 944 | 1982-1988 | Hood |
| 944 S | 1987-1988 | Hood |
| 944 S2 | 1989-1991 | Hood |
| 944 Turbo | 1986-1991 | Hood |
| 928 | 1978-1983 | Hood |
| 928 S | 1980-1983 | Hood |
| 928 S/S4 | 1984-1990 | Hood |

ABS G-Force Sensors

| MAKE/MODEL | MODEL YEAR | LOCATION |
|---------------------------|------------|-------------|
| AUDI | | |
| Audi 80/90 | 1987-1993 | Rear Seat |
| Audi 100/Avant | 1987-1993 | Rear Seat |
| Audi V8 | 1989-1995 | Rear Seat |
| Audi 200 | 1987-1991 | Rear Seat |
| Audi Coupe Quattro | 1987-1992 | Rear Seat |
| CHRYSLER LLC | | |
| 4wd Dodge Stealth | 1992-1996 | Rear Center |
| Jeep Cherokee | 1992-2001 | Rear Seat |
| Jeep Grand Cherokee | 1993-2001 | Rear Seat |
| Jeep Wrangler | 1992-2003 | Driver Seat |
| FORD MOTOR COMPANY | | |
| Ford Bronco | 1993-1997 | Driver Seat |
| Ford Explorer | 1993-2002 | Driver Seat |
| Mazda Navajo | 1993-2002 | Driver Seat |
| 4x4 Ford Ranger | 1995-2001 | Driver Seat |
| Mazda B-Series Pick-up | 1995-2001 | Driver Seat |
| AWD Mercury Mountaineer | 1997-2002 | Driver Seat |
| MITSUBISHI | | |
| 3000 GT 4WD | 1991-1994 | Rear Center |
| Galant 4WD | 1990-1992 | Rear Center |
| Expo 4WD | 1991-1993 | Rear Center |
| Expo LVR 4WD | 1991-1993 | Rear Center |
| Eclipse 4WD | 1991-1993 | Rear Center |
| Make/model | Model year | Location |
| NISSAN | | |
| Pathfinder 4x4 | 1996 | Rear Center |
| SUBARU | | |
| Subaru Legacy w/ SMT AWD | 1990-1995 | Right Front |
| Subaru Impreza w/ SMT AWD | 1993-1996 | Right Front |

Vehicles without trunks, including SUVs, station wagons and hatchbacks do not contain a mercury switch in the rear.

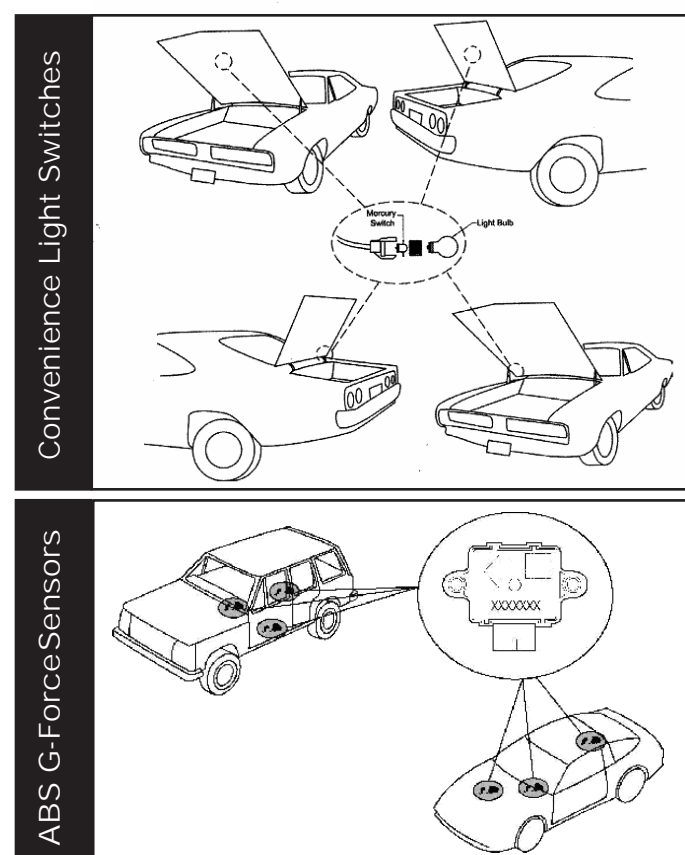

BMW, MITSUBISHI, NISSAN, SUBARU, TOYOTA, HONDA and VOLKSWAGEN vehicles do not contain mercury switches



Accommodation Requests: To request ADA accommodation including materials in a format for the visually impaired, call Ecology at 360-407-6700 or visit <https://ecology.wa.gov/accessibility>. People with impaired hearing may call Washington Relay Service at 711. People with speech disability may call TTY at 877-833-6341.

Publication Number 07-04-006. (Revised July 2018)