



November 27, 2024

Alexis McKinnon, Solid Waste Specialist
Kitsap County Public Works
Solid Waste Division
614 Division Street, MS-27
Port Orchard, WA 98366

Re: Third Quarter 2024 Environmental Monitoring Report – FINAL
Hansville Landfill, Kitsap County, Washington
Project No. AS160423-05-5.1

Dear Alexis:

This quarterly report summarizes the results of environmental monitoring conducted at the Hansville Landfill (Site) during the third quarter 2024, and was prepared by Aspect Consulting, a Geosyntec Company (Aspect), on behalf of Kitsap County Public Works Solid Waste Division (County) and Waste Management of Washington (WMW). Ongoing environmental monitoring at the Site supports the selected remedy of natural attenuation of groundwater with enhanced monitoring and institutional controls that was established under Amended Consent Decree No. 95-2-03005-1 (August 5, 2011).

The datasets presented in this letter report were collected in accordance with the “Site Cleanup Action Plan” (CAP; Ecology, 2011) and the “Compliance Monitoring Plan with Sampling & Analysis Plan and Quality Assurance Plan” (SCS, 2011; herein referred as Compliance Monitoring Plan), except where otherwise noted. These documents were prepared and approved by the Washington State Department of Ecology (Ecology) as part of the Site-specific cleanup actions under the Model Toxics Control Act (MTCA) cleanup regulations.

Conditions monitored at the Site during the third quarter 2024 were consistent with historical trends showing improvements in protection of human health and the environment, as reported in the last annual report (Aspect, 2024). This report is organized consistent with quarterly reporting topics listed in the Compliance Monitoring Plan (SCS, 2011) and includes:

- Site monitoring and maintenance activities, along with a discussion of any deviations from the CAP, or required tasks not otherwise documented in project plans
- Landfill gas monitoring results and gas collection system adjustments
- Determination of groundwater flow direction and gradient, including a groundwater surface elevation contour map
- Water quality sampling results, including tabulated field data and laboratory analyses

Also included are time-series plots and projected trends in groundwater concentrations for selected analytes at selected monitoring locations. Finally, this report discusses geochemical parameters as indicators of landfill effects on groundwater and surface water.

Site Activities – Third Quarter 2024

Site activities during the reporting period included environmental monitoring of landfill gas, groundwater, and surface water. Documentation of the quarterly activities is presented in the following attachments:

- **Attachment A** presents landfill gas monitoring data.
- **Attachment B** presents groundwater elevations, a groundwater contour map, and groundwater and surface water quality analytical results.
- **Attachment C** presents summary statistics, time-series graphs, and graphs of projected groundwater concentrations for arsenic and vinyl chloride at selected monitoring wells.
- **Attachment D** presents supporting field records, laboratory data reports, and chain-of-custody documentation.

A chronology of on-Site monitoring activities performed during the third quarter 2024 is provided below:

- On July 17, 2024, Aspect completed groundwater and surface water monitoring.
- On July 18, 2024, Aspect completed the monthly performance monitoring of the blower system and condensate management system.
- On August 15, 2024, Aspect conducted monthly performance monitoring of the landfill gas blower system and condensate management system.
- On September 25 and September 30, 2024, Aspect conducted landfill gas compliance monitoring, which included measuring landfill gas concentrations at compliance monitoring probes, across the extraction wellfield, and at the blower.

Deviations from the Compliance Monitoring Plan

There were no deviations from the Compliance Monitoring Plan (SCS, 2011) during the third quarter 2024 environmental monitoring.

Summary of Landfill Gas Conditions

The following sections provide a discussion of landfill gas monitoring and gas extraction system performance. The layout of the landfill gas extraction system is shown on Figure A-1.

Landfill Gas Monitoring

Aspect monitored landfill gas concentrations at the blower on July 18, August 15, and September 25, 2024. Aspect monitored landfill gas concentrations at the compliance monitoring probes and the extraction wellfield on September 25 and 30, 2024.

Landfill gas conditions were measured with a calibrated GEM 5000 multigas meter. Landfill gas monitoring parameters collected for the compliance monitoring event are summarized in Table A-1 and listed below:

- Landfill gas composition measurements included methane (CH₄), carbon dioxide (CO₂), oxygen (O₂), and balance gas (Balance) concentrations.
- Pressure measurements included the system pressure representing the vacuum available at the wellhead, and the static pressure representing the equilibrium downhole pressure.
- Temperature measurements are made at the wellhead except near the blower.
- Collection system flow-rate measurements were obtained at selected locations via orifice plates. The differential pressure and gas temperature were measured to calculate flow. Table A-1 presents flow rates measured after valve adjustments.

Landfill Gas System Performance

During the compliance monitoring event on September 25, 2024, conditions observed at the blower remained within the normal range. Methane and carbon dioxide concentrations at the blower inlet were approximately 3.5 percent by volume and 16.7 percent by volume, respectively. The oxygen concentration was approximately 3 percent by volume. Flow rates were approximately 108 standard cubic feet per minute (scfm) during the third quarter. Both blowers for the landfill gas collection system have been in operation since January 2023, resulting in greater landfill gas collection rates. Wellfield optimization will continue to focus on maximizing methane and carbon dioxide collection rates.

At the end of the third quarter 2024, the 2,000-gallon condensate storage tank contained approximately 1,600 gallons, and the western sump was approximately half to two-thirds full. The County was notified of the condensate levels to remove and dispose of collected condensate via vac truck.

Biofilter Bed Treatment Performance

The biofilter bed (biobed) was installed in early March 8, 2023, to replace the existing flare system. Based on surface methane concentration measurements made during 2023, the biobed appears to be effectively reducing greenhouse gas emissions and controlling odor.

Surface methane concentrations were generally less than the design criterion of 1.25 percent methane (25 percent of the lower explosive limit), with the following exceptions. Methane was detected at concentrations of up to 3.1 percent by volume at four small depressions measuring less than 3 by 3 inches wide and less than 3 inches deep. These conditions were observed when the sample tubing was held 1 inch above the depressions for 20 to 30 seconds. Biobed surface methane concentrations approaching the blower inlet concentrations may indicate preferential discharge

pathways that could be addressed by rototilling the biofilter media or adding additional biofilter media.

Explosive Gas Control

Methane was not detected in any of the compliance gas probes during the compliance monitoring event on September 25, 2024. Locations of on-property compliance probes GP-1, GP-2S, GP-2M, GP-2D, GP-3, GP-4, GP-5, and GP-6 are shown on Figure A-1, and the location of off-property compliance probe GP-7 is shown on Figure B-1. Carbon dioxide concentrations ranged from 0.1 to 4.0 percent by volume, reflecting natural conditions. Aspect observed an animal bore hole under monitoring probe GP-6.

Summary of Groundwater and Surface Water Conditions

This section addresses groundwater and surface water conditions based on the monitoring event on July 17, 2024. Samples were collected from six groundwater monitoring wells and from four surface water monitoring locations (Figure B-1) for laboratory analysis.

Groundwater Flow

Groundwater flow conditions during the third quarter 2024 were consistent with those observed during previous monitoring events. Groundwater surface elevations were calculated using water levels measured on July 17, 2024 (Table B-1). Groundwater elevations ranged from 237.8 feet North American Vertical Datum of 1988 (NAVD88) in MW-12I to 266.0 feet NAVD88 in the upgradient, background monitoring well MW-5. The direction of groundwater flow at the Site was west across the landfill then shifted southwest, consistent with historical observations. Groundwater gradients ranged from 0.0074 feet over feet (feet/feet) in the upgradient areas, to 0.013 feet/feet farther downgradient, with the gradient steepening near the groundwater discharge area (Figure B-1).

Groundwater and Surface Water Quality

Groundwater quality results from the third quarter 2024 were consistent with historical ranges and trends. Groundwater quality results presented in Table B-2 include field parameters, conventional parameters, dissolved metals, and volatile organic compounds. During the reporting period, dissolved arsenic concentrations in groundwater were below the Site-specific cleanup level of 0.005 milligrams per liter (mg/L) at all monitoring wells except MW-14 (0.0137 mg/L) and MW-13D (0.00531 mg/L). Dissolved manganese concentrations were below the Site-specific cleanup level of 2.24 mg/L and below the MTCA Method B noncancer formula value¹ of 0.75 mg/L at all wells. Vinyl chloride concentrations in groundwater were below the Site-specific groundwater cleanup level of 0.025 micrograms per liter (µg/L) at all monitoring wells except MW-6 (0.039 µg/L) and MW-12I (0.063 µg/L).

¹ As noted in the Agency Review Draft Remedial Action Status Report (Aspect, 2022), the MTCA Method B noncancer formula value for manganese in groundwater was revised downwards to a concentration below the Site-specific cleanup level. This new state regulation does not affect the Site-specific restoration time frames. This new value will be included in reporting going forward to provide context. The Hansville Site Cleanup Levels were established by the 2011 CAP and Compliance Monitoring Plan, and remain the basis for measuring remedial action performance.

Surface water quality results from the third quarter 2024 are presented in Table B-3 and include field parameters, conventional parameters, dissolved metals, and volatile organic compounds. During the reporting period, surface water concentrations of dissolved arsenic, dissolved manganese, and vinyl chloride were below the respective Site-specific cleanup levels.

Time-Series Plots and Projected Trends

Groundwater sampling results since 2007 are shown on time-series plots for dissolved arsenic (Figure C-1) and vinyl chloride (Figure C-2) at all compliance monitoring locations. Figure C-1 shows that dissolved arsenic concentrations in groundwater have consistently been less than the 0.005 mg/L cleanup level at MW-5 (background well), MW-6, MW-7, and MW-12I. Dissolved arsenic concentrations at MW-13D were historically below the cleanup level until 2019. Dissolved arsenic concentrations at MW-14 have historically exceeded the Site-specific cleanup level and have been decreasing over time, although at a slower rate since 2020.

Figure C-2 shows vinyl chloride concentrations in groundwater have been less than the Site-specific cleanup level of 0.025 µg/L at MW-5 (background well), MW-7, and MW-13D. The concentrations of vinyl chloride at MW-6, MW-12I, and MW-14 have historically exceeded the Site-specific cleanup level and have been decreasing over time. In the third quarter 2024, the concentration of vinyl chloride at MW-6 was 0.039 µg/L and MW-12I was 0.063 µg/L, above the Site-specific cleanup level. Concentrations are expected to fluctuate but continue to decrease as indicated by the trends (discussed below). The vinyl chloride concentration at MW-14 during the third quarter 2024 remains consistent with the historical decreasing trend.

Figure C-3 shows time-series plots of historical and 10-year projected groundwater concentrations for MW-6 (vinyl chloride), MW-12I (vinyl chloride), MW-14 (vinyl chloride and arsenic), and MW-13D (arsenic). The projected restoration time frames for vinyl chloride concentrations range from approximately 0 to 7 years. Dissolved arsenic concentrations at MW-13D peaked slightly above the cleanup level in 2020 and now appear to be decreasing slowly over time. For context, a linear trend line is used to project dissolved arsenic concentrations at MW-13D, which remain below the Puget Sound regional background of 0.008 mg/L (Ecology, 2016; Ecology, 2022) for more than 10 years. The projected restoration time frame for arsenic in groundwater at MW-14 is more than 10 years. In January 2023, the landfill gas collection system flow rate was increased by operating both blowers with the intention of achieving groundwater cleanup levels within a shorter time frame than shown on Figure C-3.

Statistical Evaluation of Groundwater Trends

Statistically significant decreasing trends in dissolved arsenic and/or vinyl chloride concentrations were identified at monitoring wells MW-6, MW-12I, and MW-14. We attribute the decreasing trends to the cleanup actions at the Site, and project concentrations will continue to decrease to Site-specific cleanup levels, as described above and shown on Figure C-3.

A statistically significant increasing trend in dissolved arsenic concentrations was identified at monitoring well MW-13D. Dissolved arsenic concentrations were slightly below the Site-specific cleanup levels during this monitoring period and remain below the regional natural background value provided by Ecology (Ecology, 2016; Ecology, 2022), as shown on Figure C-3. Statistical trend analysis for dissolved arsenic concentrations in MW-13D has been conducted since the “2019 Annual Environmental Monitoring Report” (Aspect, 2020). As previously noted in the 2019

Report, based on the data available, it is likely that arsenic concentrations since 2007 reflect natural variations or off-Site influences, as opposed to effects from the Hansville Landfill Site. Dissolved arsenic concentrations in MW-13D, and other locations continue to be closely monitored and evaluated.

Table C-1 provides results of statistical analysis for arsenic and vinyl chloride for monitoring wells MW-6, MW-12I, MW-13D, and MW-14. The trends are defined as “statistically significant” because the magnitude of the Mann-Kendall Test Value (Z) was greater than the Critical Value (which is based on the number of data points and alpha). A negative Sen’s slope indicates a decreasing trend in concentrations while a positive Sen’s slope indicates an increasing trend.² These statistics confirm what is visually apparent on Figure C-3 showing historical groundwater concentrations.

The statistical analysis of groundwater data was performed in accordance with the Compliance Monitoring Plan (SCS, 2011) for historical data collected since January 23, 2007. The program Sanitas (ver. 10) was used to evaluate the Mann-Kendall Test and Sen’s slope. Mann-Kendall testing was performed to assess whether there were statistically significant trends in groundwater concentrations using the two-tailed test ($\alpha = 0.05$). Mann-Kendall results are reported as an approximated normal distribution Test Value “Z” (where the number of data points was greater than 40). Sen’s slope analysis was performed to identify the trend direction for statistically significant trends and reflects the median of the slopes of all pairs of historical data.

Geochemical Parameters

Geochemical parameters in groundwater and surface water serve as indicators of landfill effects and can distinguish leachate impacts from gas-to-groundwater impacts. As shown in Tables B-2 and B-3, geochemical parameters collected at the Site include field parameters (dissolved oxygen, pH, Redox [reduction-oxidation potential], specific conductivity, and temperature), alkalinity/carbonate/bicarbonate, chloride, nitrate/nitrite/ammonia, sulfate, and total organic carbon.

Based on low concentrations of geochemical parameters identified as leachate indicators (such as chloride, sulfate, alkalinity, and bicarbonate) across the Site, there appears to be little if any leachate effect on groundwater and surface water quality. However, the downgradient monitoring wells show lower dissolved oxygen concentrations than the upgradient well (MW-5), which is likely caused by landfill gas coming in contact with groundwater directly beneath the landfill. Increasing the rate of landfill gas collection may prevent geochemically mediated effects on groundwater.

References

Aspect Consulting, LLC (Aspect), 2020, 2019 Annual Environmental Monitoring Report, Hansville Landfill, Kitsap County, Washington, February 28, 2020.

² Sen’s slope values reflect the median of the slopes of historical data pairs, and were provided in units of $\mu\text{g/L}$ per day in reports by SCS through 2016. Starting in 2017, Sen’s slope values will be provided in units of $\mu\text{g/L}$ per year to support interpretation. For comparison, Table C-1 provides Sen’s slope values for both units.

Aspect Consulting, LLC (Aspect), 2022, Agency Review Draft Remedial Action Status Report, Hansville Landfill Site, Kitsap County, Washington, June 28, 2022.

Aspect Consulting, (Aspect), 2024, Annual Environmental Monitoring Report, Hansville Landfill, Kitsap County, Washington, February 29, 2024.

SCS Engineers (SCS), 2011, Compliance Monitoring Plan with Sampling & Analysis Plan and Quality Assurance Plan – Remedial Action at the Hansville Landfill, September 15, 2011.

Washington State Department of Ecology (Ecology), 2011, Cleanup Action Plan Hansville Landfill, Kitsap County, Washington, Ecology Facility Site Identification Number: 2605, June 2011.

Washington State Department of Ecology (Ecology), 2016, Natural Background Groundwater Arsenic Concentrations in Washington State, Ecology Publication No. 14-09-044, March 2016.

Washington State Department of Ecology (Ecology), 2022, Natural Background Groundwater Arsenic Concentrations in Washington State, Ecology Publication No. 14-09-044, Draft for Public Comment published July 2021; Revised January 2022.

Limitations


Work for this project was performed for Kitsap County Public Works (Client), and this letter was prepared in accordance with generally accepted professional practices for the nature and conditions of work completed in the same or similar localities, at the time the work was performed. This letter does not represent a legal opinion. No other warranty, expressed or implied, is made.

All reports prepared by Aspect Consulting for the Client apply only to the services described in the Agreement(s) with the Client. Any use or reuse by any party other than the Client is at the sole risk of that party, and without liability to Aspect Consulting. Aspect Consulting's original files/reports shall govern in the event of any dispute regarding the content of electronic documents furnished to others.

Sincerely,
Aspect consulting,



Carmen Tappero, GIT
Staff Geologist
carmen.tappero@aspectconsulting.com

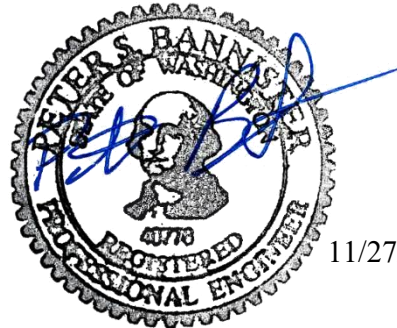

11/27/2024

Peter S. Bannister, PE
Principal Engineer
peter.bannister@aspectconsulting.com

Attachments: Attachment A – Landfill Gas Data
 Attachment B – Water Quality Results
 Attachment C – Groundwater Statistics and Time-Series Plots
 Attachment D – Field Forms and Laboratory Reports

cc: Steve Brown, Kitsap County Public Health Department
 Jakob Hughes, Kitsap County Public Health Department
 Cris Matthews, Washington State Department of Ecology
 Joshua Carter, Julie Raymond, and Roma Call, Port Gamble S’Klallam Tribe, Kitsap Public Health District

V:\160423 Kitsap County Hansville Landfill\Deliverables\2024 Reports\Q3 2024 Report\Final\Q3 2024 Hansville Monitoring Report_FINAL_2024.11.25.docx

ATTACHMENT A

Landfill Gas Data

Table A-1. Landfill Gas Data, Third Quarter 2024

Project No. AS160423, Hansville Landfill, Hansville, Washington

Location	Map ID	Date/Time	Methane CH ₄ (% by vol)	Carbon Dioxide CO ₂ (% by vol)	Oxygen O ₂ (% by vol)	Balance Bal (% by vol)	System Pressure ("H ₂ O)	Static Pressure ("H ₂ O)	Wellhead Temperature (°F)	Flow Rate (SCFM)
Blower Inlet		9/25/24 15:19	3.5	16.7	3	76.8	-6.29	-6.48	64.8	108.2
Blower Outlet		9/25/24 15:24	3.3	16.6	3	77.1	0.16	N/A	93.7	N/A
Extraction Well 001	R-1	9/30/24 13:05	4	16.1	0.1	79.8	-1.15	-0.15	67	0.5
Extraction Well 002	R-2	9/30/24 13:31	1.2	13.6	6.4	78.8	-1.2	N/A	83.7	N/A
Extraction Well 003	R-3	9/30/24 13:37	5.2	17.7	0	77.1	-3.71	-1.18	71.6	3
Extraction Well 004	R-4	9/30/24 14:43	2.4	17	1.9	78.7	-5.06	-1.26	77.6	3.3
Extraction Well 005	R-5	9/30/24 14:36	2.7	19	0.9	77.4	-5.79	-0.7	85	2.8
Extraction Well 006	R-6	9/30/24 14:30	2.1	9.7	11.7	76.5	-5.17	-1.48	94.1	3.9
Extraction Well 007	R-7	9/30/24 14:15	0	16	2.5	81.5	-3.92	-0.66	71.7	2.9
Extraction Well 008	R-8	9/25/24 15:54	4	19.8	0.1	76.1	-3.14	-1.55	64.5	2.2
Extraction Well 009	R-9	9/25/24 16:08	1.2	13.2	6.5	79.1	-2.06	N/A	106.6	N/A
Extraction Well 010	R-10	9/30/24 12:59	4.8	11.2	5.7	78.3	-1.2	-0.66	70.3	1.4
Extraction Well 011	R-11	9/30/24 13:15	2.4	14.4	0	83.2	-1.17	-0.59	72	1.3
Extraction Well 012	R-12	9/30/24 13:44	5.8	9.9	0	84.3	-1.1	-0.88	68.9	2.2
Extraction Well 013	R-13	9/30/24 13:56	2.6	15.6	2.3	79.5	-4.04	N/A	76.2	N/A
Trench Collector TD-1	TD-1	9/25/24 15:45	1.8	21.9	0.2	76.1	-5.67	0.57	60.2	17.3
Trench Collector TR-1	TR-1	9/30/24 14:20	0.1	10.9	9.4	79.6	-3.93	-0.65	87.7	2.9
Trench Collector TR-2	TR-2	9/25/24 16:02	6.2	19.4	0.8	73.6	-2.08	N/A	64.2	N/A
Trench Collector TR-3	TR-3	9/30/24 13:09	4.3	18.5	1.2	76	-1.01	N/A	71.5	N/A
Trench Collector TR-4	TR-4	9/30/24 14:50	1.4	19.4	0.3	78.9	-5.58	-0.45	76.6	3.7
Trench Collector TR-5	TR-5	9/30/24 13:52	3.1	16.7	3.1	77.1	-0.76	N/A	71.3	N/A
Trench Collector TR-6	TR-6	9/30/24 13:48	5.2	16.7	2	76.1	-0.97	N/A	70.3	N/A
Trench Collector TR-7	TR-7	9/30/24 14:56	6.9	16	1.3	75.8	0	-0.64	0	3.7
Gas Probe 1	GP-1	9/25/24 12:08	0	1.6	19.3	79.1	-0.06	N/A	N/A	N/A
Gas Probe 2 Shallow	GP-2S	9/25/24 12:37	0	0.1	21.2	78.7	-0.02	N/A	N/A	N/A
Gas Probe 2 Middle	GP-2M	9/25/24 12:51	0	1.3	18.7	80	-0.21	N/A	N/A	N/A
Gas Probe 2 Deep	GP-2D	9/25/24 13:00	0	1.3	18.4	80.3	-0.28	N/A	N/A	N/A
Gas Probe 3	GP-3	9/25/24 13:20	0	1.3	20.3	78.4	0.01	N/A	N/A	N/A
Gas Probe 4	GP-4	9/25/24 13:45	0	1.7	19.8	78.5	0.03	N/A	N/A	N/A
Gas Probe 5	GP-5	9/25/24 14:26	0	0.1	21.3	78.6	-0.02	N/A	N/A	N/A
Gas Probe 6	GP-6	9/25/24 14:45	0	4	16.1	79.9	-0.01	N/A	N/A	N/A
Gas Probe 7	GP-7	9/25/24 14:02	0	3	18.8	78.2	0.06	N/A	N/A	N/A

Notes

System pressure represents the vacuum available at the wellhead. Static pressure represents the equilibrium downhole pressure.


Flow rates measured using orifice plates (where installed).

N/A = indicates parameter not measured.

°F = degrees Fahrenheit

"H₂O = inches water column

SCFM = standard cubici feet per minute

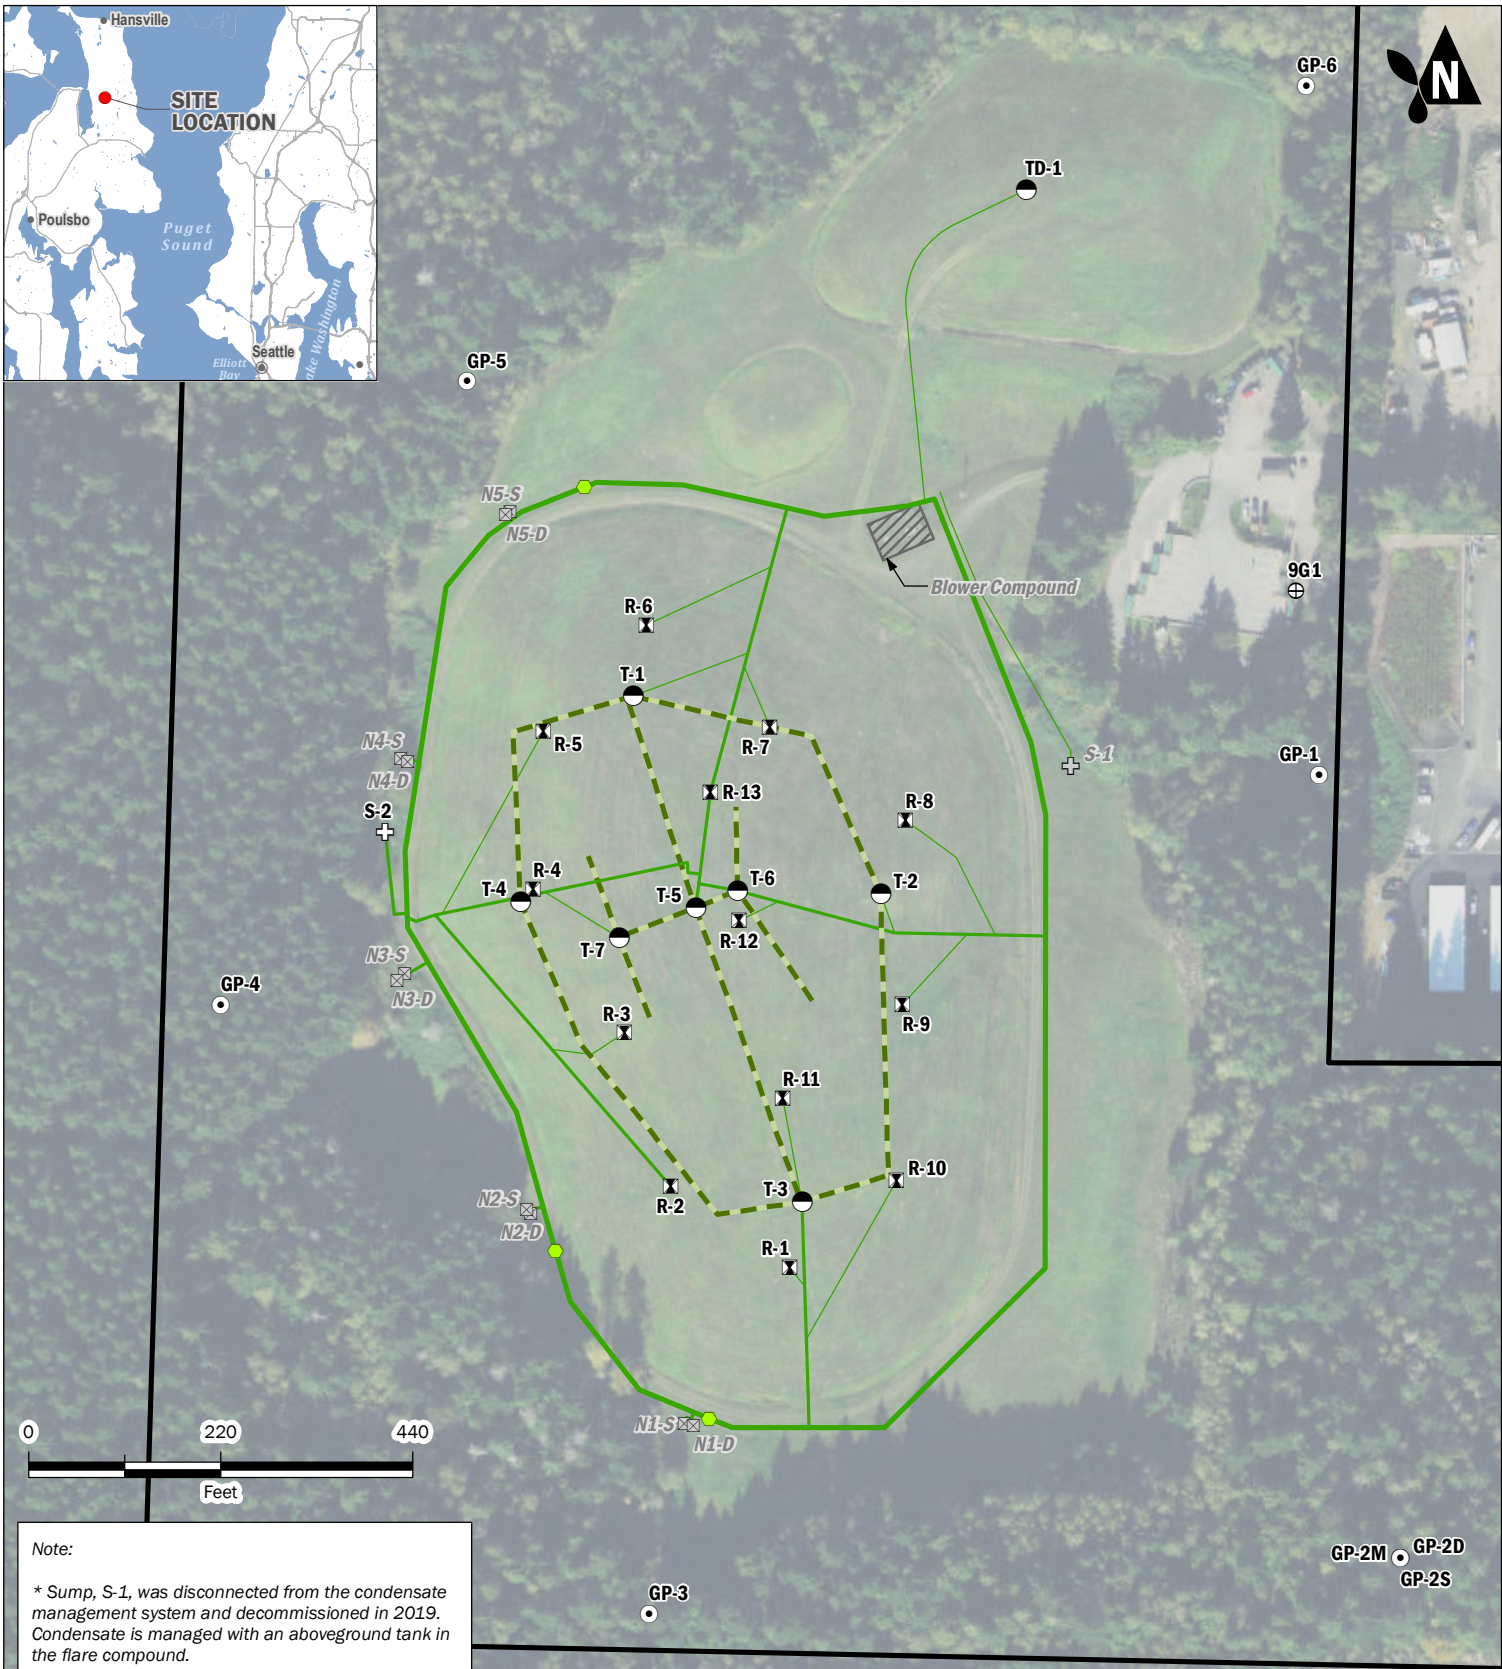

Note:

* Sump, S-1, was disconnected from the condensate management system and decommissioned in 2019. Condensate is managed with an aboveground tank in the flare compound.

Exploration ○ Gas Detection Probe ⌵ Gas Extraction Well (in Refuse Completion) ⊠ Gas Extraction Well (Native Soil Completion) <i>Disconnected in October, 2019</i> ● Trench Completion ⊕ Well Geologic Control ⊕ Condensate Sump ⊕ Condensate Sump* <i>Decomissioned in 2019</i>	Landfill Gas System — LFG Pipe - 2" — LFG Pipe - 4" — LFG Pipe - 6" — Trench ● LFG Valve ▭ Landfill Boundary	Landfill Gas System 2024 Third Quarter Environmental Monitoring Report Hansville Landfill Kitsap County, Washington		
Aspect CONSULTING		JUL-2024	BY: MLK / RAP	FIGURE NO. A-1
PROJECT NO. 160423		REVISED BY: TDR / HMD		

ATTACHMENT B

Water Quality Results

Table B-1. Water Level Elevations

Project No. AS160423, Hansville Landfill, Hansville, Washington

Well	Ground Elevation (ft NAVD88)	Top of Casing Elevation (ft NAVD88)	Screen Elevation (ft NAVD88)		Depth to Water (ft)	Water Level Elevation (ft NAVD88)
			Top	Bottom		
MW-5	363.7	366.9	244	234	100.92	266.0
MW-6	332.0	332.7	260	245	74.76	257.9
MW-7	344.3	346.0	259	244	85.35	260.7
MW-12I	245.6	248.1	217	207	10.28	237.8
MW-13D	258.1	260.4	205	195	11.71	248.7
MW-14	338.6	341.1	262	247	82.87	258.2

Notes

Depths to water collected July 17, 2024.

Elevations relative to North American Vertical Datum of 1988 (NAVD88).

ft = feet

Table B-2. Groundwater Quality Results

Project No. AS160423, Hansville Landfill, Hansville, Washington

			Location Date	MW-5 07/17/2024	MW-6 07/17/2024	MW-7 07/17/2024	MW-12I 07/17/2024	MW-13D 07/17/2024	MW-14 07/17/2024
			Sample	MW-5-240717	MW-6-240717	MW-7-240717	MW-12I-240717	MW-13D-240717	MW-14-240717
Analyte	Unit	Site Cleanup Level							
Field Parameters									
Temperature	deg C			12.93	15.79	10.5	11.07	14.66	13.3
Specific Conductance	uS/cm			114.84	138.75	250.4	184.56	107.37	150
Dissolved Oxygen	mg/L			9.45	1.24	0.83	0.15	0.47	0.35
pH	pH units			7.04	6.97	6.37	7.12	7.4	7.39
Oxidation Reduction Potential	mV			164.5	126.5	181.8	117.6	127.8	51.1
Turbidity	NTU			0.4	1.96	0.92	0.58	6.77	1.84
Conventionals									
Alkalinity as Bicarbonate	mg/L			75	98	140	130	66	69
Alkalinity as Carbonate	mg/L			< 10 U	< 10 U	< 10 U	< 10 U	< 10 U	< 10 U
Alkalinity, Total	mg/L			75	98	140	130	66	69
Ammonia as Nitrogen	mg/L			< 0.030 U	< 0.030 U	< 0.030 U	< 0.030 U	< 0.030 U	< 0.030 U
Chloride	mg/L			3.0	3.7	< 3.0 U	10	5.2	< 3.0 U
Nitrate as Nitrogen	mg/L			4.71 J	0.149 J	0.801 J	0.104 J	< 0.1 U	< 0.1 U
Nitrite as Nitrogen	mg/L			< 0.1 U	< 0.1 U	< 0.1 U	< 0.1 U	< 0.1 U	< 0.1 U
Orthophosphate	mg/L			0.032	0.03	0.042	0.044	0.082	0.142
Sulfate	mg/L			7.5	15	6.0	12	16	8.5
Total Organic Carbon	mg/L			< 1.0 U	< 1.0 U	1.7	2.2	< 1.0 U	2.6
Metals, dissolved									
Arsenic	ug/L	5		1.74	1.76	1.29	1.99	5.31	13.7
Manganese	ug/L	2240		< 1.0 U	150	1.0	63	6.2	770
Volatile Organic Compounds (VOCs)									
Vinyl Chloride	ug/L	0.025		< 0.020 U	0.039	< 0.020 U	0.063	< 0.020 U	< 0.020 U

Notes

Bold - detected

Blue Shaded - Detected result exceeded screening level

U - Analyte not detected at or above Reporting Limit (RL) shown

J - Result value estimated

deg C = degrees Celsius, uS/cm = microSiemens per centimeters, ug/L = micrograms per liter, mg/L = milligrams per liter, mV = millivolts

NTU = Nephelometric Turbidity Units

Aspect Consulting

11/27/2024

V:\160423 Kitsap County Hansville Landfill\Deliverables\2024 Reports\Q3 2024 Report\Final\Att B Water Quality\Hansville LF 2024 Q3 summary table

Table B-2

2024 Third Quarter Environmental Monitoring Report

Page 1 of 1

Table B-3. Surface Water Quality Results

Project No. AS160423, Hansville Landfill, Hansville, Washington

Location Date Sample			SW-1 07/17/2024 SW-1-240717	SW-4 07/17/2024 SW-4-240717	SW-6 07/17/2024 SW-6-240717	SW-7 07/17/2024 SW-7-240717
Analyte	Unit	Site Cleanup Level				
Field Parameters						
Temperature	deg C		12.1	13.2	15.9	14.8
Specific Conductance	uS/cm		175.9	363.5	137.1	160.4
Dissolved Oxygen	mg/L		11.74	11.61	9.97	9.19
pH	pH units		7.33	7.95	7.55	7.77
Oxidation Reduction Potential	mV		167.8	141.1	90.3	138.3
Turbidity	NTU		3.22	10.8	29.6	26.6
Conventionals						
Alkalinity as Bicarbonate	mg/L		71	160	65	76
Alkalinity as Carbonate	mg/L		< 10 U	< 10 U	< 10 U	< 10 U
Alkalinity, Total	mg/L		71	160	65	76
Ammonia as Nitrogen	mg/L		< 0.030 U	< 0.030 U	0.040	< 0.030 U
Chloride	mg/L		6.8	15	7.3	10
Nitrate as Nitrogen	mg/L		2.74 J	1.65 J	0.154 J	0.392 J
Nitrite as Nitrogen	mg/L		0.147 J	< 0.1 U	< 0.1 U	< 0.1 U
Orthophosphate	mg/L		0.035	0.026	0.06	0.132
Sulfate	mg/L		10	28	6.5	9.6
Total Organic Carbon	mg/L		1.5	2.8	8.4	6.2
Metals, dissolved						
Arsenic	ug/L	5	1.67	1.49	3.63	2.22
Manganese	ug/L	2240	< 1.0 U	26	39	9.4
Volatile Organic Compounds (VOCs)						
Vinyl Chloride	ug/L	0.025	< 0.020 U	< 0.020 U	< 0.020 U	< 0.020 U

Notes

Bold - detected

Blue Shaded - Detected result exceeded screening level

U - Analyte not detected at or above Reporting Limit (RL) shown

J - Result value estimated

deg C = degree Celsius, uS/cm = microSiemens per centimeters, ug/L = micrograms per liter, mg/L = milligrams per liter, mV = millivolts

NTU = Nephelometric Turbidity Units

Aspect Consulting


11/27/2024

V:\160423 Kitsap County Hansville Landfill\Deliverables\2024 Reports\Q3 2024 Report\Final\Att B Water Quality\Hansville LF 2024 Q3 summary table

Table B-3

2024 Third Quarter Environmental Monitoring Report

Page 1 of 1

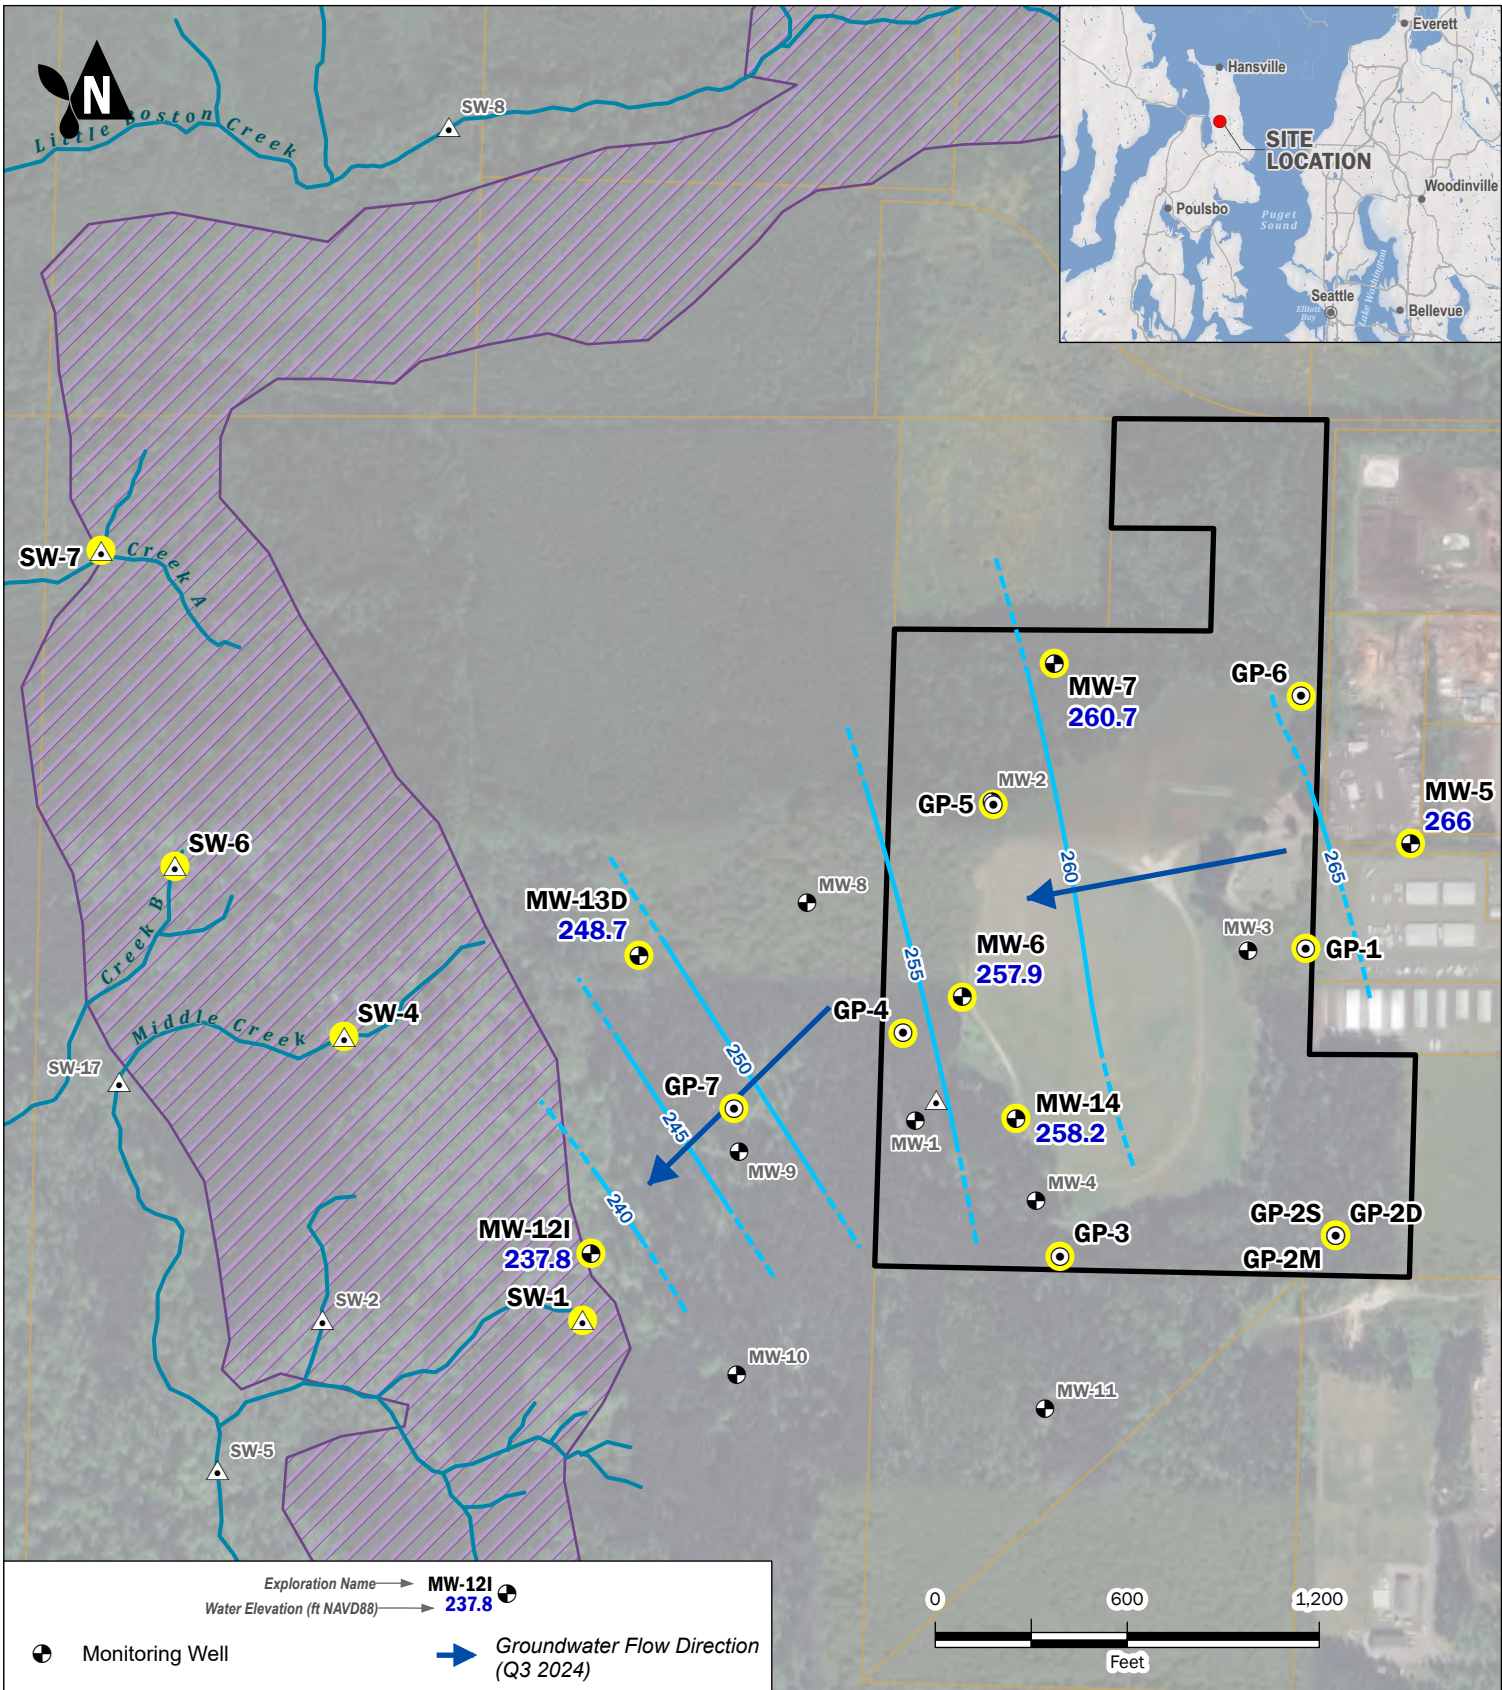

Exploration Name

MW-12I

Water Elevation (ft NAVD88)

237.8

Monitoring Well

Gas Detection Probe

Surface Water Station

Compliance Monitoring Location

Water Elevation Contour (ft NAVD88, dashed where inferred) Measured July 17, 2024

Groundwater Flow Direction (Q3 2024)

Approximate Area of Groundwater Discharge from Upper Aquifer

Stream

Landfill Boundary

Tax Parcel

Note: Vertical datum is NAVD88. Approximate area of groundwater discharge from upper aquifer delineation from Remedial Investigation Report (Parametrix, 2006).

Basemap Layer Credits | | Canvas_World_Light_Gray_Base: Esri, HERE, Garmin, (c) OpenStreetMap contributors, and the GIS user community
Shaded Relief: Copyright(c) 2014 Esri

Compliance Monitoring Locations

2024 Third Quarter Environmental Monitoring Report

Hansville Landfill

Kitsap County, Washington

Aspect CONSULTING

OCT-2024

PROJECT NO. 160423

BY: CMT / HMD

REVISED BY: --- / ---

FIGURE NO.

B-1

GIS Path: I:\projects_8\HansvilleLandfill_160423\Delivered_Quarterly_Report\HansvilleLandfill\QuarterlyReports\HansvilleLandfill\QuarterlyReports.aprx | Coordinate System: NAD 1983 StatePlane Washington North FIPS 4601 Feet | Date Saved: 9/24/2024 | User: haley.duran | Print Date: 10/2/2024

ATTACHMENT C

Groundwater Statistics and Time-Series Plots

Table C-1. Statistical Analysis

Project 160423, Hansville Landfill, Hansville, Washington

Dissolved Arsenic Statistical Results

Well	Statistical Trend ¹	Mann-Kendall Test ²				Sen's Slope	
		Test Value, Z	Critical Value	Number of data points, n	Statistical Significance	(ug/L per day)	(ug/L per year)
MW-5	-- ³	--	--	--	--	--	--
MW-6	--	--	--	--	--	--	--
MW-7	--	--	--	--	--	--	--
MW-12I	--	--	--	--	--	--	--
MW-13D	Increasing	8.3	1.96	70	Yes	4.5E-04	0.166
MW-14	Decreasing	-8.3	-1.96	70	Yes	-2.4E-03	-0.882

Vinyl Chloride Statistical Results

Well	Statistical Trend ¹	Mann-Kendall Test ²				Sen's Slope	
		Test Value, Z	Critical Value	Number of data points, n	Statistical Significance	(ug/L per day)	(ug/L per year)
MW-5	-- ³	--	--	--	--	--	--
MW-6	Decreasing	-9.1	-1.96	71	Yes	-5.7E-05	-0.021
MW-7	--	--	--	--	--	--	--
MW-12I	Decreasing	-8.1	-1.96	71	Yes	-6.3E-05	-0.023
MW-13D	--	--	--	--	--	--	--
MW-14	Decreasing	-9.7	-1.96	71	Yes	-7.5E-05	-0.027

Notes

1 - The Statistical Trend indicates:

"Non-significant" if the magnitude of the Test Value is less than the Critical Value,

"Increasing" if the magnitude of the Test Value is greater than the Critical Value and the Sen's Slope is positive, or

"Decreasing" if the magnitude of the Test Value is greater than the Critical Value and the Sen's Slope is negative.

2 - Mann-Kendall tests were performed with alpha = 0.05 (95% confidence level).

For N>40, Mann-Kendall uses an approximation of a normal distribution, represented by Test Value Z.

3 - "--" Indicates statistical analysis not conducted.

ug/L - micrograms per liter

4 - Data range is from 1st quarter 2007 through 3rd quarter 2024

Aspect Consulting

11/27/2024


V:\160423 Kitsap County Hansville Landfill\Deliverables\2024 Reports\Q3 2024 Report\Final\Att C Stats\2024 Q3 C-1 Statistical Analysis Results

Table C-1


2024 Third Quarter Monitoring Report

1 of 1


MW-5 (Background Well)

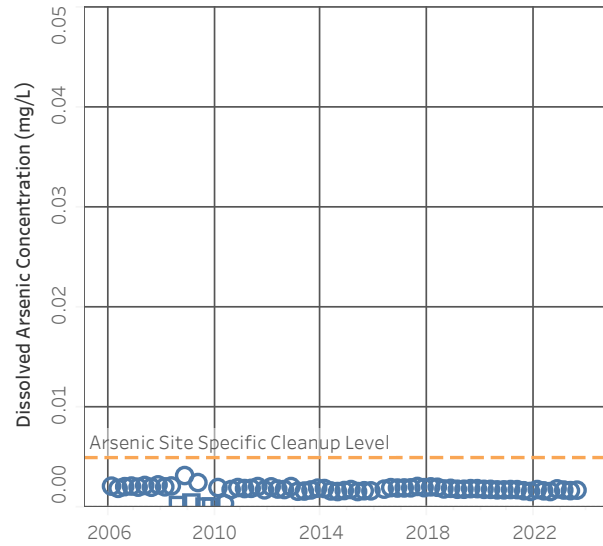


MW-6

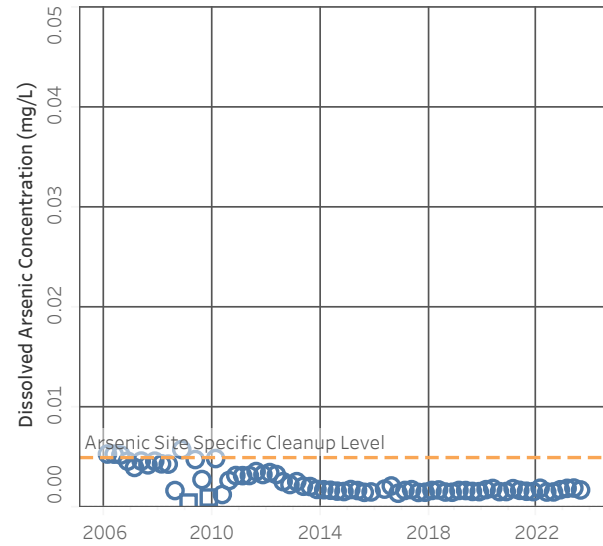


MW-7

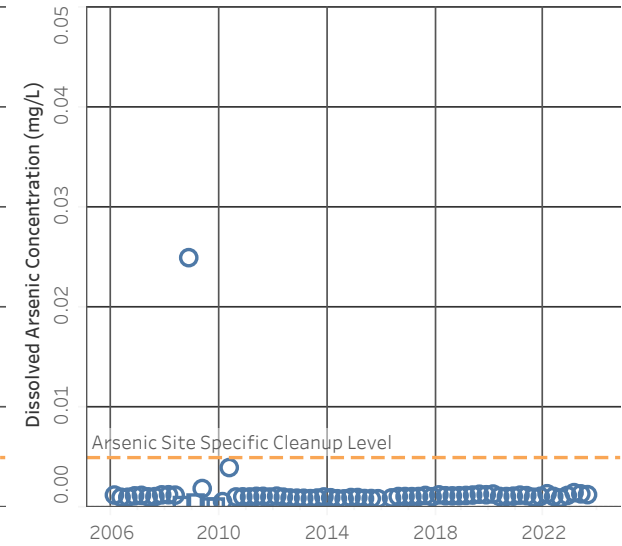


MW-12I

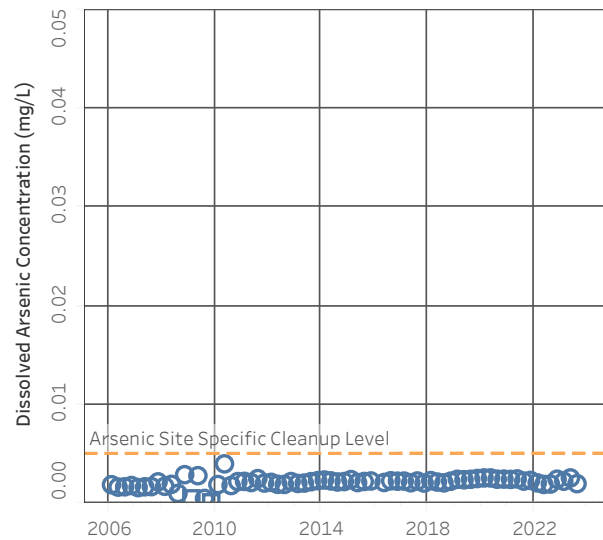

MW-13D

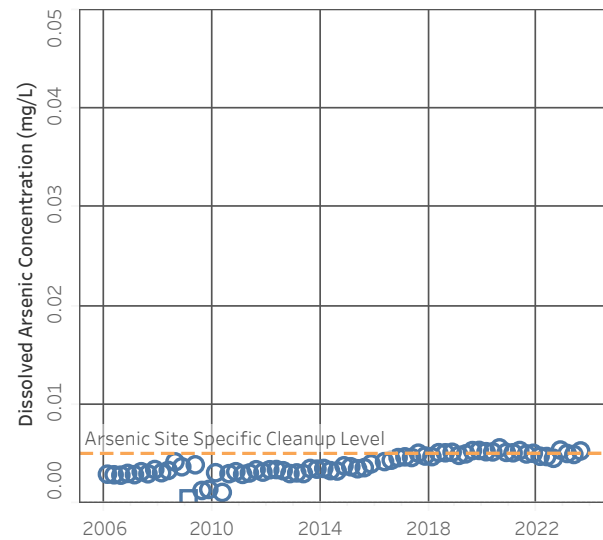

MW-14

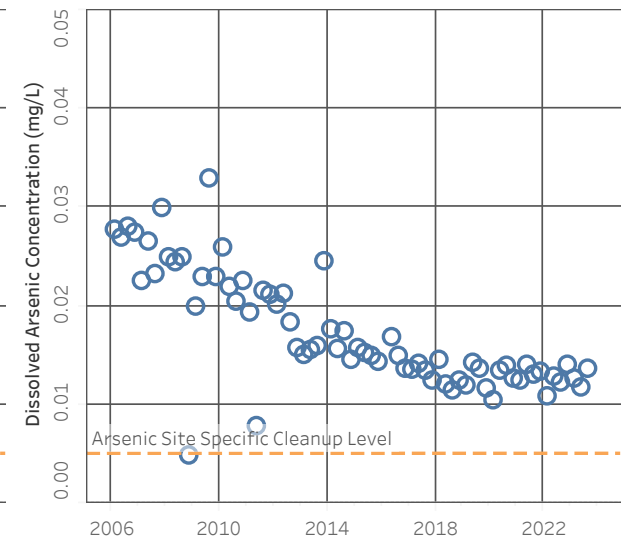


Note: Non-detected values are shown at 1/2 the reporting limit. Results from First Quarter 2017 were rejected. See text.

Result Flags


○ Detected

□ U - Non-Detect


MW-5 (Background Well)

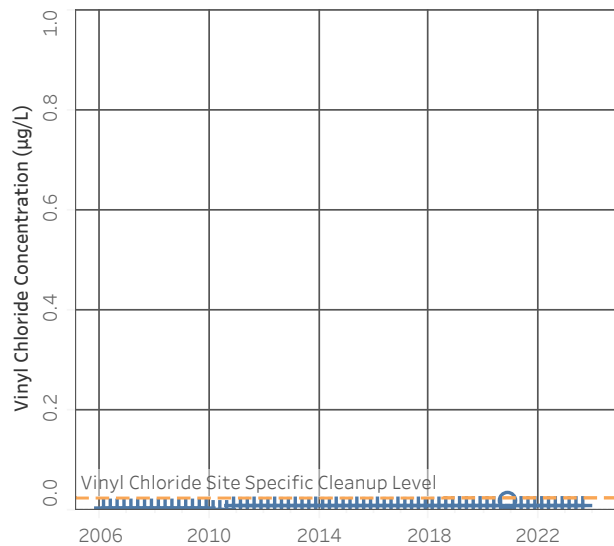


MW-6

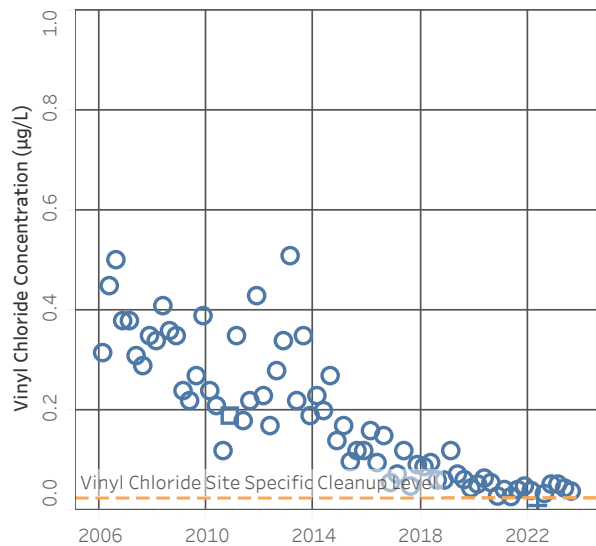


MW-7

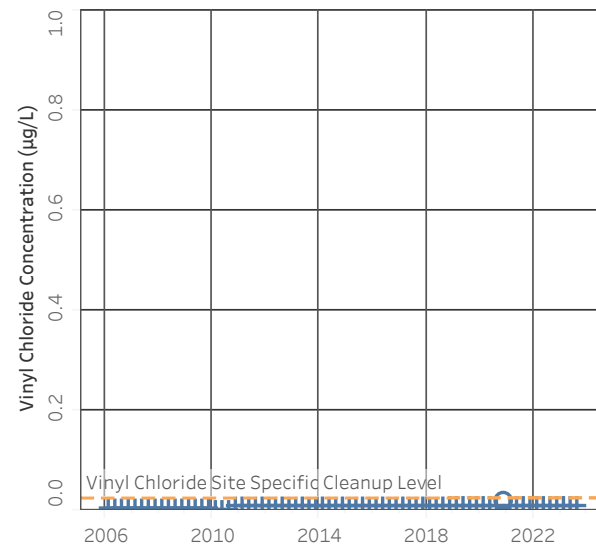


MW-12I

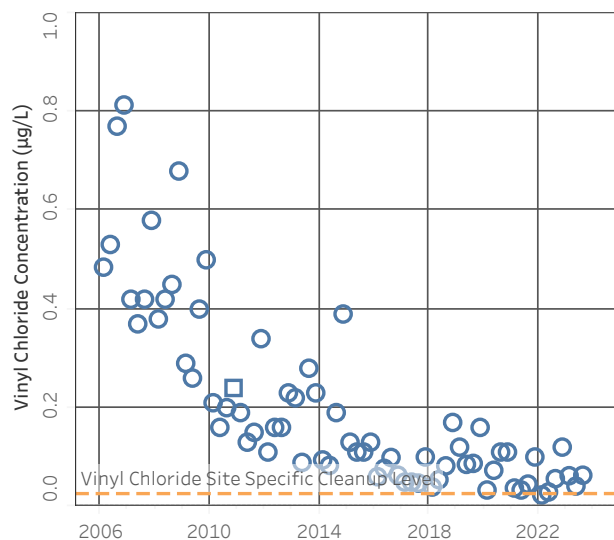

MW-13D

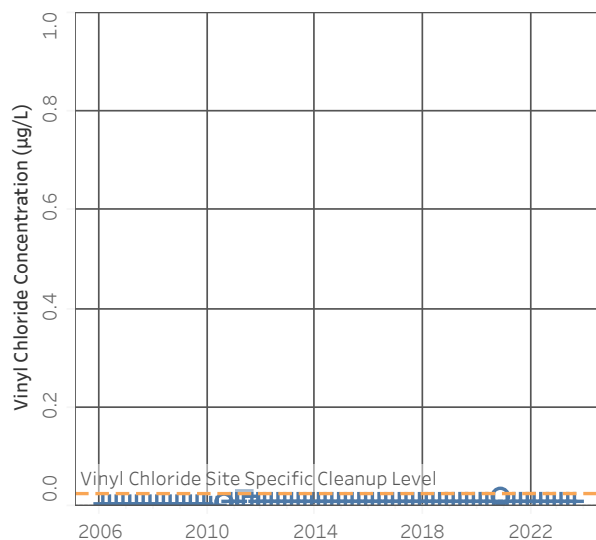

MW-14

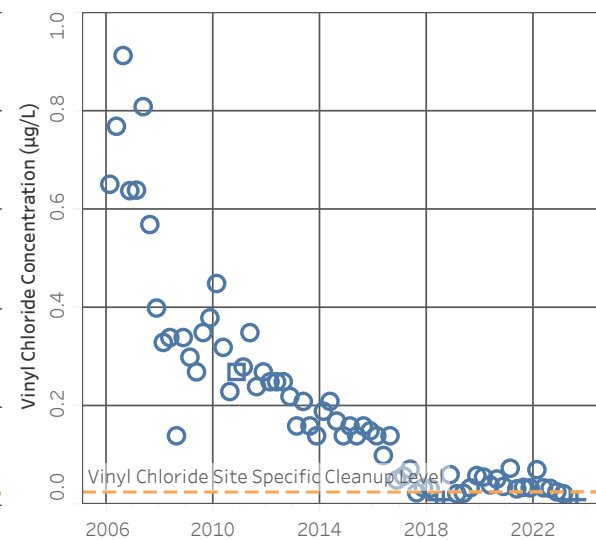

Note: Non-detected values are shown at 1/2 the reporting limit.


Result Flags

○ Detected


□ J - Estimate

+ U - Non-Detect


MW-6 Vinyl Chloride Trend

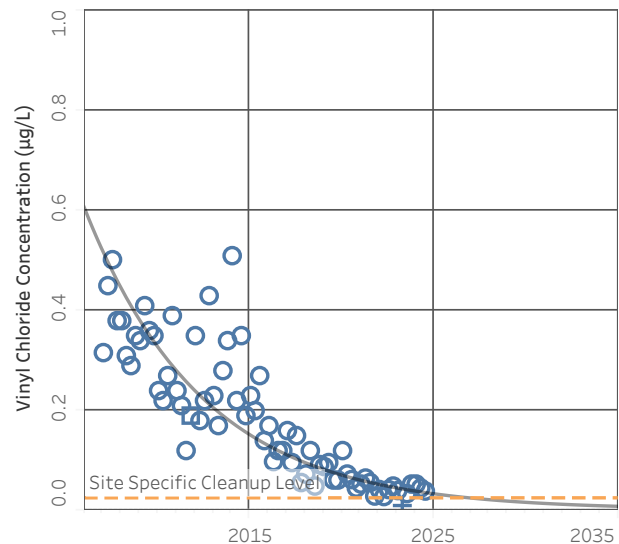


MW-12I Vinyl Chloride Trend

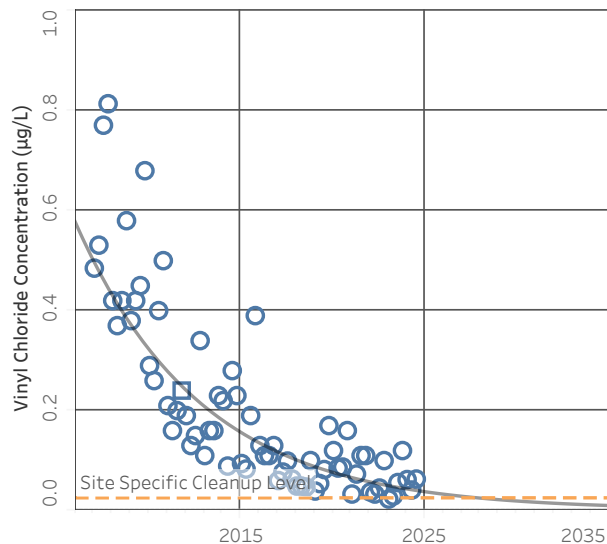


MW-14 Vinyl Chloride Trend

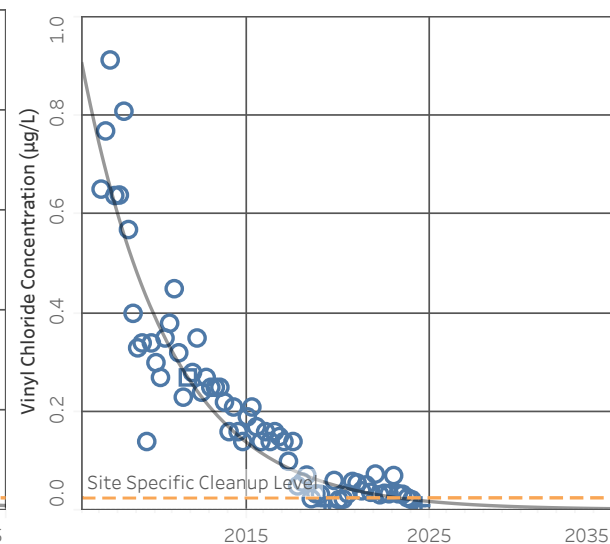

MW-13D Dissolved Arsenic Trend

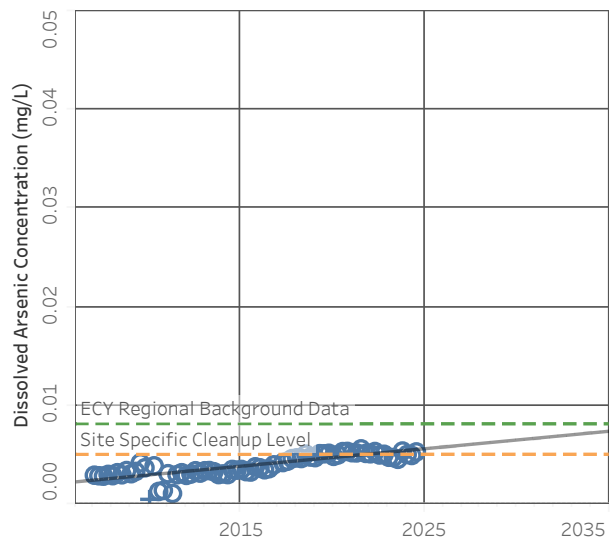

MW-14 Dissolved Arsenic Trend

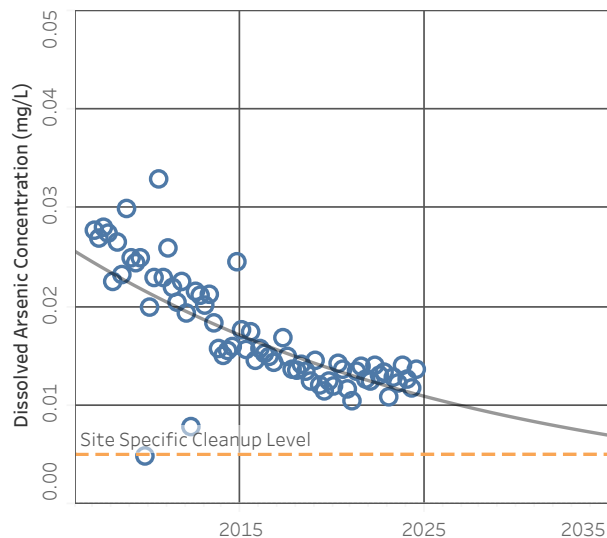

Note: Non-detected values are shown at 1/2 the reporting limit.
Attenuation curves based on exponential least squares fit to the data.

Result Flags

○ Detected

□ J - Estimate

+ U - Non-Detect

ATTACHMENT D

Field Forms and Laboratory Reports

X:\Aspect Forms\Field Forms\Groundwater Sampling Form

GROUNDWATER SAMPLING RECORD

WELL NUMBER: MW-13D

Page: 1 of 1

Project Name: Hansville Landfill Q3 2024

Project Number: AS160423

Date: 7/17/2024

Sampled by: CMT / FCE

Measuring Point of Well: NTOC

Screened Interval (ft. bgs)

Filter Pack Interval (ft. bgs)

Casing Volume 46.21 (ft Water) x 0.62 (L/ft) = 28.65 (L)

Casing volumes: 3/4" = 0.09 L/ft 2" = 0.62 L/ft 4" = 2.46 L/ft 6" = 5.56 L/ft

Starting Water Level (ft TOC): 11.71
Sample Intake Depth (ft TOC): Dedicated tubing
Total Depth After Sampling (ft TOC): 57.92
Casing Diameter (inches):
WELL CONDITION

Vault Condition: Good Well Sealed? Yes Lock Present? Yes

Standing Water in Vault? N/A Ecology Well Tag Present (and Number if yes)? N/A
PURGING MEASUREMENTS

Stabilization Criteria (for 3 consecutive readings):		Typical 0.1-0.5 Lpm	Stable (<0.3 ft target)	na	± 3%	± 10% (or ± 0.5 mg/L if < 1 mg/L)	± 0.1	± 10 mV	± 10% (or 3 successive < 10 NTU)	
Time	Cumul. Volume (L)	Purge Rate (mL/min)	Water Level (ft)	Temp. (°C)	Specific Conductance (µS/cm)	Dissolved Oxygen (mg/L)	pH	ORP (mv)	Turbidity (NTU)	Comments
1214			11.71							
1219	0.5		11.75	13.05	107.24	1.46	7.23	134.9	159	Begin purging
1224	1.0		11.75	13.91	107.25	1.06	7.23	134.4	157	Clear, no odor
1229	1.5		11.75	14.19	107.16	0.79	7.28	132.0	129	
1234	2.0		11.75	14.37	107.00	0.79	7.32	130.8	110	
1239	2.5		11.75	14.35	106.99	0.75	7.33	130.2	74.5	
1244	3.0		11.75	14.41	107.19	0.69	7.33	129.9	83.2	
1249	3.5		11.75	14.40	107.14	0.64	7.34	129.0	38.5	
1254	4.0		11.75	14.34	107.02	0.59	7.33	129.2	28.4	
1259	4.5		11.75	14.00	106.65	0.52	7.33	129.0	17.2	
1304	5.0		11.75	13.14	106.95	0.44	7.32	130.1	13.8	
1309	5.5		11.75	12.61	106.78	0.36	7.38	128.4	7.89	
1314	6.0		11.75	14.02	107.19	0.41	7.35	127.1	9.16	
1319	6.5		11.75	14.66	107.37	0.47	7.40	127.8	6.72	
1325										Sample

Total Liters Purged: 8.5 Total Casing Volumes Removed: 0.30 Ending Water Level (ft TOC): 11.70
SAMPLE INVENTORY

Time	Volume	Bottle Type	Quantity	Filtration	Preservation	Appearance		Remarks
						Color	Turbidity & Sediment	
1325	250 ml	Poly	1	YES	HNO3	Clear	8.51	FF, 1 to Denver (Diss. Mn)
	250 ml	Amber	2	No	H2SO4			To Denver (Amonia/TOC)
	500 ml	Poly	1	No	None			1 to ARI (No3/No2)
	500 ml	Poly	1	YES	HNO3			FF, to ARI (Diss AS)
	250 ml	Poly	1	YES	None			FF, to ARI (O-phos)
	250 ml	Poly	2	No	None			2 to Denver (Alks) & (Cl/SO4)
	40ml	VOA	3	No	HCL			To Denver

METHODS

Parameters measured with (instrument model & serial number): Orange YSI, Purple and White WLI, Orange Turbidimeter OR Pink Aqua Troll, red turbidimeter, blue/white WLI

Purging Equipment: Dedicated Bladder pump or Orange Per-pump Decon Equipment: Alconox and DI water

Disposal of Discharged Water: On site

Observations/Comments:

ANALYTICAL REPORT

PREPARED FOR

Attn: Mr. Peter Bannister
Aspect Consulting
350 Madison Ave N
Bainbridge Island, Washington 98110

Generated 8/30/2024 10:12:42 AM Revision 1

JOB DESCRIPTION

Hansville Landfill

JOB NUMBER

280-194308-1


Eurofins Denver

Job Notes

This report may not be reproduced except in full, and with written approval from the laboratory. The results relate only to the samples tested. For questions please contact the Project Manager at the e-mail address or telephone number listed on this page.

The test results in this report relate only to the samples as received by the laboratory and will meet all requirements of the methodology, with any exceptions noted. This report shall not be reproduced except in full, without the express written approval of the laboratory. All questions should be directed to the Eurofins TestAmerica Project Manager.

Authorization



Authorized for release by
Janice Collins, Project Manager
Janice.Collins@et.eurofinsus.com
(303)736-0100

Generated
8/30/2024 10:12:42 AM
Revision 1

Table of Contents

Cover Page 1

Table of Contents 3

Definitions 4

Case Narrative 5

Detection Summary 6

Method Summary 8

Sample Summary 9

Client Sample Results 10

Surrogate Summary 17

QC Sample Results 18

QC Association 24

Chronicle 27

Certification Summary 31

Subcontract Data 32

Chain of Custody 91

Receipt Checklists 97

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16

Definitions/Glossary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Qualifiers

Metals

Qualifier	Qualifier Description
F1	MS and/or MSD recovery exceeds control limits.

General Chemistry

Qualifier	Qualifier Description
J	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
□	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: Aspect Consulting
Project: Hansville Landfill

Job ID: 280-194308-1

Job ID: 280-194308-1

Eurofins Denver

Job Narrative 280-194308-1

Revision

The report being provided is a revision of the original report sent on 8/1/2024. The report (revision 1) is being revised to include additional information in the case narrative of subcontract report from ARI.

Analytical test results meet all requirements of the associated regulatory program listed on the Accreditation/Certification Summary Page unless otherwise noted under the individual analysis. Data qualifiers and/or narrative comments are included to explain any exceptions, if applicable.

- Matrix QC may not be reported if insufficient sample is provided or site-specific QC samples were not submitted. In these situations, to demonstrate precision and accuracy at a batch level, a LCS/LCSD may be performed, unless otherwise specified in the method.
- Surrogate and/or isotope dilution analyte recoveries (if applicable) which are outside of the QC window are confirmed unless attributed to a dilution or otherwise noted in the narrative.
- Each sample was analyzed to achieve the lowest possible reporting limit within the constraints of the method. In some cases, due to interference or analytes present at high concentrations, samples were diluted. For diluted samples, the reporting limits are adjusted relative to the dilution required.

This report may include reporting limits (RLs) lower than Eurofins Environmental Testing standard reporting limits. The reported sample results and associated reporting limits are being used specifically to meet the needs of this project. Note that data are not normally reported to these levels without qualification because they are inherently less reliable and potentially less defensible than required by the latest industry standards.

Regulated compliance samples (e.g. SDWA, NPDES) must comply with the associated agency requirements/permits.

Receipt

The samples were received on 7/19/2024 9:20 AM. Unless otherwise noted below, the samples arrived in good condition, and, where required, properly preserved and on ice. The temperatures of the 2 coolers at receipt time were 1.9°C and 2.9°C.

Subcontract Work

Methods Dissolved As (ARI) - direct sub to ARI from field, Nitrate/Nitrite/o-phos(field filtered) (ARI) - direct sub to ARI from field: These methods were subcontracted to Analytical Resources, Inc. The subcontract laboratory certifications are different from that of the facility issuing the final report. The subcontract report is appended in its entirety.

GC/MS VOA

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

Metals

Method 6020B - Dissolved: The matrix spike / matrix spike duplicate (MS/MSD) recoveries for preparation batch 280-661154 and analytical batch 280-661353 were outside control limits for one or more analytes. See QC Sample Results for detail. Sample matrix interference and/or non-homogeneity are suspected because the associated laboratory control sample (LCS) recovery is within acceptance limits.

Method 6020B - Dissolved: The instrument blank for analytical batch 280-661353 contained Mn greater than one-half the reporting limit (RL), and were not re-analyzed because results were greater than 10X the value found in the method blank. The data have been qualified and reported.

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

General Chemistry

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

Eurofins Denver

Detection Summary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Client Sample ID: SW-1-240717

Lab Sample ID: 280-194308-1

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Chloride	6.8		3.0		mg/L	1		300.0	Total/NA
Sulfate	10		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	71		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	71		10		mg/L	1		SM 2320B	Total/NA
Total Organic Carbon - Quad	1.5		1.0		mg/L	1		SM 5310B	Total/NA

Client Sample ID: SW-4-240717

Lab Sample ID: 280-194308-2

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Manganese	26		1.0		ug/L	1		6020B	Dissolved
Chloride	15		3.0		mg/L	1		300.0	Total/NA
Sulfate	28		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	160		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	160		10		mg/L	1		SM 2320B	Total/NA
Total Organic Carbon - Quad	2.8		1.0		mg/L	1		SM 5310B	Total/NA

Client Sample ID: SW-6-240717

Lab Sample ID: 280-194308-3

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Manganese	39		1.0		ug/L	1		6020B	Dissolved
Chloride	7.3		3.0		mg/L	1		300.0	Total/NA
Sulfate	6.5		5.0		mg/L	1		300.0	Total/NA
Ammonia as N	0.040		0.030		mg/L	1		350.1	Total/NA
Total Alkalinity	65		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	65		10		mg/L	1		SM 2320B	Total/NA
Total Organic Carbon - Quad	8.4		1.0		mg/L	1		SM 5310B	Total/NA

Client Sample ID: SW-7-240717

Lab Sample ID: 280-194308-4

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Manganese	9.4		1.0		ug/L	1		6020B	Dissolved
Chloride	10		3.0		mg/L	1		300.0	Total/NA
Sulfate	9.6		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	76		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	76		10		mg/L	1		SM 2320B	Total/NA
Total Organic Carbon - Quad	6.2		1.0		mg/L	1		SM 5310B	Total/NA

Client Sample ID: MW-7-240717

Lab Sample ID: 280-194308-5

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Manganese	1.0		1.0		ug/L	1		6020B	Dissolved
Sulfate	6.0		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	140		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	140		10		mg/L	1		SM 2320B	Total/NA
Total Organic Carbon - Quad	1.7		1.0		mg/L	1		SM 5310B	Total/NA

Client Sample ID: MW-5-240717

Lab Sample ID: 280-194308-6

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Chloride	3.0		3.0		mg/L	1		300.0	Total/NA
Sulfate	7.5		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	75		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	75		10		mg/L	1		SM 2320B	Total/NA

This Detection Summary does not include radiochemical test results.

Eurofins Denver

Detection Summary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Client Sample ID: MW-12I-240717

Lab Sample ID: 280-194308-7

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Vinyl chloride	0.063		0.020		ug/L	1		8260C SIM	Total/NA
Manganese	63		1.0		ug/L	1		6020B	Dissolved
Chloride	10		3.0		mg/L	1		300.0	Total/NA
Sulfate	12		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	130		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	130		10		mg/L	1		SM 2320B	Total/NA
Total Organic Carbon - Quad	2.2		1.0		mg/L	1		SM 5310B	Total/NA

Client Sample ID: MW-13D-240717

Lab Sample ID: 280-194308-8

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Manganese	6.2		1.0		ug/L	1		6020B	Dissolved
Chloride	5.2		3.0		mg/L	1		300.0	Total/NA
Sulfate	16		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	66		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	66		10		mg/L	1		SM 2320B	Total/NA

Client Sample ID: MW-6-240717

Lab Sample ID: 280-194308-9

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Vinyl chloride	0.039		0.020		ug/L	1		8260C SIM	Total/NA
Manganese	150		1.0		ug/L	1		6020B	Dissolved
Chloride	3.7		3.0		mg/L	1		300.0	Total/NA
Sulfate	15		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	98		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	98		10		mg/L	1		SM 2320B	Total/NA

Client Sample ID: MW-14-240717

Lab Sample ID: 280-194308-10

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Manganese	770		1.0		ug/L	1		6020B	Dissolved
Sulfate	8.5		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	69		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	69		10		mg/L	1		SM 2320B	Total/NA
Total Organic Carbon - Quad	2.6		1.0		mg/L	1		SM 5310B	Total/NA

Client Sample ID: MW-20DD-240717

Lab Sample ID: 280-194308-11

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Manganese	760		1.0		ug/L	1		6020B	Dissolved
Sulfate	9.1		5.0		mg/L	1		300.0	Total/NA
Total Alkalinity	70		10		mg/L	1		SM 2320B	Total/NA
Bicarbonate Alkalinity	70		10		mg/L	1		SM 2320B	Total/NA
Total Organic Carbon - Quad	2.4		1.0		mg/L	1		SM 5310B	Total/NA

Client Sample ID: TB1-240717

Lab Sample ID: 280-194308-12

No Detections.

Client Sample ID: TB2-240717

Lab Sample ID: 280-194308-13

No Detections.

This Detection Summary does not include radiochemical test results.

Eurofins Denver

Method Summary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method	Method Description	Protocol	Laboratory
8260C SIM	Volatile Organic Compounds (GC/MS)	SW846	EET BUF
6020B	Metals (ICP/MS)	SW846	EET DEN
300.0	Anions, Ion Chromatography	EPA	EET DEN
350.1	Nitrogen, Ammonia	EPA	EET DEN
SM 2320B	Alkalinity	SM	EET DEN
SM 5310B	Organic Carbon, Total (TOC)	SM	EET DEN
Subcontract	Dissolved As (ARI) - direct sub to ARI from field	None	SC0056
Subcontract	Nitrate/Nitrite/o-phos(field filtered) (ARI) - direct sub to ARI from field	None	SC0056
3005A	Preparation, Total Recoverable or Dissolved Metals	SW846	EET DEN
5030C	Purge and Trap	SW846	EET BUF

Protocol References:

EPA = US Environmental Protection Agency

None = None

SM = "Standard Methods For The Examination Of Water And Wastewater"

SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.

Laboratory References:

EET BUF = Eurofins Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

EET DEN = Eurofins Denver, 4955 Yarrow Street, Arvada, CO 80002, TEL (303)736-0100

SC0056 = Analytical Resources, Inc, 4611 South 134th Place, Suite 100, Tukwila, WA 98168, TEL (206)695-6200

Sample Summary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Lab Sample ID	Client Sample ID	Matrix	Collected	Received
280-194308-1	SW-1-240717	Water	07/17/24 10:40	07/19/24 09:20
280-194308-2	SW-4-240717	Water	07/17/24 11:40	07/19/24 09:20
280-194308-3	SW-6-240717	Water	07/17/24 12:25	07/19/24 09:20
280-194308-4	SW-7-240717	Water	07/17/24 14:25	07/19/24 09:20
280-194308-5	MW-7-240717	Water	07/17/24 08:15	07/19/24 09:20
280-194308-6	MW-5-240717	Water	07/17/24 09:35	07/19/24 09:20
280-194308-7	MW-12I-240717	Water	07/17/24 11:15	07/19/24 09:20
280-194308-8	MW-13D-240717	Water	07/17/24 13:25	07/19/24 09:20
280-194308-9	MW-6-240717	Water	07/17/24 16:05	07/19/24 09:20
280-194308-10	MW-14-240717	Water	07/17/24 16:00	07/19/24 09:20
280-194308-11	MW-20DD-240717	Water	07/17/24 07:00	07/19/24 09:20
280-194308-12	TB1-240717	Water	07/17/24 07:00	07/19/24 09:20
280-194308-13	TB2-240717	Water	07/17/24 07:00	07/19/24 09:20

Client Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: SW846 8260C SIM - Volatile Organic Compounds (GC/MS)

Client Sample ID: SW-1-240717

Date Collected: 07/17/24 10:40

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-1

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Vinyl chloride	ND		0.020		ug/L			07/23/24 21:48	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
Dibromofluoromethane (Surr)	109		50 - 150					07/23/24 21:48	1
TBA-d9 (Surr)	91		50 - 150					07/23/24 21:48	1

Client Sample ID: SW-4-240717

Date Collected: 07/17/24 11:40

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-2

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Vinyl chloride	ND		0.020		ug/L			07/23/24 22:10	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
Dibromofluoromethane (Surr)	111		50 - 150					07/23/24 22:10	1
TBA-d9 (Surr)	87		50 - 150					07/23/24 22:10	1

Client Sample ID: SW-6-240717

Date Collected: 07/17/24 12:25

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-3

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Vinyl chloride	ND		0.020		ug/L			07/23/24 22:32	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
Dibromofluoromethane (Surr)	111		50 - 150					07/23/24 22:32	1
TBA-d9 (Surr)	86		50 - 150					07/23/24 22:32	1

Client Sample ID: SW-7-240717

Date Collected: 07/17/24 14:25

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-4

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Vinyl chloride	ND		0.020		ug/L			07/23/24 22:55	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
Dibromofluoromethane (Surr)	116		50 - 150					07/23/24 22:55	1
TBA-d9 (Surr)	89		50 - 150					07/23/24 22:55	1

Client Sample ID: MW-7-240717

Date Collected: 07/17/24 08:15

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-5

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Vinyl chloride	ND		0.020		ug/L			07/23/24 23:17	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
Dibromofluoromethane (Surr)	113		50 - 150					07/23/24 23:17	1
TBA-d9 (Surr)	89		50 - 150					07/23/24 23:17	1

Client Sample ID: MW-5-240717

Date Collected: 07/17/24 09:35

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-6

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Vinyl chloride	ND		0.020		ug/L			07/23/24 23:40	1

Eurofins Denver

Client Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: SW846 8260C SIM - Volatile Organic Compounds (GC/MS)

Client Sample ID: TB1-240717
Date Collected: 07/17/24 07:00
Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-12
Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Vinyl chloride	ND		0.020		ug/L			07/24/24 01:56	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
Dibromofluoromethane (Surr)	115		50 - 150					07/24/24 01:56	1
TBA-d9 (Surr)	89		50 - 150					07/24/24 01:56	1

Client Sample ID: TB2-240717
Date Collected: 07/17/24 07:00
Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-13
Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Vinyl chloride	ND		0.020		ug/L			07/24/24 02:18	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
Dibromofluoromethane (Surr)	114		50 - 150					07/24/24 02:18	1
TBA-d9 (Surr)	88		50 - 150					07/24/24 02:18	1

Method: SW846 6020B - Metals (ICP/MS) - Dissolved

Client Sample ID: SW-1-240717
Date Collected: 07/17/24 10:40
Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-1
Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	ND		1.0		ug/L		07/22/24 08:45	07/23/24 00:16	1

Client Sample ID: SW-4-240717
Date Collected: 07/17/24 11:40
Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-2
Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	26		1.0		ug/L		07/22/24 08:45	07/23/24 00:20	1

Client Sample ID: SW-6-240717
Date Collected: 07/17/24 12:25
Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-3
Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	39		1.0		ug/L		07/22/24 08:45	07/23/24 00:23	1

Client Sample ID: SW-7-240717
Date Collected: 07/17/24 14:25
Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-4
Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	9.4		1.0		ug/L		07/22/24 08:45	07/23/24 00:27	1

Client Sample ID: MW-7-240717
Date Collected: 07/17/24 08:15
Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-5
Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	1.0		1.0		ug/L		07/22/24 08:45	07/23/24 00:30	1

Eurofins Denver

Client Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: SW846 6020B - Metals (ICP/MS) - Dissolved

Client Sample ID: MW-5-240717

Date Collected: 07/17/24 09:35

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-6

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	ND		1.0		ug/L		07/22/24 08:45	07/23/24 00:34	1

Client Sample ID: MW-12I-240717

Date Collected: 07/17/24 11:15

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-7

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	63		1.0		ug/L		07/22/24 08:45	07/23/24 00:38	1

Client Sample ID: MW-13D-240717

Date Collected: 07/17/24 13:25

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-8

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	6.2		1.0		ug/L		07/22/24 08:45	07/23/24 00:41	1

Client Sample ID: MW-6-240717

Date Collected: 07/17/24 16:05

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-9

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	150		1.0		ug/L		07/22/24 08:45	07/23/24 00:52	1

Client Sample ID: MW-14-240717

Date Collected: 07/17/24 16:00

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-10

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	770		1.0		ug/L		07/22/24 08:45	07/23/24 00:56	1

Client Sample ID: MW-20DD-240717

Date Collected: 07/17/24 07:00

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-11

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	760		1.0		ug/L		07/22/24 08:45	07/23/24 00:59	1

General Chemistry

Client Sample ID: SW-1-240717

Date Collected: 07/17/24 10:40

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-1

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	6.8		3.0		mg/L			07/22/24 18:26	1
Sulfate (EPA 300.0)	10		5.0		mg/L			07/22/24 18:26	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 11:42	1
Total Alkalinity (SM 2320B)	71		10		mg/L			07/22/24 20:27	1
Bicarbonate Alkalinity (SM 2320B)	71		10		mg/L			07/22/24 20:27	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 20:27	1
Total Organic Carbon - Quad (SM 5310B)	1.5		1.0		mg/L			07/22/24 20:41	1

Client Sample ID: SW-4-240717

Date Collected: 07/17/24 11:40

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-2

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	15		3.0		mg/L			07/22/24 18:15	1

Eurofins Denver

Client Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

General Chemistry (Continued)

Client Sample ID: SW-4-240717

Date Collected: 07/17/24 11:40

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-2

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Sulfate (EPA 300.0)	28		5.0		mg/L			07/22/24 18:15	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 11:49	1
Total Alkalinity (SM 2320B)	160		10		mg/L			07/22/24 20:38	1
Bicarbonate Alkalinity (SM 2320B)	160		10		mg/L			07/22/24 20:38	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 20:38	1
Total Organic Carbon - Quad (SM 5310B)	2.8		1.0		mg/L			07/22/24 20:55	1

Client Sample ID: SW-6-240717

Date Collected: 07/17/24 12:25

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-3

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	7.3		3.0		mg/L			07/22/24 18:04	1
Sulfate (EPA 300.0)	6.5		5.0		mg/L			07/22/24 18:04	1
Ammonia as N (EPA 350.1)	0.040		0.030		mg/L			07/23/24 11:51	1
Total Alkalinity (SM 2320B)	65		10		mg/L			07/22/24 20:44	1
Bicarbonate Alkalinity (SM 2320B)	65		10		mg/L			07/22/24 20:44	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 20:44	1
Total Organic Carbon - Quad (SM 5310B)	8.4		1.0		mg/L			07/22/24 21:43	1

Client Sample ID: SW-7-240717

Date Collected: 07/17/24 14:25

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-4

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	10		3.0		mg/L			07/22/24 17:53	1
Sulfate (EPA 300.0)	9.6		5.0		mg/L			07/22/24 17:53	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 11:53	1
Total Alkalinity (SM 2320B)	76		10		mg/L			07/22/24 20:49	1
Bicarbonate Alkalinity (SM 2320B)	76		10		mg/L			07/22/24 20:49	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 20:49	1
Total Organic Carbon - Quad (SM 5310B)	6.2		1.0		mg/L			07/22/24 21:57	1

Client Sample ID: MW-7-240717

Date Collected: 07/17/24 08:15

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-5

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	ND		3.0		mg/L			07/23/24 06:10	1
Sulfate (EPA 300.0)	6.0		5.0		mg/L			07/23/24 06:10	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 11:55	1
Total Alkalinity (SM 2320B)	140		10		mg/L			07/22/24 20:54	1
Bicarbonate Alkalinity (SM 2320B)	140		10		mg/L			07/22/24 20:54	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 20:54	1
Total Organic Carbon - Quad (SM 5310B)	1.7		1.0		mg/L			07/22/24 22:13	1

Eurofins Denver

Client Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

General Chemistry

Client Sample ID: MW-5-240717

Date Collected: 07/17/24 09:35

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-6

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	3.0		3.0		mg/L			07/23/24 05:59	1
Sulfate (EPA 300.0)	7.5		5.0		mg/L			07/23/24 05:59	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 11:57	1
Total Alkalinity (SM 2320B)	75		10		mg/L			07/22/24 20:59	1
Bicarbonate Alkalinity (SM 2320B)	75		10		mg/L			07/22/24 20:59	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 20:59	1
Total Organic Carbon - Quad (SM 5310B)	ND		1.0		mg/L			07/22/24 22:29	1

Client Sample ID: MW-12I-240717

Date Collected: 07/17/24 11:15

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-7

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	10		3.0		mg/L			07/23/24 05:48	1
Sulfate (EPA 300.0)	12		5.0		mg/L			07/23/24 05:48	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 12:00	1
Total Alkalinity (SM 2320B)	130		10		mg/L			07/22/24 21:04	1
Bicarbonate Alkalinity (SM 2320B)	130		10		mg/L			07/22/24 21:04	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 21:04	1
Total Organic Carbon - Quad (SM 5310B)	2.2		1.0		mg/L			07/22/24 22:43	1

Client Sample ID: MW-13D-240717

Date Collected: 07/17/24 13:25

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-8

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	5.2		3.0		mg/L			07/23/24 05:04	1
Sulfate (EPA 300.0)	16		5.0		mg/L			07/23/24 05:04	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 12:02	1
Total Alkalinity (SM 2320B)	66		10		mg/L			07/22/24 21:09	1
Bicarbonate Alkalinity (SM 2320B)	66		10		mg/L			07/22/24 21:09	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 21:09	1
Total Organic Carbon - Quad (SM 5310B)	ND		1.0		mg/L			07/23/24 02:55	1

Client Sample ID: MW-6-240717

Date Collected: 07/17/24 16:05

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-9

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	3.7		3.0		mg/L			07/23/24 04:53	1
Sulfate (EPA 300.0)	15		5.0		mg/L			07/23/24 04:53	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 12:04	1
Total Alkalinity (SM 2320B)	98		10		mg/L			07/22/24 21:14	1
Bicarbonate Alkalinity (SM 2320B)	98		10		mg/L			07/22/24 21:14	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 21:14	1
Total Organic Carbon - Quad (SM 5310B)	ND		1.0		mg/L			07/23/24 04:54	1

Eurofins Denver

Client Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

General Chemistry

Client Sample ID: MW-14-240717

Date Collected: 07/17/24 16:00

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-10

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	ND		3.0		mg/L			07/23/24 04:42	1
Sulfate (EPA 300.0)	8.5		5.0		mg/L			07/23/24 04:42	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 12:06	1
Total Alkalinity (SM 2320B)	69		10		mg/L			07/22/24 21:20	1
Bicarbonate Alkalinity (SM 2320B)	69		10		mg/L			07/22/24 21:20	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 21:20	1
Total Organic Carbon - Quad (SM 5310B)	2.6		1.0		mg/L			07/23/24 05:08	1

Client Sample ID: MW-20DD-240717

Date Collected: 07/17/24 07:00

Date Received: 07/19/24 09:20

Lab Sample ID: 280-194308-11

Matrix: Water

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride (EPA 300.0)	ND		3.0		mg/L			07/23/24 03:58	1
Sulfate (EPA 300.0)	9.1		5.0		mg/L			07/23/24 03:58	1
Ammonia as N (EPA 350.1)	ND		0.030		mg/L			07/23/24 12:24	1
Total Alkalinity (SM 2320B)	70		10		mg/L			07/22/24 21:37	1
Bicarbonate Alkalinity (SM 2320B)	70		10		mg/L			07/22/24 21:37	1
Carbonate Alkalinity (SM 2320B)	ND		10		mg/L			07/22/24 21:37	1
Total Organic Carbon - Quad (SM 5310B)	2.4		1.0		mg/L			07/23/24 05:24	1

Surrogate Summary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: 8260C SIM - Volatile Organic Compounds (GC/MS)
Matrix: Water

Prep Type: Total/NA

		Percent Surrogate Recovery (Acceptance Limits)	
Lab Sample ID	Client Sample ID	DBFM	TBA
		(50-150)	(50-150)
280-194308-1	SW-1-240717	109	91
280-194308-2	SW-4-240717	111	87
280-194308-3	SW-6-240717	111	86
280-194308-4	SW-7-240717	116	89
280-194308-5	MW-7-240717	113	89
280-194308-6	MW-5-240717	113	90
280-194308-7	MW-12I-240717	111	94
280-194308-8	MW-13D-240717	117	95
280-194308-9	MW-6-240717	114	89
280-194308-10	MW-14-240717	113	92
280-194308-11	MW-20DD-240717	113	88
280-194308-12	TB1-240717	115	89
280-194308-13	TB2-240717	114	88
LCS 480-719385/6	Lab Control Sample	100	104
LCSD 480-719385/7	Lab Control Sample Dup	100	101
MB 480-719385/9	Method Blank	109	92
Surrogate Legend			
DBFM = Dibromofluoromethane (Surr)			
TBA = TBA-d9 (Surr)			

QC Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: 8260C SIM - Volatile Organic Compounds (GC/MS)

Lab Sample ID: MB 480-719385/9

Matrix: Water

Analysis Batch: 719385

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Vinyl chloride	ND		0.020		ug/L			07/23/24 21:25	1
Surrogate	%Recovery	MB Qualifier	Limits				Prepared	Analyzed	Dil Fac
Dibromofluoromethane (Surr)	109		50 - 150					07/23/24 21:25	1
TBA-d9 (Surr)	92		50 - 150					07/23/24 21:25	1

Lab Sample ID: LCS 480-719385/6

Matrix: Water

Analysis Batch: 719385

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits		
Vinyl chloride	0.200	0.166		ug/L		83	50 - 150		
Surrogate	%Recovery	LCS Qualifier	Limits						
Dibromofluoromethane (Surr)	100		50 - 150						
TBA-d9 (Surr)	104		50 - 150						

Lab Sample ID: LCSD 480-719385/7

Matrix: Water

Analysis Batch: 719385

Client Sample ID: Lab Control Sample Dup

Prep Type: Total/NA

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Vinyl chloride	0.200	0.160		ug/L		80	50 - 150	3	20
Surrogate	%Recovery	LCSD Qualifier	Limits						
Dibromofluoromethane (Surr)	100		50 - 150						
TBA-d9 (Surr)	101		50 - 150						

Method: 6020B - Metals (ICP/MS)

Lab Sample ID: MB 280-661154/1-A

Matrix: Water

Analysis Batch: 661353

Client Sample ID: Method Blank

Prep Type: Total Recoverable

Prep Batch: 661154

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Manganese	ND		1.0		ug/L		07/22/24 08:45	07/23/24 00:09	1

Lab Sample ID: LCS 280-661154/2-A

Matrix: Water

Analysis Batch: 661353

Client Sample ID: Lab Control Sample

Prep Type: Total Recoverable

Prep Batch: 661154

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits		
Manganese	40.0	38.9		ug/L		97	85 - 117		

Eurofins Denver

QC Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: 6020B - Metals (ICP/MS) (Continued)

Lab Sample ID: 280-194169-B-8-B MS
Matrix: Water
Analysis Batch: 661353

Client Sample ID: Matrix Spike
Prep Type: Dissolved
Prep Batch: 661154

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Manganese	140	F1	40.0	167	F1	ug/L		69	89 - 119

Lab Sample ID: 280-194169-B-8-C MSD
Matrix: Water
Analysis Batch: 661353

Client Sample ID: Matrix Spike Duplicate
Prep Type: Dissolved
Prep Batch: 661154

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Manganese	140	F1	40.0	177		ug/L		94	89 - 119	6	20

Method: 300.0 - Anions, Ion Chromatography

Lab Sample ID: MB 280-661246/42
Matrix: Water
Analysis Batch: 661246

Client Sample ID: Method Blank
Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	ND		3.0		mg/L			07/22/24 23:45	1
Sulfate	ND		5.0		mg/L			07/22/24 23:45	1

Lab Sample ID: MB 280-661246/6
Matrix: Water
Analysis Batch: 661246

Client Sample ID: Method Blank
Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	ND		3.0		mg/L			07/22/24 13:15	1
Sulfate	ND		5.0		mg/L			07/22/24 13:15	1

Lab Sample ID: LCS 280-661246/4
Matrix: Water
Analysis Batch: 661246

Client Sample ID: Lab Control Sample
Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Chloride	100	101		mg/L		101	90 - 110
Sulfate	100	99.6		mg/L		100	90 - 110

Lab Sample ID: LCS 280-661246/40
Matrix: Water
Analysis Batch: 661246

Client Sample ID: Lab Control Sample
Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Chloride	100	102		mg/L		102	90 - 110
Sulfate	100	101		mg/L		101	90 - 110

Lab Sample ID: LCSD 280-661246/41
Matrix: Water
Analysis Batch: 661246

Client Sample ID: Lab Control Sample Dup
Prep Type: Total/NA

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	100	102		mg/L		102	90 - 110	0	10
Sulfate	100	102		mg/L		102	90 - 110	0	10

Eurofins Denver

QC Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: 300.0 - Anions, Ion Chromatography (Continued)

Lab Sample ID: LCSD 280-661246/5

Matrix: Water

Analysis Batch: 661246

Client Sample ID: Lab Control Sample Dup

Prep Type: Total/NA

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	100	101		mg/L		101	90 - 110	0	10
Sulfate	100	99.5		mg/L		99	90 - 110	0	10

Lab Sample ID: MRL 280-661246/3

Matrix: Water

Analysis Batch: 661246

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	MRL Result	MRL Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	5.00	4.77		mg/L		95	50 - 150		
Sulfate	5.00	4.50	J	mg/L		90	50 - 150		

Lab Sample ID: 280-194308-8 MS

Matrix: Water

Analysis Batch: 661246

Client Sample ID: MW-13D-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	5.2		50.0	58.1		mg/L		106	80 - 120		
Sulfate	16		50.0	69.2		mg/L		106	80 - 120		

Lab Sample ID: 280-194308-8 MSD

Matrix: Water

Analysis Batch: 661246

Client Sample ID: MW-13D-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	5.2		50.0	58.1		mg/L		106	80 - 120	0	20
Sulfate	16		50.0	69.2		mg/L		106	80 - 120	0	20

Lab Sample ID: 280-194308-11 MS

Matrix: Water

Analysis Batch: 661246

Client Sample ID: MW-20DD-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	ND		50.0	56.4		mg/L		107	80 - 120		
Sulfate	9.1		50.0	63.3		mg/L		108	80 - 120		

Lab Sample ID: 280-194308-11 MSD

Matrix: Water

Analysis Batch: 661246

Client Sample ID: MW-20DD-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	ND		50.0	55.6		mg/L		106	80 - 120	1	20
Sulfate	9.1		50.0	62.4		mg/L		107	80 - 120	1	20

Lab Sample ID: 280-194308-8 DU

Matrix: Water

Analysis Batch: 661246

Client Sample ID: MW-13D-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	DU Result	DU Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	5.2		5.21		mg/L				0.09	15
Sulfate	16		16.2		mg/L				0.2	15

Eurofins Denver

QC Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: 300.0 - Anions, Ion Chromatography

Lab Sample ID: 280-194308-11 DU

Matrix: Water

Analysis Batch: 661246

Client Sample ID: MW-20DD-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	DU Result	DU Qualifier	Unit	D	RPD	RPD Limit
Chloride	ND		ND		mg/L		NC	15
Sulfate	9.1		9.18		mg/L		1	15

Method: 350.1 - Nitrogen, Ammonia

Lab Sample ID: MB 280-661462/21

Matrix: Water

Analysis Batch: 661462

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Ammonia as N	ND		0.030		mg/L			07/23/24 11:36	1

Lab Sample ID: LCS 280-661462/22

Matrix: Water

Analysis Batch: 661462

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Ammonia as N	2.50	2.49		mg/L		100	90 - 110

Lab Sample ID: 280-194308-1 MS

Matrix: Water

Analysis Batch: 661462

Client Sample ID: SW-1-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Ammonia as N	ND		1.00	1.04		mg/L		104	90 - 110

Lab Sample ID: 280-194308-1 MSD

Matrix: Water

Analysis Batch: 661462

Client Sample ID: SW-1-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Ammonia as N	ND		1.00	1.06		mg/L		106	90 - 110	2	10

Lab Sample ID: 280-194308-11 MS

Matrix: Water

Analysis Batch: 661462

Client Sample ID: MW-20DD-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Ammonia as N	ND		1.00	1.05		mg/L		105	90 - 110

Lab Sample ID: 280-194308-11 MSD

Matrix: Water

Analysis Batch: 661462

Client Sample ID: MW-20DD-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Ammonia as N	ND		1.00	1.07		mg/L		107	90 - 110	2	10

Eurofins Denver

QC Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: SM 2320B - Alkalinity

Lab Sample ID: MB 280-661358/33

Matrix: Water

Analysis Batch: 661358

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total Alkalinity	ND		10		mg/L			07/22/24 20:22	1
Bicarbonate Alkalinity	ND		10		mg/L			07/22/24 20:22	1
Carbonate Alkalinity	ND		10		mg/L			07/22/24 20:22	1

Lab Sample ID: LCS 280-661358/32

Matrix: Water

Analysis Batch: 661358

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Total Alkalinity	200	185		mg/L		92	89 - 110

Lab Sample ID: 280-194308-1 DU

Matrix: Water

Analysis Batch: 661358

Client Sample ID: SW-1-240717

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	DU Result	DU Qualifier	Unit	D	RPD	RPD Limit
Total Alkalinity	71		72.2		mg/L		2	10
Bicarbonate Alkalinity	71		72.2		mg/L		2	20
Carbonate Alkalinity	ND		ND		mg/L		NC	20

Method: SM 5310B - Organic Carbon, Total (TOC)

Lab Sample ID: MB 280-661410/35

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total Organic Carbon - Quad	ND		1.0		mg/L			07/22/24 23:16	1

Lab Sample ID: MB 280-661410/4

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total Organic Carbon - Quad	ND		1.0		mg/L			07/22/24 15:22	1

Lab Sample ID: LCS 280-661410/3

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Total Organic Carbon - Quad	25.0	25.5		mg/L		102	88 - 112

Lab Sample ID: LCS 280-661410/34

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Total Organic Carbon - Quad	25.0	25.4		mg/L		102	88 - 112

Eurofins Denver

QC Sample Results

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Method: SM 5310B - Organic Carbon, Total (TOC) (Continued)

Lab Sample ID: 280-194247-C-1 MS

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Matrix Spike

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits		
Total Organic Carbon - Quad	3.3		25.0	28.2		mg/L		100	88 - 112		

Lab Sample ID: 280-194247-C-1 MSD

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Matrix Spike Duplicate

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Total Organic Carbon - Quad	3.3		25.0	28.3		mg/L		100	88 - 112	0	15

Lab Sample ID: 280-194247-C-9 MS

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Matrix Spike

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits		
Total Organic Carbon - Quad	15		25.0	40.1		mg/L		100	88 - 112		

Lab Sample ID: 280-194247-C-9 MSD

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Matrix Spike Duplicate

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Total Organic Carbon - Quad	15		25.0	40.0		mg/L		100	88 - 112	0	15

Lab Sample ID: 280-194310-H-1 MS

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Matrix Spike

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits		
Total Organic Carbon - Quad	9.8		25.0	35.1		mg/L		101	88 - 112		

Lab Sample ID: 280-194310-H-1 MSD

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Matrix Spike Duplicate

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Total Organic Carbon - Quad	9.8		25.0	35.2		mg/L		102	88 - 112	0	15

Lab Sample ID: 280-194328-E-5 MS

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Matrix Spike

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits		
Total Organic Carbon - Quad	ND		25.0	25.9		mg/L		100	88 - 112		

Lab Sample ID: 280-194328-E-5 MSD

Matrix: Water

Analysis Batch: 661410

Client Sample ID: Matrix Spike Duplicate

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Total Organic Carbon - Quad	ND		25.0	25.6		mg/L		99	88 - 112	1	15

Eurofins Denver

QC Association Summary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

GC/MS VOA

Analysis Batch: 719385

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
280-194308-1	SW-1-240717	Total/NA	Water	8260C SIM	
280-194308-2	SW-4-240717	Total/NA	Water	8260C SIM	
280-194308-3	SW-6-240717	Total/NA	Water	8260C SIM	
280-194308-4	SW-7-240717	Total/NA	Water	8260C SIM	
280-194308-5	MW-7-240717	Total/NA	Water	8260C SIM	
280-194308-6	MW-5-240717	Total/NA	Water	8260C SIM	
280-194308-7	MW-12I-240717	Total/NA	Water	8260C SIM	
280-194308-8	MW-13D-240717	Total/NA	Water	8260C SIM	
280-194308-9	MW-6-240717	Total/NA	Water	8260C SIM	
280-194308-10	MW-14-240717	Total/NA	Water	8260C SIM	
280-194308-11	MW-20DD-240717	Total/NA	Water	8260C SIM	
280-194308-12	TB1-240717	Total/NA	Water	8260C SIM	
280-194308-13	TB2-240717	Total/NA	Water	8260C SIM	
MB 480-719385/9	Method Blank	Total/NA	Water	8260C SIM	
LCS 480-719385/6	Lab Control Sample	Total/NA	Water	8260C SIM	
LCSD 480-719385/7	Lab Control Sample Dup	Total/NA	Water	8260C SIM	

Metals

Prep Batch: 661154

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
280-194308-1	SW-1-240717	Dissolved	Water	3005A	
280-194308-2	SW-4-240717	Dissolved	Water	3005A	
280-194308-3	SW-6-240717	Dissolved	Water	3005A	
280-194308-4	SW-7-240717	Dissolved	Water	3005A	
280-194308-5	MW-7-240717	Dissolved	Water	3005A	
280-194308-6	MW-5-240717	Dissolved	Water	3005A	
280-194308-7	MW-12I-240717	Dissolved	Water	3005A	
280-194308-8	MW-13D-240717	Dissolved	Water	3005A	
280-194308-9	MW-6-240717	Dissolved	Water	3005A	
280-194308-10	MW-14-240717	Dissolved	Water	3005A	
280-194308-11	MW-20DD-240717	Dissolved	Water	3005A	
MB 280-661154/1-A	Method Blank	Total Recoverable	Water	3005A	
LCS 280-661154/2-A	Lab Control Sample	Total Recoverable	Water	3005A	
280-194169-B-8-B MS	Matrix Spike	Dissolved	Water	3005A	
280-194169-B-8-C MSD	Matrix Spike Duplicate	Dissolved	Water	3005A	

Analysis Batch: 661353

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
280-194308-1	SW-1-240717	Dissolved	Water	6020B	661154
280-194308-2	SW-4-240717	Dissolved	Water	6020B	661154
280-194308-3	SW-6-240717	Dissolved	Water	6020B	661154
280-194308-4	SW-7-240717	Dissolved	Water	6020B	661154
280-194308-5	MW-7-240717	Dissolved	Water	6020B	661154
280-194308-6	MW-5-240717	Dissolved	Water	6020B	661154
280-194308-7	MW-12I-240717	Dissolved	Water	6020B	661154
280-194308-8	MW-13D-240717	Dissolved	Water	6020B	661154
280-194308-9	MW-6-240717	Dissolved	Water	6020B	661154
280-194308-10	MW-14-240717	Dissolved	Water	6020B	661154
280-194308-11	MW-20DD-240717	Dissolved	Water	6020B	661154
MB 280-661154/1-A	Method Blank	Total Recoverable	Water	6020B	661154

Eurofins Denver

QC Association Summary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Metals (Continued)

Analysis Batch: 661353 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
LCS 280-661154/2-A	Lab Control Sample	Total Recoverable	Water	6020B	661154
280-194169-B-8-B MS	Matrix Spike	Dissolved	Water	6020B	661154
280-194169-B-8-C MSD	Matrix Spike Duplicate	Dissolved	Water	6020B	661154

General Chemistry

Analysis Batch: 661246

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
280-194308-1	SW-1-240717	Total/NA	Water	300.0	
280-194308-2	SW-4-240717	Total/NA	Water	300.0	
280-194308-3	SW-6-240717	Total/NA	Water	300.0	
280-194308-4	SW-7-240717	Total/NA	Water	300.0	
280-194308-5	MW-7-240717	Total/NA	Water	300.0	
280-194308-6	MW-5-240717	Total/NA	Water	300.0	
280-194308-7	MW-12I-240717	Total/NA	Water	300.0	
280-194308-8	MW-13D-240717	Total/NA	Water	300.0	
280-194308-9	MW-6-240717	Total/NA	Water	300.0	
280-194308-10	MW-14-240717	Total/NA	Water	300.0	
280-194308-11	MW-20DD-240717	Total/NA	Water	300.0	
MB 280-661246/42	Method Blank	Total/NA	Water	300.0	
MB 280-661246/6	Method Blank	Total/NA	Water	300.0	
LCS 280-661246/4	Lab Control Sample	Total/NA	Water	300.0	
LCS 280-661246/40	Lab Control Sample	Total/NA	Water	300.0	
LCSD 280-661246/41	Lab Control Sample Dup	Total/NA	Water	300.0	
LCSD 280-661246/5	Lab Control Sample Dup	Total/NA	Water	300.0	
MRL 280-661246/3	Lab Control Sample	Total/NA	Water	300.0	
280-194308-8 MS	MW-13D-240717	Total/NA	Water	300.0	
280-194308-8 MSD	MW-13D-240717	Total/NA	Water	300.0	
280-194308-11 MS	MW-20DD-240717	Total/NA	Water	300.0	
280-194308-11 MSD	MW-20DD-240717	Total/NA	Water	300.0	
280-194308-8 DU	MW-13D-240717	Total/NA	Water	300.0	
280-194308-11 DU	MW-20DD-240717	Total/NA	Water	300.0	

Analysis Batch: 661358

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
280-194308-1	SW-1-240717	Total/NA	Water	SM 2320B	
280-194308-2	SW-4-240717	Total/NA	Water	SM 2320B	
280-194308-3	SW-6-240717	Total/NA	Water	SM 2320B	
280-194308-4	SW-7-240717	Total/NA	Water	SM 2320B	
280-194308-5	MW-7-240717	Total/NA	Water	SM 2320B	
280-194308-6	MW-5-240717	Total/NA	Water	SM 2320B	
280-194308-7	MW-12I-240717	Total/NA	Water	SM 2320B	
280-194308-8	MW-13D-240717	Total/NA	Water	SM 2320B	
280-194308-9	MW-6-240717	Total/NA	Water	SM 2320B	
280-194308-10	MW-14-240717	Total/NA	Water	SM 2320B	
280-194308-11	MW-20DD-240717	Total/NA	Water	SM 2320B	
MB 280-661358/33	Method Blank	Total/NA	Water	SM 2320B	
LCS 280-661358/32	Lab Control Sample	Total/NA	Water	SM 2320B	
280-194308-1 DU	SW-1-240717	Total/NA	Water	SM 2320B	

Eurofins Denver

QC Association Summary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

General Chemistry

Analysis Batch: 661410

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
280-194308-1	SW-1-240717	Total/NA	Water	SM 5310B	
280-194308-2	SW-4-240717	Total/NA	Water	SM 5310B	
280-194308-3	SW-6-240717	Total/NA	Water	SM 5310B	
280-194308-4	SW-7-240717	Total/NA	Water	SM 5310B	
280-194308-5	MW-7-240717	Total/NA	Water	SM 5310B	
280-194308-6	MW-5-240717	Total/NA	Water	SM 5310B	
280-194308-7	MW-12I-240717	Total/NA	Water	SM 5310B	
280-194308-8	MW-13D-240717	Total/NA	Water	SM 5310B	
280-194308-9	MW-6-240717	Total/NA	Water	SM 5310B	
280-194308-10	MW-14-240717	Total/NA	Water	SM 5310B	
280-194308-11	MW-20DD-240717	Total/NA	Water	SM 5310B	
MB 280-661410/35	Method Blank	Total/NA	Water	SM 5310B	
MB 280-661410/4	Method Blank	Total/NA	Water	SM 5310B	
LCS 280-661410/3	Lab Control Sample	Total/NA	Water	SM 5310B	
LCS 280-661410/34	Lab Control Sample	Total/NA	Water	SM 5310B	
280-194247-C-1 MS	Matrix Spike	Total/NA	Water	SM 5310B	
280-194247-C-1 MSD	Matrix Spike Duplicate	Total/NA	Water	SM 5310B	
280-194247-C-9 MS	Matrix Spike	Total/NA	Water	SM 5310B	
280-194247-C-9 MSD	Matrix Spike Duplicate	Total/NA	Water	SM 5310B	
280-194310-H-1 MS	Matrix Spike	Total/NA	Water	SM 5310B	
280-194310-H-1 MSD	Matrix Spike Duplicate	Total/NA	Water	SM 5310B	
280-194328-E-5 MS	Matrix Spike	Total/NA	Water	SM 5310B	
280-194328-E-5 MSD	Matrix Spike Duplicate	Total/NA	Water	SM 5310B	

Analysis Batch: 661462

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
280-194308-1	SW-1-240717	Total/NA	Water	350.1	
280-194308-2	SW-4-240717	Total/NA	Water	350.1	
280-194308-3	SW-6-240717	Total/NA	Water	350.1	
280-194308-4	SW-7-240717	Total/NA	Water	350.1	
280-194308-5	MW-7-240717	Total/NA	Water	350.1	
280-194308-6	MW-5-240717	Total/NA	Water	350.1	
280-194308-7	MW-12I-240717	Total/NA	Water	350.1	
280-194308-8	MW-13D-240717	Total/NA	Water	350.1	
280-194308-9	MW-6-240717	Total/NA	Water	350.1	
280-194308-10	MW-14-240717	Total/NA	Water	350.1	
280-194308-11	MW-20DD-240717	Total/NA	Water	350.1	
MB 280-661462/21	Method Blank	Total/NA	Water	350.1	
LCS 280-661462/22	Lab Control Sample	Total/NA	Water	350.1	
280-194308-1 MS	SW-1-240717	Total/NA	Water	350.1	
280-194308-1 MSD	SW-1-240717	Total/NA	Water	350.1	
280-194308-11 MS	MW-20DD-240717	Total/NA	Water	350.1	
280-194308-11 MSD	MW-20DD-240717	Total/NA	Water	350.1	

Lab Chronicle

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Client Sample ID: SW-1-240717

Lab Sample ID: 280-194308-1

Date Collected: 07/17/24 10:40

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/23/24 21:48	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:16	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/22/24 18:26	IRC	EET DEN
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 11:42	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 20:27	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/22/24 20:41	GMW	EET DEN

Client Sample ID: SW-4-240717

Lab Sample ID: 280-194308-2

Date Collected: 07/17/24 11:40

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/23/24 22:10	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:20	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/22/24 18:15	IRC	EET DEN
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 11:49	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 20:38	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/22/24 20:55	GMW	EET DEN

Client Sample ID: SW-6-240717

Lab Sample ID: 280-194308-3

Date Collected: 07/17/24 12:25

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/23/24 22:32	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:23	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/22/24 18:04	IRC	EET DEN
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 11:51	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 20:44	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/22/24 21:43	GMW	EET DEN

Client Sample ID: SW-7-240717

Lab Sample ID: 280-194308-4

Date Collected: 07/17/24 14:25

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/23/24 22:55	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:27	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/22/24 17:53	IRC	EET DEN

Eurofins Denver

Lab Chronicle

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Client Sample ID: SW-7-240717

Lab Sample ID: 280-194308-4

Date Collected: 07/17/24 14:25

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 11:53	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 20:49	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/22/24 21:57	GMW	EET DEN

Client Sample ID: MW-7-240717

Lab Sample ID: 280-194308-5

Date Collected: 07/17/24 08:15

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/23/24 23:17	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:30	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/23/24 06:10	IRC	EET DEN
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 11:55	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 20:54	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/22/24 22:13	GMW	EET DEN

Client Sample ID: MW-5-240717

Lab Sample ID: 280-194308-6

Date Collected: 07/17/24 09:35

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/23/24 23:40	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:34	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/23/24 05:59	IRC	EET DEN
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 11:57	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 20:59	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/22/24 22:29	GMW	EET DEN

Client Sample ID: MW-12I-240717

Lab Sample ID: 280-194308-7

Date Collected: 07/17/24 11:15

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/24/24 00:03	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:38	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/23/24 05:48	IRC	EET DEN
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 12:00	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 21:04	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/22/24 22:43	GMW	EET DEN

Eurofins Denver

Lab Chronicle

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Client Sample ID: MW-13D-240717

Lab Sample ID: 280-194308-8

Date Collected: 07/17/24 13:25

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/24/24 00:26	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:41	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/23/24 05:04	IRC	EET DEN
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 12:02	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 21:09	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/23/24 02:55	GMW	EET DEN

Client Sample ID: MW-6-240717

Lab Sample ID: 280-194308-9

Date Collected: 07/17/24 16:05

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/24/24 00:49	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:52	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/23/24 04:53	IRC	EET DEN
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 12:04	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 21:14	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/23/24 04:54	GMW	EET DEN

Client Sample ID: MW-14-240717

Lab Sample ID: 280-194308-10

Date Collected: 07/17/24 16:00

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/24/24 01:11	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:56	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/23/24 04:42	IRC	EET DEN
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 12:06	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 21:20	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/23/24 05:08	GMW	EET DEN

Client Sample ID: MW-20DD-240717

Lab Sample ID: 280-194308-11

Date Collected: 07/17/24 07:00

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/24/24 01:33	CDC	EET BUF
Dissolved	Prep	3005A			50 mL	50 mL	661154	07/22/24 08:45	AMH	EET DEN
Dissolved	Analysis	6020B		1			661353	07/23/24 00:59	LMT	EET DEN
Total/NA	Analysis	300.0		1	10 mL	10 mL	661246	07/23/24 03:58	IRC	EET DEN

Eurofins Denver

Lab Chronicle

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Client Sample ID: MW-20DD-240717

Lab Sample ID: 280-194308-11

Date Collected: 07/17/24 07:00

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	350.1		1	10 mL	10 mL	661462	07/23/24 12:24	LBR	EET DEN
Total/NA	Analysis	SM 2320B		1			661358	07/22/24 21:37	EL	EET DEN
Total/NA	Analysis	SM 5310B		1	20 mL	20 mL	661410	07/23/24 05:24	GMW	EET DEN

Client Sample ID: TB1-240717

Lab Sample ID: 280-194308-12

Date Collected: 07/17/24 07:00

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/24/24 01:56	CDC	EET BUF

Client Sample ID: TB2-240717

Lab Sample ID: 280-194308-13

Date Collected: 07/17/24 07:00

Matrix: Water

Date Received: 07/19/24 09:20

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C SIM		1	25 mL	25 mL	719385	07/24/24 02:18	CDC	EET BUF

Laboratory References:

EET BUF = Eurofins Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

EET DEN = Eurofins Denver, 4955 Yarrow Street, Arvada, CO 80002, TEL (303)736-0100

SC0056 = Analytical Resources, Inc, 4611 South 134th Place, Suite 100, Tukwila, WA 98168, TEL (206)695-6200

Accreditation/Certification Summary

Client: Aspect Consulting
Project/Site: Hansville Landfill

Job ID: 280-194308-1

Laboratory: Eurofins Denver

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
Washington	State	C583	08-03-24

The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.

Analysis Method	Prep Method	Matrix	Analyte
SM 5310B		Water	Total Organic Carbon - Quad

Laboratory: Eurofins Buffalo

All accreditations/certifications held by this laboratory are listed. Not all accreditations/certifications are applicable to this report.

Authority	Program	Identification Number	Expiration Date
Arkansas DEQ	State	88-00686	07-06-25
Connecticut	State	PH-0807	03-31-25
Georgia	State	10026 (NY)	03-31-25
Georgia	State Program	N/A	03-31-09 *
Illinois	NELAP	200003	09-30-24
Iowa	State	374	03-01-25
Iowa	State Program	374	03-01-09 *
Kansas	NELAP	E-10187	02-01-25
Kentucky (UST)	State	108092	04-01-25
Kentucky (WW)	State	KY90029	12-31-24
Maine	State	NY00044	12-04-24
Maryland	State	294	06-30-25
Massachusetts	State	M-NY044	07-01-25
Michigan	State	9937	03-31-25
Michigan	State Program	9937	04-01-09 *
New Hampshire	NELAP	2973	09-11-19 *
New Hampshire	NELAP	2337	11-17-24
New Jersey	NELAP	NY455	07-02-25
New York	NELAP	10026	03-31-25
Pennsylvania	NELAP	68-00281	08-31-24
Rhode Island	State	LAO00378	12-30-24
Virginia	NELAP	460185	09-14-24
Washington	State	C784	02-10-25
Wisconsin	State	998310390	08-31-24

* Accreditation/Certification renewal pending - accreditation/certification considered valid.

Eurofins Denver



Analytical Resources, LLC
Analytical Chemists and Consultants
Tukwila, WA

29 August 2024

Janice Collins
Eurofins - Test America - Denver
4955 Yarrow Street
Arvada, CO 80002

RE: Hansville Landfill (28006013-2Q_3Q_4Q Sampling)

Please find enclosed sample receipt documentation and analytical results for samples from the project referenced above.

Sample analyses were performed according to ARI's Quality Assurance Plan and any provided project specific Quality Assurance Plan. Each analytical section of this report has been approved and reviewed by an analytical peer, the appropriate Laboratory Supervisor or qualified substitute, and a technical reviewer.

Should you have any questions or problems, please feel free to contact us at your convenience.

Associated Work Order(s)
24G0408

Associated SDG ID(s)
N/A

I certify that this data package is in compliance with the terms and conditions of the contract, both technically and for completeness, for other than the conditions detailed in the enclose Narrative. ARI, an accredited laboratory, certifies that the report results for which ARI is accredited meets all the requirements of the accrediting body. A list of certified analyses, accreditations, and expiration dates is included in this report.

Release of the data contained in this hardcopy data package has been authorized by the Laboratory Manager or his/her designee, as verified by the following signature.

Analytical Resources, LLC

Phillip Bates For Shelly Fishel, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.



Chain of Custody Record

Client Information		Lab PM: Collins, Janice S		Carrier Tracking No(s):		COC No: 280-125973-19522.1											
Client Contact: Peter Bannister		E-Mail: Janice.Collins@et.eurofins.com		State of Origin:		Page:											
Company: Aspect Consulting, LLC		PWSID:		Job #:													
Address: 350 Madison Ave N		Due Date Requested:		Analysis Requested													
City: Bainbridge Island		TAT Requested (days):															
State, Zip: WA, 98110		Compliance Project: ☐ Yes ☒ No															
Phone: 404-210-6437		Purchase Order not required															
Email: Peter.Bannister@aspectconsulting.com		WO #:															
Project Name: Hansville Landfill		Project # skip sites/events: 28006013 - 2Q_3Q_4Q Sampling															
Site: Washington		SSOW#:															
Carmen: Tupper@aspectconsulting.com																	
Sample Identification		Sample Date	Sample Time	Sample Type (C=Comp, G=Grab)	Matrix (W=water, S=solid, O=wastewater, BT=Tissue, AA=Air)	Field Filtered Sample (Yes or No)	Perform MS/MSD (Yes or No)	Alks/Cl/SO4	6020 - Dissolved Metals (field filtered)	Ammonia/TOC	8260C SIM - Vinyl Chloride (Buffalo)	Ortho-phosphate (field filtered) - Direct sub to ARI	Dissolved Arsenic (Direct sub to ARI)	Nitrate/Nitrite (IC) - Direct sub to ARI	Total Number of containers	Preservation Codes:	Special Instructions/Note:
SW-1-240717	7/17/24	1040	G	W													Diss As, NO3, NO2, o-phos subbed direct to ARI
SW-4-240717		1140															
SW-6-240717		1225															
SW-7-240717		1425															
MW-7-240717		0815															
MW-5-240717		0935															
MW-12-240717		1115															
MW-13D-240717		1325															
MW-6-240717		1605															
MW-14-240717		1600															
MW-20DD-240717		0700															
Possible Hazard Identification		☐ Non-Hazard ☐ Flammable ☐ Skin Irritant ☐ Poison B ☐ Unknown ☐ Radiological		Sample Disposal (A fee may be assessed if samples are retained longer than 1 month)													
Deliverable Requested: I, II, III, IV, Other (specify)				☐ Return To Client ☐ Disposal By Lab ☐ Archive For Months													
Empty Kit Relinquished by:		Date:		Method of Shipment:													
Relinquished by: Emily Benson		Date/Time: 7/18/24 10:25		Received by: JW													
Relinquished by:		Date/Time:		Received by: Savannah Wright													
Relinquished by:		Date/Time:		Received by:													
Custody Seals Intact: ☐ Yes ☒ No		Custody Seal No.:		Cooler Temperature(s) °C and Other Remarks:													



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
SW-1-240717	24G0408-01	Water	17-Jul-2024 10:40	18-Jul-2024 10:24
SW-4-240717	24G0408-02	Water	17-Jul-2024 11:40	18-Jul-2024 10:24
SW-6-240717	24G0408-03	Water	17-Jul-2024 12:25	18-Jul-2024 10:24
SW-7-240717	24G0408-04	Water	17-Jul-2024 14:25	18-Jul-2024 10:24
MW-7-240717	24G0408-05	Water	17-Jul-2024 08:15	18-Jul-2024 10:24
MW-5-240717	24G0408-06	Water	17-Jul-2024 09:35	18-Jul-2024 10:24
MW-12I-240717	24G0408-07	Water	17-Jul-2024 11:15	18-Jul-2024 10:24
MW-13D-240717	24G0408-08	Water	17-Jul-2024 13:25	18-Jul-2024 10:24
MW-6-240717	24G0408-09	Water	17-Jul-2024 16:05	18-Jul-2024 10:24
MW-14-240717	24G0408-10	Water	17-Jul-2024 16:00	18-Jul-2024 10:24
MW-20DD-240717	24G0408-11	Water	17-Jul-2024 07:00	18-Jul-2024 10:24



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

Work Order Case Narrative

Client: Eurofins - Test America - Denver
Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Work Order: 24G0408

Revised Report - 08/29/24

The report was revised to include additional information on the Nitrate and Nitrite analysis.

Sample receipt

Samples as listed on the preceding page were received 18-Jul-2024 10:24 under ARI work order 24G0408. For details regarding sample receipt, please refer to the Cooler Receipt Form.

Dissolved Metals - EPA Method 200.8

The sample(s) were prepared and analyzed within the recommended holding times.

Initial and continuing calibrations including interference checks were within method requirements for reported elements.

The method blank(s) were clean at the reporting limits.

The blank spike (BS/LCS) percent recoveries were within control limits.

The matrix spike (MS) percent recoveries and the duplicate (DUP) relative percent difference (RPD) were within advisory control limits.

Wet Chemistry

The sample(s) were prepared and analyzed within the recommended holding times except as follows. Both the Nitrate and Nitrite were run out of hold. The samples were originally run in hold but had QC failures; all the calibration verifications and LCS recoveries were above the control limits. Something in the instrument was biasing all the results high for that run. The samples were rerun out of hold with passing QC. Both the in hold and out of hold data was reported to demonstrate that when the slight high bias in the first run is considered, the results stayed consistent for the out of hold run. The out of hold data has been flagged with "H" qualifiers.

Initial and continuing calibrations were within method requirements except as follows. In the initial Nitrate and Nitrite run the ICV and CCVs were out of control high.

The method blank(s) were clean at the reporting limits.

The blank spike (BS/LCS) percent recoveries were within control limits.



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

The duplicate (DUP) relative percent difference (RPD) were within advisory control limits. The matrix spike/matrix spike duplicate (MS/MSD) spike recoveries and relative percent difference (RPD) were within advisory control limits.



WORK ORDER

24G0408

Samples will be discarded 90 days after submission of a final report unless other instructions are received

Client: Eurofins - Test America - Denver

Project Manager: Shelly Fishel

Project: Hansville Landfill

Project Number: [none]

Preservation Confirmation

Container ID	Container Type	pH	
24G0408-01 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-01 B	HDPE NM, 500 mL		
24G0408-01 C	HDPE NM, 500 mL (FF)		
24G0408-02 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-02 B	HDPE NM, 500 mL		
24G0408-02 C	HDPE NM, 500 mL (FF)		
24G0408-03 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-03 B	HDPE NM, 500 mL		
24G0408-03 C	HDPE NM, 500 mL (FF)		
24G0408-04 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-04 B	HDPE NM, 500 mL		
24G0408-04 C	HDPE NM, 500 mL (FF)		
24G0408-05 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	>2	F
24G0408-05 B	HDPE NM, 500 mL		
24G0408-05 C	HDPE NM, 500 mL (FF)		
24G0408-06 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-06 B	HDPE NM, 500 mL		
24G0408-06 C	HDPE NM, 500 mL (FF)		
24G0408-07 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-07 B	HDPE NM, 500 mL		
24G0408-07 C	HDPE NM, 500 mL (FF)		
24G0408-08 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-08 B	HDPE NM, 500 mL		
24G0408-08 C	HDPE NM, 500 mL (FF)		
24G0408-09 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-09 B	HDPE NM, 500 mL		
24G0408-09 C	HDPE NM, 500 mL (FF)		
24G0408-10 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-10 B	HDPE NM, 500 mL		
24G0408-10 C	HDPE NM, 500 mL (FF)		
24G0408-11 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-11 B	HDPE NM, 500 mL		
24G0408-11 C	HDPE NM, 500 mL (FF)		



WORK ORDER

24G0408

Samples will be discarded 90 days after submission of a final report unless other instructions are received

Client: Eurofins - Test America - Denver

Project Manager: Shelly Fishel

Project: Hansville Landfill

Project Number: [none]


Preservation Confirmed By

7-18-24
Date



Analytical Resources, LLC
Analytical Chemists and Consultants

Cooler Receipt Form

ARI Client: Aspect Consulting

COC No(s): _____ (NA)

Assigned ARI Job No: 24G0408

Project Name: Hansville Landfill

Delivered by: Fed-Ex UPS Courier Hand Delivered Other: _____

Tracking No: _____ (NA)

Preliminary Examination Phase:

Were intact, properly signed and dated custody seals attached to the outside of the cooler? _____

YES (NO)

Were custody papers included with the cooler? _____

YES NO

Were custody papers properly filled out (ink, signed, etc.) _____

YES NO

Temperature of Cooler(s) (°C) (recommended 2.0-6.0 °C for chemistry)

Time 10:24

3.3

If cooler temperature is out of compliance fill out form 00070F

Temp Gun ID#: 041

Cooler Accepted by: JW Date: 7-18-24 Time: 10:24

Complete custody forms and attach all shipping documents

Log-In Phase:

Was a temperature blank included in the cooler? _____

YES (NO)

What kind of packing material was used? ... Bubble Wrap Wet Ice Gel Packs Baggies Foam Block Paper Other: _____

Was sufficient ice used (if appropriate)? _____

NA YES NO

How were bottles sealed in plastic bags? _____

Individually Grouped Not

Did all bottles arrive in good condition (unbroken)? _____

YES NO

Were all bottle labels complete and legible? _____

YES NO

Did the number of containers listed on COC match with the number of containers received? _____

YES NO

Did all bottle labels and tags agree with custody papers? _____

YES NO

Were all bottles used correct for the requested analyses? _____

YES NO

Do any of the analyses (bottles) require preservation? (attach preservation sheet, excluding VOCs) ...

NA YES NO

Were all VOC vials free of air bubbles? _____

NA YES NO

Was sufficient amount of sample sent in each bottle? _____

YES NO

Date VOC Trip Blank was made at ARI: _____

NA

Were the sample(s) split by ARI? _____

(NA)

YES

Date/Time: _____

Equipment: _____

Split by: _____

Samples Logged by: JW Date: 7/18/24 Time: 11:10 Labels checked by: _____

**** Notify Project Manager of discrepancies or concerns ****

Sample ID on Bottle	Sample ID on COC	Sample ID on Bottle	Sample ID on COC

Additional Notes, Discrepancies, & Resolutions:

By: _____ Date: _____



WORK ORDER

24G0408

Samples will be discarded 90 days after submission of a final report unless other instructions are received

Client: Eurofins - Test America - Denver

Project Manager: Shelly Fishel

Project: Hansville Landfill

Project Number: [none]

Preservation Confirmation

Container ID	Container Type	pH	
24G0408-01 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-01 B	HDPE NM, 500 mL		
24G0408-01 C	HDPE NM, 500 mL (FF)		
24G0408-02 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-02 B	HDPE NM, 500 mL		
24G0408-02 C	HDPE NM, 500 mL (FF)		
24G0408-03 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-03 B	HDPE NM, 500 mL		
24G0408-03 C	HDPE NM, 500 mL (FF)		
24G0408-04 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-04 B	HDPE NM, 500 mL		
24G0408-04 C	HDPE NM, 500 mL (FF)		
24G0408-05 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	>2	F (1)
24G0408-05 B	HDPE NM, 500 mL		
24G0408-05 C	HDPE NM, 500 mL (FF)		
24G0408-06 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-06 B	HDPE NM, 500 mL		
24G0408-06 C	HDPE NM, 500 mL (FF)		
24G0408-07 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-07 B	HDPE NM, 500 mL		
24G0408-07 C	HDPE NM, 500 mL (FF)		
24G0408-08 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-08 B	HDPE NM, 500 mL		
24G0408-08 C	HDPE NM, 500 mL (FF)		
24G0408-09 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-09 B	HDPE NM, 500 mL		
24G0408-09 C	HDPE NM, 500 mL (FF)		
24G0408-10 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-10 B	HDPE NM, 500 mL		
24G0408-10 C	HDPE NM, 500 mL (FF)		
24G0408-11 A	HDPE NM, 500 mL, 1:1 HNO3 (FF)	L2	P
24G0408-11 B	HDPE NM, 500 mL		
24G0408-11 C	HDPE NM, 500 mL (FF)		



WORK ORDER

24G0408


Samples will be discarded 90 days after submission of a final report unless other instructions are received

Client: Eurofins - Test America - Denver

Project Manager: Shelly Fishel

Project: Hansville Landfill

Project Number: [none]


Preservation Confirmed By

7-18-24
Date

① checked preservation and sample
was already pH<2.
7/22/24 JS



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-1-240717
24G0408-01 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 10:40

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 20:24

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-01 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	1	0.0373	0.200	1.67	ug/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-1-240717
24G0408-01 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 10:40

Instrument: IC930 Analyst: SRB

Analyzed: 07/18/2024 19:47

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-01 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	2.74	mg/L	

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	0.147	mg/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-1-240717
24G0408-01 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 10:40

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 12:52

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP
Preparation Batch: BMG0456
Prepared: 07/18/2024

Sample Size: 50 mL
Final Volume: 50 mL

Extract ID: 24G0408-01 C

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.0350	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-1-240717
24G0408-01RE2 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 10:40

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 17:27

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-01RE2 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	1.60	mg/L	H

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-4-240717
24G0408-02 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 11:40

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 22:01

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-02 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	1	0.0373	0.200	1.49	ug/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-4-240717
24G0408-02 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 11:40

Instrument: IC930 Analyst: SRB

Analyzed: 07/18/2024 20:47

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-02 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	1.65	mg/L	

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-4-240717
24G0408-02 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 11:40

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 12:54

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP
Preparation Batch: BMG0456
Prepared: 07/18/2024

Sample Size: 50 mL
Final Volume: 50 mL

Extract ID: 24G0408-02 C

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.0260	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-4-240717
24G0408-02RE2 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 11:40

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 18:47

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-02RE2 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	0.863	mg/L	H

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-6-240717
24G0408-03 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 12:25

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 22:05

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-03 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	1	0.0373	0.200	3.63	ug/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-6-240717
24G0408-03 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 12:25

Instrument: IC930 Analyst: SRB

Analyzed: 07/18/2024 21:07

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-03 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	0.154	mg/L	

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-6-240717
24G0408-03 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 12:25

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 12:54

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP
Preparation Batch: BMG0456
Prepared: 07/18/2024

Sample Size: 50 mL
Final Volume: 50 mL

Extract ID: 24G0408-03 C

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.0600	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-6-240717
24G0408-03RE1 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 12:25

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 19:07

Sample Preparation:

Preparation Method: No Prep Wet Chem

Extract ID: 24G0408-03RE1 B

Preparation Batch: BMG0466

Sample Size: 10 mL

Prepared: 07/18/2024

Final Volume: 10 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	ND	mg/L	H, U

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-7-240717
24G0408-04 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 14:25

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 22:10

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-04 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	1	0.0373	0.200	2.22	ug/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-7-240717
24G0408-04 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 14:25

Instrument: IC930 Analyst: SRB

Analyzed: 07/18/2024 21:27

Sample Preparation:

Preparation Method: No Prep Wet Chem

Extract ID: 24G0408-04 B

Preparation Batch: BMG0466

Sample Size: 10 mL

Prepared: 07/18/2024

Final Volume: 10 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	0.392	mg/L	

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-7-240717
24G0408-04 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 14:25

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 12:55

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP

Extract ID: 24G0408-04 C

Preparation Batch: BMG0456

Sample Size: 50 mL

Prepared: 07/18/2024

Final Volume: 50 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.132	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

SW-7-240717
24G0408-04RE2 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 14:25

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 19:27

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-04RE2 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	0.247	mg/L	H

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-7-240717
24G0408-05 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 08:15

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 22:15

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-05 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	1	0.0373	0.200	1.29	ug/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-7-240717
24G0408-05 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 08:15

Instrument: IC930 Analyst: SRB

Analyzed: 07/18/2024 22:48

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-05 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	0.801	mg/L	

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-7-240717
24G0408-05 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 08:15

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 12:56

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP
Preparation Batch: BMG0456
Prepared: 07/18/2024

Sample Size: 50 mL
Final Volume: 50 mL

Extract ID: 24G0408-05 C

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.0420	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-7-240717
24G0408-05RE1 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 08:15

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 19:47

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-05RE1 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	0.495	mg/L	H

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-5-240717
24G0408-06 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 09:35

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 22:20

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-06 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	1	0.0373	0.200	1.74	ug/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-5-240717
24G0408-06 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 09:35

Instrument: IC930 Analyst: SRB

Analyzed: 07/18/2024 23:08

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-06 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	4.71	mg/L	

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-5-240717
24G0408-06 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 09:35

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 12:58

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP

Extract ID: 24G0408-06 C

Preparation Batch: BMG0456

Sample Size: 50 mL

Prepared: 07/18/2024

Final Volume: 50 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.0320	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-5-240717
24G0408-06RE2 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 09:35

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 21:07

Sample Preparation:

Preparation Method: No Prep Wet Chem

Extract ID: 24G0408-06RE2 B

Preparation Batch: BMG0466

Sample Size: 10 mL

Prepared: 07/18/2024

Final Volume: 10 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	3.02	mg/L	H

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-12I-240717
24G0408-07 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 11:15

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 22:25

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-07 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	1	0.0373	0.200	1.99	ug/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-12I-240717
24G0408-07 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 11:15

Instrument: IC930 Analyst: SRB

Analyzed: 07/18/2024 23:28

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-07 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	0.104	mg/L	

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-12I-240717

24G0408-07 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 11:15

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 12:58

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP

Extract ID: 24G0408-07 C

Preparation Batch: BMG0456

Sample Size: 50 mL

Prepared: 07/18/2024

Final Volume: 50 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.0440	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-12I-240717
24G0408-07RE2 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 11:15

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 21:27

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-07RE2 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	ND	mg/L	H, U

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-13D-240717

24G0408-08 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 13:25

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 22:30

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-08 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	1	0.0373	0.200	5.31	ug/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-13D-240717

24G0408-08 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 13:25

Instrument: IC930 Analyst: SRB

Analyzed: 07/18/2024 23:48

Sample Preparation:

Preparation Method: No Prep Wet Chem

Extract ID: 24G0408-08 C

Preparation Batch: BMG0466

Sample Size: 10 mL

Prepared: 07/18/2024

Final Volume: 10 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	ND	mg/L	U

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-13D-240717

24G0408-08 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 13:25

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 12:59

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP

Extract ID: 24G0408-08 C

Preparation Batch: BMG0456

Sample Size: 50 mL

Prepared: 07/18/2024

Final Volume: 50 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.0820	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-13D-240717
24G0408-08RE2 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 13:25

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 21:47

Sample Preparation:

Preparation Method: No Prep Wet Chem

Extract ID: 24G0408-08RE2 C

Preparation Batch: BMG0466

Sample Size: 10 mL

Prepared: 07/18/2024

Final Volume: 10 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	ND	mg/L	H, U

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-6-240717
24G0408-09 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 16:05

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 22:34

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-09 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	1	0.0373	0.200	1.76	ug/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-6-240717
24G0408-09 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 16:05

Instrument: IC930 Analyst: SRB

Analyzed: 07/19/2024 00:08

Sample Preparation:

Preparation Method: No Prep Wet Chem

Extract ID: 24G0408-09 B

Preparation Batch: BMG0466

Sample Size: 10 mL

Prepared: 07/18/2024

Final Volume: 10 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	0.149	mg/L	

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-6-240717
24G0408-09 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 16:05

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 12:59

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP
Preparation Batch: BMG0456
Prepared: 07/18/2024

Sample Size: 50 mL
Final Volume: 50 mL

Extract ID: 24G0408-09 C

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.0300	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-6-240717
24G0408-09RE2 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 16:05

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 22:07

Sample Preparation:

Preparation Method: No Prep Wet Chem

Extract ID: 24G0408-09RE2 B

Preparation Batch: BMG0466

Sample Size: 10 mL

Prepared: 07/18/2024

Final Volume: 10 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	0.128	mg/L	H

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-14-240717
24G0408-10 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 16:00

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 22:56

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-10 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	5	0.187	1.00	13.7	ug/L	D



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-14-240717
24G0408-10 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 16:00

Instrument: IC930 Analyst: SRB

Analyzed: 07/19/2024 00:28

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-10 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	ND	mg/L	U

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-14-240717
24G0408-10 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 16:00

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 13:00

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP
Preparation Batch: BMG0456
Prepared: 07/18/2024

Sample Size: 50 mL
Final Volume: 50 mL

Extract ID: 24G0408-10 C

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.142	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-14-240717
24G0408-10RE2 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 16:00

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 22:27

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-10RE2 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	ND	mg/L	H, U

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-20DD-240717
24G0408-11 (Water)

Metals and Metallic Compounds (dissolved)

Method: EPA 200.8 UCT-KED

Sampled: 07/17/2024 07:00

Instrument: ICPMS2 Analyst: HAL

Analyzed: 07/23/2024 23:01

Sample Preparation:

Preparation Method: REN - EPA 3010A M

Extract ID: 24G0408-11 A

Preparation Batch: BMG0516

Sample Size: 25 mL

Prepared: 07/22/2024

Final Volume: 25 mL

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Arsenic, Dissolved	7440-38-2	5	0.187	1.00	12.7	ug/L	D



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-20DD-240717
24G0408-11 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 07:00

Instrument: IC930 Analyst: SRB

Analyzed: 07/19/2024 00:48

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-11 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	ND	mg/L	U

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-20DD-240717
24G0408-11 (Water)

Wet Chemistry

Method: SM 4500-P E-11

Sampled: 07/17/2024 07:00

Instrument: UV1800-2 Analyst: SRB

Analyzed: 07/18/2024 13:01

Sample Preparation:

Preparation Method: SM 4500-P B-1 SRP
Preparation Batch: BMG0456
Prepared: 07/18/2024

Sample Size: 50 mL
Final Volume: 50 mL

Extract ID: 24G0408-11 C

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Orthophosphorus	1426-44-42	1	0.0040	0.0040	0.142	mg-P/L	



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

MW-20DD-240717
24G0408-11RE2 (Water)

Wet Chemistry

Method: EPA 300.0

Sampled: 07/17/2024 07:00

Instrument: IC930 Analyst: CDE

Analyzed: 07/29/2024 22:47

Sample Preparation:

Preparation Method: No Prep Wet Chem
Preparation Batch: BMG0466
Prepared: 07/18/2024

Sample Size: 10 mL
Final Volume: 10 mL

Extract ID: 24G0408-11RE2 B

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrate-N	14797-55-8	1	0.100	0.100	ND	mg/L	H, U

Analyte	CAS Number	Dilution	Detection Limit	Reporting Limit	Result	Units	Notes
Nitrite-N	14797-65-0	1	0.100	0.100	ND	mg/L	H, U



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

Analysis by: Analytical Resources, LLC

Metals and Metallic Compounds (dissolved) - Quality Control

Batch BMG0516 - EPA 200.8 UCT-KED

Instrument: ICPMS2 Analyst: HAL

QC Sample/Analyte	Isotope	Result	Detection Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Blank (BMG0516-BLK1)						Prepared: 22-Jul-2024 Analyzed: 23-Jul-2024 20:14						
Arsenic, Dissolved	75a	ND	0.0373	0.200	ug/L							U
LCS (BMG0516-BS1)						Prepared: 22-Jul-2024 Analyzed: 23-Jul-2024 20:19						
Arsenic, Dissolved	75a	25.3	0.0373	0.200	ug/L	25.0		101	80-120			
Duplicate (BMG0516-DUP1)						Source: 24G0408-01 Prepared: 22-Jul-2024 Analyzed: 23-Jul-2024 20:29						
Arsenic, Dissolved	75a	1.67	0.0373	0.200	ug/L		1.67			0.36	20	
Matrix Spike (BMG0516-MS1)						Source: 24G0408-01 Prepared: 22-Jul-2024 Analyzed: 23-Jul-2024 20:33						
Arsenic, Dissolved	75a	26.8	0.0373	0.200	ug/L	25.0	1.67	100	75-125			

Recovery limits for target analytes in MS/MSD QC samples are advisory only.



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

Analysis by: Analytical Resources, LLC

Wet Chemistry - Quality Control

Batch BMG0456 - SM 4500-P E-11

Instrument: UV1800-2 Analyst: SRB

QC Sample/Analyte	Result	Detection Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Blank (BMG0456-BLK1)						Prepared: 18-Jul-2024 Analyzed: 18-Jul-2024 12:50					
Orthophosphorus	ND	0.0040	0.0040	mg-P/L							U
LCS (BMG0456-BS1)						Prepared: 18-Jul-2024 Analyzed: 18-Jul-2024 12:51					
Orthophosphorus	0.155	0.0040	0.0040	mg-P/L	0.150		103	90-110			
Duplicate (BMG0456-DUP1)						Source: 24G0408-01 Prepared: 18-Jul-2024 Analyzed: 18-Jul-2024 12:52					
Orthophosphorus	0.0370	0.0040	0.0040	mg-P/L		0.0350			5.56	20	
Matrix Spike (BMG0456-MS1)						Source: 24G0408-01 Prepared: 18-Jul-2024 Analyzed: 18-Jul-2024 12:53					
Orthophosphorus	0.137	0.0040	0.0040	mg-P/L	0.101	0.0350	101	75-125			

Recovery limits for target analytes in MS/MSD QC samples are advisory only.



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

Analysis by: Analytical Resources, LLC

Wet Chemistry - Quality Control

Batch BMG0466 - EPA 300.0

Instrument: IC930 Analyst: CDE

QC Sample/Analyte	Result	Detection Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Blank (BMG0466-BLK2) Prepared: 18-Jul-2024 Analyzed: 29-Jul-2024 14:06											
Nitrate-N	ND	0.100	0.100	mg/L							U
Nitrite-N	ND	0.100	0.100	mg/L							U
LCS (BMG0466-BS2) Prepared: 18-Jul-2024 Analyzed: 29-Jul-2024 14:26											
Nitrate-N	4.86	0.100	0.100	mg/L	5.00		97.1	90-110			
Nitrite-N	4.96	0.100	0.100	mg/L	5.00		99.2	90-110			
LCS (BMG0466-BS3) Prepared: 18-Jul-2024 Analyzed: 09-Aug-2024 15:22											
Nitrate-N	4.95	0.100	0.100	mg/L	5.00		99.1	90-110			
Nitrite-N	5.05	0.100	0.100	mg/L	5.00		101	90-110			
Duplicate (BMG0466-DUP3) Source: 24G0408-01RE2 Prepared: 18-Jul-2024 Analyzed: 29-Jul-2024 17:47											
Nitrate-N	1.59	0.100	0.100	mg/L		1.60			0.25	20	
Nitrite-N	ND	0.100	0.100	mg/L		ND					U
Matrix Spike (BMG0466-MS3) Source: 24G0408-01RE2 Prepared: 18-Jul-2024 Analyzed: 30-Jul-2024 01:46											
Nitrate-N	3.73	0.200	0.200	mg/L	2.00	1.60	107	75-125			D
Nitrite-N	1.50	0.200	0.200	mg/L	2.00	ND	75.2	75-125			D
Recovery limits for target analytes in MS/MSD QC samples are advisory only.											
Matrix Spike Dup (BMG0466-MSD3) Source: 24G0408-01RE2 Prepared: 18-Jul-2024 Analyzed: 30-Jul-2024 02:06											
Nitrate-N	3.73	0.200	0.200	mg/L	2.00	1.60	107	75-125	0.16	20	D
Nitrite-N	1.52	0.200	0.200	mg/L	2.00	ND	75.8	75-125	0.80	200	D
Recovery limits for target analytes in MS/MSD QC samples are advisory only.											



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

Certified Analyses included in this Report

Analyte	Certifications
EPA 200.8 UCT-KED in Water	
Arsenic-75a	NELAP,WADOE,WA-DW,DoD-ELAP
EPA 300.0 in Water	
Nitrate-N	DoD-ELAP,WADOE,WA-DW,NELAP
Nitrite-N	DoD-ELAP,WADOE,WA-DW,NELAP
SM 4500-P E-11 in Water	
Orthophosphorus	WADOE,NELAP

Code	Description	Number	Expires
ADEC	Alaska Dept of Environmental Conservation	17-015	03/28/2025
DoD-ELAP	DoD-Environmental Laboratory Accreditation Program, PJLA Testing	66169	02/28/2025
NELAP	ORELAP - Oregon Laboratory Accreditation Program	WA100006-012	05/12/2025
WADOE	WA Dept of Ecology	C558	06/30/2025
WA-DW	Ecology - Drinking Water	C558	06/30/2025



Eurofins - Test America - Denver
4955 Yarrow Street
Arvada CO, 80002

Project: Hansville Landfill
Project Number: 28006013-2Q_3Q_4Q Sampling
Project Manager: Janice Collins

Reported:
29-Aug-2024 13:09

Notes and Definitions

D	The reported value is from a dilution
H	Hold time violation - Hold time was exceeded.
J	Estimated concentration value detected below the reporting limit.
U	This analyte is not detected above the reporting limit (RL) or if noted, not detected above the limit of detection (LOD).
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference
[2C]	Indicates this result was quantified on the second column on a dual column analysis.

Client Information			Sampler: Favor + Carmen Phone: Peter Bannister Company: Aspect Consulting, LLC			Lab PM: Collins, Janice S E-Mail: Janice.Collins@et.eurofinsus.com			Carrier Tracking No(s): 280-125973-19522.1			COC No: 280-125973-19522.1					
			Address: 350 Madison Ave N City: Bainbridge Island State, Zip: WA, 98110 Phone: 404-310-6437 Email: Peter.Bannister@aspectconsulting.com Project Name: Hansville Landfill Site: Washington Carmen Tapper@aspectconsulting.com			Due Date Requested: TAT Requested (days): Compliance Project: ☐ Yes ☒ No PO #: Purchase Order not required WO #: 404-310-6437			Analysis Requested			Job #:					
Sample Identification			Sample Date	Sample Time	Sample Type (C=Comp, G=grab)	Matrix (W=water, S=solid, O=waste/oil, BT=Tissue, A=Air)	Field Filtered Sample (Yes or No)	Perform MS/MSD (Yes or No)	Ak/Cr/SI/So4	6020 - Dissolved Metals (field filtered)	Ammonia/TOC	8260C SIM - Vinyl Chloride (Buffalo)	Ortho-phosphate (field filtered) - Direct sub to ARI	Dissolved Arsenic (Direct sub to ARI)	Nitrate/Nitrite (IC) - Direct sub to ARI	Total Number of containers	Special Instructions/Note:
SW-1-240717	7/17/24	1040	G	W	X	X	X	X	X	X	X	X	X	X	X	X	Diss As, NO3, NO2, o-phos subbed direct to ARI
SW-4-240717		1140															
SW-6-240717		1225															
SW-7-240717		1425															
MW-7-240717		0815															
MW-5-240717		0935															
MW-12I-240717		1115															
MW-13D-240717		1325															
MW-6-240717		1605															
MW-14-240717		1600															
MW-20DD-240717		0700															
Possible Hazard Identification ☐ Non-Hazard ☐ Flammable ☐ Skin Irritant ☐ Poison B ☐ Unknown ☐ Radiological Deliverable Requested: I, II, III, IV, Other (specify) _____																	
Empty Kit Relinquished by: Relinquished by: <i>Gaily Rusev</i> Date/Time: 07/18/24 11:00 Company: Aspect Company Relinquished by: _____ Date/Time: _____ Company: _____ Relinquished by: _____ Date/Time: _____ Company: _____																	
Sample Disposal (A fee may be assessed if samples are retained longer than 1 month) ☐ Return To Client ☐ Disposal By Lab ☐ Archive For _____ Months Special Instructions/QC Requirements: _____																	
Method of Shipment: Date/Time: 7/19/24 09:20 Company: EET DEN Received by: _____ Date/Time: _____ Company: _____ Received by: _____ Date/Time: _____ Company: _____ Cooler Temperature(s) °C and Other Remarks: 4.8 °C, Tur CE+0.1 2.8																	

2
3
4
5
6
7
3
9
0
1
2
3
4
5
6

ORIGIN ID:BFIA

SHIP DATE: 18JUL24
ACTWGT: 48.00 LB
CAD: /SSFE2521
DIMS: 25x14x14 IN

PKT # 156295-465-381228-EXP 06/23

TO **SAMPLE RECEIVING
EUROFINS ENVIRON TESTI
4955 YARROW ST**

Environment Testing
TestAmerica


ARVADA CO 80002-4517 2390686

(US)

(303) 736-0100
THU:
PO:

REF:

DEPT:

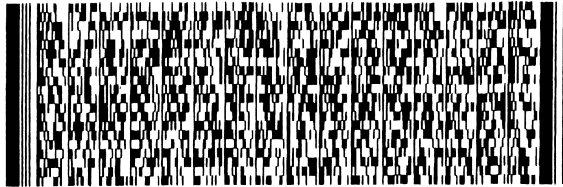

FedEx
Express




J24302407130264

TRK# 8182 2609 6430
0667

**FRI - 19 JUL 10:30A
PRIORITY OVERNIGHT**

XA LAAA

**80002
CO-US DEN**

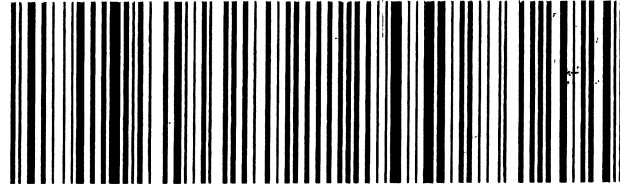

280-194308 Waybill

ORIGIN ID:BFIA

SHIP DATE: 18JUL24
ACTWGT: 46.35 LB
CAD: /SSFE2521
DIMS: 25x14x14 IN

Part # 1562344336898EXP-06/23

TO **SAMPLE RECEIVING**
EUROFINS ENVIRON TESTIN
4955 YARROW ST

ins | Environment Testi
TestAmerica

2390685

ARVADA CO 80002-4517


(US)

(303) 736-0100

REF:

THU:

DEPT:

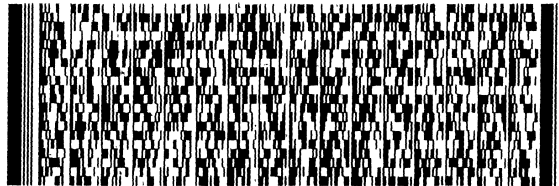

FedEx
Express



J2430240713021W

TRK# 8182 2609 6440
0667

FRI - 19 JUL 10:30A
PRIORITY OVERNIGHT

XA LAAA

80002
CO-US DEN



Chain of Custody Record



Client Information (Sub Contract Lab)		Lab PM: Collins, Janice S		Carrier Tracking No(s):		COC No: 280-710466-1	
Client Contact:		Phone:		State of Origin: Washington		Page: Page 1 of 2	
Shipping/Receiving		Company:		E-Mail: Janice.Collins@et.eurofins.com		Job #: 280-194308-1	
Eurofins Environment Testing Northeast,		Address: 10 Hazelwood Drive,		Accreditations Required (See note): State Program - Washington		Preservation Codes:	
City: Amherst		Due Date Requested: 8/1/2024		Analysis Requested			
State, Zip: NY, 14228-2298		TAT Requested (days):					
Phone: 716-691-2600(Tel) 716-691-7991(Fax)		PO #:					
Email:		WO #:					
Project Name: Hansville Landfill		Project #: 28006013		Perform MS/MSD (Yes or No) 8260C SIM/5030C (MOD) Local Method			
Site: Hansville		SSOW#:					
Sample Identification - Client ID (Lab ID)		Sample Date	Sample Time	Sample Type (C=Comp, G=grab)	Matrix (W=water, S=solid, O=waste/oil, BT=tissue, A=AU)	Field Filtered Sample (Yes or No)	Special Instructions/Note:
SW-1-240717 (280-194308-1)		7/17/24	10:40 Pacific		Water	X	
SW-4-240717 (280-194308-2)		7/17/24	11:40 Pacific		Water	X	
SW-6-240717 (280-194308-3)		7/17/24	12:25 Pacific		Water	X	
SW-7-240717 (280-194308-4)		7/17/24	14:25 Pacific		Water	X	
MW-7-240717 (280-194308-5)		7/17/24	08:15 Pacific		Water	X	
MW-5-240717 (280-194308-6)		7/17/24	09:35 Pacific		Water	X	
MW-121-240717 (280-194308-7)		7/17/24	11:15 Pacific		Water	X	
MW-13D-240717 (280-194308-8)		7/17/24	13:25 Pacific		Water	X	
MW-6-240717 (280-194308-9)		7/17/24	16:05 Pacific		Water	X	
Note: Since laboratory accreditations are subject to change, Eurofins TestAmerica places the ownership of method, analyte & accreditation compliance upon our subcontract laboratories. This sample shipment is forwarded under chain-of-custody. If the laboratory does not currently maintain accreditation in the State of Origin listed above for analysis/test/matrix being analyzed, the samples must be shipped back to the Eurofins TestAmerica laboratory or other instructions will be provided. Any changes to accreditation status should be brought to Eurofins TestAmerica attention immediately. If all requested accreditations are current to date, return the signed Chain of Custody attesting to said compliance to Eurofins TestAmerica.							
Possible Hazard Identification							
Unconfirmed							
Deliverable Requested: I, II, III, IV, Other (specify)				Primary Deliverable Rank: 2			
Empty Kit Relinquished by:				Time: Date:			
Relinquished by:				Date/Time: 7/22/24 15:27			
Relinquished by:				Date/Time: 7/23/24 11:15			
Relinquished by:				Date/Time:			
Custody Seals Intact: ☐ Yes ☐ No				Cooler Temperature(s) °C and Other Remarks: 3, 2 # Ice			

Login Sample Receipt Checklist

Client: Aspect Consulting

Job Number: 280-194308-1

Login Number: 194308

List Source: Eurofins Denver

List Number: 1

Creator: Roehsner, Karen P

Question	Answer	Comment
Radioactivity either was not measured or, if measured, is at or below background	True	
The cooler's custody seal, if present, is intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the sample IDs on the containers and the COC.	True	
Samples are received within Holding Time (Excluding tests with immediate HTs)..	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified	N/A	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
VOA sample vials do not have headspace or bubble is <6mm (1/4") in diameter.	False	Refer to job narrative for details
If necessary, staff have been informed of any short hold time or quick TAT needs	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Sampling Company provided.	True	
Samples received within 48 hours of sampling.	True	
Samples requiring field filtration have been filtered in the field.	True	
Chlorine Residual checked.	N/A	

Login Sample Receipt Checklist

Client: Aspect Consulting

Job Number: 280-194308-1

Login Number: 194308

List Number: 2

Creator: Stapleton, Kaitlyn

List Source: Eurofins Buffalo

List Creation: 07/23/24 11:42 AM

Question	Answer	Comment
Radioactivity either was not measured or, if measured, is at or below background	True	
The cooler's custody seal, if present, is intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	3.2 #1 ice
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the sample IDs on the containers and the COC.	True	
Samples are received within Holding Time (Excluding tests with immediate HTs)..	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified	True	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
VOA sample vials do not have headspace or bubble is <6mm (1/4") in diameter.	True	
If necessary, staff have been informed of any short hold time or quick TAT needs	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Sampling Company provided.	True	
Samples received within 48 hours of sampling.	True	
Samples requiring field filtration have been filtered in the field.	True	
Chlorine Residual checked.	N/A	