



BASALT
environmental

June 9, 2015

Pryde-Johnson

Attn: Mr. Curt Pryde
419 NE 70th Street
Seattle, Washington

RECEIVED
JUN 09 2015
DEPT OF ECOLOGY
TCP-NWRO
MAIL ROOM

Subject: Final Remediation Report
Former Ballard Library
5711 24th Avenue NW
Seattle, Washington

Dear Mr. Pryde,

Basalt Environmental Consulting, Inc. (Basalt) is pleased to present the results of the soil remediation activities at 5711 24th Avenue NW, Seattle Washington (the Property).

BACKGROUND

The subject site is the location the former Ballard Branch of the Seattle Public Library and site consists of a rectangular, 0.46-acre parcel. The general area is characterized by retail, commercial, and residential uses. Surface topography slopes down gently to the south.

According to previous environmental reports conducted by others, past uses of the site include a gas station in the northern portion from approximately 1940 to 1960; an auto repair facility in the southern portion from approximately 1940 to 1960; a clothes cleaners in the southeast corner from circa 1938 to 1940. A library building was constructed in 1962 and was in use as a municipal library until 2005. In summer 2013, the building was demolished in preparation for site redevelopment.

Prior to the remediation, three prior subsurface evaluations for the site were conducted: "Phase I and Phase II Site Assessment, Ballard Library, Seattle, Washington" Shannon & Wilson, Inc. (S&W) dated February 2005; "Phase II Site Assessment, Former Ballard Library Property, 5711 24th Avenue Northwest," prepared by Geotech Consultants, Inc. (GCI) dated February 6, 2006; and "Limited Phase II Evaluation, Former Ballard Library" prepared by Basalt, dated June 15, 2011.

These studies detected concentrations of gasoline-range petroleum hydrocarbons exceeding the Model Toxics Control Act (MTCA) Method A cleanup criteria for unrestricted land use in two primary areas, specifically in the southern portion of the parking area and to the northeast side of the building. Petroleum impacts to soil appeared to be limited to the Property boundaries and typically did not extend below about 9-12 feet below ground surface, below which a dense glacial till layer was encountered. Petroleum impacts did not appear to extend off-site and no evidence of off-site impacts was detected. Additionally, no chlorinated solvents, which potentially could have existed from the site's past use as a clothes cleaner, were reported.

Soils were generally reported as brown silty sands and gravels, until about 9-12 feet below ground surface, which point a silty, gravelly glacial till layer was encountered.

Groundwater was not encountered in the prior evaluations, except for one location encountered by Shannon & Wilson, Inc. in 2005. Shannon & Wilson, Inc. opined the groundwater was perched and not continuous. Based on well logs for nearby parcels, groundwater is expected to be encountered at depths of about 20-30 feet below ground surface.

In fall of 2013, the building was demolished and soils were removed in October through December, 2013. As part of site preparation for future construction, site soils were removed to an average depth of about 13-feet below ground surface. The purpose of this report is to document soil remediation activities conducted in the fall of 2013.

METHODS

Soils were removed by means of a trackhoe. Field screening of soils was accomplished by means of a photo-ionization detector, as well as visual and olfactory methods. Soils with indications of petroleum were segregated, transported by truck, and disposed of at a permitted facility, which for this project was Cemex, Inc. in Everett, Washington.

When field screening indicated no evidence of petroleum impacts, confirmation soil samples for laboratory analysis were collected, with emphasis in areas where previous studies had indicated soils exceeded MTCA Method A cleanup standards.

Samples were collected directly from the excavation floor and sidewalls by means of a single-use stainless steel spoon, and transferred to laboratory-supplied glass jars using a sampler extrusion tool in accordance with EPA Method 5035A. Decontamination of sampling equipment was accomplished by a wash with laboratory grade detergent, followed by a distilled water rinse.

All samples were placed in a cooler packed with ice and transported directly to the analytical laboratory, which for this project was Onsite Environmental, Redmond, Washington. Samples were analyzed by method NWTPH-HCID for hydrocarbon identification.

Site plans and measurements were generated by hand taping from existing site features and should be considered accurate within the limitation of the methods used.

FINDINGS**Field observations and activities**

At the time of the mass excavation, soils exhibiting staining or petroleum odors were screened and disposed separately off site at a permitted facility, which for this project was Cemex, Inc. in Everett, Washington. Approximately 7,688 tons of soil were screened as petroleum impacted and disposed of at Cemex, Inc.

After the impacted soils were removed, no evidence of petroleum was detected below the glacial till layer, which was encountered at about 7-9 feet across the site. Additionally no evidence of petroleum was detected in the sidewalls of the excavation. Soil disposal documentation is provided in the Appendix.

Analytical results are summarized in Table 1 below, and sampling locations are provided in Figure 4:

Table 1 –Laboratory Soil Results

Sample Number	Gasoline-Range Organics	Diesel-Range Organics	Lube Oil-Range Organics	Depth (feet)	Location
S1	<23	<57	<110	9.5	Excavation floor, NE
S2	<23	<54	<110	8.5	Excavation floor, SW
S3	<23	<56	<110	9.5	Excavation floor, SW
S4	<9	<130	<110	6.5	West sidewall
S5	<23	<57	<110	13.0	Excavation floor, NE
S6	<23	<56	<110	13.0	Excavation floor, NE
S7	<23	<57	<110	13.0	Excavation floor, South
S8	<23	<56	<110	13.0	Excavation floor, South
Clean up Levels MTCA Method A	100	2,000	2,000		

Notes:

All results in milligrams per kilogram

MTCA Method A = Washington State Model Toxics Control Act Method A Clean Up Levels for Unrestricted Land Use

< = Not detected at the given laboratory reporting limit

Results for each of the samples were below laboratory method detection limits for NWTPH-HCID, except for gasoline-range organics in sample S4; however the results for sample S4 were below method detection limits for NWTPH-Gx/BTEX. The laboratory report is attached.

CONCLUSIONS

Laboratory analysis of eight soil samples collected post-excavation indicated no petroleum hydrocarbons in concentrations exceeding MTCA Method A were detected in site soils. Additionally, no soils exhibiting petroleum staining or odors were observed remaining on site. Groundwater was not encountered or observed during the site excavation.


Based on this result and the results of prior evaluations, in Basalt's opinion no further evaluation or remediation regarding petroleum hydrocarbon in soils is warranted at this time.

Basalt appreciates the opportunity to be of service to you on this project. Should you have any questions concerning this report, or if we can assist you in any way, please contact us at (206) 399-7224.

Respectfully submitted,
Basalt Environmental, LLC.



Gregory S. Peterson
Principal

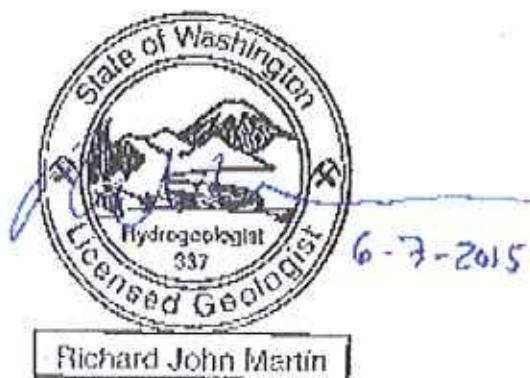


Richard Martin, LHG
Hydrogeologist

GSP/gsp

Attachments: Site Vicinity Map
Topographic Map
Summary of Prior Sampling Results Plan
Site and Sampling Plan

Figures

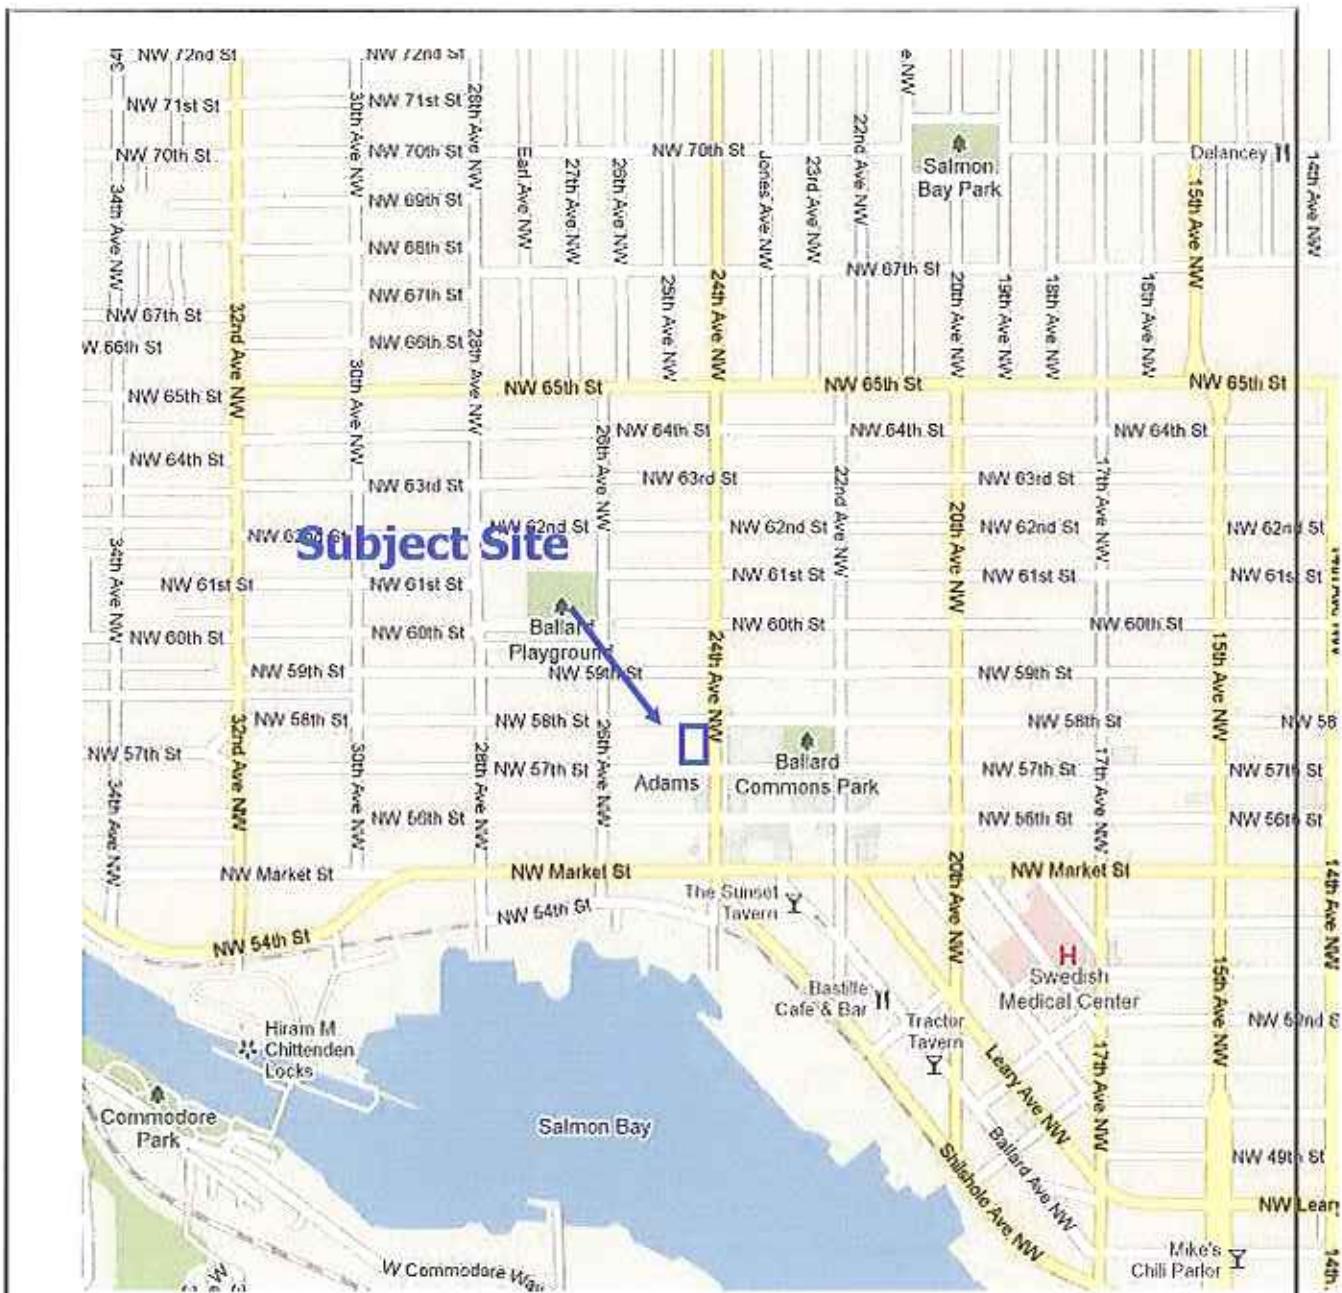


TOPOGRAPHIC MAP

Source: Google Maps, No scale




68 20 36th Ave. NE
Seattle, WA 98115

Site Name: Former Ballad Library
Project Number: 5711 24th Avenue NW
Seattle, WA
110421-1

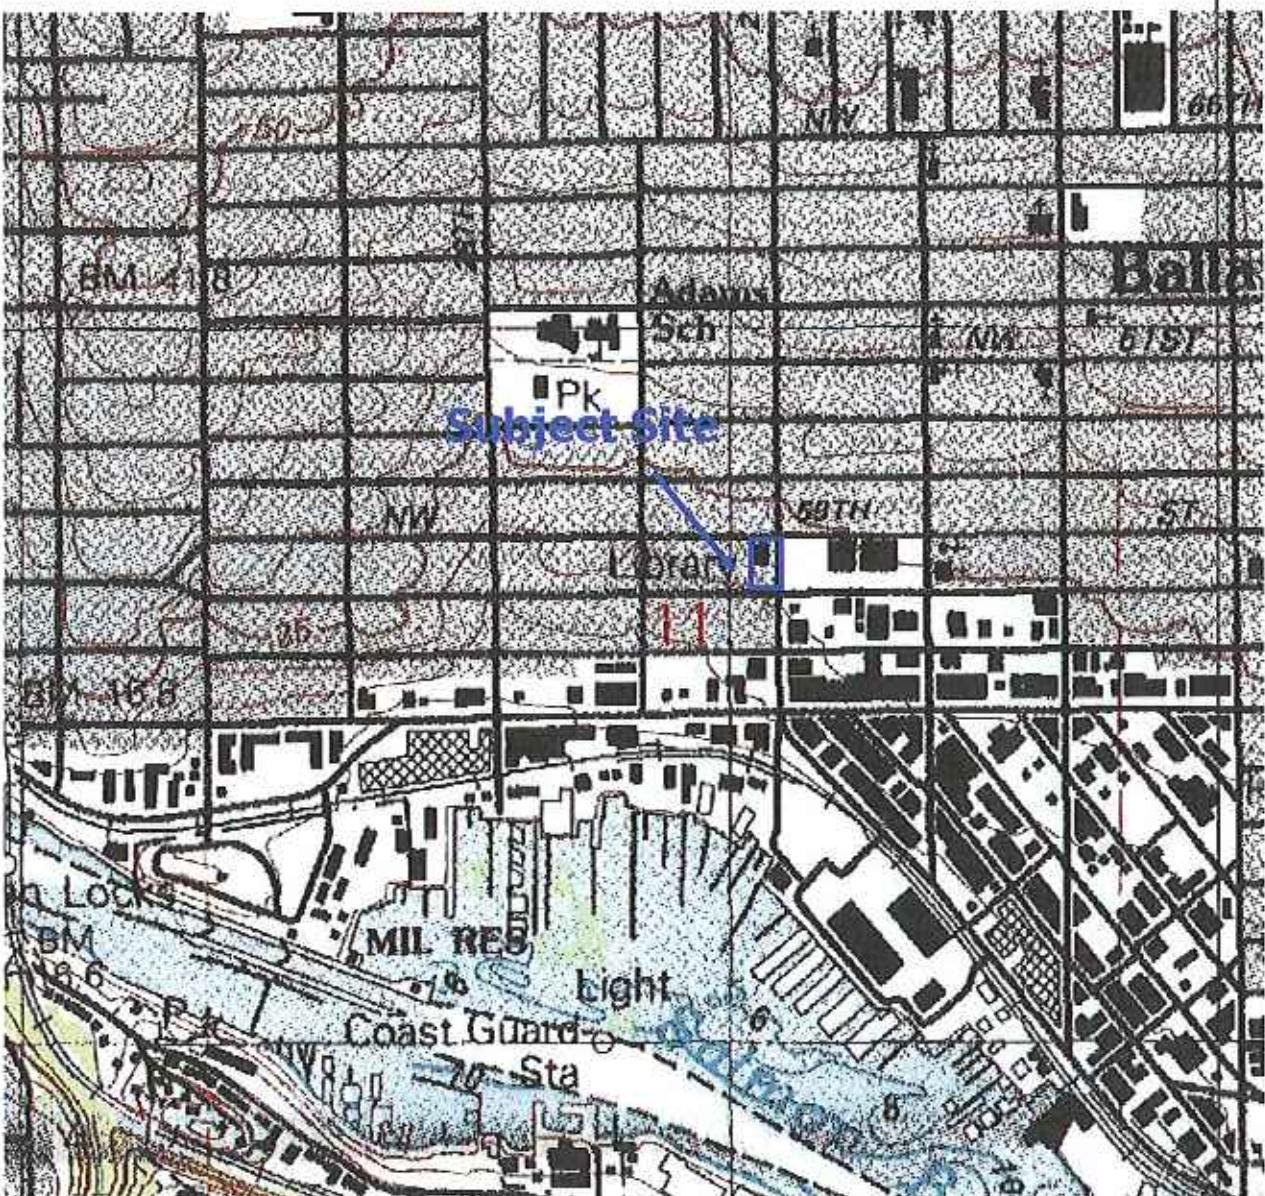

TOPOGRAPHIC MAP		Source: USGS 7.5 Minute Topographic Map, Seattle North Quadrangle, 1995	N↑
 BASALT environmental	68 20 36 th Ave. NE Seattle, WA 98115	Site Name: Former Ballard Library 5711 24th Avenue NW Seattle, WA Project Number: 110421-1	

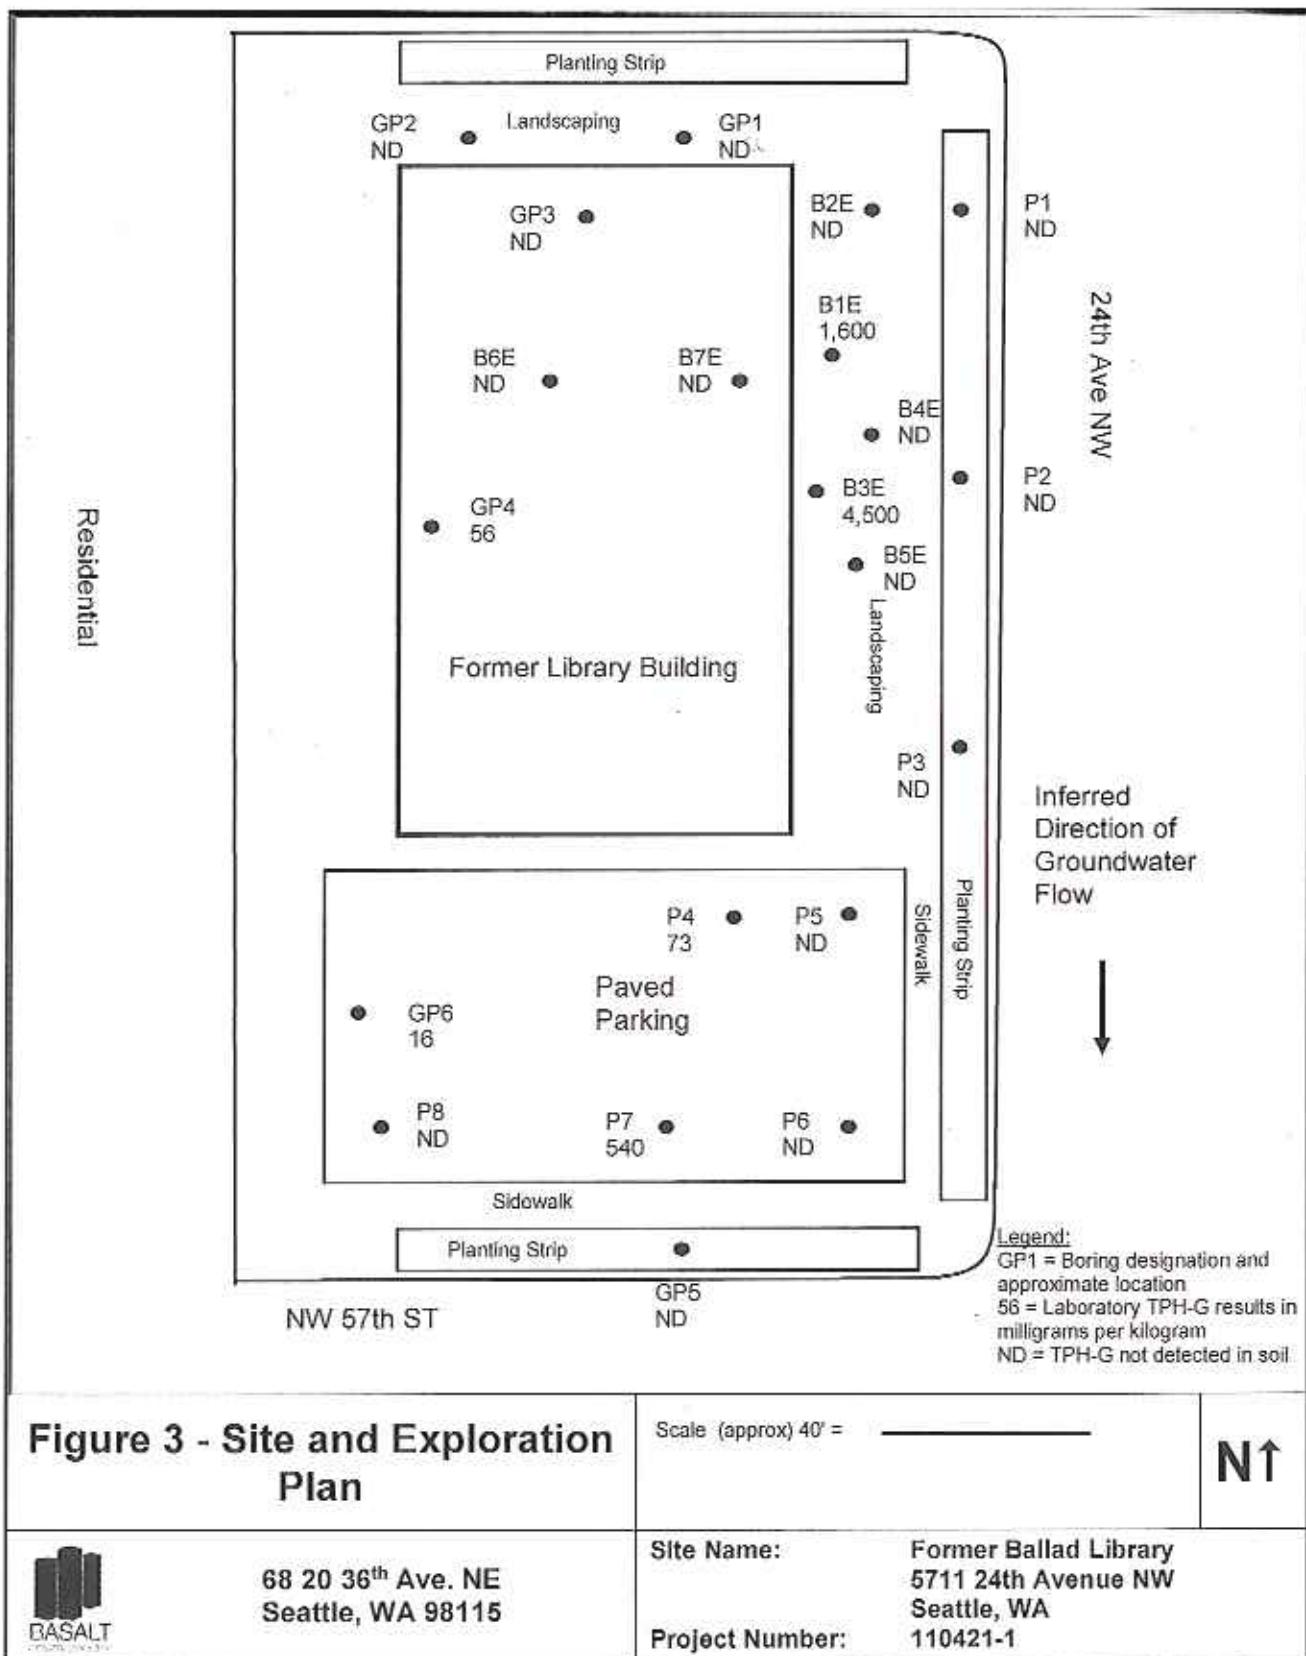

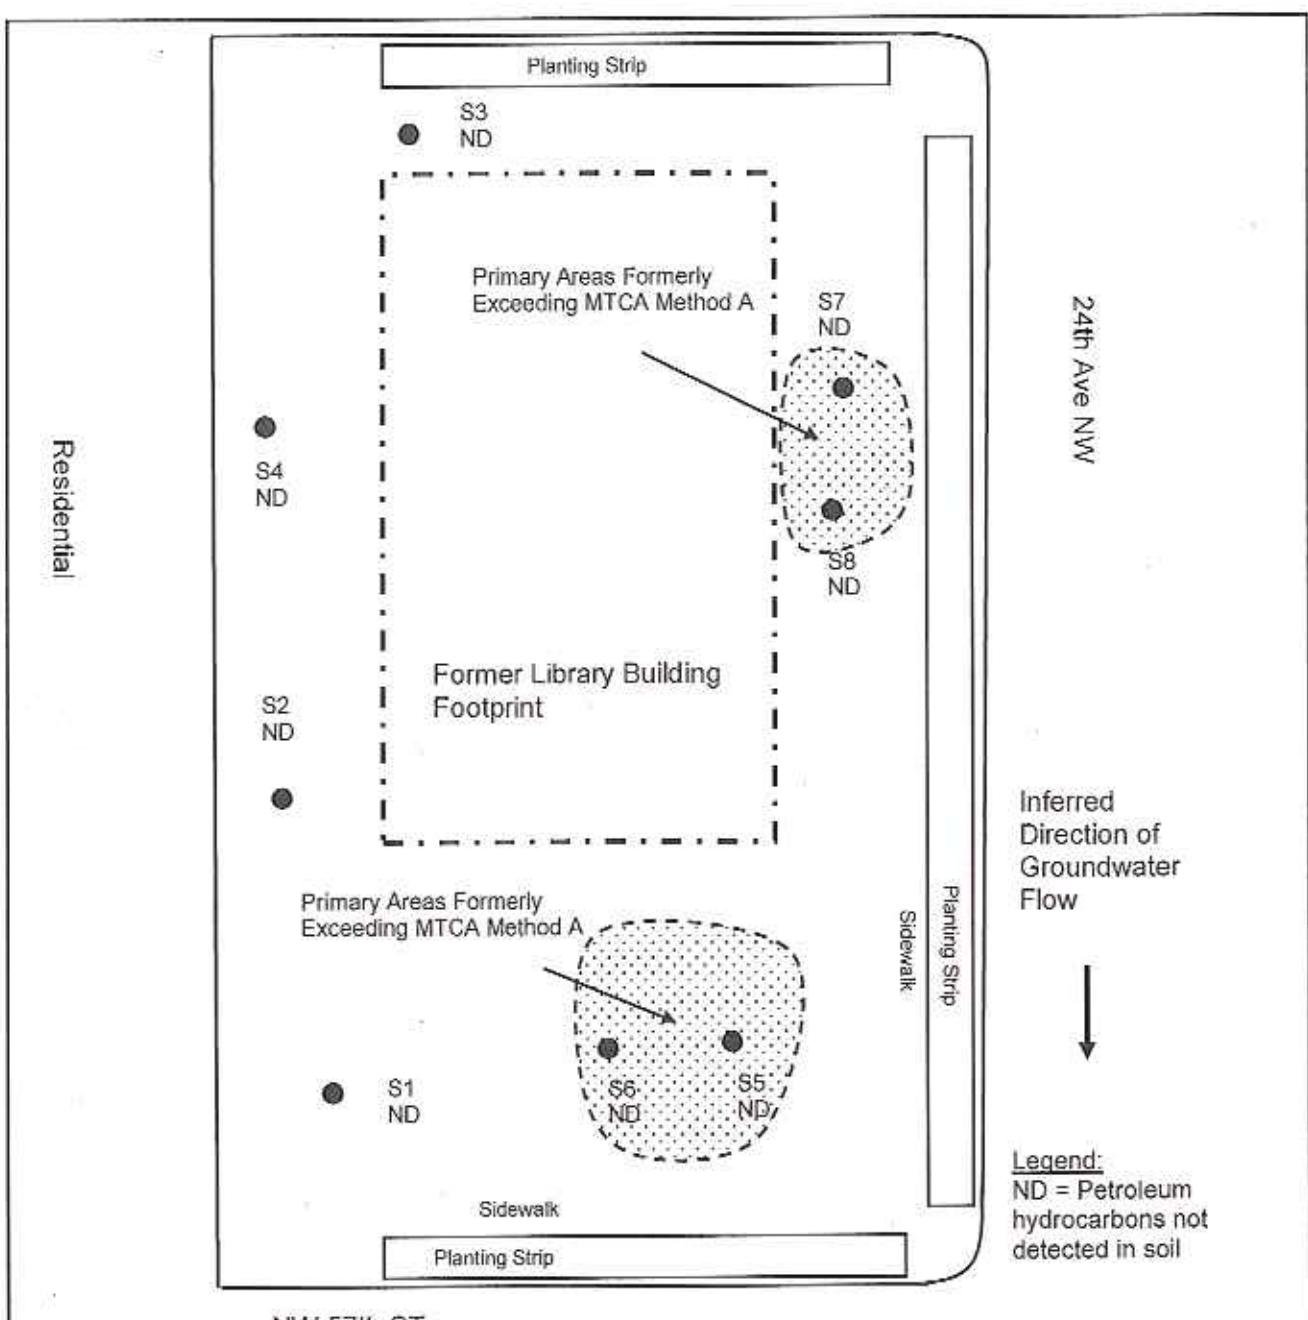


Figure 4 - Post Excavation Sampling Results

Scale (approx) 40' = _____



68 20 36th Ave. NE
Seattle, WA 98115

Site Name:

Former Ballard Library
5711 24th Avenue NW
Seattle, WA
110421-1

Project Number:

References

Basalt Environmental, LLC "Limited Phase II Evaluation, Former Ballard Library," June 15, 2011.

Geotech Consultants, Inc. "Phase II Site Assessment, Former Ballard Library Property, 5711 24th Avenue Northwest," February 6, 2006.

Shannon & Wilson, Inc. "Phase I and Phase II Site Assessment, Ballard Library, Seattle, Washington," February 2005

Basalt

Laboratory Report



**OnSite
Environmental Inc.**

14648 NE 95th Street, Redmond, WA 98052 • (425) 883-3881

October 14, 2013

Greg Peterson
Basalt Environmental Consulting, L.L.C.
6820 36th Avenue NE
Seattle, WA 98115

Re: Analytical Data for Project 131008-1
Laboratory Reference No. 1310-084

Dear Greg:

Enclosed are the analytical results and associated quality control data for samples submitted on October 8, 2013.

The standard policy of OnSite Environmental, Inc. is to store your samples for 30 days from the date of receipt. If you require longer storage, please contact the laboratory.

We appreciate the opportunity to be of service to you on this project. If you have any questions concerning the data, or need additional information, please feel free to call me.

Sincerely,

A handwritten signature in black ink, appearing to read "DB" followed by a cursive surname.

David Baumeister
Project Manager

Enclosures

Date of Report: October 14, 2013
Samples Submitted: October 8, 2013
Laboratory Reference: 1310-084
Project: 131008-1

Case Narrative

Samples were collected on October 8, 2013 and received by the laboratory on October 8, 2013. They were maintained at the laboratory at a temperature of 2°C to 6°C.

General QA/QC issues associated with the analytical data enclosed in this laboratory report will be indicated with a reference to a comment or explanation on the Data Qualifier page. More complex and involved QA/QC issues will be discussed in detail below.

NWTPH Gx/BTEX Analysis

Per EPA Method 5035A, samples were received by the laboratory in pre-weighed 40 mL VOA vials within 48 hours of sample collection. They were stored in a freezer at between -7°C and -20°C until extraction or analysis.

Any other QA/QC issues associated with this extraction and analysis will be indicated with a footnote reference and discussed in detail on the Data Qualifier page.

Date of Report: October 14, 2013
 Samples Submitted: October 8, 2013
 Laboratory Reference: 1310-084
 Project: 131008-1

NWTPH-HCID

Matrix: Soil
 Units: mg/Kg (ppm)

Analyte	Result	PQL	Method	Date Prepared	Date Analyzed	Flags
Client ID:	S1					
Laboratory ID:	10-084-01					
Gasoline Range Organics	ND	23	NWTPH-HCID	10-8-13	10-8-13	
Diesel Range Organics	ND	56	NWTPH-HCID	10-8-13	10-8-13	
Lube Oil Range Organics	ND	110	NWTPH-HCID	10-8-13	10-8-13	
Surrogate: o-Terphenyl	Percent Recovery 88	Control Limits 50-150				
Client ID:	S2					
Laboratory ID:	10-084-02					
Gasoline Range Organics	ND	23	NWTPH-HCID	10-8-13	10-8-13	
Diesel Range Organics	ND	57	NWTPH-HCID	10-8-13	10-8-13	
Lube Oil Range Organics	ND	110	NWTPH-HCID	10-8-13	10-8-13	
Surrogate: o-Terphenyl	Percent Recovery 84	Control Limits 50-150				
Client ID:	S3					
Laboratory ID:	10-084-03					
Gasoline Range Organics	ND	22	NWTPH-HCID	10-8-13	10-8-13	
Diesel Range Organics	ND	54	NWTPH-HCID	10-8-13	10-8-13	
Lube Oil Range Organics	ND	110	NWTPH-HCID	10-8-13	10-8-13	
Surrogate: o-Terphenyl	Percent Recovery 89	Control Limits 50-150				
Client ID:	S4					
Laboratory ID:	10-084-04					
Gasoline Range Organics	Detected	23	NWTPH-HCID	10-8-13	10-8-13	
Diesel Range Organics	ND	130	NWTPH-HCID	10-8-13	10-8-13	U1
Lube Oil Range Organics	ND	110	NWTPH-HCID	10-8-13	10-8-13	
Surrogate: o-Terphenyl	Percent Recovery 87	Control Limits 50-150				

Date of Report: October 14, 2013
 Samples Submitted: October 8, 2013
 Laboratory Reference: 1310-084
 Project: 131008-1

NWTPH-HCID
QUALITY CONTROL

Matrix: Soil
 Units: mg/Kg (ppm)

Analyte	Result	PQL	Method	Date Prepared	Date Analyzed	Flags
METHOD BLANK						
Laboratory ID:	MB1008S2					
Gasoline Range Organics	ND	20	NWTPH-HCID	10-8-13	10-8-13	
Diesel Range Organics	ND	50	NWTPH-HCID	10-8-13	10-8-13	
Lube Oil Range Organics	ND	100	NWTPH-HCID	10-8-13	10-8-13	
Surrogate: <i>o</i> -Terphenyl	Percent Recovery 96	Control Limits 50-150				

Date of Report: October 14, 2013
 Samples Submitted: October 8, 2013
 Laboratory Reference: 1310-084
 Project: 131008-1

NWTPH-Gx/BTEX

Matrix: Soil
 Units: mg/kg (ppm)

Analyte	Result	PQL	Method	Date Prepared	Date Analyzed	Flags
Client ID:	S4					
Laboratory ID:	10-084-04					
Benzene	ND	0.020	EPA 8021B	10-9-13	10-9-13	
Toluene	ND	0.096	EPA 8021B	10-9-13	10-9-13	
Ethyl Benzene	ND	0.096	EPA 8021B	10-9-13	10-9-13	
m,p-Xylene	ND	0.096	EPA 8021B	10-9-13	10-9-13	
o-Xylene	ND	0.096	EPA 8021B	10-9-13	10-9-13	
Gasoline	ND	9.6	NWTPH-Gx	10-9-13	10-9-13	
Surrogate:	<i>Percent Recovery</i>		<i>Control Limits</i>			
Fluorobenzene	93		71-121			

Date of Report: October 14, 2013
 Samples Submitted: October 8, 2013
 Laboratory Reference: 1310-084
 Project: 131008-1

NWTPH-Gx/BTEX
QUALITY CONTROL

Matrix: Soil
 Units: mg/kg (ppm)

Analyte	Result	PQL	Method	Date Prepared	Date Analyzed	Flags
METHOD BLANK						
Laboratory ID:	MB1009S2					
Benzene	ND	0.020	EPA 8021B	10-9-13	10-9-13	
Toluene	ND	0.050	EPA 8021B	10-9-13	10-9-13	
Ethyl Benzene	ND	0.050	EPA 8021B	10-9-13	10-9-13	
m,p-Xylene	ND	0.050	EPA 8021B	10-9-13	10-9-13	
o-Xylene	ND	0.050	EPA 8021B	10-9-13	10-9-13	
Gasoline	ND	5.0	NWTPH-Gx	10-9-13	10-9-13	
<i>Surrogate:</i>		Percent Recovery	Control Limits			
Fluorobenzene		92	71-121			

Analyte	Result	Spike Level	Source Result	Percent Recovery	Recovery LImits	RPD	RPD Limit	Flags
DUPLICATE								
Laboratory ID:	10-098-01							
	ORIG	DUP						
Benzene	ND	ND	NA	NA	NA	NA	NA	30
Toluene	ND	ND	NA	NA	NA	NA	NA	30
Ethyl Benzene	ND	ND	NA	NA	NA	NA	NA	30
m,p-Xylene	ND	ND	NA	NA	NA	NA	NA	30
o-Xylene	ND	ND	NA	NA	NA	NA	NA	30
Gasoline	ND	ND	NA	NA	NA	NA	NA	30
<i>Surrogate:</i>				108	110	71-121		
Fluorobenzene								

Analyte	SB	SBD	SB	SBD	SB	SBD		
SPIKE BLANKS								
Laboratory ID:	SB1009S1							
Benzene	1.01	0.952	1.00	1.00	101	95	73-121	6
Toluene	1.02	0.961	1.00	1.00	102	96	75-124	6
Ethyl Benzene	1.02	0.969	1.00	1.00	102	97	75-125	5
m,p-Xylene	1.04	0.988	1.00	1.00	104	99	75-126	5
o-Xylene	1.04	0.991	1.00	1.00	104	99	74-123	5
<i>Surrogate:</i>					99	91	71-121	
Fluorobenzene								

Date of Report: October 14, 2013
Samples Submitted: October 8, 2013
Laboratory Reference: 1310-084
Project: 131008-1

% MOISTURE

Date Analyzed: 10-8-13

Client ID	Lab ID	% Moisture
S1	10-084-01	11
S2	10-084-02	12
S3	10-084-03	7
S4	10-084-04	12



OnSite Environmental Inc.

Data Qualifiers and Abbreviations

- A - Due to a high sample concentration, the amount spiked is insufficient for meaningful MS/MSD recovery data.
- B - The analyte indicated was also found in the blank sample.
- C - The duplicate RPD is outside control limits due to high result variability when analyte concentrations are within five times the quantitation limit.
- E - The value reported exceeds the quantitation range and is an estimate.
- F - Surrogate recovery data is not available due to the high concentration of coeluting target compounds.
- H - The analyte indicated is a common laboratory solvent and may have been introduced during sample preparation, and be impacting the sample result.
- I - Compound recovery is outside of the control limits.
- J - The value reported was below the practical quantitation limit. The value is an estimate.
- K - Sample duplicate RPD is outside control limits due to sample inhomogeneity. The sample was re-extracted and re-analyzed with similar results.
- L - The RPD is outside of the control limits.
- M - Hydrocarbons in the gasoline range are impacting the diesel range result.
- M1 - Hydrocarbons in the gasoline range (toluene-naphthalene) are present in the sample.
- N - Hydrocarbons in the lube oil range are impacting the diesel range result.
- N1 - Hydrocarbons in diesel range are impacting lube oil range results.
- O - Hydrocarbons indicative of heavier fuels are present in the sample and are impacting the gasoline result.
- P - The RPD of the detected concentrations between the two columns is greater than 40.
- Q - Surrogate recovery is outside of the control limits.
- S - Surrogate recovery data is not available due to the necessary dilution of the sample.
- T - The sample chromatogram is not similar to a typical _____.
- U - The analyte was analyzed for, but was not detected above the reported sample quantitation limit.
- U1 - The practical quantitation limit is elevated due to interferences present in the sample.
- V - Matrix Spike/Matrix Spike Duplicate recoveries are outside control limits due to matrix effects.
- W - Matrix Spike/Matrix Spike Duplicate RPD are outside control limits due to matrix effects.
- X - Sample extract treated with a mercury cleanup procedure.
- X1 - Sample extract treated with a Sulfuric acid/Silica gel cleanup procedure.
- Y - The calibration verification for this analyte exceeded the 20% drift specified in method 8260C, and therefore the reported result should be considered an estimate. The overall performance of the calibration verification standard met the acceptance criteria of the method.
- Z -
- ND - Not Detected at PQL.
- PQL - Practical Quantitation Limit
- RPD - Relative Percent Difference



**OnSite
Environmental Inc.**

14648 NE 95th Street, Redmond, WA 98052 • (425) 883-3881

December 3, 2013

Greg Peterson
Basalt Environmental Consulting, L.L.C.
6820 36th Avenue NE
Seattle, WA 98115

Re: Analytical Data for Project 131008-1
Laboratory Reference No. 1311-236

Dear Greg:

Enclosed are the analytical results and associated quality control data for samples submitted on November 27, 2013.

The standard policy of OnSite Environmental, Inc. is to store your samples for 30 days from the date of receipt. If you require longer storage, please contact the laboratory.

We appreciate the opportunity to be of service to you on this project. If you have any questions concerning the data, or need additional information, please feel free to call me.

Sincerely,

A handwritten signature in black ink, appearing to read "D. Baumeister".

David Baumeister
Project Manager

Enclosures

Date of Report: December 3, 2013
Samples Submitted: November 27, 2013
Laboratory Reference: 1311-236
Project: 131008-1

Case Narrative

Samples were collected on November 25, 2013 and received by the laboratory on November 27, 2013. They were maintained at the laboratory at a temperature of 2°C to 6°C.

General QA/QC issues associated with the analytical data enclosed in this laboratory report will be indicated with a reference to a comment or explanation on the Data Qualifier page. More complex and involved QA/QC issues will be discussed in detail below.

Date of Report: December 3, 2013
 Samples Submitted: November 27, 2013
 Laboratory Reference: 1311-236
 Project: 131008-1

NWTPH-HCID

Matrix: Soil
 Units: mg/Kg (ppm)

Analyte	Result	PQL	Method	Date Prepared	Date Analyzed	Flags
Client ID:	S5					
Laboratory ID:	11-236-01					
Gasoline Range Organics	ND	23	NWTPH-HCID	12-2-13	12-2-13	
Diesel Range Organics	ND	57	NWTPH-HCID	12-2-13	12-2-13	
Lube Oil Range Organics	ND	120	NWTPH-HCID	12-2-13	12-2-13	
Surrogate:	Percent Recovery	Control Limits				
<i>o-Terphenyl</i>	80	50-150				
Client ID:	S6					
Laboratory ID:	11-236-02					
Gasoline Range Organics	ND	22	NWTPH-HCID	12-2-13	12-2-13	
Diesel Range Organics	ND	56	NWTPH-HCID	12-2-13	12-2-13	
Lube Oil Range Organics	ND	110	NWTPH-HCID	12-2-13	12-2-13	
Surrogate:	Percent Recovery	Control Limits				
<i>o-Terphenyl</i>	74	50-150				
Client ID:	S7					
Laboratory ID:	11-236-03					
Gasoline Range Organics	ND	23	NWTPH-HCID	12-2-13	12-2-13	
Diesel Range Organics	ND	57	NWTPH-HCID	12-2-13	12-2-13	
Lube Oil Range Organics	ND	110	NWTPH-HCID	12-2-13	12-2-13	
Surrogate:	Percent Recovery	Control Limits				
<i>o-Terphenyl</i>	79	50-150				
Client ID:	S8					
Laboratory ID:	11-236-04					
Gasoline Range Organics	ND	23	NWTPH-HCID	12-2-13	12-2-13	
Diesel Range Organics	ND	56	NWTPH-HCID	12-2-13	12-2-13	
Lube Oil Range Organics	ND	110	NWTPH-HCID	12-2-13	12-2-13	
Surrogate:	Percent Recovery	Control Limits				
<i>o-Terphenyl</i>	81	50-150				

Date of Report: December 3, 2013
 Samples Submitted: November 27, 2013
 Laboratory Reference: 1311-236
 Project: 131008-1

NWTPH-HCID
QUALITY CONTROL

Matrix: Soil
 Units: mg/Kg (ppm)

Analyte	Result	PQL	Method	Date Prepared	Date Analyzed	Flags
METHOD BLANK						
Laboratory ID:	MB1202S2					
Gasoline Range Organics	ND	20	NWTPH-HCID	12-2-13	12-2-13	
Diesel Range Organics	ND	50	NWTPH-HCID	12-2-13	12-2-13	
Lube Oil Range Organics	ND	100	NWTPH-HCID	12-2-13	12-2-13	
Surrogate: o-Terphenyl	Percent Recovery 90	Control Limits 50-150				

Date of Report: December 3, 2013
Samples Submitted: November 27, 2013
Laboratory Reference: 1311-236
Project: 131008-1

% MOISTURE

Date Analyzed: 12-2-13

Client ID	Lab ID	% Moisture
S5	11-236-01	13
S6	11-236-02	11
S7	11-236-03	12
S8	11-236-04	11



Data Qualifiers and Abbreviations

- A - Due to a high sample concentration, the amount spiked is insufficient for meaningful MS/MSD recovery data.
- B - The analyte indicated was also found in the blank sample.
- C - The duplicate RPD is outside control limits due to high result variability when analyte concentrations are within five times the quantitation limit.
- E - The value reported exceeds the quantitation range and is an estimate.
- F - Surrogate recovery data is not available due to the high concentration of coeluting target compounds.
- H - The analyte indicated is a common laboratory solvent and may have been introduced during sample preparation, and be impacting the sample result.
- I - Compound recovery is outside of the control limits.
- J - The value reported was below the practical quantitation limit. The value is an estimate.
- K - Sample duplicate RPD is outside control limits due to sample inhomogeneity. The sample was re-extracted and re-analyzed with similar results.
- L - The RPD is outside of the control limits.
- M - Hydrocarbons in the gasoline range are impacting the diesel range result.
- M1 - Hydrocarbons in the gasoline range (toluene-naphthalene) are present in the sample.
- N - Hydrocarbons in the lube oil range are impacting the diesel range result.
- N1 - Hydrocarbons in diesel range are impacting lube oil range results.
- O - Hydrocarbons indicative of heavier fuels are present in the sample and are impacting the gasoline result.
- P - The RPD of the detected concentrations between the two columns is greater than 40.
- Q - Surrogate recovery is outside of the control limits.
- S - Surrogate recovery data is not available due to the necessary dilution of the sample.
- T - The sample chromatogram is not similar to a typical _____.
- U - The analyte was analyzed for, but was not detected above the reported sample quantitation limit.
- U1 - The practical quantitation limit is elevated due to interferences present in the sample.
- V - Matrix Spike/Matrix Spike Duplicate recoveries are outside control limits due to matrix effects.
- W - Matrix Spike/Matrix Spike Duplicate RPD are outside control limits due to matrix effects.
- X - Sample extract treated with a mercury cleanup procedure.
- X1 - Sample extract treated with a Sulfuric acid/Silica gel cleanup procedure.
- Y - The calibration verification for this analyte exceeded the 20% drift specified in method 8260C, and therefore the reported result should be considered an estimate. The overall performance of the calibration verification standard met the acceptance criteria of the method.
- Z -
- ND - Not Detected at PQL
- PQL - Practical Quantitation Limit
- RPD - Relative Percent Difference



**OnSite
Environmental Inc.**

1457 NE 25th Street • Redmond, WA 98052
Phone: (425) 889-3961 • www.onsite-env.com

Chain of Custody

Turnaround Request (In working days)		Laboratory Number:		Date Received	
(Check One)					
<input type="checkbox"/> Same Day <input type="checkbox"/> 1 Day <input type="checkbox"/> 2 Days <input type="checkbox"/> 3 Days <input checked="" type="checkbox"/> Standard (7 Days) <small>(TPH analysis 5 Days)</small>					
Company: <i>Basecamp</i>	Project Number: <i>131003-1</i>	Sample Identification: <i>S5</i>	Date Sampled: <i>11-25-13</i>	Time Sampled: <i>16:55</i>	Matrix: <i>S</i>
Project Manager: <i>Carol Libraay</i>	Sampled by: <i>CSP</i>	Number of Contaminants: <i>2</i>	NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	Wobblies 8260C
			NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	Surficial soils 8270D/SIM (With Low-Low-PALIS)
			NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	PAHS 8270D/SIM (Low-Wave)
			NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	Dichloroethane Acidic Herbicides 8151A
			NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	Chlorophenoxyphenoxy Pesticides 8270D/SIM
			NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	Organochlorine Pesticides 8091B
			NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	TCLP Metals
			NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	HEM (oil and grease) 1661A
			NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	Total RCRA Metals/ MTCA Metals (low)
			NWTF-HX/CHClD <i>X</i>	NWTF-HX/CHClD <i>X</i>	None

Reviewed/Date

Reviewed/Date

Comments/Instructions

Done Packaged Level III [] Level IV []

Electronic Data Deliverables (EDDs) []

Comments/Instructions

Page 1 of 1

- 236

CEMEX
7150 Pollock Dr
Las Vegas, NV 89119-9012



0000035 PRYDE JOHNSON 5711 LLC
'COD'
419 NE 70TH ST
SEATTLE, WA 98115-5481
USA



Date : 03/08/2014
Account No. : 3169361
Page 1 of 1



CEMEX Construction Materials Pacific, LLC

Rinker Materials Nevada
Associated Sand & Gravel

Remit
To:
CEMEX
PO Box 73261
Chicago, IL 60673-3261

The invoices listed below were not paid according to our terms, therefore a finance charge has been assessed to your account. This charge is for the period ending 02/28/2014.

Please remit payment upon receipt of this notice.

Job No.	Document No.	Original Amount	Calculated From	Calculated To	Job Total	Interest Amount	Document No.	Amount
13844751	1600937958	\$29,699.21	01/31/2014	02/28/2014	\$2,637.99	\$273.40	1600937958	\$2,637.99
94274439388		\$51,808.21	01/31/2014	02/28/2014		\$476.92		
9427451624		\$67,266.30	01/31/2014	02/28/2014		\$619.22		
9427458920		\$29,480.63	01/31/2014	02/28/2014		\$271.38		
9427466911		\$7,658.36	01/31/2014	02/28/2014		\$70.50		
9427474995		\$63,018.67	01/31/2014	02/28/2014		\$580.12		
9427485777		\$23,605.78	01/31/2014	02/28/2014		\$217.30		
9427495952		\$10,968.75	01/31/2014	02/28/2014		\$100.97		
9427527860		\$3,061.63	01/31/2014	02/28/2014		\$28.18		
9427534802								

▲ PLEASE DETACH & RETURN THIS PORTION WITH YOUR PAYMENT. ▲

CEMEX
PO Box 2037
Everett, WA 98213-2037



CEMEX Construction Materials Pacific, LLC

Rinker Materials Nevada
Associated Sand & Gravel

N PRYDE JOHNSON 5711 LLC
COD
419 NE 70TH ST
SEATTLE, WA 98115-5481

STATEMENT DATE: 02/28/2014 We appreciate your business!
CUSTOMER NUMBER: 3169361 For inquiries call: 800-99-CEMEX (23639)

Page 1 of 1

STATEMENT OF ACCOUNT

SUBTOTALS BY ACCOUNT

Date	InvType	Reference #	Invoice #	Amount			
13844751 5711 24TH AVE NW-SEATTLE EVERETT, WA 98203-8203							
02/08/2014	Finance Charge	1600936190		\$2,777.63			
11/18/2013	Invoice	9427439388	9427439388	\$29,699.21			
11/19/2013	Invoice	9427451824	9427451824	\$51,808.21			
11/20/2013	Invoice	9427458920	9427458920	\$67,266.30			
11/21/2013	Invoice	9427466911	9427466911	\$29,480.63			
11/22/2013	Invoice	9427474995	9427474995	\$7,658.36			
11/25/2013	Invoice	9427485777	9427485777	\$63,018.67			
11/26/2013	Invoice	9427495952	9427495952	\$23,605.78			
12/04/2013	Invoice	9427527860	9427527860	\$10,968.75			
12/05/2013	Invoice	9427534802	9427534802	\$3,061.63			
13844751 DUE	\$2,777.63	>30	\$14,030.38	>60	\$272,537.16	>90	\$0.00



Page 1 of 1

STATEMENT DATE: 02/28/2014

CUSTOMER NUMBER: 3169361

PRYDE JOHNSON 5711 LLC

To insure proper credit please check the items being paid and return this remittance advice with your payment to this address:

CEMEX
PO Box 73261
Chicago, IL 60673-3261

REMITTANCE

Ref#	Amt Due	Paid	Amt Pa
1600936190	\$2,777.63	<input type="checkbox"/>	\$
9427439388	\$29,699.21	<input type="checkbox"/>	\$
9427451824	\$51,808.21	<input type="checkbox"/>	\$
9427458920	\$67,266.30	<input type="checkbox"/>	\$
9427466911	\$29,480.63	<input type="checkbox"/>	\$
9427474995	\$7,658.36	<input type="checkbox"/>	\$
9427485777	\$63,018.67	<input type="checkbox"/>	\$
9427495952	\$23,605.78	<input type="checkbox"/>	\$
9427527860	\$10,968.75	<input type="checkbox"/>	\$
9427534802	\$3,061.63	<input type="checkbox"/>	\$

ACCOUNT STATUS

DUE	> 30 DAYS	> 60 DAYS	> 90 DAYS
2,777.63	14,030.38	272,537.16	0.00

PLEASE PAY
THIS AMOUNT **TOTAL**
289,345.17

AMOUNT PAID **TOTAL**

CEMEX
PO Box 2037
Everett, WA 98213-2037



CEMEX Construction Materials Pacific, LLC

Rinker Materials Nevada
Associated Sand & Gravel

PRYDE JOHNSON 5711 LLC
COD
419 NE 70TH ST
SEATTLE, WA 98115-5481

STATEMENT DATE: 01/31/2014 We appreciate your business!
CUSTOMER NUMBER: 3169361 For inquiries call: 800-99-CEMEX (23639)

Page 1 of 1

STATEMENT OF ACCOUNT

SUBTOTALS BY ACCOUNT

Date	InvType	Reference #	Invoice #	Amount
13844751	5711 24TH AVE NW-SEATTLE		EVERETT, WA 98203-8203	
11/18/2013	Invoice	9427439388	9427439388	\$29,699.21
11/19/2013	Invoice	9427451824	9427451824	\$51,808.21
11/20/2013	Invoice	9427458920	9427458920	\$67,266.30
11/21/2013	Invoice	9427466911	9427466911	\$29,480.63
11/22/2013	Invoice	9427474995	9427474995	\$7,658.36
11/25/2013	Invoice	9427485777	9427485777	\$83,018.67
11/26/2013	Invoice	9427495952	9427495952	\$23,605.78
12/04/2013	Invoice	9427527860	9427527860	\$10,968.75
12/05/2013	Invoice	9427534802	9427534802	\$3,061.63
13844751 DUE	\$0.00	>30	\$14,030.38	>80 \$272,537.16 >90 \$0.00



Page 1 of 1
STATEMENT DATE: 01/31/2014
CUSTOMER NUMBER: 3169361
PRYDE JOHNSON 5711 LLC

To insure proper credit please
check the items being paid
and return this remittance
advice with your payment to
this address:

CEMEX
PO Box 73261
Chicago, IL 60673-3261

REMITTANCE

Ref#	Amt Due	Paid	Amt Pa
9427439388	\$29,699.21	<input type="checkbox"/>	\$
9427451824	\$51,808.21	<input type="checkbox"/>	\$
9427458920	\$67,266.30	<input type="checkbox"/>	\$
9427466911	\$29,480.63	<input type="checkbox"/>	\$
9427474995	\$7,658.36	<input type="checkbox"/>	\$
9427485777	\$83,018.67	<input type="checkbox"/>	\$
9427495952	\$23,605.78	<input type="checkbox"/>	\$
9427527860	\$10,968.75	<input type="checkbox"/>	\$
9427534802	\$3,061.63	<input type="checkbox"/>	\$

ACCOUNT STATUS			
DUE	> 30 DAYS	> 60 DAYS	> 90 DAYS
0.00	14,030.38	272,537.16	0.00

PLEASE PAY
THIS AMOUNT **TOTAL**
286,567.54

AMOUNT PAID **TOTAL**



EMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

INVOICE



CEMEX
PO Box 2037
Everett, WA 98213-2037

Date	12/05/13
Invoice No.	9427534802
Reference No.	

Terms: Net 20th prox Please note change of terms

Payment Due On 01/20/14

Job No. 13844751

Legal Address: 5711 24TH AVE NW-SEATTLE

Customer Job No. 5711 LLC

Account: 3169361

or All Inquiries Call: 800-355-2772

PO Number	Delivery Address	Product Code	Product Description	DELIVERED		NET UNIT PRICE	CITY	City	Zip Code
				DATE SHIPPED	DELIVERY NUMBER				
711	5711 24TH AVE NW-SEATTLE						EVERETT	EVERETT	98203
1205/13	8080336102	1876058461	1192508 CLASS 3 SOIL DUMPED BY TON		25.090 TON	35.00		1 TON	903.24
1205/13	8080336110	1876058465	1192508 CLASS 3 SOIL DUMPED BY TON		27.970 TON	36.00		1 TON	1006.92
1205/13	8080336113	1876058467	1192508 CLASS 3 SOIL DUMPED BY TON		29.030 TON	36.00		1 TON	1045.08
0 Subtotal:	0.00 Yards	82.09 Tons	2,955.24 Material	0.00	Freight	106.39	Other	0.00 Tax	3,061.63 Total

Term To:

CEMEX

PO Box 73261
Chicago, IL 60673-3261

Yards 0.00 Tons 82.09 Freight Total 0.00 Other

Sales Tax Total 0.00 Invoice Total 3,061.63



Yards	0.00	Tons	82.09	Freight Total	0.00	Other	0.00	Sales Tax Total	0.00	Invoice Total	3,061.63
<small>The invoice incorporates Seller's previously executed Credit Application, if any, Seller's Standard Terms and Conditions, Seller's Quotation and Seller's Order Confirmation (including limitations of liability if any) as fully set forth on the credit application or otherwise incorporated by reference. Seller reserves all rights under such documents and Seller's order confirmation, subject to payment in full and without defense or offset.</small>											

AGE # 1

The invoice incorporates Seller's previously executed Credit Application, if any, Seller's Standard Terms and Conditions, Seller's Quotation and Seller's Order Confirmation (including limitations of liability if any) as fully set forth on the credit application or otherwise incorporated by reference. Seller reserves all rights under such documents and Seller's order confirmation, subject to payment in full and without defense or offset.



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

INVOICE

Date	12/04/13
Invoice No.	9427527860
Reference No.	

Terms: Net 20th prox Please note change of terms

Payment Due On 01/20/14
Job No. 13844751
Legal Address: 5711 24TH AVE NW-SEATTLE
Customer Job No. 5711 LLC
Account: 3169361

Shipment To:
CEMEX
PO Box 73261
Chicago, IL 60673-3261
or All Inquiries Call: 800-355-2772

PO Number	Delivery Address	Product Code	Description	Delivered		Net Unit Price	Priced by	Units	Material Amount	Zip Code
				Date Shipped	Qty					
1711	76:5711 24TH AVE NW-SEA									98203
1204/13	8050321025	1878068356	1192508 CLASS 3 SOIL DUMPED BY TON	25.57	TON	36.00	1 TON	25.57	920.52	0.00
1204/13	8050321029	1878068360	1192508 CLASS 3 SOIL DUMPED BY TON	34.38	TON	36.00	1 TON	34.38	1237.68	0.00
1204/13	8060321037	1878068368	1192508 CLASS 3 SOIL DUMPED BY TON	32.04	TON	36.00	1 TON	32.04	1153.44	0.00
1204/13	8060321048	1878068379	1192508 CLASS 3 SOIL DUMPED BY TON	27.81	TON	36.00	1 TON	27.81	1001.16	0.00
1204/13	8060321052	1878068383	1192508 CLASS 3 SOIL DUMPED BY TON	29.52	TON	36.30	1 TON	29.52	1062.72	0.00
1204/13	8060321064	1878068395	1192508 CLASS 3 SOIL DUMPED BY TON	30.46	TON	36.30	1 TON	30.46	1086.56	0.00
1204/13	8060321076	1878068407	1192508 CLASS 3 SOIL DUMPED BY TON	29.51	TON	36.30	1 TON	29.51	1085.96	0.00
1204/13	8060321088	1878068419	1192508 CLASS 3 SOIL DUMPED BY TON	25.21	TON	36.00	1 TON	25.21	907.56	0.00
1204/13	8060321093	1878068424	1192508 CLASS 3 SOIL DUMPED BY TON	28.59	TON	36.00	1 TON	28.59	1029.24	0.00
1204/13	8060321102	1878068433	1192508 CLASS 3 SOIL DUMPED BY TON	30.91	TON	36.00	1 TON	30.91	1112.76	0.00
0 Subtotal:	0.00	Yards	294.10 Tons	10,587.60	Material	0.00	Freight	381.15	Other	0.00 Tax
										10,968.75 Total



AMOUNT

10,968.75

Date

12/04/13

Signature _____

Signature _____

Signature _____

Signature _____

Yards 0.00 Tons 294.10 Freight Total 0.00 Other 381.15 Sales Tax Total 0.00 Invoice Total 10,968.75

The vendor incorporates herein by reference Buyer's previously executed Credit Application, if any; Seller's Standard Terms and Conditions; Seller's Quotation and Seller's Order Confirmation (excluding limitations of warranties) as fully set forth on this invoice ("Agreement"). Buyer agrees that, unless otherwise noted herein, all credit sales and items sold and delivered are subject to acceptance by Seller, which may accept or reject any or all such sales and items at its sole discretion. If any term or provision of this Agreement is held invalid, illegal or unenforceable, the remaining terms and provisions shall nevertheless remain in full force and effect.

AGE # 1

10,968.75



EMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

Shipped To:
CEMEX
PO Box 73261
Chicago, IL 60673-3261
or All Inquiries Call: 800-355-2772

4/25/673 6819 Mar 4

Date	11/26/13
Invoice No.	9427495952
Reference No.	

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13
Job No. 13844751
Legal Address: 5711 24TH AVE NW-SEATTLE
Customer Job No. 5711 LLC
Account: 3169361

000755

CEMEX
PO Box 2037
Everett, WA 98213-2037

Yards	0.00	Tons	0.00	Freight Total	820.30	Sales Tax Total	0.00	Invoice Total	23,605.78
YAGE # 1									

The invoice incorporates herein by reference Buyer's previously executed Credit Application, if any, Seller's Standard Terms and Conditions, Seller's Quantities, and Seller's Order Confirmation, indicating limitations of warranties, if any, set forth in the same. This invoice Agreement, Buyer agrees that, unless otherwise noted herein, all quantities and items were delivered as indicated and further expressly agrees to pay in accordance with this Agreement, interest shall accrue on late payments.

PO Number	Delivery Address	PRODUCT CODE	PRODUCT DESCRIPTION	DELIVERED QTY	NET UNIT PRICE	CITY BY UOM UNITS	MATERIAL AMOUNT	FREIGHT	Zip Code
7711	5711 24TH AVE NW-SEATTLE								98203
11/26/13	8080257416	1876067873	1192508 CLASS 3 SOIL DUMPED BY TON	22,530 TON	36.00	1 TON		811.08	0.00
11/26/13	8080258224	1876067875	1192508 CLASS 3 SOIL DUMPED BY TON	25,290 TON	36.00	1 TON		910.44	0.00
11/26/13	8080258237	1876067879	1192508 CLASS 3 SOIL DUMPED BY TON	28,350 TON	36.00	1 TON		1020.60	0.00
11/26/13	8080258239	1876067880	1192508 CLASS 3 SOIL DUMPED BY TON	27,080 TON	36.00	1 TON		974.16	0.00
11/26/13	8080258244	1876067881	1192508 CLASS 3 SOIL DUMPED BY TON	26,210 TON	36.00	1 TON		943.56	0.00
11/26/13	8080258248	1876067882	1192508 CLASS 3 SOIL DUMPED BY TON	29,680 TON	36.00	1 TON		1068.48	0.00
11/26/13	8080258256	1876067884	1192508 CLASS 3 SOIL DUMPED BY TON	26,660 TON	36.00	1 TON		959.76	0.00
11/26/13	8080258274	1876067888	1192508 CLASS 3 SOIL DUMPED BY TON	31,530 TON	36.00	1 TON		1135.08	0.00
11/26/13	8080258283	1876067891	1192508 CLASS 3 SOIL DUMPED BY TON	32,360 TON	36.00	1 TON		1164.96	0.00
11/26/13	8080258286	1876067892	1192508 CLASS 3 SOIL DUMPED BY TON	30,350 TON	36.00	1 TON		1092.60	0.00
11/26/13	8080258290	1876067894	1192508 CLASS 3 SOIL DUMPED BY TON	30,030 TON	36.00	1 TON		1081.08	0.00
11/26/13	8080258298	1876067896	1192508 CLASS 3 SOIL DUMPED BY TON	25,230 TON	36.00	1 TON		908.28	0.00
11/26/13	8080258306	1876067898	1192508 CLASS 3 SOIL DUMPED BY TON	31,310 TON	36.00	1 TON		1127.16	0.00
11/26/13	8080258308	1876067899	1192508 CLASS 3 SOIL DUMPED BY TON	28,000 TON	36.00	1 TON		1038.09	0.00
11/26/13	8080258311	1876067900	1192508 CLASS 3 SOIL DUMPED BY TON	30,690 TON	36.00	1 TON		1104.84	0.00
11/26/13	8080258320	1876067903	1192508 CLASS 3 SOIL DUMPED BY TON	32,790 TON	36.00	1 TON		1180.44	0.00
11/26/13	8080258324	1876067904	1192508 CLASS 3 SOIL DUMPED BY TON	26,370 TON	36.00	1 TON		949.32	0.00
11/26/13	8080258327	1876067905	1192508 CLASS 3 SOIL DUMPED BY TON	29,450 TON	36.00	1 TON		1060.20	0.00
11/26/13	8080258355	1876067907	1192508 CLASS 3 SOIL DUMPED BY TON	28,060 TON	36.00	1 TON		1010.16	0.00
11/26/13	8080258358	1876067908	1192508 CLASS 3 SOIL DUMPED BY TON	30,370 TON	36.00	1 TON		1093.32	0.00
11/26/13	8080258551	1876067912	1192508 CLASS 3 SOIL DUMPED BY TON	29,450 TON	36.00	1 TON		1060.20	0.00
11/26/13	8080258578	1876067919	1192508 CLASS 3 SOIL DUMPED BY TON	31,160 TON	36.00	1 TON		1121.76	0.00
0 Subtotal:	0.00 Yards	632.93 Tons	22,785.48 Material	0.00 Freight	820.30 Other	0.00 Tax	23,605.78 Total		



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

INVOICE



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

CEMEX
PO Box 2037
Everett, WA 98213-2037

000210

PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

Date	11/25/13
Invoice No.	9427485777
Reference No.	

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13

Job No. 13844751

Legal Address: 5711 24TH AVE NW-SEATTLE

Customer Job No. 5711 LLC

Account: 3169361

For All Inquiries Call: 800-355-2772

Remit To:

CEMEX
PO Box 73261
Chicago, IL 60673-3261

Delivery Address

PO Number	DATE SHIPPED	DELIVERY NUMBER	PRODUCT CODE	DESCRIPTION	DELIVERED QTY	NET UNIT PRICE	PRICE BY UOM	UNITS	CITY	MATERIAL AMOUNT	FREIGHT	Zip Code
5711	11/25/13	8060245424	18760677696	1192503 CLASS 3 SOIL DUMPED BY TON	32.310 TON	36.00	1 TON		EVERETT	32.310	0.00	98203
	11/25/13	8060245433	1876067700	1192503 CLASS 3 SOIL DUMPED BY TON	31.520 TON	36.00	1 TON			31.520	0.00	
	11/25/13	8060245440	1876067703	1192508 CLASS 3 SOIL DUMPED BY TON	30.020 TON	36.00	1 TON			30.020	0.00	
	11/25/13	8060245445	1876067705	1192508 CLASS 3 SOIL DUMPED BY TON	30.200 TON	36.00	1 TON			30.200	0.00	
	11/25/13	8060245445	1876067706	1192508 CLASS 3 SOIL DUMPED BY TON	30.930 TON	36.00	1 TON			30.930	0.00	
	11/25/13	8060245449	1876067708	1192508 CLASS 3 SOIL DUMPED BY TON	28.370 TON	36.00	1 TON			28.370	0.00	
	11/25/13	8060245453	1876067711	1192508 CLASS 3 SOIL DUMPED BY TON	32.550 TON	36.00	1 TON			32.550	0.00	
	11/25/13	8060245457	1876067714	1192508 CLASS 3 SOIL DUMPED BY TON	28.620 TON	36.00	1 TON			28.620	0.00	
	11/25/13	8060245460	1876067717	1192508 CLASS 3 SOIL DUMPED BY TON	33.750 TON	36.00	1 TON			33.750	0.00	
	11/25/13	8060245467	1876067721	1192508 CLASS 3 SOIL DUMPED BY TON	33.400 TON	36.00	1 TON			33.400	0.00	
	11/25/13	8060245474	1876067742	1192508 CLASS 3 SOIL DUMPED BY TON	31.070 TON	36.00	1 TON			31.070	0.00	
	11/25/13	8060245489	1876067749	1192508 CLASS 3 SOIL DUMPED BY TON	30.670 TON	36.00	1 TON			30.670	0.00	
	11/25/13	8060245494	1876067747	1192508 CLASS 3 SOIL DUMPED BY TON	32.370 TON	36.00	1 TON			32.370	0.00	
	11/25/13	8060245495	1876067748	1192508 CLASS 3 SOIL DUMPED BY TON	30.010 TON	36.00	1 TON			30.010	0.00	
	11/25/13	8060245500	1876067753	1192508 CLASS 3 SOIL DUMPED BY TON	33.210 TON	36.00	1 TON			33.210	0.00	
	11/25/13	8060245501	1876067754	1192508 CLASS 3 SOIL DUMPED BY TON	28.610 TON	36.00	1 TON			28.610	0.00	
	11/25/13	8060245502	1876067755	1192508 CLASS 3 SOIL DUMPED BY TON	25.520 TON	36.00	1 TON			25.520	0.00	
	11/25/13	8060245506	1876067758	1192508 CLASS 3 SOIL DUMPED BY TON	30.450 TON	36.00	1 TON			30.450	0.00	
	11/25/13	8060245508	1876067761	1192508 CLASS 3 SOIL DUMPED BY TON	35.080 TON	36.00	1 TON			35.080	0.00	
	11/25/13	8060245509	1876067762	1192508 CLASS 3 SOIL DUMPED BY TON	30.990 TON	36.00	1 TON			30.990	0.00	
	11/25/13	8060245515	1876067768	1192508 CLASS 3 SOIL DUMPED BY TON	39.770 TON	36.00	1 TON			39.770	0.00	
	11/25/13	8060246019	1876067772	1192508 CLASS 3 SOIL DUMPED BY TON	32.710 TON	36.00	1 TON			32.710	0.00	
	11/25/13	8063246021	1876067774	1192508 CLASS 3 SOIL DUMPED BY TON	32.330 TON	36.00	1 TON			32.330	0.00	
	11/25/13	8063246025	1876067778	1192508 CLASS 3 SOIL DUMPED BY TON	32.720 TON	36.00	1 TON			32.720	0.00	
	11/25/13	8060246027	1876067780	1192508 CLASS 3 SOIL DUMPED BY TON	32.740 TON	36.00	1 TON			32.740	0.00	
	11/25/13	8060246028	1876067781	1192508 CLASS 3 SOIL DUMPED BY TON	27.850 TON	36.00	1 TON			27.850	0.00	
	11/25/13	8060246031	1876067784	1192508 CLASS 3 SOIL DUMPED BY TON	31.770 TON	36.00	1 TON			31.770	0.00	

The invoice incorporates herein by reference Buyer's previously executed Credit Application, if any, Seller's Standard Terms and Conditions, Seller's Quotation and Seller's Order Confirmation (including Limitations of remedies) as fully set forth on this invoice ("Agreement")



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel



000210

CEMEX
PO Box 2037
Everett, WA 98213-2037

PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

Remit To:
CEMEX
PO Box 73261
Chicago, IL 60673-3261
For All Inquiries Call: 800-355-2772

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13
Job No. 13844751
Legal Address: 5711 24TH AVE NW SEATTLE
Customer Job No. 5711 LLC
Account: 3169361

Date	1/25/13
Invoice No.	9427485777
Reference No.	

PO Number	Delivery Number Shipped	Delivery Address	Product Code	Product Description	Delivered Qty	Net Unit Price	Priced By	Units	City	Zip Code	Material Amount	Freight
1125/13	8060246048	1878067801	1192508	CLASS 3 SOIL DUMPED BY TON	29,830	TON	36.00	TON	29,830	1073.88	0.00	
1125/13	8060246050	1878067803	1192508	CLASS 3 SOIL DUMPED BY TON	27,340	TON	36.00	TON	27,340	984.24	0.00	
1125/13	8060246053	1878067806	1192508	CLASS 3 SOIL DUMPED BY TON	30,010	TON	36.00	TON	30,010	1080.36	0.00	
1125/13	8060246054	1878067807	1192508	CLASS 3 SOIL DUMPED BY TON	28,800	TON	36.00	TON	28,800	1036.80	0.00	
1125/13	8060246055	1878067808	1192508	CLASS 3 SOIL DUMPED BY TON	31,620	TON	36.00	TON	31,620	1138.32	0.00	
1125/13	8060246057	1878067810	1192508	CLASS 3 SOIL DUMPED BY TON	30,390	TON	36.00	TON	30,390	1094.04	0.00	
1125/13	8060246060	1878067813	1192508	CLASS 3 SOIL DUMPED BY TON	29,920	TON	36.00	TON	29,920	1077.12	0.00	
1125/13	8060246064	1878067817	1192508	CLASS 3 SOIL DUMPED BY TON	32,530	TON	36.00	TON	32,530	1171.08	0.00	
1125/13	8060246067	1878067820	1192508	CLASS 3 SOIL DUMPED BY TON	39,760	TON	36.00	TON	39,760	1431.36	0.00	
1125/13	8060246070	1878067823	1192508	CLASS 3 SOIL DUMPED BY TON	25,190	TON	36.00	TON	25,190	905.84	0.00	
1125/13	8060246073	1878067826	1192508	CLASS 3 SOIL DUMPED BY TON	28,880	TON	36.00	TON	28,880	1039.68	0.00	
1125/13	8060246075	1878067828	1192508	CLASS 3 SOIL DUMPED BY TON	30,870	TON	36.00	TON	30,870	1111.32	0.00	
1125/13	8060246079	1878067832	1192508	CLASS 3 SOIL DUMPED BY TON	25,550	TON	36.00	TON	25,550	919.80	0.00	
1125/13	8060246083	1878067836	1192508	CLASS 3 SOIL DUMPED BY TON	32,140	TON	36.00	TON	32,140	1157.04	0.00	
1125/13	8060246084	1878067837	1192508	CLASS 3 SOIL DUMPED BY TON	30,140	TON	36.00	TON	30,140	1085.04	0.00	
1125/13	8060246096	1878067849	1192508	CLASS 3 SOIL DUMPED BY TON	28,210	TON	36.00	TON	28,210	1015.56	0.00	
1125/13	8060246098	1878067851	1192508	CLASS 3 SOIL DUMPED BY TON	29,480	TON	36.00	TON	29,480	1061.28	0.00	
1125/13	8060246100	1878067853	1192508	CLASS 3 SOIL DUMPED BY TON	30,410	TON	36.00	TON	30,410	1094.76	0.00	
1125/13	8060246104	1878067857	1192508	CLASS 3 SOIL DUMPED BY TON	28,000	TON	36.00	TON	28,000	1008.00	0.00	
1125/13	8060246105	1878067858	1192508	CLASS 3 SOIL DUMPED BY TON	30,240	TON	36.00	TON	30,240	1088.64	0.00	
1125/13	8060246106	1878067859	1192508	CLASS 3 SOIL DUMPED BY TON	27,060	TON	36.00	TON	27,060	974.16	0.00	
1125/13	8060246108	1878067861	1192508	CLASS 3 SOIL DUMPED BY TON	28,450	TON	36.00	TON	28,450	1024.20	0.00	
1125/13	8060246111	1878067864	1192508	CLASS 3 SOIL DUMPED BY TON	31,420	TON	36.00	TON	31,420	1131.12	0.00	
1125/13	8060246113	1878067866	1192508	CLASS 3 SOIL DUMPED BY TON	28,310	TON	36.00	TON	28,310	1019.16	0.00	
1125/13	8060246114	1878067867	1192508	CLASS 3 SOIL DUMPED BY TON	36,620	TON	36.00	TON	36,620	1318.32	0.00	
1125/13	8060246115	1878067868	1192508	CLASS 3 SOIL DUMPED BY TON	29,470	TON	36.00	TON	29,470	1060.92	0.00	
1125/13	8060246116	1878067869	1192508	CLASS 3 SOIL DUMPED BY TON	30,030	TON	36.00	TON	30,030	1081.08	0.00	
1125/13	8060246118	1878067871	1192508	CLASS 3 SOIL DUMPED BY TON	25,500	TON	36.00	TON	25,500	918.00	0.00	

The invoice incorporates herein by reference Buyer's previously executed Credit Application, if any, Seller's Standard Terms and Conditions, Seller's Quotation and Seller's Order Confirmation (including limitations of warranties) as fully set forth on this invoice ("Agreement").
Buyer agrees that unless otherwise indicated, all quantities and items were delivered as indicated and further expressly agrees to pay in accordance with this Agreement. Interest will accrue on late payments.



EMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

CEMEX
PO Box 2037
Everett, WA 98213-2037

PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13

Job No. 13844751

Legal Address: 5711 24TH AVE NW-SEATTLE

Customer Job No. 5711 LLC

Account: 3169361

Shipment To:
CEMEX
PO Box 73261
Chicago, IL 60673-3261
or All Inquiries Call: 800-355-2772

DO Number	Delivery Address			PRODUCT DESCRIPTION	DELIVERED QTY	NET UNIT PRICE	PRICED BY UOM	CITY	Zip Code
DATE SHIPPED	DELIVERY NUMBER	REF#	PRODUCT CODE	DESCRIPTION	UOM	PRICE	UNITS		FREIGHT
0 Subtotal:	0.00	Yards	1,689.69	Tons	60,828.84	Material	0.00	Freight	2,189.83

Yards	Tons	Freight Total	Other	Sales Tax Total	Invoice Total
3	0.00	41,689.69	0.00	2,189.83	63,018.67

The invoice incorporates herein by reference Buyer's previously executed Credit Application, if any, Seller's Standard Terms and Conditions, Seller's Quotations and Seller's Order Confirmation (including limitations of warranties) as fully set forth on this invoice ("Agreement"). Buyer agrees that, unless otherwise stated herein, all quantities and items were delivered in accordance with this Agreement, "Seller" shall never incur late payments, "Interest" shall never accrue on late payments.



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

INVOICE

Date	11/22/13
Invoice No.	9427474995
Reference No.	

Shipment To:
CEMEX
PO Box 73261
Chicago, IL 60673-3261
or All Inquiries Call: 800-355-2772

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13
Job No. 13844751
Legal Address: 5711 24TH AVE NW-SEATTLE
Customer Job No. 5711 LLC
Account: 3169361

O Subtotal: 0.00 Yards
205.34 Tons 7,392.24 Material

Q Number	Delivery Address	Product Code	Product Description	DELIVERED		NET UNIT PRICE	CITY	PRICED BY UNITS	MAILED AMOUNT	Zip Code
				DATE SHIPPED	TIME CITY					
741	5711 24TH AVE NW-SEATTLE		CLASS 3 SOIL DUMPED BY TON			31.390	TON	36.00	1 TON	98203
1122/13	8060228705 18776067589	1192508	CLASS 3 SOIL DUMPED BY TON	31.390	TON	36.00	1 TON	36.00	1 TON	1148.04
1122/13	8060228713 18776067603	1192508	CLASS 3 SOIL DUMPED BY TON	36.010	TON	36.00	1 TON	36.010	1 TON	1296.36
1122/13	8060228750 18776067621	1192508	CLASS 3 SOIL DUMPED BY TON	31.980	TON	36.00	1 TON	31.980	1 TON	1151.28
1122/13	8060228774 18776067640	1192508	CLASS 3 SOIL DUMPED BY TON	27.900	TON	36.00	1 TON	27.900	1 TON	1004.40
1122/13	8060228782 18776067648	1192508	CLASS 3 SOIL DUMPED BY TON	17.410	TON	36.00	1 TON	17.410	1 TON	626.76
1122/13	8060228795 18776067660	1192508	CLASS 3 SOIL DUMPED BY TON	30.920	TON	36.00	1 TON	30.920	1 TON	1113.12
1122/13	8060228805 18776067667	1192508	CLASS 3 SOIL DUMPED BY TON	29.230	TON	36.00	1 TON	29.230	1 TON	1052.28
O Subtotal:	0.00 Yards		Material	0.00	Freight	266.12	Other	0.00	Tax	7,658.36 Total

Yards	Tons	Freight Total	Sales Tax Total	Invoice Total
AGE # 1	0.00	0.00	0.00	7,658.36

The foregoing incorporates herein by reference Buyer's previously executed Credit Agreement, if any, Seller's Standard Terms and Conditions, Seller's Quotations and Seller's Order Confirmation (including limitations of warranties) as fully set forth on the credit insertion or otherwise stated herein, all of which are incorporated herein by reference and made a part hereof.



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

INVOICE



Rinker Materials Nevada
Associated Sand & Gravel

CEMEX
PO Box 2037
Everett, WA 98213-2037

PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

CEMEX

PO Box 2037

Everett, WA 98213-2037

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13

Job No. 13844751

Legal Address: 5711 24TH AVE NW-SEATTLE

Customer Job No. 5711 LLC

Account: 3169361

Remit To:

CEMEX
PO Box 73261
Chicago, IL 60673-3261

For All Inquiries Call: 800-355-2772

PO Number

Delivery Address

PO Number	Delivery Number	Ref#	Product Code	Product Description	Delivered Qty	Net Unit Price	Material Amount	Zip Code
5711	11/21/13	8060213252	1876067494	1192508 CLASS 3 SOIL DUMPED BY TON	28.410 TON	36.00	1 TON	98203
	11/21/13	8060213280	1876067498	1192508 CLASS 3 SOIL DUMPED BY TON	27.680 TON	36.00	1 TON	
	11/21/13	8060213284	1876067499	1192508 CLASS 3 SOIL DUMPED BY TON	29.010 TON	36.00	1 TON	
	11/21/13	8060213286	1876067500	1192508 CLASS 3 SOIL DUMPED BY TON	25.760 TON	36.00	1 TON	
	11/21/13	8060213309	1876067504	1192508 CLASS 3 SOIL DUMPED BY TON	28.230 TON	36.00	1 TON	
	11/21/13	8060213316	1876067506	1192508 CLASS 3 SOIL DUMPED BY TON	28.750 TON	36.00	1 TON	
	11/21/13	8060213318	1876067507	1192508 CLASS 3 SOIL DUMPED BY TON	28.700 TON	36.00	1 TON	
	11/21/13	8060213522	1876067508	1192508 CLASS 3 SOIL DUMPED BY TON	27.750 TON	36.00	1 TON	
	11/21/13	8060213529	1876067510	1192508 CLASS 3 SOIL DUMPED BY TON	25.210 TON	36.00	1 TON	
	11/21/13	8060213531	1876067511	1192508 CLASS 3 SOIL DUMPED BY TON	29.840 TON	36.00	1 TON	
	11/21/13	8060213534	1876067512	1192508 CLASS 3 SOIL DUMPED BY TON	28.560 TON	36.00	1 TON	
	11/21/13	8060213548	1876067516	1192508 CLASS 3 SOIL DUMPED BY TON	28.580 TON	36.00	1 TON	
	11/21/13	8060213552	1876067517	1192508 CLASS 3 SOIL DUMPED BY TON	28.640 TON	36.00	1 TON	
	11/21/13	8060213553	1876067519	1192508 CLASS 3 SOIL DUMPED BY TON	33.480 TON	36.00	1 TON	
	11/21/13	8060213576	1876067522	1192508 CLASS 3 SOIL DUMPED BY TON	30.130 TON	36.00	1 TON	
	11/21/13	8060213578	1876067523	1192508 CLASS 3 SOIL DUMPED BY TON	9.150 TON	36.00	1 TON	
	11/21/13	8060213616	1876067534	1192508 CLASS 3 SOIL DUMPED BY TON	30.220 TON	36.00	1 TON	
	11/21/13	8060213584	1876067525	1192508 CLASS 3 SOIL DUMPED BY TON	30.680 TON	36.00	1 TON	
	11/21/13	8060213592	1876067527	1192508 CLASS 3 SOIL DUMPED BY TON	31.600 TON	36.00	1 TON	
	11/21/13	8060213603	1876067530	1192508 CLASS 3 SOIL DUMPED BY TON	30.400 TON	36.00	1 TON	
	11/21/13	8060213615	1876067534	1192508 CLASS 3 SOIL DUMPED BY TON	35.280 TON	36.00	1 TON	
	11/21/13	8060213581	1876067524	1192508 CLASS 3 SOIL DUMPED BY TON	32.770 TON	36.00	1 TON	
	11/21/13	8060213593	1876067535	1192508 CLASS 3 SOIL DUMPED BY TON	32.600 TON	36.00	1 TON	
	11/21/13	8060213592	1876067536	1192508 CLASS 3 SOIL DUMPED BY TON	26.720 TON	36.00	1 TON	
	11/21/13	8060213924	1876067537	1192508 CLASS 3 SOIL DUMPED BY TON	35.490 TON	36.00	1 TON	
	11/21/13	8060213930	1876067539	1192508 CLASS 3 SOIL DUMPED BY TON	33.780 TON	36.00	1 TON	
	11/21/13	8060213935	1876067541	1192508 CLASS 3 SOIL DUMPED BY TON	33.030 TON	36.00	1 TON	
	11/21/13	8060213545	1876067544	1192508 CLASS 3 SOIL DUMPED BY TON	1189.08	0.00		



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel



CEMEX
PO Box 2037
Everett, WA 98213-2037

001120
PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13
Job No. 13844751
Legal Address: 5711 24TH AVE NW-SEATTLE
Customer Job No. 5711 LLC
Account: 3169361

CEMEX
PO Box 73261
Chicago, IL 60673-3261
For All Inquiries Call: 800-355-2772

Delivery Address

PO Number	PRODUCT CODE	PRODUCT DESCRIPTION	NET UNIT PRICE	NET UNIT QUANTITY	UNIT PRICE	UNIT QUANTITY	CITY	ZIP CODE
DATE SHIPPED	DELIVERY NUMBER	ITEM	ITEM	ITEM	ITEM	ITEM	ITEM	ITEM
PO Subtotal:	0.00 Yards	790.45 Tons	28,456.20 Material	0.00 Freight	1,024.43 Other	0.00 Tax	29,480.63 Total	

Yards	Tons	Freight Total	Sales Tax Total	Invoice Total
PAGE # 2	0.00	0.00	1,024.43	29,480.63

The invoice incorporates herein by reference Buyer's previously executed Credit Application, if any. Seller's Standard Terms and Conditions, Seller's Quotation and Seller's Order Confirmation (including limitations of warranties) or fully set forth on this invoice ("Agreement"). Buyer agrees that, unless otherwise noted herein, all quantities and items were delivered as indicated and further expressly agrees to pay in accordance with this Agreement. Interest shall accrue on late payments.



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel



INVOICE

Date 11/20/13
Invoice No. 9427458920
Reference No.

Ship To:
CEMEX
PO Box 73261
Chicago, IL 60673-3261
For All Inquiries Call: 800-355-2772

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13

Job No. 13844751

Legal Address: 5711 24TH AVE NW-SEATTLE

Customer Job No. 5711 LLC

Account: 3169361

000200

PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

CEMEX
PO Box 2037
Everett, WA 98213-2037

PO Number	Delivery Address	Product Code	Description	NET UNIT PRICE	DELIVERED QTY	NET UNIT PRICE	AMOUNT	City	Zip Code
5711	76-5711 24TH AVE NW-SEA							EVERETT	98203
11/20/13	8060190812	1876067355	CLASS 3 SOIL DUMPED BY TON	26.070	TON	36.00	1 TON	26.070	938.52
11/20/13	8060195420	1876067357	CLASS 3 SOIL DUMPED BY TON	29.470	TON	36.00	1 TON	29.470	1060.92
11/20/13	8060195423	1876067358	CLASS 3 SOIL DUMPED BY TON	28.310	TON	36.00	1 TON	28.310	1019.16
11/20/13	8060195448	1876067365	CLASS 3 SOIL DUMPED BY TON	30.930	TON	36.00	1 TON	30.930	1113.48
11/20/13	8060195448	1876067367	CLASS 3 SOIL DUMPED BY TON	30.290	TON	36.00	1 TON	30.290	1090.44
11/20/13	8060195461	1876067369	CLASS 3 SOIL DUMPED BY TON	30.500	TON	36.00	1 TON	30.500	1101.60
11/20/13	8060195466	1876067371	CLASS 3 SOIL DUMPED BY TON	29.720	TON	36.00	1 TON	29.720	1069.92
11/20/13	8060195469	1876067372	CLASS 3 SOIL DUMPED BY TON	30.100	TON	36.00	1 TON	30.100	1083.60
11/20/13	8060195472	1876067373	CLASS 3 SOIL DUMPED BY TON	34.710	TON	36.00	1 TON	34.710	1249.56
11/20/13	8060195475	1876067374	CLASS 3 SOIL DUMPED BY TON	31.880	TON	36.00	1 TON	31.880	1147.68
11/20/13	8060195478	1876067375	CLASS 3 SOIL DUMPED BY TON	31.360	TON	36.00	1 TON	31.360	1128.96
11/20/13	8060195481	1876067376	CLASS 3 SOIL DUMPED BY TON	30.430	TON	36.00	1 TON	30.430	1095.48
11/20/13	8060195489	1876067378	CLASS 3 SOIL DUMPED BY TON	30.260	TON	36.00	1 TON	30.260	1089.36
11/20/13	8060195492	1876067379	CLASS 3 SOIL DUMPED BY TON	33.760	TON	36.00	1 TON	33.760	1215.36
11/20/13	8060195501	1876067381	CLASS 3 SOIL DUMPED BY TON	33.110	TON	36.00	1 TON	33.110	1191.96
11/20/13	8060195532	1876067387	CLASS 3 SOIL DUMPED BY TON	25.580	TON	36.00	1 TON	25.580	920.88
11/20/13	8060195829	1876067389	CLASS 3 SOIL DUMPED BY TON	24.600	TON	36.00	1 TON	24.600	885.60
11/20/13	8060195847	1876067393	CLASS 3 SOIL DUMPED BY TON	28.900	TON	36.00	1 TON	28.900	1040.40
11/20/13	8060195855	1876067395	CLASS 3 SOIL DUMPED BY TON	27.070	TON	36.00	1 TON	27.070	974.52
11/20/13	8060195866	1876067398	CLASS 3 SOIL DUMPED BY TON	29.600	TON	36.00	1 TON	29.600	1065.60
11/20/13	8060195870	1876067399	CLASS 3 SOIL DUMPED BY TON	27.370	TON	36.00	1 TON	27.370	985.32
11/20/13	8060195874	1876067400	CLASS 3 SOIL DUMPED BY TON	27.670	TON	36.00	1 TON	27.670	996.12
11/20/13	8060195879	1876067401	CLASS 3 SOIL DUMPED BY TON	27.100	TON	36.00	1 TON	27.100	975.60
11/20/13	8060195883	1876067402	CLASS 3 SOIL DUMPED BY TON	29.390	TON	36.00	1 TON	29.390	1058.04
11/20/13	8060195887	1876067403	CLASS 3 SOIL DUMPED BY TON	29.390	TON	36.00	1 TON	29.390	1058.04
11/20/13	8060195889	1876067404	CLASS 3 SOIL DUMPED BY TON	26.570	TON	36.00	1 TON	26.570	956.52
11/20/13	8060195893	1876067405	CLASS 3 SOIL DUMPED BY TON	22.790	TON	36.00	1 TON	22.790	820.44

The invoice incorporates Seller's previously executed Credit Application, if any, Sellers Standard Terms and Conditions, Seller's Quotation and Seller's Order Confirmation (including limitations of warranties) as fully set forth on this invoice. "Agreement" means the entire agreement between Seller and Buyer in writing, including all addenda, attachments, exhibits, and other documents, whether or not referred to by reference, which are made a part of this Agreement.



CEMEX
Rinker Materials Nevada
Associated Sand & Gravel

000200

CEMEX
PO Box 2037
Everett, WA 98213-2037

PRYDE JOHNSON 5711 L.L.C.
419 NE 70TH ST
SEATTLE, WA 98115-5481

Date	11/20/13
Invoice No.	9427458920
Reference No.	

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13

Job No. 13844751

Legal Address: 5711 24TH AVE NW-SEATTLE

Customer Job No. 5711 LLC

Account: 3169351

Remit To:
CEMEX
PO Box 73261
Chicago, IL 60673-3261
For All Inquiries Call: 800-355-2772

PO Number	Delivery Address	Product Description	Quantity	Unit Price	Extended Price	City	Zip Code
DATE	DELIVERY NUMBER	ROUTE	PRODUCT CODE	ITEM #	QTY	UNIT	AMOUNT
11/20/13	8060195898	1876067406	1192508 CLASS 3 SOIL DUMPED BY TON	27,120	TON	36.00	1 TON
11/20/13	8060195902	1876067407	1192508 CLASS 3 SOIL DUMPED BY TON	30,280	TON	36.00	1 TON
11/20/13	8060195905	1876067408	1192508 CLASS 3 SOIL DUMPED BY TON	30,180	TON	36.00	1 TON
11/20/13	8060195910	1876067409	1192508 CLASS 3 SOIL DUMPED BY TON	29,420	TON	36.00	1 TON
11/20/13	8060195914	1876067410	1192508 CLASS 3 SOIL DUMPED BY TON	28,860	TON	36.00	1 TON
11/20/13	8060195919	1876067411	1192508 CLASS 3 SOIL DUMPED BY TON	28,420	TON	36.00	1 TON
11/20/13	8060195923	1876067412	1192508 CLASS 3 SOIL DUMPED BY TON	28,240	TON	36.00	1 TON
11/20/13	8060195927	1876067413	1192508 CLASS 3 SOIL DUMPED BY TON	25,850	TON	36.00	1 TON
11/20/13	8060195931	1876067414	1192508 CLASS 3 SOIL DUMPED BY TON	26,460	TON	36.00	1 TON
11/20/13	8060195935	1876067415	1192508 CLASS 3 SOIL DUMPED BY TON	29,100	TON	36.00	1 TON
11/20/13	8060195938	1876067416	1192508 CLASS 3 SOIL DUMPED BY TON	31,380	TON	36.00	1 TON
11/20/13	8060195946	1876067418	1192508 CLASS 3 SOIL DUMPED BY TON	29,950	TON	36.00	1 TON
11/20/13	8060195949	1876067419	1192508 CLASS 3 SOIL DUMPED BY TON	27,490	TON	36.00	1 TON
11/20/13	8060195951	1876067420	1192508 CLASS 3 SOIL DUMPED BY TON	27,510	TON	36.00	1 TON
11/20/13	8060195954	1876067421	1192508 CLASS 3 SOIL DUMPED BY TON	26,870	TON	36.00	1 TON
11/20/13	8060195958	1876067422	1192508 CLASS 3 SOIL DUMPED BY TON	33,380	TON	36.00	1 TON
11/20/13	8060195961	1876067423	1192508 CLASS 3 SOIL DUMPED BY TON	28,980	TON	36.00	1 TON
11/20/13	8060195963	1876067424	1192508 CLASS 3 SOIL DUMPED BY TON	24,840	TON	36.00	1 TON
11/20/13	8060195965	1876067425	1192508 CLASS 3 SOIL DUMPED BY TON	30,500	TON	36.00	1 TON
11/20/13	8060195969	1876067426	1192508 CLASS 3 SOIL DUMPED BY TON	28,450	TON	36.00	1 TON
11/20/13	8060195971	1876067427	1192508 CLASS 3 SOIL DUMPED BY TON	28,150	TON	36.00	1 TON
11/20/13	8060195973	1876067428	1192508 CLASS 3 SOIL DUMPED BY TON	28,940	TON	36.00	1 TON
11/20/13	8060195976	1876067429	1192508 CLASS 3 SOIL DUMPED BY TON	28,310	TON	36.00	1 TON
11/20/13	8060195980	1876067430	1192508 CLASS 3 SOIL DUMPED BY TON	25,080	TON	36.00	1 TON
11/20/13	8060195983	1876067431	1192508 CLASS 3 SOIL DUMPED BY TON	26,740	TON	36.00	1 TON
11/20/13	8060195988	1876067433	1192508 CLASS 3 SOIL DUMPED BY TON	27,910	TON	36.00	1 TON
11/20/13	8060195991	1876067434	1192508 CLASS 3 SOIL DUMPED BY TON	30,400	TON	36.00	1 TON
11/20/13	8060195995	1876067436	1192508 CLASS 3 SOIL DUMPED BY TON	32,240	TON	36.00	1 TON

The invoices incorporated herein by reference Breyce's previously extacted Credit Application, if any, Seller's Standard Terms and Condition, Seller's Quotation and Seller's Order Confirmation (including limitations of warranty) are fully set forth in this invoice ("Agreement").
Buyer agrees that, unless otherwise stated, all quantities and items and terms were delivered or indicated and further expressly agreed to now in agreement with this Agreement.



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel



CEMEX
PO Box 2037
Everett, WA 98213-2037

CEMEX
Rinker Materials Nevada
Associated Sand & Gravel

CEMEX
PO Box 73261
Chicago, IL 60673-3261
For All Inquiries Call: 800-355-2772

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13

Job No. 13844751

Legal Address: 5711 24TH AVE NW-SEATTLE

Customer Job No. 5711 LLC

Account: 3169361

PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

000200

Date	11/20/13
Invoice No.	9427458920
Reference No.	

PO Number	Delivery Address	Product Description	Quantity	Delivered	Net Unit Price	Unit	Shipped By	Units	Material Amount	Zip Code
DATE SHIPPED	REF#	PRODUCT CODE	QTY.	TON						
11/20/13	8060195998	1876067437	1192508	CLASS 3 SOIL DUMPED BY TON	29.100	TON	36.00	1 TON	29.100	1047.60
11/20/13	8060195999	1876067438	1192508	CLASS 3 SOIL DUMPED BY TON	30.820	TON	36.00	1 TON	30.820	1109.52
11/20/13	8060196001	1876067439	1192508	CLASS 3 SOIL DUMPED BY TON	29.980	TON	36.00	1 TON	29.980	1079.28
11/20/13	8060196004	1876067440	1192508	CLASS 3 SOIL DUMPED BY TON	34.520	TON	36.00	1 TON	34.520	1242.72
11/20/13	8060196006	1876067441	1192508	CLASS 3 SOIL DUMPED BY TON	30.750	TON	36.00	1 TON	30.750	1107.00
11/20/13	8060196009	1876067442	1192508	CLASS 3 SOIL DUMPED BY TON	31.820	TON	36.00	1 TON	31.820	1145.52
11/20/13	8060196011	1876067443	1192508	CLASS 3 SOIL DUMPED BY TON	28.510	TON	36.00	1 TON	28.510	1026.36
Subtotal:	0.00 Yards	1,803.58 Tons	64,928.88 Material	0.00 Freight	2,337.42	Other	0.00 Tax	67,266.30 Total		

Yards	Tons	Freight Total	0.00 Other	2,337.42 Sales Tax Total	0.00 Invoice Total
PAGE # 3					67,266.30

The invoice incorporates herein by reference Buyer's previously executed Credit Application, Seller's Standard Terms and Conditions, Seller's Quotation and Seller's Order Confirmation (including Limitations of warranties) as fully set forth on this invoice ("Agreement"). Buyer agrees that, unless otherwise noted herein, all quantities and items were delivered as indicated and further expressly agrees to pay in accordance with this Agreement, interest shall accrue on late payments.



CEMEX
CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

INVOICE



Rinker Materials Nevada
Associated Sand & Gravel

CEMEX
PO Box 2037
Everett, WA 98213-2037

001172

PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

Date	11/19/13
Invoice No.	9427451824
Reference No.	

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13
Job No. 13844751
Legal Address: 5711 24TH AVE NW-SEATTLE
Customer Job No. 5711 LLC
Account: 3169361

For All Inquiries Call: 800-355-2772

Renit To:
CEMEX
PO Box 73261
Chicago, IL 60673-3261

PO Number	Delivery Address			PRODUCT CODE	DESCRIPTION	NET UNIT PRICE	DEMANDED QUANTITY	NET UNIT PRICE	QUANTITY	CITY	MATERIAL AMOUNT	FREIGHT	Zip Code
	DATE SHIPPED	DELIVERY NUMBER	REF#										
5711 24TH AVE NW-SEATTLE													
11/19/13	8060179843	1876067275	1192508	CLASS 3 SOIL DUMPED BY TON	25.920 TON	36.00	1 TON	25.920	1 TON	EVERETT	933.12	0.00	98203
11/19/13	8060179844	1876067276	1192508	CLASS 3 SOIL DUMPED BY TON	26.900 TON	36.00	1 TON	26.900	1 TON		968.40	0.00	
11/19/13	8060179846	1876067277	1192508	CLASS 3 SOIL DUMPED BY TON	23.910 TON	36.00	1 TON	23.910	1 TON		860.76	0.00	
11/19/13	8060179854	1876067281	1192508	CLASS 3 SOIL DUMPED BY TON	28.590 TON	36.00	1 TON	28.590	1 TON		1029.24	0.00	
11/19/13	8060179856	1876067283	1192508	CLASS 3 SOIL DUMPED BY TON	26.260 TON	36.00	1 TON	26.260	1 TON		945.36	0.00	
11/19/13	8060179862	1876067286	1192508	CLASS 3 SOIL DUMPED BY TON	27.980 TON	36.00	1 TON	27.980	1 TON		1007.28	0.00	
11/19/13	8060179868	1876067288	1192508	CLASS 3 SOIL DUMPED BY TON	27.590 TON	36.00	1 TON	27.590	1 TON		993.24	0.00	
11/19/13	8060179869	1876067290	1192508	CLASS 3 SOIL DUMPED BY TON	28.120 TON	36.00	1 TON	28.120	1 TON		1012.32	0.00	
11/19/13	8060179870	1876067291	1192508	CLASS 3 SOIL DUMPED BY TON	26.880 TON	36.00	1 TON	26.880	1 TON		967.68	0.00	
11/19/13	8060179871	1876067292	1192508	CLASS 3 SOIL DUMPED BY TON	27.490 TON	36.00	1 TON	27.490	1 TON		989.64	0.00	
11/19/13	8060179872	1876067293	1192508	CLASS 3 SOIL DUMPED BY TON	31.100 TON	36.00	1 TON	31.100	1 TON		1119.60	0.00	
11/19/13	8060179874	1876067295	1192508	CLASS 3 SOIL DUMPED BY TON	31.060 TON	36.00	1 TON	31.060	1 TON		1118.16	0.00	
11/19/13	8060179884	1876067302	1192508	CLASS 3 SOIL DUMPED BY TON	24.770 TON	36.00	1 TON	24.770	1 TON		891.72	0.00	
11/19/13	8060179885	1876067303	1192508	CLASS 3 SOIL DUMPED BY TON	29.160 TON	36.00	1 TON	29.160	1 TON		1049.76	0.00	
11/19/13	8060179890	1876067305	1192508	CLASS 3 SOIL DUMPED BY TON	28.430 TON	36.00	1 TON	28.430	1 TON		1023.48	0.00	
11/19/13	8060179891	1876067307	1192508	CLASS 3 SOIL DUMPED BY TON	28.220 TON	36.00	1 TON	28.220	1 TON		1015.92	0.00	
11/19/13	8060179893	1876067308	1192508	CLASS 3 SOIL DUMPED BY TON	31.190 TON	36.00	1 TON	31.190	1 TON		1122.84	0.00	
11/19/13	8060179893	1876067313	1192508	CLASS 3 SOIL DUMPED BY TON	26.860 TON	36.00	1 TON	26.860	1 TON		966.96	0.00	
11/19/13	8060179896	1876067315	1192508	CLASS 3 SOIL DUMPED BY TON	30.200 TON	36.00	1 TON	30.200	1 TON		1087.20	0.00	
11/19/13	8060179907	1876067316	1192508	CLASS 3 SOIL DUMPED BY TON	27.610 TON	36.00	1 TON	27.610	1 TON		993.96	0.00	
11/19/13	8060179913	1876067320	1192508	CLASS 3 SOIL DUMPED BY TON	27.180 TON	36.00	1 TON	27.180	1 TON		978.48	0.00	
11/19/13	8060179916	1876067322	1192508	CLASS 3 SOIL DUMPED BY TON	29.080 TON	36.00	1 TON	29.080	1 TON		1046.88	0.00	
11/19/13	8060179920	1876067325	1192508	CLASS 3 SOIL DUMPED BY TON	31.190 TON	36.00	1 TON	31.190	1 TON		1122.84	0.00	
11/19/13	8060180021	1876067326	1192508	CLASS 3 SOIL DUMPED BY TON	31.480 TON	36.00	1 TON	31.480	1 TON		1133.28	0.00	
11/19/13	8060180022	1876067327	1192508	CLASS 3 SOIL DUMPED BY TON	31.030 TON	36.00	1 TON	31.030	1 TON		1117.08	0.00	
11/19/13	8060180026	1876067329	1192508	CLASS 3 SOIL DUMPED BY TON	31.290 TON	36.00	1 TON	31.290	1 TON		1126.44	0.00	
11/19/13	8060180029	1876067331	1192508	CLASS 3 SOIL DUMPED BY TON	31.560 TON	36.00	1 TON	31.560	1 TON		1139.76	0.00	

The invoice incorporates herein by reference buyer's previously executed Credit Application, if any, Seller's Standard Terms and Conditions, Seller's Quotations and Seller's Order Confirmation. Limiting conditions of warranties as fully set forth on this invoice ("Agreement")



CEMEX
EMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

Date	11/19/13
Invoice No.	9427451824
Reference No.	

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13

Job No. 13B44751

Project _____

Legal Address: 5711 24TH AVE NW SEATTLE

Code _____

Customer Job No. 5711 LLC

Account: 3168361

Shipped To:

CEMEX

PO Box 73261

Chicago, IL 60673-3261

or All Inquiries Call: 800-355-2772

00-172

PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

CEMEX
PO Box 2037
Everett, WA 98213-2037

Approved By _____	Date _____
_____	_____
_____	_____
_____	_____

PO Number	Delivery Address		PRODUCT DESCRIPTION	DELIVERED QTY	NET UNIT PRICE	PRICED BY UNIT	City	Material Amount	Freight	Zip Code
	DATE SHIPPED	DELIVERY NUMBER	ITEM CODE	UOM	UOM					
11/19/13	8060180038	1876067337	1192508 CLASS 3 SOIL DUMPED BY TON	29.650 TON	36.00	1 TON	29.650	1067.40	0.00	
11/19/13	8060180042	1876067339	1192508 CLASS 3 SOIL DUMPED BY TON	31.030 TON	36.00	1 TON	31.030	1117.08	0.00	
11/19/13	8060180048	1876067342	1192508 CLASS 3 SOIL DUMPED BY TON	29.800 TON	36.00	1 TON	29.800	1072.80	0.00	
11/19/13	8060180050	1876067343	1192508 CLASS 3 SOIL DUMPED BY TON	30.690 TON	36.00	1 TON	30.690	1104.84	0.00	
11/19/13	8060180053	1876067345	1192508 CLASS 3 SOIL DUMPED BY TON	27.850 TON	36.00	1 TON	27.850	1002.60	0.00	
11/19/13	8060180054	1876067346	1192508 CLASS 3 SOIL DUMPED BY TON	29.500 TON	36.00	1 TON	29.500	1062.00	0.00	
11/19/13	8060180055	1876067350	1192508 CLASS 3 SOIL DUMPED BY TON	31.320 TON	36.00	1 TON	31.320	1127.52	0.00	
11/19/13	8060180056	1876067351	1192508 CLASS 3 SOIL DUMPED BY TON	28.340 TON	36.00	1 TON	28.340	1020.24	0.00	
11/19/13	8060187302	HW61274519	1192508 CLASS 3 SOIL DUMPED BY TON	24.600 TON	36.00	1 TON	24.600	885.60	0.00	
11/19/13	8060187303	HW61274518	1192508 CLASS 3 SOIL DUMPED BY TON	31.220 TON	36.00	1 TON	31.220	1123.92	0.00	
11/19/13	8060187304	HW61274520	1192508 CLASS 3 SOIL DUMPED BY TON	27.500 TON	36.00	1 TON	27.500	990.00	0.00	
11/19/13	8060187305	HW61274521	1192508 CLASS 3 SOIL DUMPED BY TON	22.780 TON	36.00	1 TON	22.780	820.08	0.00	
11/19/13	8060187306	HW61274522	1192508 CLASS 3 SOIL DUMPED BY TON	24.170 TON	36.00	1 TON	24.170	870.12	0.00	
11/19/13	8060187307	HW61274523	1192508 CLASS 3 SOIL DUMPED BY TON	26.040 TON	36.00	1 TON	26.040	937.44	0.00	
11/19/13	8060187308	HW61274524	1192508 CLASS 3 SOIL DUMPED BY TON	26.840 TON	36.00	1 TON	26.840	966.24	0.00	
11/19/13	8060187309	HW61274525	1192508 CLASS 3 SOIL DUMPED BY TON	23.730 TON	36.00	1 TON	23.730	854.28	0.00	
11/19/13	8060187310	HW61274526	1192508 CLASS 3 SOIL DUMPED BY TON	25.880 TON	36.00	1 TON	25.880	931.68	0.00	
11/19/13	8060187311	HW61274527	1192508 CLASS 3 SOIL DUMPED BY TON	22.610 TON	36.00	1 TON	22.610	813.96	0.00	
11/19/13	8060187312	HW61274528	1192508 CLASS 3 SOIL DUMPED BY TON	25.710 TON	36.00	1 TON	25.710	925.56	0.00	
11/19/13	8060187313	HW61274529	1192508 CLASS 3 SOIL DUMPED BY TON	26.010 TON	36.00	1 TON	26.010	936.36	0.00	
11/19/13	8060187314	HW61274530	1192508 CLASS 3 SOIL DUMPED BY TON	21.450 TON	36.00	1 TON	21.450	772.20	0.00	
11/19/13	8060187315	HW61274531	1192508 CLASS 3 SOIL DUMPED BY TON	26.750 TON	36.00	1 TON	26.750	963.00	0.00	
11/19/13	8060187317	HW61274532	1192508 CLASS 3 SOIL DUMPED BY TON	24.490 TON	36.00	1 TON	24.490	881.64	0.00	
O Subtotal:	0.00 Yards	1,389.11 Tons	50,007.96 Material	0.00 Freight	1,800.25 Other	0.00 Tax	51,808.21 Total			

Yards	0.00	Tons	1,389.11 Freight Total	0.00 Other	1,800.25 Sales Tax Total	0.00	Invoice Total
AGE # 2							51,808.21

The above incorporates herein by reference Buyer's presently executed Credit Application, if any, Seller's Standard Terms and Conditions, Seller's Quotation and Seller's Order Confirmation (including limitations or warranties) as fully set forth on this invoice.

"Agreement": Buyer agrees that, unless otherwise noted, all quantities and items were delivered as indicated and further expressly agrees to pay in accordance with this Agreement. Buyer shall receive an late payment.



INVOICE

CEMEX Construction Materials Pacific, LLC

Rinker Materials Nevada
Associated Sand & Gravel

Date	11/18/13
Invoice No.	9427439388
Reference No.	

For All Inquiries Call: 800-355-2772

Remit To:
CEMEX
 PO Box 73261
 Chicago, IL 60673-3261

For All Inquiries Call: 800-355-2772

Payment Due On 12/20/13

Job No. 13844751

Legal Address: 5711 24TH AVE NW-SEATTLE

Customer Job No. 5711 LLC

Account: 3169361

Terms: Net 20th prox Please note change of terms

PRYDE JOHNSON 5711 LLC
 419 NE 70TH ST
 SEATTLE, WA 98115-5481

S711

Date
02250Amount.
\$29,699.21Approved By
MCRDate
11/25/13

PO Number	Delivery Address	Product Code	Product Description	DELIVERED QUANTITY	NET UNIT PRICE	REFUSED UNITS	MATERIAL AMOUNT	Zip Code
5711	5711 24TH AVE NW-SEATTLE		CLASS 3 SOIL DUMPED BY TON	27.710 TON	36.00	1 TON	27.710	997.56 0.00
11/18/13	8060170617 HW60250684	1192508	CLASS 3 SOIL DUMPED BY TON	28.060 TON	36.00	1 TON	28.060	1010.16 0.00
11/18/13	8060170618 HW60250685	1192508	CLASS 3 SOIL DUMPED BY TON	25.640 TON	36.00	1 TON	25.640	923.04 0.00
11/18/13	8060171119 HW60250685	1192508	CLASS 3 SOIL DUMPED BY TON	21.500 TON	36.00	1 TON	21.500	774.00 0.00
11/18/13	8060171120 HW60250687	1192508	CLASS 3 SOIL DUMPED BY TON	30.270 TON	36.00	1 TON	30.270	1089.72 0.00
11/18/13	8060171121 HW60250688	1192508	CLASS 3 SOIL DUMPED BY TON	26.160 TON	36.00	1 TON	26.160	941.76 0.00
11/18/13	8060171122 HW60250689	1192508	CLASS 3 SOIL DUMPED BY TON	28.650 TON	36.00	1 TON	28.650	1031.40 0.00
11/18/13	8060171123 HW60250690	1192508	CLASS 3 SOIL DUMPED BY TON	28.420 TON	36.00	1 TON	28.420	1023.12 0.00
11/18/13	8060171124 HW60250691	1192508	CLASS 3 SOIL DUMPED BY TON	26.540 TON	36.00	1 TON	26.540	955.44 0.00
11/18/13	8060171125 HW60250692	1192508	CLASS 3 SOIL DUMPED BY TON	22.800 TON	36.00	1 TON	22.800	820.80 0.00
11/18/13	8060171127 HW60250693	1192508	CLASS 3 SOIL DUMPED BY TON	27.940 TON	36.00	1 TON	27.940	1005.84 0.00
11/18/13	8060171128 HW60250694	1192508	CLASS 3 SOIL DUMPED BY TON	29.840 TON	36.00	1 TON	29.840	1074.24 0.00
11/18/13	8060171129 HW60250695	1192508	CLASS 3 SOIL DUMPED BY TON	27.120 TON	36.00	1 TON	27.120	976.32 0.00
11/18/13	8060171130 HW60250696	1192508	CLASS 3 SOIL DUMPED BY TON	32.990 TON	36.00	1 TON	32.990	1187.64 0.00
11/18/13	8060171131 HW60250697	1192508	CLASS 3 SOIL DUMPED BY TON	30.830 TON	36.00	1 TON	30.830	1109.88 0.00
11/18/13	8060171132 HW60250698	1192508	CLASS 3 SOIL DUMPED BY TON	25.260 TON	36.00	1 TON	25.260	909.36 0.00
11/18/13	8060171133 HW60250699	1192508	CLASS 3 SOIL DUMPED BY TON	29.680 TON	36.00	1 TON	29.680	1068.48 0.00
11/18/13	8060171134 HW60250700	1192508	CLASS 3 SOIL DUMPED BY TON	31.340 TON	36.00	1 TON	31.340	1128.24 0.00
11/18/13	8060171135 HW60250701	1192508	CLASS 3 SOIL DUMPED BY TON	28.940 TON	36.00	1 TON	28.940	1041.84 0.00
11/18/13	8060171136 HW60250702	1192508	CLASS 3 SOIL DUMPED BY TON	29.130 TON	36.00	1 TON	29.130	1048.68 0.00
11/18/13	8060171137 HW60250703	1192508	CLASS 3 SOIL DUMPED BY TON	28.170 TON	36.00	1 TON	28.170	1014.12 0.00
11/18/13	8060171138 HW60250704	1192508	CLASS 3 SOIL DUMPED BY TON	23.680 TON	36.00	1 TON	23.680	852.48 0.00
11/18/13	8060171139 HW60250705	1192508	CLASS 3 SOIL DUMPED BY TON	27.900 TON	36.00	1 TON	27.900	1004.40 0.00
11/18/13	8060171140 HW60250706	1192508	CLASS 3 SOIL DUMPED BY TON	33.950 TON	36.00	1 TON	33.950	1222.20 0.00
11/18/13	8060171141 HW60250707	1192508	CLASS 3 SOIL DUMPED BY TON	31.640 TON	36.00	1 TON	31.640	1139.04 0.00
11/18/13	8060171142 HW60250708	1192508	CLASS 3 SOIL DUMPED BY TON	27.080 TON	36.00	1 TON	27.080	974.88 0.00
11/18/13	8060171143 HW60250709	1192508	CLASS 3 SOIL DUMPED BY TON	32.380 TON	36.03	1 TON	32.380	1165.68 0.00



CEMEX Construction Materials Pacific, LLC
Rinker Materials Nevada
Associated Sand & Gravel

CEMEX
PO Box 2037
Everett, WA 98213-2037

002989

PRYDE JOHNSON 5711 LLC
419 NE 70TH ST
SEATTLE, WA 98115-5481

Date	11/18/13
Invoice No.	9427439388
Reference No.	

Terms: Net 20th prox Please note change of terms

Payment Due On 12/20/13

Job No. 13844751

Legal Address: 5711 24TH AVE NW-SEATTLE

Customer Job No. 5711 LLC

Account: 3169361

CEMEX
PO Box 73261
Chicago, IL 60673-3261
or All Inquiries Call: 800-355-2772

PO Number	Delivery Address			PRODUCT DESCRIPTION	DELIVERED QTY	NET UNIT PRICE	PRICED BY UNIT	CITY	ZIP CODE
DATE SHIPPED	REF#	PRODUCT CODE	ITEM NUMBER	ITEM NUMBER	TON	TON	TON	TON	TON
11/18/13	806D171145	HWD0250711	1192508	CLASS 3 SOIL DUMPED BY TON	32,690	36.00	1 TON	1176.84	0.00
O Subtotal:	0.00 Yards	796.31	Tons	28,667.16 Material	0.00	Freight	1,032.05	Other	0.00 Tax 29,699.21 Total

Yards	0.00	Tons	796.31	Freight Total	0.00	Other	1,032.05	Sales Tax Total	0.00	Invoice Total	29,699.21
PAGE #	2										

The invoice incorporates herein by reference Buyer's previously executed Credit Application, if any, Seller's Standard Terms and Conditions, Seller's Quantities and Seller's Order Confirmation (including limitations of warranties) as fully set forth in the credit application ("Agreement"). Buyer agrees that, unless otherwise noted herein, all quantities and items were delivered as indicated and further expressly agrees to pay in accordance with this Agreement. Interest shall accrue on late payment.