



RECEIVED
OCT 09 2015
DEPT. OF ECOLOGY

P.C.S. (Petroleum Contaminated Soil)

Removal & Disposal Report:

5050 Hannegan Road Bellingham, WA 98226

Prepared for:

Donna Musa (Department of Ecology)

Ted Benson (Department of Ecology)

Will Anderson (Whatcom County Fire Marshal)

Andy Garcia (ReMax)



Table of Contents

P.C.S. Removal & Disposal Report

Appendix A – CEMEX P.C.S. load slips

Appendix B – Chain of Custody Lab Analysis Requests

Appendix C – ALS Laboratories Soil Analysis Reports

Appendix D – Site Maps

Appendix E – Site photos

Appendix F – Soil Sample Descriptions and Map



P.C.S. (Petroleum Contaminated Soil) Report

Date: September 24, 2015

R.E.: 5050 Hannegan Road, Bellingham WA 98226
ERTS#658358

On July 15, 2015 Ultra Tank Services, Inc. removed a 500 gallon underground heating oil tank located 5050 Hannegan Road, Bellingham WA 98226. A permit was taken out through Whatcom County.

Upon removal of the tank, and inspection by Whatcom County Fire Marshall Will Anderson, a soil sample was taken and submitted to ALS Laboratories in Everett Washington for DX-Analysis.

On July 21, 2015 ALS provided results showing 16,000 P.P.M. (Part per Million) well above the MTCA limit of 2,000 P.P.M.

On July 22, 2015 DOE was notified of the release and an ERTS # was issued from Donna Musa @ DOE, ERTS #658358.

On August 20, 2015 Ultra Tank Services, Inc. started voluntary cleanup action, removing and disposing of P.C.S. (Petroleum Contaminated Soil). On August 20, 2015 11.89 tons of P.C.S. was removed disposed of to CEMAX in Everett Washington (See soil disposal weight slips in Appendix A), On August 24, 2015, 5.53 tons of P.C.S. was removed and disposed of to CEMEX. At this point there was still some P.C.S. to remove and dispose of, and the owners needed some time to acquire funding to complete the project.

On September 22, 2015 6.79 tons of P.C.S. was removed and disposed of and taken to CEMEX in Everett Washington, (See Appendix A) The excavation looked good, sheen tests were done on floor soils, as well as side wall samples, with no sheen.

Seven soil samples were taken from the excavation, two (2) floor samples, and five (5) sidewall samples were taken and put into ALS provided sample jars and delivered to ALS Laboratories in Everett Washington for DX-Analysis.



(See chains of custody in Appendix B, and soil sample results in Appendix C).

The excavation was 12'ft. in length North to South, and 8'in. in width East to West, and 8'ⁱⁿ. in depth. (See site map in Appendix D).

(See Appendix E for photographs showing excavation and soil sample locations).

(See Appendix F for excavation and soil sample descriptions and locations).

ALS DX-Analysis on all seven (7) final samples showed clean soils, thus concluding the P.C.S. removal and disposal.

In conclusion, 24.21 tons of heating oil contaminated soils were removed and disposed of and delivered to CEMEX. Seven (7) soil samples were taken and submitted to ALS for DX analysis, and all Seven (7) were non-detect, meeting the MTCA clean-up level. The site does not require any further remediation from the heating oil tank release.

Please feel free to contact manager Leo Day if you have any questions.

Thank you.


Leo Day, Ultra Tank Services, Inc.

Leo Day,
President
Ultra Tank Services, Inc.

CC:

Donna Musa D.O.E. (Department of Ecology)
Ted Benson D.O.E. (Department of Ecology)
Will Anderson (Whatcom County Fire Marshall)
Andy Garcia (ReMax)



1876083806

Weighted At: Soil Remediation
6300 Glenwood Ave
Everett, WA 98213

Location: 1876



Order: Dispatch: 0 Date: 09/22/2015
Ship To: 3042112 - ULTRA TANK SERVICE INC
5050 HANNEGAN RD BELLINGHAM
5050 HANNEGAN RD BELLINGHAM
BELLINGHAM, WA 98226-7724
Instruct: ULTRA TANK DUMP


Job #: PO: PER LEO
Product: 1192508 - CLASS 3 SOIL DUMPED BY TON
Carrier: -
Vehicle: 2034265 - 1876-3, EVERETT SOIL GENERIC
Tractor / Trailer: 1 / Trailer 2 -/-

Qty: 6.79 ton					--- DRIVER ON AT TARE & GROSS ---				
Weighmaster:					lb	ton	lb	ton	tne
CEMEX					23,360	11.68	21,000	10.50	9.53
Gross:					9,780	4.89	9,940	4.97	4.51
Tare:					13,580	6.79	11,060	5.53	5.02
Net:									
Deputy Weighmaster:									
Elizabeth M. Arnold									
Scale:					1				
In:					11:10 am				
Out:					11:30 am				
Today Loads:									1
Today Qty:						-6.79 ton			5.53 ton
						0.00			0.00

CEMEX'S STANDARD TERMS AND
CONDITIONS INCORPORATED HEREIN.

Signature of Receiving Agent
METRIC CONVERSION FORMULA: POUNDS DIVIDED BY 2204.623, ROUNDED TO 2 DECIMALS
SEE REVERSE SIDE FOR PRODUCT LABEL INFORMATION

Driver:



1876082521

Weighted At: Soil Remediation
6300 Glenwood Ave
Everett, WA 98213

Location: 1876



Order: Dispatch: 0 Date: 08/24/2015
Ship To: 3042112 - ULTRA TANK SERVICE INC
5050 HANNUGAN DR BELLINGHAM
5050 HANNUGAN DR BELLINGHAM
BELLINGHAM, WA 98226-7724
Instruct: WHITE FORD

Job #: 5050 HANNUGAN DR BELLIN PO: 5050 HANNUGAN DR BELL
Product: 1192508 - CLASS 3 SOIL DUMPED BY TON
Carrier: -
Vehicle: 2034264 - 1876-2, EVERETT SOIL GENERIC
Tractor / Trailer: 1 / Trailer 2 -/-

Qty: 5.53 ton					--- DRIVER ON AT TARE & GROSS ---				
Weighmaster:					lb	ton	lb	ton	tne
CEMEX					21,000	10.50	21,000	10.50	9.53
Gross:					9,940	4.97	9,940	4.97	4.51
Tare:					11,060	5.53	11,060	5.53	5.02
Net:									
Deputy Weighmaster:									
Elizabeth M. Arnold									
Scale:					0				
In:					10:57 am				
Out:					1:59 pm				
Today Loads:									1
Today Qty:						5.53 ton			5.53 ton
						0.00			0.00

CEMEX'S STANDARD TERMS AND
CONDITIONS INCORPORATED HEREIN.

Signature of Receiving Agent
METRIC CONVERSION FORMULA: POUNDS DIVIDED BY 2204.623, ROUNDED TO 2 DECIMALS
SEE REVERSE SIDE FOR PRODUCT LABEL INFORMATION

Driver:



1876082315

Weighed At: Soil Remediation

6300 Glenwood Ave

CEMEX Everett, WA 98213

Location: 1876

Order: Dispatch: 0 Date: 08/20/2015

Ship To: 3042112 - ULTRA TANK SERVICE INC

5050 HANNUGAN DR BELLINGHAM

5050 HANNUGAN DR BELLINGHAM

BELLINGHAM, WA 98226-7724

Instruct: WHITE FORD

Job #: 5050 HANNUGAN DR BELLIN PO: 5050 HANNUGAN DR BELL

Product: 1192508 - CLASS 3 SOIL DUMPED BY TON

Carrier:

Vehicle: 2034264 - 1876-2 EVERETT SOIL GENERIC

Tractor / Trailer 1 / Trailer 2 - / -

Qty:	5.92 ton	--- DRIVER ON AT TARE & GROSS ---			
Weightmaster:		lb	ton	tne	
CEMEX		21,840	10.92	9.91	
Deputy Weightmaster:		Gross:	10,000	5.00	4.54
Elizabeth M. Arnold		Tare:	11,840	5.92	5.37
Scale:	1	Net:	* Predetermined Tare		
In:	1:19 pm	Today Loads:	2		
Out:		Today Qty:	-0.05 ton		
			0.00		

CEMEX'S STANDARD TERMS AND CONDITIONS INCORPORATED HEREIN.

Signature of Receiving Agent

Driver:

METRIC CONVERSION FORMULA: POUNDS DIVIDED BY 2204.623, ROUNDED TO 2 DECIMALS
SEE REVERSE SIDE FOR PRODUCT LABEL INFORMATION



1876082297

Weighed At: Soil Remediation

6300 Glenwood Ave

CEMEX Everett, WA 98213

Location: 1876

Order: Dispatch: 0 Date: 08/20/2015

Ship To: 3042112 - ULTRA TANK SERVICE INC

5050 HANNUGAN DR BELLINGHAM

5050 HANNUGAN DR BELLINGHAM

BELLINGHAM, WA 98226-7724

Instruct: WHITE FORD

Job #: 5050 HANNUGAN DR BELLIN PO: 5050 HANNUGAN DR BELL

Product: 1192508 - CLASS 3 SOIL DUMPED BY TON

Carrier:

Vehicle: 2034264 - 1876-2 EVERETT SOIL GENERIC

Tractor / Trailer 1 / Trailer 2 - / -

Qty:	5.97 ton	--- DRIVER ON AT TARE & GROSS ---			
Weightmaster:		lb	ton	tne	
CEMEX		21,940	10.97	9.95	
Deputy Weightmaster:		Gross:	10,000	5.00	4.54
Elizabeth M. Arnold		Tare:	11,940	5.97	5.42
Scale:	1	Net:			
In:	9:55 am	Today Loads:	1		
Out:	10:11 am	Today Qty:	-5.97 ton		
			0.00		

CEMEX'S STANDARD TERMS AND CONDITIONS INCORPORATED HEREIN.

Signature of Receiving Agent

Driver:

METRIC CONVERSION FORMULA: POUNDS DIVIDED BY 2204.623, ROUNDED TO 3 DECIMALS
SEE REVERSE SIDE FOR PRODUCT LABEL INFORMATION



Chain Of Custody/ Laboratory Analysis Request

ALS Job# (Laboratory Use Only)

EVI507002

Date _____ Page _____ Of _____

PROJECT ID: 60 Day				OTHER (Specify)			
REPORT TO COMPANY: Ultra Tank Sys				NUMBER OF CONTAINERS			
PROJECT MANAGER: 60 Day				TCLP-Metals ☐ VOA ☐ Semi-Vol ☐ Pest ☐ Herbs ☐			
ADDRESS: 5314 E 1st Ave				Metals Other (Specify)			
PHONE: 3608151415				Metals-MTCA-5 ☐ RCRA-8 ☐ P/I Pol ☐ TAL ☐			
E-MAIL: LADS@2000.com				PCB ☐ Pesticides ☐ by EPA 8081/8082			
PO. NUMBER:				Polycyclic Aromatic Hydrocarbons (PAH) by EPA-8270 SIM ☐			
INVOICE TO COMPANY: Sam				Semi-volatile Organic Compounds by EPA 8270			
ATTENTION:				EDB / EDC by EPA 8260 (soil)			
ADDRESS:				EDB / EDC by EPA 8260 SIM (water)			
				Volatile Organic Compounds by EPA 8260			
				Halogenated Volatiles by EPA 8260			
				MTBE by EPA-8021 ☐ EPA-8260 ☐			
				BTEX by EPA-8021			
				NMTPH-GX			
				NMTPH-DX			
				NMTPH-HCID			
1. Tank Bottom 7/1/50905 soil				X			
2.							
3.							
4.							
5.							
6.							
7.							
8.							
9.							
10.							

SIGNATURES (Name, Company, Date, Time):

TURNAROUND REQUESTED in Business Days*

OTHER: Organic, Metals & Inorganic Analysis

1. Relinquished By: A young Har Uberg 7/20/2015 9:10 AM

Received By:

Specify: _____

Standard

10

5

3

2

1

SAME DAY

Fuels & Hydrocarbon Analysis

2. Relinquished By:


Fuels & Hydrocarbon Analysis

Received By:

Standard

* Turnaround request less than standard may incur Rush Charges

CLIENT COPY

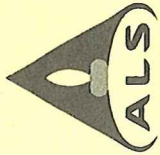

ALS Environmental
8620 Holly Drive, Suite 100
Everett, WA 98208
Phone (425) 356-2600
Fax (425) 356-2626
http://www.alsglobal.com

Chain Of Custody/ Laboratory Analysis Request

ALS Job#

(Laboratory Use Only)

EV15090133

Date _____ Page _____ Of _____

PROJECT INFORMATION				ANALYSIS REQUESTED										OTHER (Specify)		RECEIVED IN GOOD CONDITION?											
PROJECT ID:	REPORT TO COMPANY:	PROJECT MANAGER:	ADDRESS:	PHONE:	P.O. #:	INVOICE TO COMPANY:	ATTENTION:	ADDRESS:	DATE	TIME	TYPE	LAB#	NWTPH-HCID	NWTPH-DX	NWTPH-GX	BTEX by EPA-8021	MTBE by EPA-8021	Halogenated Volatiles by EPA 8260	Volatile Organic Compounds by EPA 8260	EDB / EDC by EPA 8260 SIM (water)	EDB / EDC by EPA 8260 (soil)	Semivolatile Organic Compounds by EPA 8270	Polycyclic Aromatic Hydrocarbons (PAH) by EPA-8270 SIM	PCB ☐ Pesticides ☐ by EPA 8081/8082	Metals-MTCA-5 ☐ RCRA-8 ☐ TAL ☐ Metals Other (Specify)	TCLP-Metals ☐ VOA ☐ Semi-Vol ☐ Pest ☐ Herbs ☐	
1.	#1-W. S. Sidewalk	9/22/15	9:29	Soil																							
2.	#2-S.	11	9:35	"																							
3.	#3-S. Floor	11	9:40	"																							
4.	#4-N. Floor	11	9:45	"																							
5.	#5-N. Wall	11	9:50	"																							
6.	#6-N.E. Sidewalk	11	9:55	"																							
7.	#7-S.E.	11	9:58	"																							
8.																											
9.																											
10.																											

SPECIAL INSTRUCTIONS

SIGNATURES (Name, Company, Date, Time): Shawn Roberson

1. Relinquished By: Jeff Dadd ULTRATANK 506 9/22/15 11:44

Received By: Shawn Roberson ALS 9/22/15 11:44

2. Relinquished By: _____

Received By: _____

TURNAROUND REQUESTED in Business Days*
Organic, Metals & Inorganic Analysis
OTHER:

Specify:

10 5 3 2 1

Standard

Fuels & Hydrocarbon Analysis

5 3 1

Standard



September 22, 2015

Mr. Leo Day
UTS, Inc.
PO Box 30096
Bellingham, WA 98228

Dear Mr. Day,

On September 22nd, 7 samples were received by our laboratory and assigned our laboratory project number EV15090133. The project was identified as your 5050 Hannegan. The sample identification and requested analyses are outlined on the attached chain of custody record.

No abnormalities or nonconformances were observed during the analyses of the project samples.

Please do not hesitate to call me if you have any questions or if I can be of further assistance.

Sincerely,

ALS Laboratory Group

Rick Bagan
Laboratory Director



CERTIFICATE OF ANALYSIS

CLIENT: UTS, Inc.
PO Box 30096
Bellingham, WA 98228

DATE: 9/22/2015

ALS JOB#: EV15090133

ALS SAMPLE#: EV15090133-01

CLIENT CONTACT: Leo Day
CLIENT PROJECT: 5050 Hannegan

DATE RECEIVED: 09/22/2015

COLLECTION DATE: 9/22/2015 9:29:00 AM

CLIENT SAMPLE ID #1 W. Sidewall

WDOE ACCREDITATION: C601

SAMPLE DATA RESULTS

ANALYTE	METHOD	RESULTS	REPORTING LIMITS	DILUTION FACTOR	UNITS	ANALYSIS DATE	ANALYSIS BY
TPH-Diesel Range	NWTPH-DX	U	25	1	MG/KG	09/22/2015	EBS
TPH-Oil Range	NWTPH-DX	U	50	1	MG/KG	09/22/2015	EBS

SURROGATE	METHOD	%REC	ANALYSIS DATE	ANALYSIS BY
C25	NWTPH-DX	86.2	09/22/2015	EBS

U - Analyte analyzed for but not detected at level above reporting limit.



CERTIFICATE OF ANALYSIS

CLIENT: UTS, Inc.
PO Box 30096
Bellingham, WA 98228

DATE: 9/22/2015

ALS JOB#: EV15090133

ALS SAMPLE#: EV15090133-02

CLIENT CONTACT: Leo Day

DATE RECEIVED: 09/22/2015

CLIENT PROJECT: 5050 Hannegan

COLLECTION DATE: 9/22/2015 9:35:00 AM

CLIENT SAMPLE ID #2 - S. Sidewall

WDOE ACCREDITATION: C601

SAMPLE DATA RESULTS

ANALYTE	METHOD	RESULTS	REPORTING LIMITS	DILUTION FACTOR	UNITS	ANALYSIS DATE	ANALYSIS BY
TPH-Diesel Range	NWTPH-DX	U	25	1	MG/KG	09/22/2015	EBS
TPH-Oil Range	NWTPH-DX	U	50	1	MG/KG	09/22/2015	EBS

SURROGATE	METHOD	%REC	ANALYSIS DATE	ANALYSIS BY
C25	NWTPH-DX	98.1	09/22/2015	EBS

U - Analyte analyzed for but not detected at level above reporting limit.

CERTIFICATE OF ANALYSIS

CLIENT:	UTS, Inc. PO Box 30096 Bellingham, WA 98228	DATE:	9/22/2015
		ALS JOB#:	EV15090133
		ALS SAMPLE#:	EV15090133-03
CLIENT CONTACT:	Leo Day	DATE RECEIVED:	09/22/2015
CLIENT PROJECT:	5050 Hannegan	COLLECTION DATE:	9/22/2015 9:40:00 AM
CLIENT SAMPLE ID	#3 - S. Floor	WDOE ACCREDITATION:	C601

SAMPLE DATA RESULTS

ANALYTE	METHOD	RESULTS	REPORTING LIMITS	DILUTION FACTOR	UNITS	ANALYSIS DATE	ANALYSIS BY
TPH-Diesel Range	NWTPH-DX	U	25	1	MG/KG	09/22/2015	EBS
TPH-Oil Range	NWTPH-DX	U	50	1	MG/KG	09/22/2015	EBS

SURROGATE	METHOD	%REC	ANALYSIS DATE	ANALYSIS BY
C25	NWTPH-DX	98.0	09/22/2015	EBS

U - Analyte analyzed for but not detected at level above reporting limit.

CERTIFICATE OF ANALYSIS

CLIENT:	UTS, Inc. PO Box 30096 Bellingham, WA 98228	DATE:	9/22/2015
		ALS JOB#:	EV15090133
		ALS SAMPLE#:	EV15090133-04
CLIENT CONTACT:	Leo Day	DATE RECEIVED:	09/22/2015
CLIENT PROJECT:	5050 Hannegan	COLLECTION DATE:	9/22/2015 9:45:00 AM
CLIENT SAMPLE ID	#4 - N. Floor	WDOE ACCREDITATION:	C601

SAMPLE DATA RESULTS

ANALYTE	METHOD	RESULTS	REPORTING LIMITS	DILUTION FACTOR	UNITS	ANALYSIS DATE	ANALYSIS BY
TPH-Diesel Range	NWTPH-DX	U	25	1	MG/KG	09/22/2015	EBS
TPH-Oil Range	NWTPH-DX	U	50	1	MG/KG	09/22/2015	EBS

SURROGATE	METHOD	%REC	ANALYSIS DATE	ANALYSIS BY
C25	NWTPH-DX	83.1	09/22/2015	EBS

U - Analyte analyzed for but not detected at level above reporting limit.



CERTIFICATE OF ANALYSIS

CLIENT:	UTS, Inc. PO Box 30096 Bellingham, WA 98228	DATE:	9/22/2015
CLIENT CONTACT:	Leo Day	ALS JOB#:	EV15090133
CLIENT PROJECT:	5050 Hannegan	ALS SAMPLE#:	EV15090133-05
CLIENT SAMPLE ID	#5 - N. Wall	DATE RECEIVED:	09/22/2015
		COLLECTION DATE:	9/22/2015 9:50:00 AM
		WDOE ACCREDITATION:	C601

SAMPLE DATA RESULTS

ANALYTE	METHOD	RESULTS	REPORTING LIMITS	DILUTION FACTOR	UNITS	ANALYSIS DATE	ANALYSIS BY
TPH-Diesel Range	NWTPH-DX	U	25	1	MG/KG	09/22/2015	EBS
TPH-Oil Range	NWTPH-DX	U	50	1	MG/KG	09/22/2015	EBS

SURROGATE	METHOD	%REC	ANALYSIS DATE	ANALYSIS BY
C25	NWTPH-DX	89.1	09/22/2015	EBS

U - Analyte analyzed for but not detected at level above reporting limit.



CERTIFICATE OF ANALYSIS

CLIENT: UTS, Inc.
PO Box 30096
Bellingham, WA 98228
DATE: 9/22/2015
ALS JOB#: EV15090133
ALS SAMPLE#: EV15090133-06
CLIENT CONTACT: Leo Day
DATE RECEIVED: 09/22/2015
CLIENT PROJECT: 5050 Hannegan
COLLECTION DATE: 9/22/2015 9:55:00 AM
CLIENT SAMPLE ID: #6 - N.E. Sidewall
WDOE ACCREDITATION: C601

SAMPLE DATA RESULTS

ANALYTE	METHOD	RESULTS	REPORTING LIMITS	DILUTION FACTOR	UNITS	ANALYSIS DATE	ANALYSIS BY
TPH-Diesel Range	NWTPH-DX	U	25	1	MG/KG	09/22/2015	EBS
TPH-Oil Range	NWTPH-DX	U	50	1	MG/KG	09/22/2015	EBS

SURROGATE	METHOD	%REC	ANALYSIS DATE	ANALYSIS BY
C25	NWTPH-DX	90.4	09/22/2015	EBS

U - Analyte analyzed for but not detected at level above reporting limit.



CERTIFICATE OF ANALYSIS

CLIENT: UTS, Inc.
PO Box 30096
Bellingham, WA 98228
CLIENT CONTACT: Leo Day
CLIENT PROJECT: 5050 Hannegan
CLIENT SAMPLE ID: #7 - S.E. Sidewall

DATE: 9/22/2015
ALS JOB#: EV15090133
ALS SAMPLE#: EV15090133-07
DATE RECEIVED: 09/22/2015
COLLECTION DATE: 9/22/2015 9:58:00 AM
WDOE ACCREDITATION: C601

SAMPLE DATA RESULTS

ANALYTE	METHOD	RESULTS	REPORTING LIMITS	DILUTION FACTOR	UNITS	ANALYSIS DATE	ANALYSIS BY
TPH-Diesel Range	NWTPH-DX	U	25	1	MG/KG	09/22/2015	EBS
TPH-Oil Range	NWTPH-DX	U	50	1	MG/KG	09/22/2015	EBS

SURROGATE	METHOD	%REC	ANALYSIS DATE	ANALYSIS BY
C25	NWTPH-DX	95.4	09/22/2015	EBS

U - Analyte analyzed for but not detected at level above reporting limit.



CERTIFICATE OF ANALYSIS

CLIENT: UTS, Inc.
PO Box 30096
Bellingham, WA 98228

DATE: 9/22/2015
ALS SDG#: EV15090133
WDOE ACCREDITATION: C601

CLIENT CONTACT: Leo Day
CLIENT PROJECT: 5050 Hannegan

LABORATORY BLANK RESULTS

MB-091715S - Batch 97179 - Soil by NWTPH-DX

ANALYTE	METHOD	RESULTS	QUAL	UNITS	REPORTING LIMITS	ANALYSIS DATE	ANALYSIS BY
TPH-Diesel Range	NWTPH-DX	U		MG/KG	25	09/17/2015	EBS
TPH-Oil Range	NWTPH-DX	U		MG/KG	50	09/17/2015	EBS

U - Analyte analyzed for but not detected at level above reporting limit.



CERTIFICATE OF ANALYSIS

CLIENT: UTS, Inc.
PO Box 30096
Bellingham, WA 98228

DATE: 9/22/2015
ALS SDG#: EV15090133
WDOE ACCREDITATION: C601

CLIENT CONTACT: Leo Day
CLIENT PROJECT: 5050 Hannegan


LABORATORY CONTROL SAMPLE RESULTS

ALS Test Batch ID: 97179 - Soil by NWTPH-DX

SPIKED COMPOUND	METHOD	%REC	RPD	QUAL	ANALYSIS DATE	ANALYSIS BY
TPH-Diesel Range - BS	NWTPH-DX	106			09/17/2015	EBS
TPH-Diesel Range - BSD	NWTPH-DX	96.2	10		09/17/2015	EBS

APPROVED BY

Laboratory Director

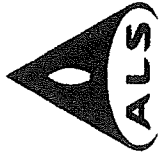

ALS Environmental
8620 Holly Drive, Suite 100
Everett, WA 98208
Phone (425) 356-2600
Fax (425) 356-2626
<http://www.alsglobal.com>

Chain Of Custody/ Laboratory Analysis Request

ALS Job# (Laboratory Use Only)

EV15090133

Date _____ Page _____ Of _____

PROJECT ID: 5050 Hannegan
REPORT TO COMPANY: Ultra-Tek Inc
PROJECT MANAGER: Leo D. Day
ADDRESS: 5314 E. 18th Ave
Bellingham WA 98226
PHONE: 360 815 1415 FAX: _____
P.O. #: _____ E-MAIL: LEO.D.DAY@ultra-tek.com
INVOICE TO COMPANY: Sisena
ATTENTION: _____
ADDRESS: _____

ANALYSIS REQUESTED					OTHER (Specify)										
SAMPLE I.D.	DATE	TIME	TYPE	LAB#	MTBE by EPA-8021 ☐ EPA-8260 ☐	Halogenated Volatiles by EPA 8260	Volatile Organic Compounds by EPA 8260	EDB / EDC by EPA 8260 SIM (water)	EDB / EDC by EPA 8260 (soil)	Semivolatile Organic Compounds by EPA 8270	Polycyclic Aromatic Hydrocarbons (PAH) by EPA-8270 SIM ☐	PCB ☐ Pesticides ☐ by EPA 8081/8082	Metals-MTCA-5 ☐ RCRA-8 ☐ TAL ☐	Metals Other (Specify)	TCLP-Metals ☐ VOA ☐ Semi-Vol ☐ Pest ☐ Herbs ☐
1. #1 W. Sidewalk	9/23/15	9:29	S.C.I	1											
2. #2 S. "	"	9:35	"	2											
3. #3 S. Floor	"	9:40	"	3											
4. #4 N. Floor	"	9:45	"	4											
5. #5 N. Wall	"	9:50	"	5											
6. #6 N.E. Sidewalk	"	9:55	"	6											
7. #7 S.E. "	"	9:58	"	7											
8.															
9.															
10.															

SPECIAL INSTRUCTIONS

SIGNATURES (Name, Company, Date, Time): Jeff Dadd
1. Relinquished By: JEFF DADD ULTRATEK INC. 9/23/15 11:44
Received By: Shawn Robinson ACS 9/22/15 11:44
2. Relinquished By: _____
Received By: _____

TURNAROUND REQUESTED IN Business Days*
Organic, Metals & Inorganic Analysis
OTHER: _____

Specify: _____
10 5 3 1
Standard
Fuels & Hydrocarbon Analysis
5 3 1
Standard


Hannegan St.

Driveway →

5050
Hannegan St.

Stairway to Basement


concrete wall

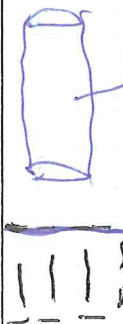

500 gallon
#2 heating oil tank

Driveway →

Hannegan St

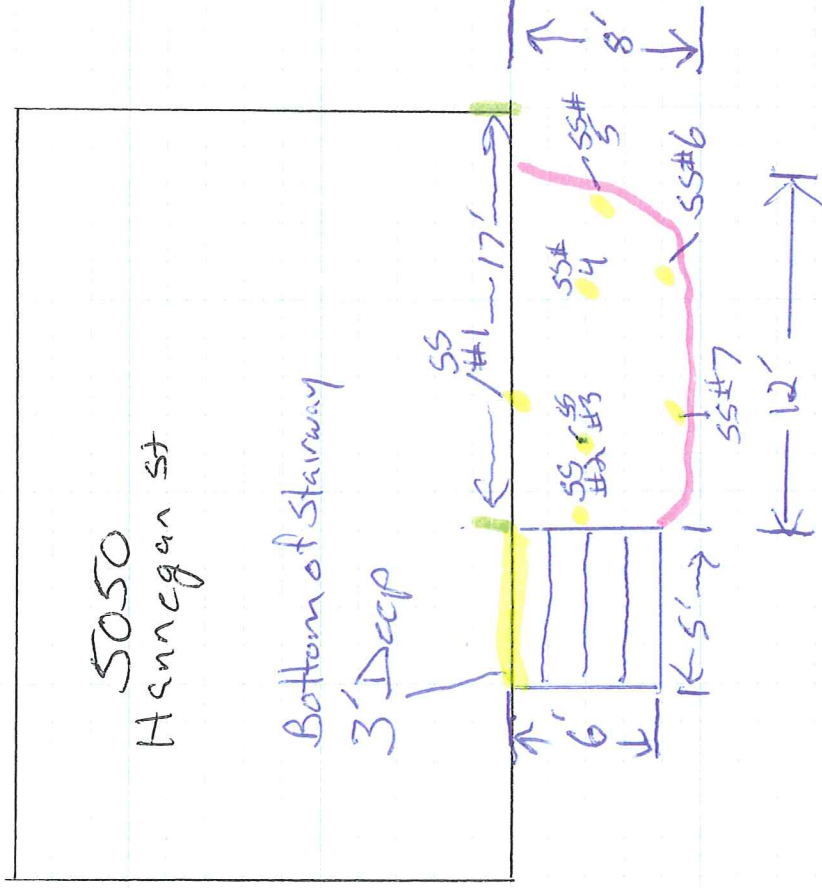


- Stairway Wall to N. Corner of house
- Stairway Bottom @ 3'
- Soil Sample locations










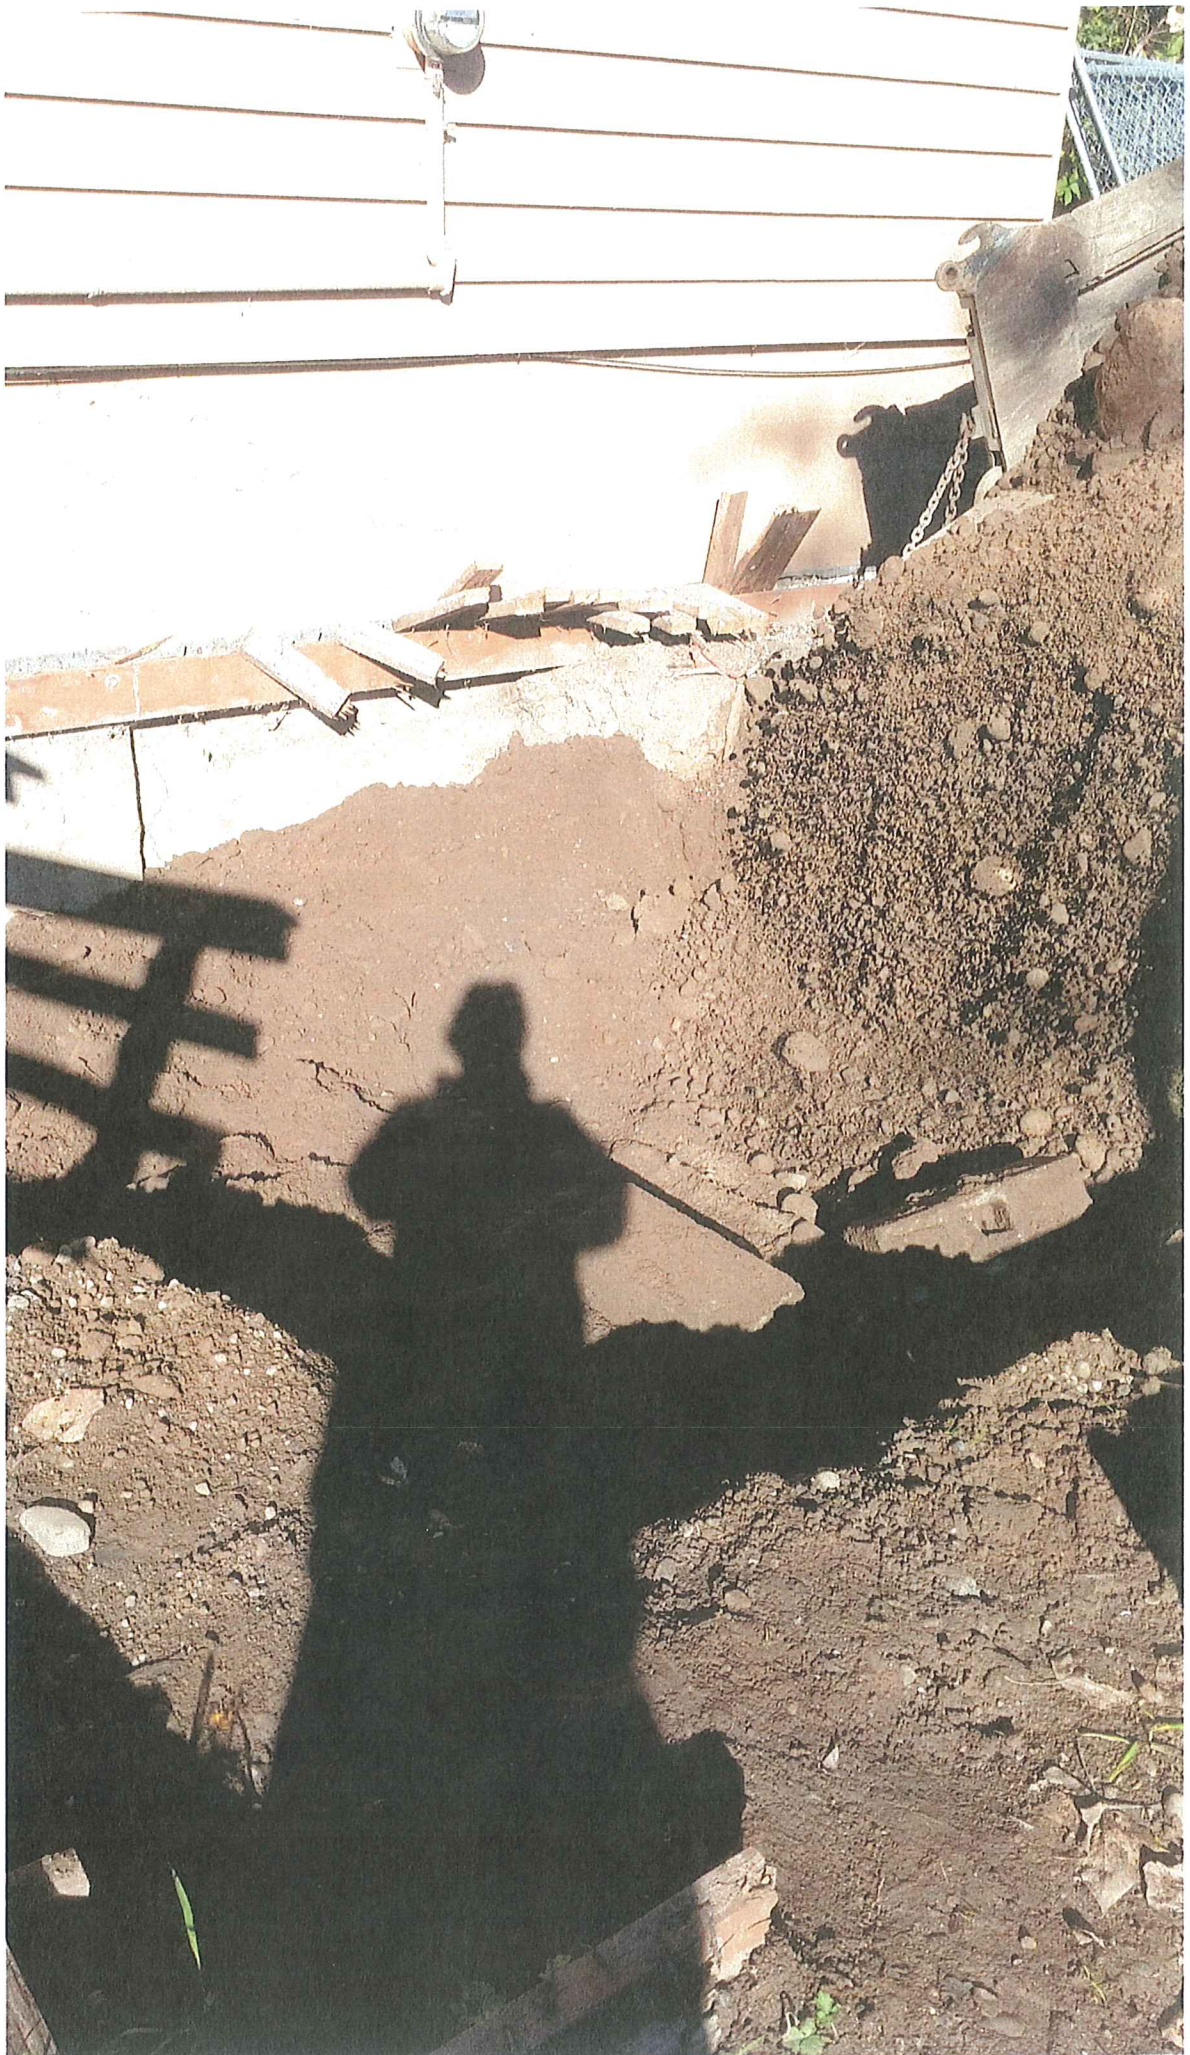

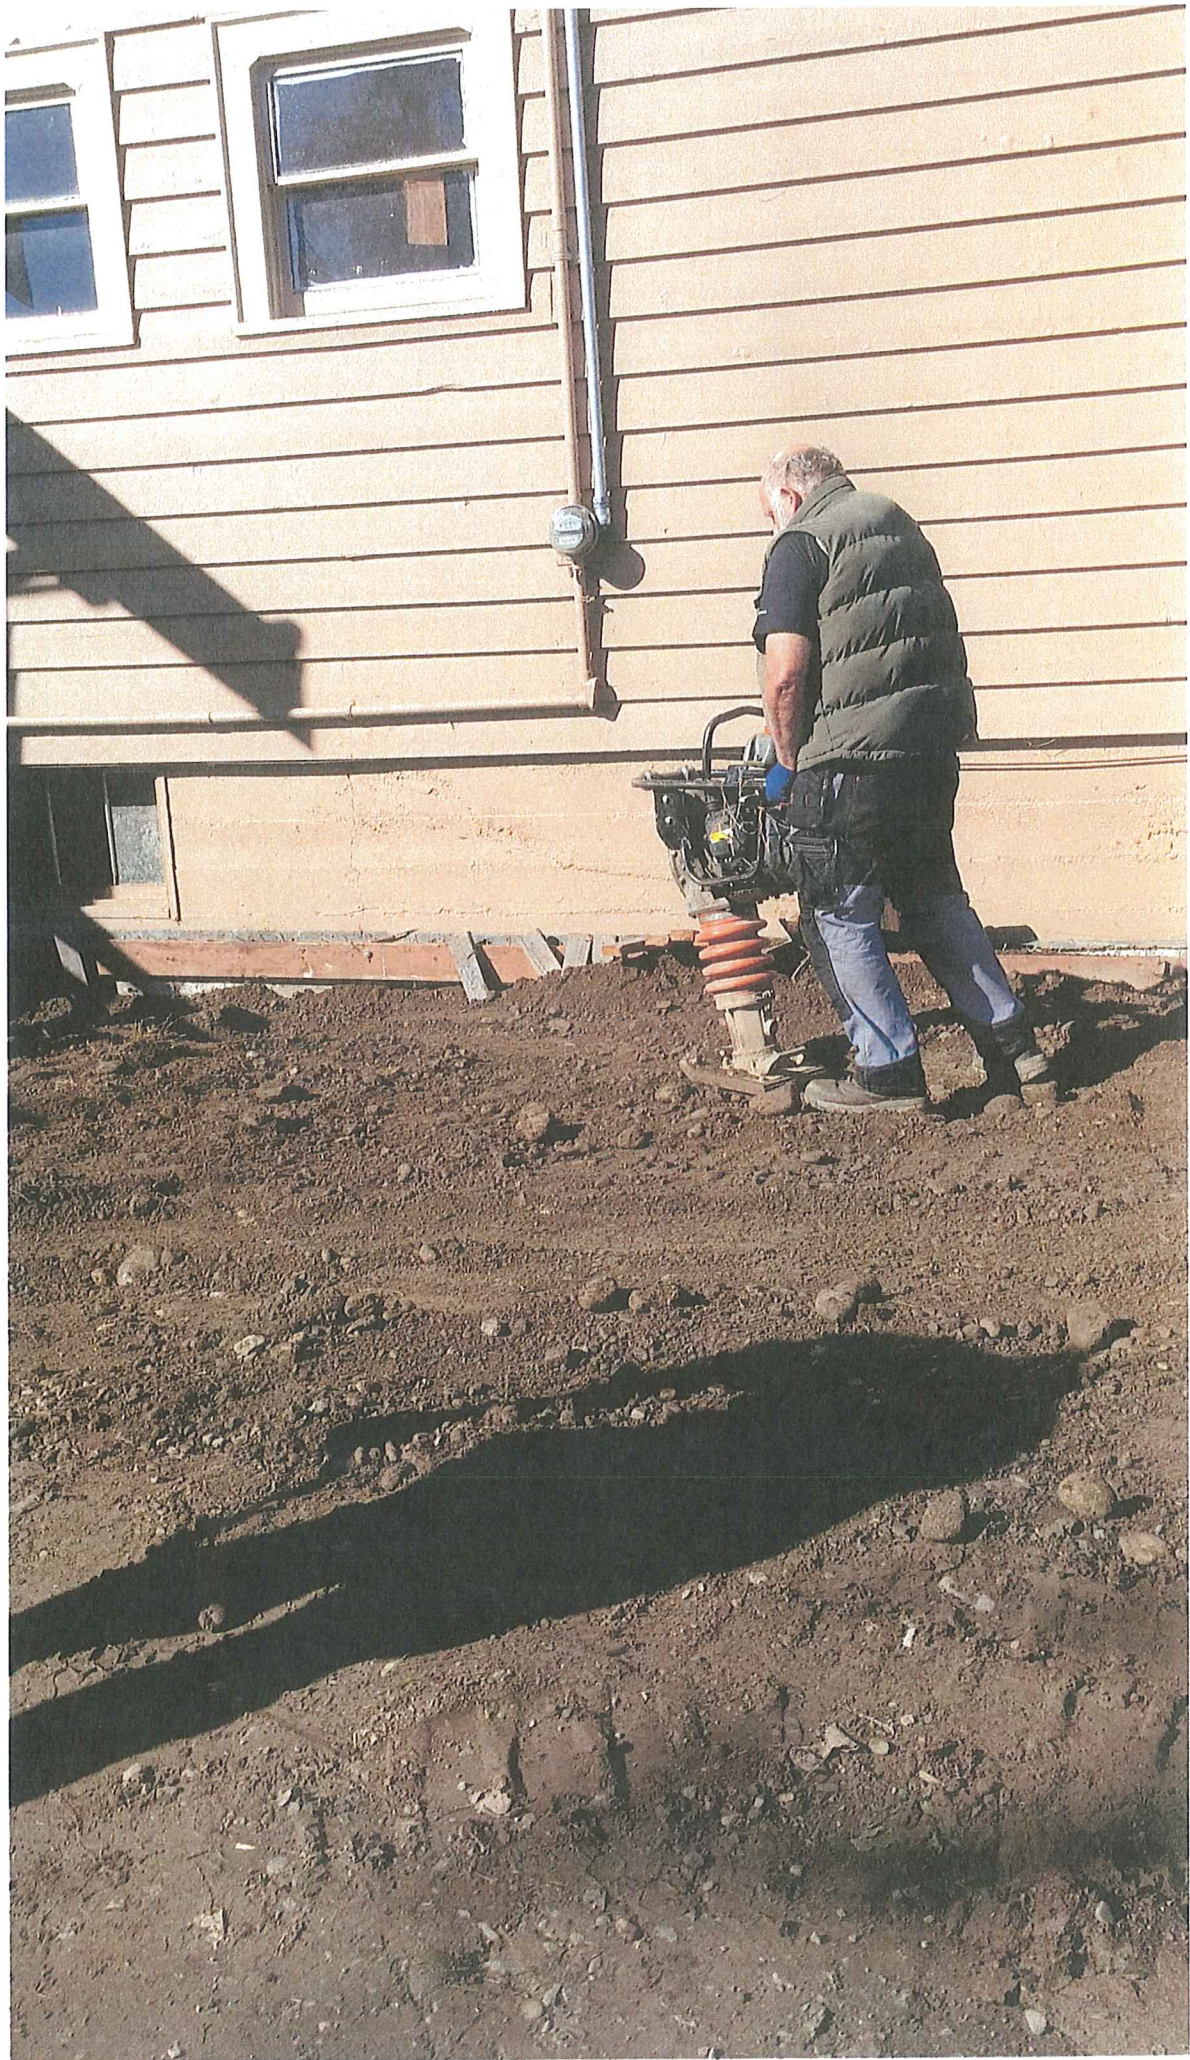



Appendix F - Soil Sample Descriptions

SS#1 – West Sidewall – 4'ft. North of foundation wall @ 5'ft. deep.

SS#2 – South Sidewall – 3'ft. East of foundation wall @ 5.5'ft. deep.

SS#3 – South Floor – 4'ft. North of South sidewall @ 7'ft. deep.



SS#4 – North Floor – 8'ft. North of South sidewall, 4'ft. South of North wall @ 8'ft. deep.

SS#5 – North Wall – 5'ft. East of foundation @ 6'ft. deep.

SS#6 – North East sidewall – 4'ft. South of Northwest wall @ 6.5'ft. deep.

SS#7 – South East sidewall – 2'ft. North of South wall @ 6'ft. deep.

Hanneken St

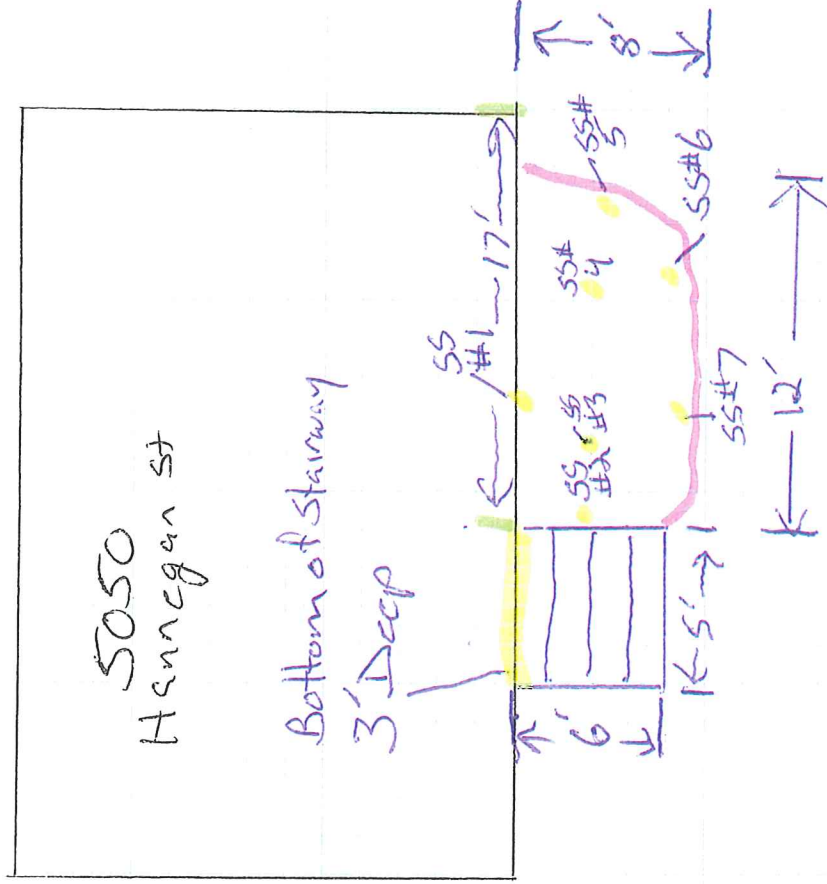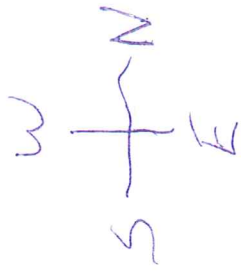

- Stairway Wall to N. Corner of house 17'
- Stairway Bottom @ 3'
- Soil Sample locations